

## Report Version 6 Hazardous Materials Initial Site Assessment (ISA)

November 2020 District: Austin

CSJ: 0016-01-113, 0015-13-007, I-35 Capital Express South from US 290W/SH 71 to SH 45SE

The environmental review, consultation, and other actions required by applicable Federal environmental laws for this project are being, or have been, carried-out by TxDOT pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated December 9, 2019, and executed by FHWA and TxDOT.

TxDOT Environmental Affairs Division Effective Date: December 2019 510.02.DS Version 6

### Hazardous Materials Initial Site Assessment (ISA) Report

This ISA complies with the Federal Highway Administration's (FHWA's) policy dealing with hazardous materials discussed in FHWA's *Supplemental Hazardous Waste Guidance* (January 16, 1997) located at <a href="http://www.environment.fhwa.dot.gov/guidebook/vol1/doc7b.pdf">http://www.environment.fhwa.dot.gov/guidebook/vol1/doc7b.pdf</a>.

FHWA's policy emphasizes three objectives: 1) identify and assess potentially contaminated sites early in project development, 2) coordinate early with federal/ state/ local agencies to assess the contamination and the cleanup needed; and 3) determine and implement measures early to avoid or minimize involvement with substantially contaminated properties.

In addition, completing the ISA will aid in identifying hazardous material issues early, avoiding construction delays, and reducing the department's liability associated with the purchase of contaminated right of way.

Maintain a copy of the completed ISA report with all applicable attachments in the project file.

For additional information, refer to TxDOT's online manual: *Hazardous Materials in Project Development:* <a href="http://onlinemanuals.txdot.gov/txdotmanuals/haz/index.htm">http://onlinemanuals.txdot.gov/txdotmanuals/haz/index.htm</a> and the Hazardous Materials Toolkit Site: <a href="http://www.txdot.gov/inside-txdot/division/environmental/compliance-toolkits/haz-mat.html">http://www.txdot.gov/inside-txdot/division/environmental/compliance-toolkits/haz-mat.html</a>

### **Abbreviations and Acronyms**

CALF	Closed and Abandoned Landfill		
CERCLIS	Comprehensive Environmental Response Compensation and Liability Information System		
EA	Environmental Assessment		
EIS	Environmental Impact Statement		
ECOS	Environmental Compliance Oversight System		
ERNS	Emergency Response Notification System		
EPA	Environmental Protection Agency		
ESA	Environmental Site Assessment		
HAZMAT	Hazardous Materials		
MS4	Municipal Separate Storm Sewer System		
MSWLF	Municipal Solid Waste Landfill		
NPL	National Priorities List		
RCRA	Resource Conservation and Recovery Act		
ROW	Right of Way		
SEMS	Superfund Enterprise Management System		
TCEQ	Texas Commission on Environmental Quality		
TRRC	Texas Railroad Commission		
US	United States		
USGS	United States Geological Survey		
VCP	Voluntary Cleanup Program		

# TxDOT Hazardous Materials Initial Site Assessment (ISA) Report Project Information CSJ No:0016-01-113, 001513-007 City:Austin Zip Code:Multiple County:Travis HWY:I-35 Capital Express South

Section 1: Identify Previously Completed Environmental Site Assessments, Known Hazmat Conditions, Preliminary Project Design, and Right-of-Way Requirements			
Note: Obtain information/comments from design, right-of-way, and/or environmental staff. Attach maps and/or details as appropriate.			
☐ Yes ☑ No ☐ Unknown	Are there any previous environmental assessments, testing, or studies performed within the proposed project area related to contamination issues (to include Phase I ESAs)? If yes, explain here if there are any concerns to the proposed project:		
⊠Yes □ No	Have the project schematics and/or plan-profile sheets (if available) been reviewed?* Look for substantial excavations (including utilities and storm sewer designs), new ROW and easements, and bridge demolitions or renovations.		

### Section 2: Demolition and Renovation Information Related to Asbestos and Lead-Containing-Paint Yes No Are there proposed bridges or building demolitions or renovations for this project?

**Note**: If "Yes" is selected, buildings or structures being acquired through the acquisition process are assessed and mitigated for asbestos, as needed, within the ROW process according to the TxDOT ROW Manual ROW Vol. 6 Miscellaneous -Chapter 1 Section 5. Bridge structures being demolished or renovated are assessed and mitigated for asbestos and lead-containing-paint, as needed, within the construction process according to Standard Specification Item 6.10 (and applicable Provisions), and the TxDOT guidance document: Guidance for Handling Asbestos in Construction Projects, dated January 26, 2007.

### **Section 3: Project Screening**

**Note:** Section 3.1 is only applicable for Categorically Excluded (CE) projects. If you are uncertain of the project type, select "No" and continue to Section 3.2.

**Section 3.1** Determine if the proposed project has a low potential to encounter contamination. Refer to the preliminary schematics for project limits and internet-based maps for surrounding land use.

☐ Yes ☐ No or an EA or EIS Project  Are the limits of the proposed project within a historically undeveloped area and outside boundaries of a designated MS4 permitted area? Historically undeveloped areas are located where no commercial buildings are located within one-half (0.5) miles of the proposed project line and the surrounding land use is historically agricultural, forest, or ranch lands.

If "Yes" is selected, the ISA is complete. The proposed project has a low potential to encounter contamination. Complete Sections 9 and 10 of this ISA and maintain a copy and all applicable attachments in the project file.

If "No" is selected, proceed to Section 3.2 of this ISA.

### Section 3.2

Note: Determine if the project includes any of the activities listed below:

<sup>\*</sup> For consultants: this information shall be supplied by TxDOT.

⊠ Yes □ No	Project Excavations: Will the work consist of substantial excavation operations. Substantial excavation includes, but is not necessarily limited to:  • Underpass construction, • Storm sewer installations, and • Trenching or tunneling that would require temporary or permanent shoring.				
☐ Yes ☑ No	<b>Dewatering of Groundwater:</b> Are there proposed de-watering operations. If yes, what is the estimated depth to groundwater?				
☐ Yes ☑ No	<b>Encroachments:</b> Are there known or potential encroachments into the project area? Encroachments include soil and groundwater contamination, dump sites, tanks, and other issues in the ROW.				
⊠ Yes □ No	<b>ROW and Easements:</b> Are there any acquisitions of new ROW, easements, temporary construction easements planned for the project?				
3.3 Complete the	appropriate box below:				
☐ If Section 3.2 of	ontains any "Yes" answers, please procee	d to Section 4.			
documenting th	contains all "No" answers, proceed to ne results in Section 6 and then mark the s project, you may use the applicable site	ne appropriate bo	ox below. If a Phase I ESA has been		
comple	e survey did not identify evidence of any ete. Complete Sections 9 and 10 and mai ject file.				
☐ The site survey identified evidence of environmental concerns listed in Section 6. Continue with Section 4.					
Section 4: Curren	t and Past Land Use Information				
sources that were	d assess current and past land use (up reviewed. If one or more Phase I ESA e Phase I ESAs to help complete this sect	s were prepared			
⊠Yes	4.1 Review Current and Past USGS 7.				
☐ No	for oil & gas pipelines, tanks, landfills, or	other industrial fe	eatures.		
☐ Not Available	Describe any concerns:no concerns	D-4	0		
	List Topo Maps Reviewed:	Dates:	Comments:		
	Oak Hill Quadrangle	1966, 1988, 2013, 2019	no comments		
	Montopolis Quandrangle	1973, 2019			
	Buda Quadrangle	2013, 2019			
⊠Yes □ No	4.2 Review Current and Past Aerial pipelines, tanks, landfills, or other industrial		the project area: Look for oil & gas		
☐ Not Available	Describe any concerns:no concerns				

1 Hazardous Materials – ISA – Version 6 510.01.RPT

Photo Dates:

4.3 Review Current and Past Right-of-Way Maps/Files\*: Look for oil & gas pipelines, tanks,

1995, 2019

Comments:

Comments:

no comments

List All Aerial Photos Reviewed:

landfills, or other industrial features.

List Maps/ Files & Dates Reviewed:

Describe any concerns:

Google Earth

☐ Not Applicable

☑ Not Available☑ Not Applicable

Yes

☐ No

☐Yes ☐ No ☑ Not Available	<b>4.4 Review Sanborn Fire Insurance M</b> other industrial features.  Describe any concerns:	laps/Files: Look for tanks, oil & gas pipelines, landfills, or	
☐ Not Applicable	List Maps/ Files & Dates Reviewed:	Comments:	
☐Yes ☐ No ☐ Not Available ☐ Not Applicable	4.5 Review TxDOT As-Built Plans*: Were any concerns identified during previous work within the project limits? If yes, explain: If known, what is the previous Project CSJ:		
☐Yes ☐ No ☑ Not Available ☐ Not Applicable	4.6 Review TxDOT Geotechnical Soil Boring Logs*: Were any concerns noted on the boring logs such as unusual odors, visible contamination, trash, waste or debris? If yes, explain:		
☐Yes ☐ No	entities to occupy a portion of the RO	•	
⊠ Not Available	Were any concerns such as monitor we consultants: this information shall be sup If yes, explain:	ells or treatment systems identified within the ROW? For oplied by TxDOT.	
☐Yes ☐ No ☑ Not Available	<b>4.8 Review Notifications of Contamination to TxDOT*</b> (These are typically letters from TCEQ or third parties explaining the presence of contamination on TxDOT ROW): Were any concerns regarding contamination of ROW from off-site sources? If yes, explain:		
* For consultants	: this information shall be supplied by TxDOT. If no	information is supplied by TxDOT, then select Not Available.	

### Section 5: Complete a Regulatory Records Review (Database Search)

**Note:** Use the comment field in Section 5.1 to provide a synopsis of the total number of sites identified within the search distances of the regulatory record reviewed. No comments are required when no sites were identified or the regulatory record was not reviewed.

### Select the appropriate box below:

No Sites Identified

A Database search was conducted through a contracted service. Indicate in Section 5.1, and if applicable, Section 5.2, the regulatory records searched. Maintain a complete copy of the database search findings (contractor's report deliverable) in the project file with the ISA.

A Database search was conducted in-house. For in-house database searches, not all databases need to be reviewed, but at a minimum the databases listed in Section 5.1 marked in **bold with a star(\*)** must be reviewed. Include database records that list potential issues in the project file with the ISA. It is not necessary to include records of negative findings.

Section 5.1 Standard Database Sources of Environmental Information from Government Agency Records

Findings	Regulatory Record		
☐Sites Identified ☑No Sites Identified	Federal Active NPL or Not NPL list (CERCLIS or SEMS sites)*  https://cumulis.epa.gov/supercpad/CurSites/srchsites.cfm; and/or https://www.epa.gov/cleanups/cleanups-my-community  (1 mile minimum search distance from project limits)		
Comments for Sites Identified:			
Sites Identified	Federal Archived NPL or Not NPL list (CERCLIS or SEMS sites)* <a href="https://cumulis.epa.gov/supercpad/CurSites/srchsites.cfm">https://cumulis.epa.gov/supercpad/CurSites/srchsites.cfm</a>		

(0.5 mile minimum search distance from project limits)

of the proposed ROW. A	ntified: 2 Sites: aughter Creek Groundwater Plume at 10019 South IH35 in Austin, TX 78747, 0.014 mile ESE according to the EPA, this site does not qualify for the NPL based on existing information. not considered an environmental concern.			
ROW. According to the I	shing, Inc. at 3909 A Warehouse Row in Austin,TX 78767, 0.469 mile NW of the proposed EPA, this site was archived in 2000 with no further action required. Due to its status and sed ROW, this facility is not considered an environmental concern.			
Sites Identified ☐No Sites Identified ☐Not Reviewed	US EPA Brownfield Properties <a href="https://www.epa.gov/cleanups/cleanups-my-community">https://www.epa.gov/cleanups/cleanups-my-community</a> (0.5 mile minimum search distance from project limits)			
	podward Street Lot 2 in Austin, TX 78741, 0.479 mile NW of the proposed ROW. According to completed status. Due to its status and distance from the proposed ROW, this facility is not			
Sites Identified     No Sites Identified     Not Reviewed	Sites Identified Federal RCRA Corrective Action (CORRACTS) list <a href="https://www.epa.gov/cleanups/cleanups-my-community">https://www.epa.gov/cleanups-my-community</a> and/or <a href="https://www.epa.gov/cleanups-my-community">https://www.epa.gov/cleanups-my-community</a> and/or <a href="https://www.epa.gov/epuiro/">https://www.epa.gov/epuiro/</a>			
#117: Capitol Metal Finis ROW. According to TCE	Comments for Sites Identified: 1 site: #117: Capitol Metal Finishing, Inc. at 3909 A Warehouse Row in Austin,TX 78767, 0.469 mile NW of the proposed ROW. According to TCEQ, this site is listed as inactive. Due to its activity status and distance from the proposed ROW, this facility is not considered an environmental concern.			
Sites Identified     No Sites Identified     Not Reviewed	Federal RCRA non-CORRACTS Treatment Storage Disposal (TSD) facilities list <a href="http://www.envcap.org/statetools/tsdf/">http://www.envcap.org/statetools/tsdf/</a> and/or <a href="http://www.epa.gov/enviro/">http://www.epa.gov/enviro/</a> (0.5 mile minimum search distance from project limits)			
	ntified: 1 Site: 11 Meinardus Drive, Building B in Austin, TX 78704, 0.105 mile ESE of proposed ROW. site is listed as inactive. Due to its activity status, this facility is not considered an			
Sites Identified ☐No Sites Identified ☐Not Reviewed	Federal RCRA generators <a href="http://www.epa.gov/enviro/">http://www.epa.gov/enviro/</a> (acquired property and adjoining properties)			
Comments for Sites Ider 4 sites within 0.02 mile (	ntified: 10 Sites: 100 feet) of the proposed ROW (distance given in miles from proposed ROW):			
#2: Lowes of SE Austin 689 at 5510 South IH 35 in Austin, TX 78745, 0 mile from the proposed ROW. According to the TCEQ, this facility is listed as an SQG.				
#31: Range at Austin at 8301 South IH 35 in Austin, TX 78744, 0.003 mile ESE from the proposed ROW. According to the TCEQ, this facility is listed as an SQG.				
	nter 5217 at 9300 South IH 35 Suite B in Austin, TX 78748, 0.017 mile W from the proposed TCEQ, this facility is listed as a CESQG.			
#54 NTB #8686 at 4720 South IH 35 in Austin, TX 78745, 0.018 mile WNW from the proposed ROW. According to the TCEQ, this facility is listed as a CESQG.				
6 sites located more tha	t 0.02 mile (100 feet) of the proposed ROW. Due to distance from the proposed ROW, these			

facilities are not considered environmental concerns: #62: Sams Club 8259 at 9900 South IH 35 Service Road SB in Austin, TX 78748, 0.027 mile WNW from the proposed ROW. According to the TCEQ, this facility is listed as an SQG. #66: Holt CAT at 9601 South IH 35 in Austin, TX 78744, 0.038 mile ESE, from the proposed ROW. According to the TCEQ, this facility is listed as a VSG. #68: Home Depot USA HD6563 at 8801 South IH 35 in Austin, TX 78744, 0.039 mile ESE from the proposed ROW. According to the TCEQ, this facility is listed as an SQG. #76: Target Store 0683 at 6405 South IH 35 in Austin, TX 78744, 0.074 mile ESE from the proposed ROW. According to the TCEQ, this facility is listed as an SQG. #79: ESE-T Operating LP at 919 East St. Elmo in Austin, TX 78745, 0.086 mile WNW from the proposed ROW. According to the TCEQ, this facility is listed as an SQG. #85: Commemorative Brands at 7211 Circle S Road in Austin, TX 78745, 0.117 mile WNW from the proposed ROW. According to the TCEQ, this facility is listed as an SQG. Sites Identified Federal ERNS (or Responses) No Sites Identified https://www.epa.gov/cleanups/cleanups-my-community ☐Not Reviewed (acquired property and adjoining properties) Comments for Sites Identified: 5 Sites: #13: name not reported at Oak Hill Community in Austin, TX, 0 mile from the proposed ROW. According to the TCEQ, a spill of ammonium sulfide was dumped on a lawn at this site in 1996. Due to the elapsed time since this event occurred and the nature of the material, this facility is not considered an environmental concern. #14: Interstate 35 NB @ Slaughter Creek in Austin, TX 78705, 0 mile from the proposed ROW. According to the TCEQ, this event consisted of a propane release near a road. Due to the dissapating nature of the material, this facility is not considered an environmental concern. #34: name not reported at 4701 South IH 35 in Austin TX, 0.004 mile ESE of the proposed ROW. According to the TCEQ, a radiography camera was stolen at this location. Law enforcement was contacted, and the facility is not considered an environmental concern. #56: Onion Creek Liquor Store at 10430 South IH 35 in Austin, TX, 0.02 mile WNW of the proposed ROW. According to the TCEQ, a drum of unknown contents was discovered at this site and no remediation was required. As such, this facility is not considered an environmental concern. 1 Unlocated Site at MP 243 on IH 35 NB in Austin, TX. No information is available about this facility, and it may pose an environmental concern. TCEQ Industrial Hazardous Waste Corrective Action (IHWCA) sites only\* Sites Identified http://www15.tceq.texas.gov/crpub/ No Sites Identified (1 mile minimum search distance from project limits) Comments for Sites Identified: 22 Sites:

1 site within 0.02 mile (100 feet) of the proposed ROW. According to the TCEQ, this site has a completed workload. Therefore, it is not considered an environmental concern:

#10: Galvon Industries at 9808 South IH 35 in Austin, TX 78748, 0 mile;

21 sites located more than 0.02 mile (100 feet) of the proposed ROW, all with completed workloads, according to the TCEQ. Due to workload status distance from the proposed ROW, these facilities are not considered environmental concerns.

#55: South Point Nissan Preowned at 6001 South IH 35 in Austin, TX 78744, 0.02 mile ESE;

#64: South Fork Hyunda #65: South Star Dodge a #67: Maxwell Chrysler P #69: Cen-Tex Nissan at #72: Aaron's Auto Parts #78: Pompa Trucking Au #90: Commercial Metals #112: Ambion at 2130 W #113: Modern Metal Fini #114 Cen-Tex Plating at #117: Capitol Metal Finis #119: Crystal Semicond #120: Arthrocare at 230 #121: Air Products and 0 #122: BOC Edwards Ka #123: Proposed CVS Pr #124: Austin Scientific a #125: Majestic Products	on Services at 8300 South IH 35 in Austin, TX 78745 0.024 mile WNW; at 15306 South IH 35 in Austin, TX 78745, 0.028 mile WNW; at 15210 South IH 35 in Austin, TX 78745, 0.036 mile S; at 15210 South IH 35 in Austin, TX 78745, 0.036 mile S; at 15210 South IH 35 in Austin, TX 78745, 0.039 mile NNW; at 8409 South Congress Avenue in Austin, TX 78745, 0.056 mile NW; at 8409 South Congress Avenue in Austin, TX 78745, 0.056 mile NW; at 1710 Industrial Boulevard in Austin, TX 78745, 0.164 mile W; at 1710 Industrial Boulevard in Austin, TX 78745, 0.164 mile W; at 1710 Industrial Boulevard in Austin, TX 78744, 0.396 mile ESE; at 1710 Industrial Boulevard in Austin, TX 78744, 0.41 mile ESE; at 1710 ESE Saint Elmo Road in Austin, TX 78745, 0.437 mile WNW; and Austin at 3909 Warehouse Row in Austin, TX 78767, 0.469 mile NW; actor at 4210 South Industrial Drive in Austin, TX 78744, 0.516 mile ESE; at 1710 ESE Saint Elmo Road Suite 110 in Austin, TX 78744, 0.563 mile ESE; at 1710 Commercial Center Drive in Austin, TX 78744, 0.678 mile ESE; and 4117 Commercial Center Drive Building 5 in Austin, TX 78744, 0.687 mile ESE; armacy at 5526 South Congress Avenue in Austin, TX 78745, 0.744 mile WNW; at 114 Todd Lane in Austin, TX 78744, 0.795 mile ESE; and Austin at 118 East Alpine Road in Austin, TX 78704, 0.798 mile NNW; aperty-8401 S First St Austin TX at 8401 South 1st Street in Austin, TX 78748, 0.822 mile			
	TCEQ Superfund sites*			
☐Sites Identified ☑No Sites Identified	http://www15.tceq.texas.gov/crpub/ and/or https://www.tceq.texas.gov/remediation/superfund/sites/index.html (1 mile minimum search distance from project limits)			
Comments for Sites Ider				
⊠Sites Identified ☐No Sites Identified	Closed and abandoned municipal solid waste landfill sites* <a href="http://www.tceq.texas.gov/permitting/waste_permits/msw_permits/msw_data">http://www.tceq.texas.gov/permitting/waste_permits/msw_permits/msw_data</a> (0.5 mile minimum search distance from project limits)			
Comments for Sites Ider				
#101: McGuire at East of 0.231 mile ESE of the pr	of IH 35 and West of Friedrich Lane, South of East Saint Elmo (4500 Block of Friedrich) in TX, roposed ROW.			
Per COA watershed pro	tection development review, "current conditions associated with this site may pose current or			
	to human health or the environment additional actions may be warranted at this site."			
⊠Sites Identified ☐No Sites Identified	TCEQ leaking petroleum storage tank remediation lists (LPST)*  http://www15.tceq.texas.gov/crpub/ (0.5 mile minimum search distance from project limits)			
Comments for Sites Ider	ntified: 27 Sites (some addresses with multiple sites) all with final concurrence issued,			
according to the TCEQ (	(distance given in miles from proposed ROW):			
8 sites within 0.02 mile (100 feet) of the proposed ROW. Due their current status (final concurrence issued), these facilities are not considered environmental concerns:				
#5: Sams Club 8259 at !	5107 South IH 35 in Austin, TX 78744, 0 mile;			
#36: 7 Eleven 39068 at 120 West Slaughter Lane in Austin, TX 78748, 0.005 mile W;				
#38: Shoppers Mart 23 at 800 East William Cannon Drive in Austin, TX 78745, 0.008 mile NW;				
#40: Texaco Service 11 at 1601 East Saint Elmo Road in Austin, TX 78744, 0.007 mile ESE; #46 (2 sites): Texaco One Stop at 6500 South IH 35 in Austin, TX 78745, 0.014 mile SSW;				
#46 (2 sites): Texaco One Stop at 6500 South IH 35 in Austin, TX 78745, 0.014 mile SSW; #50: Friendly Olds Mazda at 4506 South IH 35 in Austin, TX 78745, 0.017 mile WNW;				
#54: NTW at 4720 South IH 35 in Austin, TX 78745, 0.018 mile WNW;				
	18 sites (some addresses with multiple sites)located more than 0.02 mile (100 feet) of the proposed ROW. Due to distance from the proposed ROW, these facilities are not considered environmental concerns.			
alstance nom the propos	304 NOVV, aleae lacilities are not considered environmental concerns.			

- #63: Lipshy Motor Cars at 4738 South IH 35 in Austin, TX 78745, 0.028 mile WNW; #66 (2 sites): Holt Machinery Co at 9601 South IH 35 in Austin, TX 78744, 0.038 mile ESE;
- #83: Howdy Honda at 4110 Santiago Street in Austin, TX 78745, 0.111 mile W;
- #84: Hendrix GMC Trucks Inc at 4400 South IH 35 in Austin, TX 78745, 0.112 mile WNW:
- #85: CJC Holdings at 7211 Circle South Road in Austin, TX 78745, 0.117 mile WNW;
- #87 (2 sites): Shoppers Mart 16 at 4036 South IH 35 in Austin, TX 78704, 0.139 mile NNE;
- #89 (3 sites): Shop N Carry Foods at 8514 South Congress Avenue in Austin, TX 78748, 0.145 mile WNW;
- #90: Commercial metals Austin Inc at 710 Industrial Boulevard in Austin, TX 78745, 0.164 mile W;
- #106: Chisholm Corner Store 7 at 600 East Ben White Boulevard in Austin, TX 78704, 0.307 mile NW;
- #108: Onion Creek Club at 2510 Onion Creek Parkway in Austin, TX 78747, 0.343 mile ESE;
- #109: Metro Marts 2 Former 7 Eleven at 2008 Teri Road in Austin, TX 78744, 0.369 mile ESE;
- #110: Wenco Distributing at 600 Industrial Boulevard in Austin, TX 78745, 0.378 mile WNW;
- #111: Former Truck City Dealership at 502 East Ben White Boulevard in Austin, TX 78704, 0.382 mile WNW;
- #115: Austin Four Corners Old Stop N Go at 111 West William Cannon Drive in Austin, TX 78745, 0.442 mile WNW;
- #116: Former 7 Eleven Store 20079 at 6702 South Congress Avenue in Austin, TX 78745, 0.146 mile WNW.

1 site has not been issued final concurrence, according to the TCEQ:

#56: Former Crumleys Grocery at 10730 South IH 35 in Austin, TX 78748, 0.02 mile WNW of the proposed ROW. According to the TCEQ, this LPST has impacted groundwater within 0.25 miles and is pending final plug. It's current status is listed as inactive. As such, it may be considered an environmental concern.

### Sites Identified No Sites Identified

TCEQ registered petroleum storage tank lists (PST)\* http://www15.tceq.texas.gov/crpub/

(acquired property and adjoining properties)

Comments for Sites Identified: 60 Sites (some addresses with multiple Sites)

18 sites within 0.02 mile (100 feet) of the proposed ROW (distance given in miles from proposed ROW):

- #1: KMART 7511 at 6715 South IH 35 in Austin, TX 78744, 0 mile
- #2: Fiesta Mart 64 at 5510 South IH 35 in Austin, TX 78745, 0 mile;
- #2: Lowes of SE Austin 689 at 5510 South IH 35 in Austin, TX 78745, 0 mile;
- #3: George Coffey Lincoln-Mercury at 4800 South IH 35 in Austin, TX 78747, 0 mile;
- #3: Red McCombs Toyota at 4800 South IH 35 in Austin, TX 78747, 0 mile;
- #6: Maxwell Ford at 5000 South IH 35 in Austin, TX 78745, 0 mile;
- #26: John Roberts BMW of Austin at 4108 South IH 35 in Austin, TX 78745, 0.014 mile WNW;
- #26: Lexus of Austin at 4107 Santiago Street in Austin, TX 78745, 0.008 mile WNW;
- #27: Wattinger Facility at 114 West Slaughter Lane in Austin, TX 78748, 0.008 mile N;
- #27: Fast Mart 8166 at 110 West Slaughter Lane in Austin, TX 78748, 0.008 mile N;
- #33: Onion Creek Food Mart at 2107 Boca Raton Drive in Austin, TX 78747, 0.003 mile ESE;
- #36: 7 Eleven 39068 at 120 West Slaughter Lane in Austin, TX 78748, 0.005 mile W;
- #37: Stassney Food Mart at 5717 South IH 35 Building D in Austin, TX 78744, 0.005 mile SE;
- #38: Shoppers Mart 23 at 800 East William Cannon Drive in Austin, TX 788745, 0.008 mile NW;
- #38: Town Food Mart at 800 East William Cannon Drive in Austin, TX 788745, 0.008 mile NW;
- #40: Circle K Store 2704677 at 1601 East Saint Elmo Road in Austin, TX 78744 0.007 mile ESE;
- #42: Onion Creek Texaco at 11031 South IH 35 in Austin, TX 78747, 0.009 mile ESE;
- #44: 7-Eleven Store 36587 at 6515 South IH 35 in Austin, TX 78744, 0.011 mile NE;

40 sites (some addresses with multiple sites) located more than 0.02 mile (100 feet) of the proposed ROW. Due to distance from the proposed ROW, these facilities are not considered environmental concerns.

- #46: Texaco One Stop at 6500 South IH 35 in Austin, TX 78745, 0.014 mile SSW;
- #48: KOA Kampground at 7009 South IH 35 in Austin, TX 78744, 0.016 mile ESE;
- #49: Wal-Mart Supercenter 5317 at 9300 South IH 35 in Austin. TX 78748. 0.017 mile W:
- #49: Murphy USA 7211 at 9300 South IH 35, Service Building Road J in Austin, TX 78748, 0.017 mile W;
- #50: Roger Beasley Mazda South at 4506 South IH 35 in Austin, TX 78745, 0.017 mile WNW;
- #53: South Austin Area Engineers & Special Crews OFC at 3725 South IH 35 in Austin, TX 78744, 0.018 mile ESE;
- #54: NTW at 4720 South IH 35 in Austin, TX 78745, 0.018 mile WNW;

#56: D E Crumley Groc at IH 35 in Austin, TX 78744, 0.02 mile WNW; #57: Southpoint Pontiac at 4610 South IH 35 in Austin, TX 78745, 0.02 mile WNW; #58: Dave Transportation Services at 8300 South IH 35 in Austin, TX 78745, 0.024 mile WNW; #59: Circle K Store 2741570 at 11206 South IH 35 Frontage Road in Austin, TX 78748, 0.024 mile WNW: #62: Sams Club 8259 at 9900 South IH 35 Service Road SB in Austin, TX 78748, 0.027 mile WNW; #63: Lipshy Motor Cars at 4738 South IH 35 in Austin, TX 78745, 0.028 mile WNW; #65: South Star Dodge at 5210 South IH 35 in Austin, TX 78745, 0.036 mile S; #66: Holt CAT Austin at 9601 South IH 35 in Austin, TX 78744, 0.038 mile ESE; #67: Prestige South Chrysler Plymouth at 6905 South IH 35 in Austin, TX 78744, 0.039 mile ESE; #68: Circle K Store 2704673 at 8801 South IH 35 Suite B In Austin, TX 78744, 0.039 mile ESE; #71: PCW Construction at 10704 South IH 35 in Austin, TX 78748, 0.045 mile WNW; #74: Adams Extract at 2217 Onion Creek Parkway in Austin, TX 78747, 0.072 mile E; #77: Night Hawk Frozen Foods at 1120 Shelby Lane in Austin, TX 78745, 0.08 mile NW; #80: Cannon Food Mart at 1719 East William Cannon Drive in Austin, TX 78744, 0.093 mile ESE; #81: Circle K Store 2742194 at 1706 East William Cannon Drive in Austin, TX 78744, 0.093 mile E; #82: Service Center 8 at 4411 Meinardus Drive Suite D in Austin, TX 78744, 0.105 mile ESE; #83: Howdy Honda at 4110 Santiago Street in Austin, TX 78745, 0.111 mile W; #84: Carmax 7190 at 4400 South IH 35 in Austin, TX 78745, 0.112 mile WNW; #85: CJC Holdings at 7211 Circle South Road In Austin, TX 78745, 0.117 mile WNW; #86: L&T Waggoner Trucking at 1825 Oak Hill Lane in Austin, TX 78744, 0.134 mile E; #87: Shoppers Mart 16 4036 South IH 35 in Austin, TX 78704, 0.139 mile NNE; #87: Texas Alternator Starter Service (2 sites) at 1230 East Ben White Boulevard in Austin, TX 78742, 0.139 mile #87: Old Fueling Facility at 1240 East Ben White Boulevard in Austin, TX 78742 0.139 mile NNE; #88: Penske Truck Leasing Austin Congress at 8800 South Congress Avenue in Austin, TX 78745, 0.139 mile WNW; #89: Shop N Carry Foods at 8514 South Congress Avenue in Austin, TX 78748, 0.145 mile WNW; #90: Commercial Metals Austin Inc at 710 Industrial Boulevard in Austin, TX 78745, 0.164 mile W; #93: Capitol Chevrolet Parts Building at 700 North Bluff Drive in Austin, TX 78745, 0.189 mile WNW; #96: 7-Eleven Store 35792 at 1901 East William Cannon Drive in Austin, TX 78744, 0.2 mile ESE; #97: Centex Materials Farewell in Austin, TX 78768, 0.202 mile WNW; #97: Centex Materials South at 817 East Saint Elmo Road in Austin, TX 78745, 0.202 mile WNW; #98: Southwestern Bell (2 sites) at 3909 Payload Pass in Austin, TX 78704, 0.208 mile NNW; #98: Wal-Mart Supercenter 1253 at 710 East Ben White Boulevard in Austin, TX 78704, 0.208 mile NNW; #98: Murphy USA 7209 at 710 East Ben White Boulevard in Austin, TX 78704, 0.208 mile NNW.

### Sites Identified No Sites Identified

TCEQ voluntary cleanup program (VCP) sites\* http://www15.tceq.texas.gov/crpub/

ified (0.5 mile minimum search distance from project limits)

Comments for Sites Identified: 6 sites all with completed workloads, according to the TCEQ. 3 sites within 0.02 mile (100 feet) of the proposed ROW:

#9: Century South Shopping Center at 801 East William Cannon Drive in Austin, TX 78745, 0 miles from proposed ROW. Due to its status, this facility is not considered an environmental concern.

#10: Janssen Tracy at 9808 South IH 35 in Austin, TX 78748, 0 miles from proposed ROW. Due to its status, this facility is not considered an environmental concern.

#83: John Roberts BMW/Lexus of Austin at 4110 Santiago Street in Austin, TX 78745, 0.111 mile W from proposed ROW. Due to its status and distance from the proposed ROW, this facility is not considered an environmental concern.

3 sites located more than 0.02 mile (100 feet) of the proposed ROW:

#107: Muldoon Interests at 6201 Crown Lane in Austin, TX 78745, 0.31 mile WNW from proposed ROW. Due to its status and distance from the proposed ROW, this facility is not considered an environmental concern.

#111: Ben White Lots 1, 2, 3, 4, 5 at 500 East Ben White Boulevard in Austin, TX 78704, 0.391 mile NW;

	dward at 2000 Woodward Street in Austin, TX 78741, 0.479 mile ENE from proposed ROW. tance from the proposed ROW, this facility is not considered an environmental concern.		
⊠Sites Identified □No Sites Identified □Not Reviewed	TCEQ Innocent Owner/ Operator (IOP) sites <a href="http://www15.tceq.texas.gov/crpub/">http://www15.tceq.texas.gov/crpub/</a> (0.5 mile minimum search distance from project limits)		
Comments for Sites Identified: 1 site: #111: KMs Retail Payload Pass at 500 East Ben White Boulevard in Austin, TX 78704, 0.382 mile NW of the proposed ROW. According to the TCEQ, this site has a completed workload. Due to its status and distance from the proposed ROW, this site is not considered an environmental concern.			
⊠Sites Identified ☐No Sites Identified	TCEQ Dry Cleaners remediation only Database* http://www15.tceq.texas.gov/crpub/ (0.5 mile minimum search distance from project limits)		
Comments for Sites Ider 2 sites within 0.02 mile (	ntified: 4 sites: 100 feet) of the proposed ROW:		
#32: Jack Brown Cleaners 28 at 11001 South IH 35 in Austin, TX 78747, 0.003 mile NNE of the proposed ROW. According to TCEQ, this site has no unaddressed violations. As such, it is not considered an environmental concern.			
#45: Deluxe Cleaners at 11215 South IH 35 Suite 126 in Austin, TX 78747, 0.012 mile ESE of the proposed ROW. According to TCEQ, this facility has no unaddressed violations. As such, it is not considered an environmental concern.			
2 sites located more than 0.02 mile (100 feet) of the proposed ROW:			
#79: SE-P Operating at 919 East Saint Elmo Road in Austin, TX 78745, 0.086 mile WNW of the proposed ROW. Due to its distance from the proposed ROW, this facility is not considered an environmental concern.			
#92: name not reported at 6500 South IH 35 Suite 650 in Austin, TX 78748, 0.167 mile WSW of the proposed ROW.Due to its distance from the proposed ROW, this facility is not considered an environmental concern.			
☐Sites Identified ☑No Sites Identified	Texas Railroad Commission VCP sites*		

### Section 6: Complete a Project Site Survey

Note: Do not document site survey concerns that were previously identified by the regulatory list search, by the Current and Past Land Use review, or both. In Section 6.1, describe the location and size of the concern. Attach site maps and photographs, as appropriate. If a Phase I ESA has been prepared for this project, you may use the applicable site survey information from the Phase I ESA and updated current site conditions, as needed.

Possible Site Survey Concerns: The following items are to be used as a guide to help identify potential hazardous material issues during a site survey.

- underground storage tanks
- aboveground storage tanks

- vent pipes, fill pipes, or access ways indicating a fill pipe protruding from the ground
- electrical and transformer equipment storage or evidence of release

- injection wells, cisterns, sumps, dry wells
- floor drains, walls stained by substances other than water or emitting foul odors
- stockpiling, storage of material
- surface dumping of trash, garbage, refuse, rubbish, debris half exposed/buried, etc.
- stained, discolored, barren, exposed or foreign (fill) soil
- oil sheen or film on surface water, seeps, lagoons, ponds, or drainage basins
- changes in drainage patterns from possible fill areas
- Dead animals (fish, birds, etc.)

- groundwater monitoring wells and groundwater treatment systems
- vats, 55-gallon drums (labeled/unlabeled), canisters, barrels, bottles, etc.
- evidence of liquid spills
- damaged or discarded automotive or industrial batteries
- dead, damaged, or stressed vegetation
- pits, ponds, or lagoons associated with waste treatment or waste disposal
- security fencing, protected areas, placards, warning signs

### Site Survey Date(s): 7/28/2020

**6.1** Describe Concerns Observed During the Site Survey. **Do not** include concerns previously identified during the regulatory list search, the current and past land use review or both. Indicate if the concern is associated with existing ROW, proposed ROW, adjacent property, or easements. Provide address location (or relative location) and any additional information about the evidence identified; include photographs as an attachment to the ISA.

Comments or Concerns Identified: No sites or concerns observed.

Section 7: Interviews			
Section 7.1 Were interviews conducted?  \( \subseteq Yes \otin No\) Possible interviewees include local residents, TxDOT staff, fire department personnel, city or county department of health/environmental staff, city or county planning staff, TCEQ staff, TRRC staff, and current and former property owners or operators.			
If one or more Phase I ESAs were prepared for this project Phase I ESAs to help complete this section of the ISA.	t, please use applicable	interview information from the	
<b>Section 7.2 Interview Summary:</b> Complete this section if interviews were conducted. Add additional rows as needed. Attach record of communications to the ISA.			
Name:	Title:	Date:	
Describe any potential concerns:			
Name:	Title:	Date:	
Describe any potential concerns:			
Name:	Title:	Date:	
Describe any potential concerns:			

### **Section 8: Hazardous Material Concerns**

On the list below, indicate if a concern is resolved or unresolved. "Unresolved" indicates additional investigation or research is required. "Resolved" indicates the concern has been resolved during the preparation of this ISA. If a concern is "Unresolved" or "Resolved", include a statement explaining the planned next steps to resolve the issue. If no concerns were identified, select "No Issue".

For additional information regarding scheduling considerations, internal/external coordination and recommended practices for resolving hazmat issues please refer to TxDOT's Environmental Tool Kit web site. Contact TxDOT ENV Hazardous Material Management (HMM) for additional assistance. 8.1 Identify Type of Hazardous Material Concerns Resolution **Type of Concern** Current or Past Land Use Concerns: These concerns are associated with hazardous material Unresolved issues identified in Section 4 that were not discovered during the database search in Section 5.1 or Resolved during the Site Survey in Section 6.1. Note: For ECOS IIR development, the Available Contaminated ⊠No Issue Media would be "Other". Explain Unresolved or Resolved Issues:None Unresolved Site Visit Concerns: These concerns are associated with hazardous material issues discovered following the completion of Section 6 that were not previously discovered during the database search Resolved in Section 5.1 or during the current and past land use review in Section 4. Note: For ECOS IIR ⊠No Issue development, the Available Contaminated Media would be "Other". Explain Unresolved or Resolved Issues:None Unresolved Interview Concerns: These concerns are associated with any hazardous material issues discovered during an interview listed in Section 7, that were not previously discovered during the Resolved database search in Section 5.1, during the current and past land use review in Section 4, or during No Issue the Site Survey in Section 6.1. Note: For ECOS IIR development, the Available Contaminated Media  $\square$ N/A would be "Other". Explain Unresolved or Resolved Issues: Not Applicable

□Unresolved □Resolved □No Issue	Petroleum Storage Tanks (PSTs) Concerns discovered during the database search: PSTs are underground or aboveground storage tanks used to store fuel or other petroleum substances. Typically, these are found at gasoline and diesel refueling facilities. Select below all that apply.		
	⊠Yes □No	ROW acquisition or partial acquisition of a parcel with one or more PSTs.	
	☐Yes ⊠No	Other- Describe: none	
Explain Unresol	ved or Resolve	ed Issues:no issues	
<ul><li>☐Unresolved</li><li>☐Resolved</li><li>☐No Issue</li></ul>	Leaking Petroleum Storage Tanks (LPSTs) Concerns discovered during the database search: LPSTs are PSTs that have caused or are suspected to have caused a release of fuel or other petroleum substances to the environment.		
	☐Yes ⊠No	Additional Research is needed or uncertain of impacts from one or more LPSTs. Request assistance from ENV.	
	⊠Yes □No	ROW acquisition or partial acquisition of a parcel with one or more LPSTs.	
	⊠Yes □No	One or more LPSTs are located within 0.25 miles of the project.	
	☐Yes ⊠No	Other- Describe: none	
Explain Unresol	ved or Resolve	ed Issues:.	
□Unresolved □Resolved □No Issue	<b>Oil and Gas Activity Concerns</b> : TxDOT is concerned with the acquisition of oil and gas wells (and ancillary equipment) such as process, piping, production equipment, pipelines, etc. Select below all that apply.		
	☐Yes ⊠No	Additional Research needed or uncertain of impacts. Request assistance from ENV.	
	☐Yes ⊠No	Database search identified TRRC VCP Site within 0.5 miles of project.	
	☐Yes ⊠No	Oil/ Gas Wells within future ROW.	
	☐Yes ⊠No	Spills or other Contamination Issues associated with ancillary equipment or pipelines.	
	☐Yes ⊠No	Other- Describe: none	
Explain Unresol	ved or Resolve	ed Issues:no issues	
□Unresolved □Resolved □No Issue	Non-LPST Source Contamination Concerns discovered during the database search: These are sites or locations that have a potential for soil and groundwater contamination and are not associated with LPST sites. Select below all that apply.		
	☐Yes ⊠No	Additional Research is needed or uncertain of impacts from a Non-LPST site. Request assistance from ENV.	
	☐Yes ⊠No	Database search identified SEMS Active NPL or Not NPL site(s) within 1 mile of the project. This may be identified on a database search as a CERCLIS or NPL site.	
	⊠Yes □No	Database search identified SEMS Archived NPL or Not NPL site(s) within 0.5 miles of the project. This may be identified on a database search as a CERCLIS NFRAP.	
	⊠Yes □No	Database search identified RCRA Corrective Action(s) site within 1 mile of project.	
	⊠Yes □No	Database search identified RCRA TSD facilities within 0.5 miles of project.	
	⊠Yes □No	Database search identified TCEQ IHW Corrective Action sites within 1 mile of project.	
	☐Yes ⊠No	Database search identified TCEQ Superfund sites within 1 mile of project.	
	⊠Yes □No	Database search identified TCEQ VCP sites within 0.5 miles of project.	
	⊠Yes □No	Database search identified TCEQ IOP sites within 0.5 miles of project.	

	☐Yes ⊠No	Other- Describe: none		
Explain Unresolved or Resolved Issues: RESOLVED:				
ERNSTX:				
1 Unlocated Site at MP 243 on IH 35 NB in Austin, TX. No information is available about this facility. Per TXDOT, spills with known responsible parties are cleaned up per the TCEQ Spill Rules. Should contaminated media be encountered, it should be handled per Item 6.10 of the Standard Specifications.				
SEMS Archived	, 2 sites, archiv	ved sites with no further action:		
#47 Martine Spr	ings-Slaughter	GW Plume at 10019 South IH 35 in Austin, TX 78747, 0.014 mile ESE; nc. at 3909 A Warehosue Row in Austin, TX 78767, 0.469 mile NW.		
		e, inactive status:		
#117 Capitol Me	etal Finishing, I	nc. at 3909 A Warehouse Row in Austin, TX 78704, 0.469 mile NW		
RCRA TSD Fac #82 City of Aust	-	ctive status: nardus Drive Building B in Austin, TX 78744, 0.105 mile ESE		
TCEQ IHW Cor	rective Action,	22 sites, all with complete workloads:		
#10 Galvon Indu	ustries at 9808	South IH 35 in Austin, TX 78748, 0 mile;		
#55 South Point	Nissan Preow	ned at 6001 South IH 35 in Austin, TX 78744, 0.02 mile ESE;		
#58 Dave Trans	portation Servi	ces at 8300 South IH 35 in Austin, TX 78745, 0.024 mile WNW;		
#64 South Fork	Hyundai at 530	06 South IH 35 in Austin, TX 78745, 0.028 mile WNW;		
#65 South Star	Dodge at 5210	South IH 35 in Austin, TX 78745, 0.036 mile S;		
#67 Maxwell Ch	rysler Plymout	h Dodge at 6905 South IH 35 in Austin, TX 78744, 0.039 mile ESE;		
#69 Cen-Tex Ni	ssan at 4914 S	South IH 35 in Austin, TX 78745, 0.039 mile NNW;		
#72 Aaron's Aut	o Parts at 8409	9 South Congress Avenue in Austin, TX 78745, 0.056 mile NW;		
#78 Pompa True	cking Austin at	9203 Cullen Lane in Austin, TX 78748, 0.081 mile SW;		
#90 Commercia	l Metals Austin	at 710 Industrial Boulevard in Austin, TX 78745, 0.164 mile W;		
#112 Ambion at	2130 Woodwa	ard Street Suite 200 in Austin, TX 78744, 0.396 mile ESE;		
#113 Modern Metal Finishing at 7432 Bluff Springs Drive in Austin, TX 78744, 0.41 mile ESE;				
#114 Cen-Tex F	Plating at 509 E	East Saint Elmo Road in Austin, TX 78745, 0.437 mile WNW;		
#117 Capitol Me	etal Finishing A	ustin at 3909 Warehouse Row in Austin, TX 78767, 0.469 mile NW;		
		Saint Elmo Road Suite 110 in Austin, TX 78744, 0.563 mile ESE;		
		als Austin at 2307 Business Center Drive in Austin, TX 78744, 0.678 mile ESE;		
		<u>-</u>		
#122 BOC Edwa	ards Kachina a	t 4117 Commercial Center Drive Building 5 in Austin, TX 78744, 0.687 mile ESE;		

osed CVS Pharmacy at 5526 South Congress Avenue in Austin, TX 78745, 0.744 mile WNW

#124 Austin Scientific at 4114 Todd Lane in Austin, TX 78744, 0.795 mile ESE;

#125 Majestic Products Austin at 118 East Alpine Road in Austin, TX 78704, 0.798 mile NNW;

#126 Undeveloped Property - 8401 S First St Austin TX at 8401 South 1st Street in Austin, TX 78748, 0.822 mile WNW.

### TCEQ VCP, 6 sites, all completed:

#9 Century South Shopping Center at 801 East William Cannon Drive in Austin, TX 78745, 0 mile;

#10 Janssen Tract at 9808 South IH 35 in Austin, TX 78748, 0 mile;

#83 John Rober	ts BMW/Lexus	of Austin at 4110 Santiago Street in Austin, TX 78745, 0.111 mile W	
#107 Muldoon II	nterests at 620	1 Crown Lane in Austin, TX 78745, 0.31 mile WNW	
#111 Ben White	Lots 1, 2, 3, 4	, 5 at 500 East Ben White Boulevard in Austin, TX 78704, 0.391 mile NW;	
#118 AFCU 200	0 Woodward a	at 2000 Woodward Street in Austin, TX 78741, 0.479 mile ENE.	
TCEQ IOP, 1 sit	te, complete:		
#111 KMs Retai	l Payload Pass	s at 500 East Ben White Boulevard in Austin, TX 78704, 0.391 mile NW	
□Unresolved ☑Resolved □No Issue	Landfills/Waste Pits/Dump Site Concerns: These concerns are associated with any known or suspected (based on visual observations) landfills, dump sites, or waste pits. These concerns may appear on a database search as CALF or MSWLF site. Additionally, the local Council of Governments (COG) maintains a list of closed and open landfills in your project area. Select below all that apply.		
	☐Yes ⊠No	Additional research is needed or uncertain of impacts. Request assistance from ENV.	
	⊠Yes □No	Database search identified active/closed/abandoned CALF or MSWLF landfill sites within .5 miles of the project.	
	☐Yes ⊠No	Other- Describe: none	
Explain Unresol	ved or Resolve	ed Issues:	
#101: McGuire a 0.231 mile E	at East of IH 35	5 and West of Friedrich Lane, South of East Saint Elmo (4500 Block of Friedrich) in TX,	
		development review, "current conditions associated with this site may pose current or an health or the environment additional actions may be warranted at this site."	
Per TXDOT, the propose project.		within the foot print of the proposed work, therefore, there should be conflict with the	
No, unresolve the ISA. No furthazardous mate with regulatory of the ISA and a	ved hazardous ther hazardous erials impacts requirements a Ill applicable at	Inresolved Hazardous Material concerns?  materials concerns were identified and/or all potential concerns were resolved within a materials action is required. The ISA is complete for this project. Any unanticipated encountered during the project construction phase shall be addressed in accordance and TxDOT standard specifications. Complete Sections 9 and 10 and maintain a copy tachments in the project file.	
assessments. A	An Issues, Ider nd assessmer	or more unresolved hazardous materials concerns requiring additional investigations or ntification, and Resolution (IIR) form shalll be completed in ECOS to track the additional its. Complete Sections 9 and 10 and maintain a copy of the ISA and all applicable	

Section 9: Reference Materials Utilized (Identify any referenced materials and attach them to the ISA or in the project file.						
Referenced	⊠ Project Map	⊠ USGS Topo Maps				
Materials	□ ROW Maps/Files	☐ Sanborn Fire Insurance Maps	☐ Temporary Use Agreements			
Used	TxDOT As-Built Plans	Notifications				
	☐ Project Schematics/Profiles	⊠ Regulatory Database	☐ Record of Interviews			
		Other:TCEQ and COA records				
Section 10: Contact/Completed by						
Name:	Kathryn D. Saucier		Tel: 281-529-4114			
Title:	Senior Scientist					
Firm (District	Atkins	Atkins				
Section):						
Address:	11801 Domain Boulevard #50	11801 Domain Boulevard #500 in Austin, TX 78758				
Signature:	Kathujn D. Saucier	Kathuyn D. Saucier Date:11/30/2020				

### Appendix A

The following table shows the revision history for this guidance document.

	Revision History
Effective Date	Reason for and Description of the Change
December 2019	Version 6
	Updated NEPA assignment disclaimer language to reflect first renewed NEPA assignment MOU date of December 9, 2019.
April 2017	Version 5
	The cover page has additional fields related to specific project information. This is added to personalize the ISA to a project.
	Section 2 was modified to acknowledge that asbestos or lead-in-paint issues might exist on our construction projects, but the identification and resolution to these issues are outside of the ISA process and are handled programmatically by TxDOT (usually in CST or the ROW processes).
	Section 3 was modified by adding an additional screening option. You are now able to screen out of performing a full ISA if your project meets the parameters described.
	Section 6 was reformatted to remove the numerous selections related to the Possible Site Survey Concerns. Additionally, redundant questions were removed to make the section easier to use. Under the new format, the preparer is required to insert the survey dates and a description of what was identified during the survey.
	Minor changes were made to terminology throughout the ISA, this was performed to clarify and streamline the process.
	Section 8.1 has been modified to provide resolution to potential hazardous materials issues that can be resolved easily during the ISA process. Additionally, a comment field was added to provide direction related to issues requiring further action to resolve. This will streamline the process in reducing the amount of IIR entries requires in ECOS and will reduce the time required to review a project.
June 2016	Version 4
	Modifications to Section 5: Web links and database names were modified based on changes made by regulatory agency websites.
October 2014	Version 3
	Modifications to Section 2: Clarified this section to better define what are asbestos and lead-in-paint concerns. Changes were made due to numerous comments from the end-user.
	An additional note was added to this section. This note directs end-users to ENV-HMM for further assistance related to lead-in-paint issues.
	Modifications to Section 3: The question concerning Project Excavations in Section 3.1 was modified to match the definition used in Scoping Procedure for Categorically Excluded TxDOT Projects for Hazardous Materials found in the NEPA and Project Development Toolkit.
	Modifications to Section 5: Web links were modified based on changes made by regulatory agency websites.


	Modifications to 8.2: Clarified the "Yes" answer in 8.2 to remove the need for additional assessments for all identified hazardous materials concerns. The question was modified due to comments by the end-user.
August 2014	Version 2 Removed introductory note describing ISA threshold criteria. Note was removed because the ISA threshold criteria are located in other TxDOT guidance.
April 2014	Version 1 Released

### Attachment A Figures


Figure 1: Project Location Map

Figure 2: Project Location Topographic Map

Figure 3: Hazardous Materials Locations

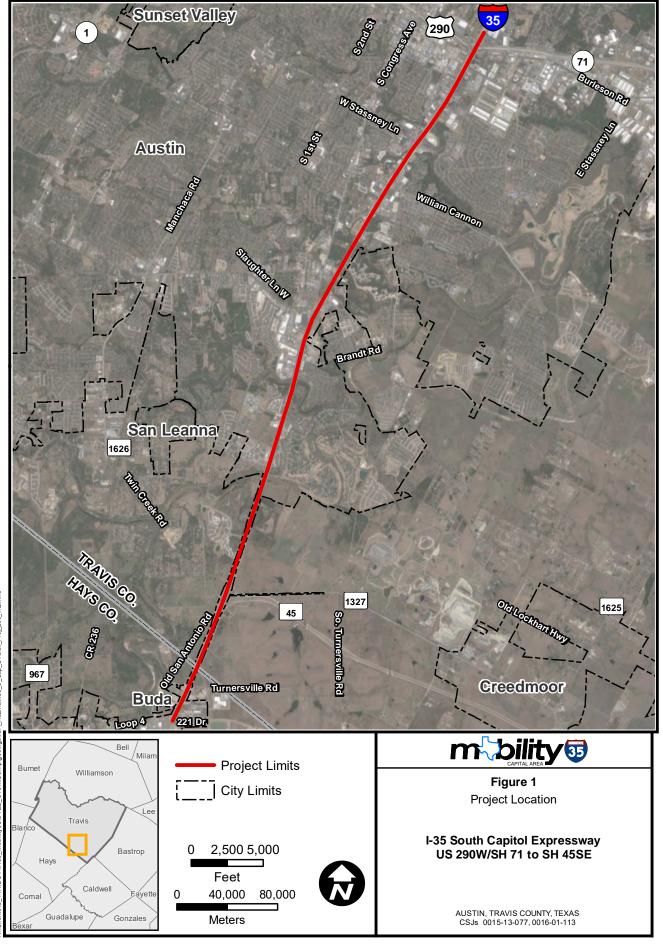



N:\Clients\S\_T\TxDOT\\H35\_Mobility35\STEL\_S10miComp\geo\tigs\\SA\_Hazmat\\35\_S\_Gap\_Overall\_Proj\_Loc\_vr2.mxd

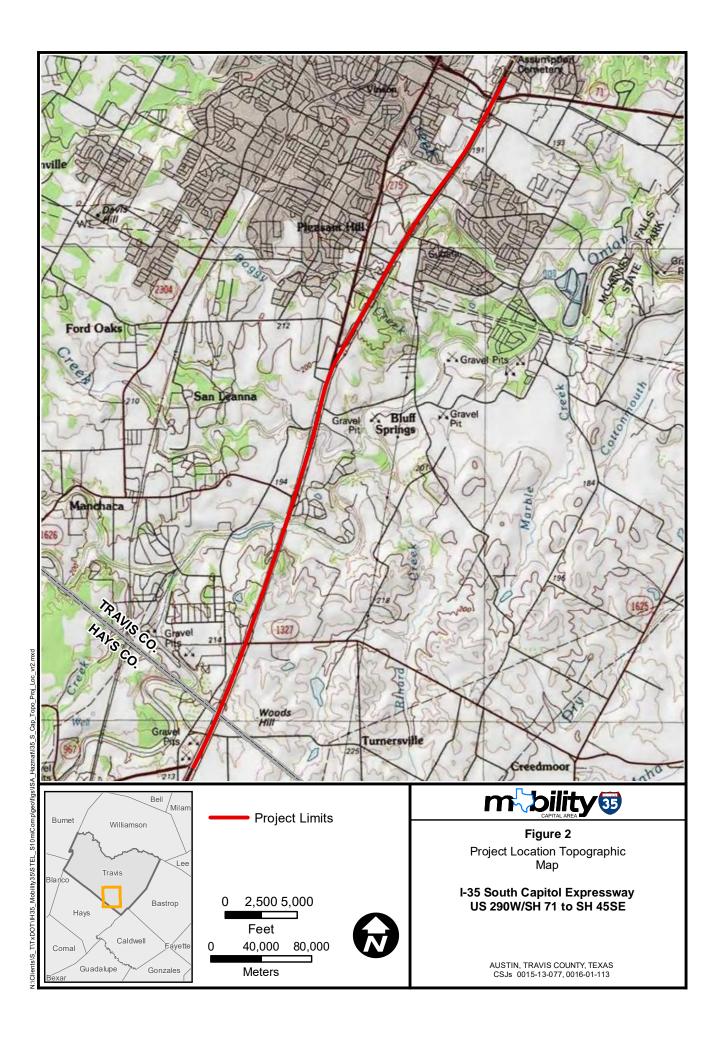







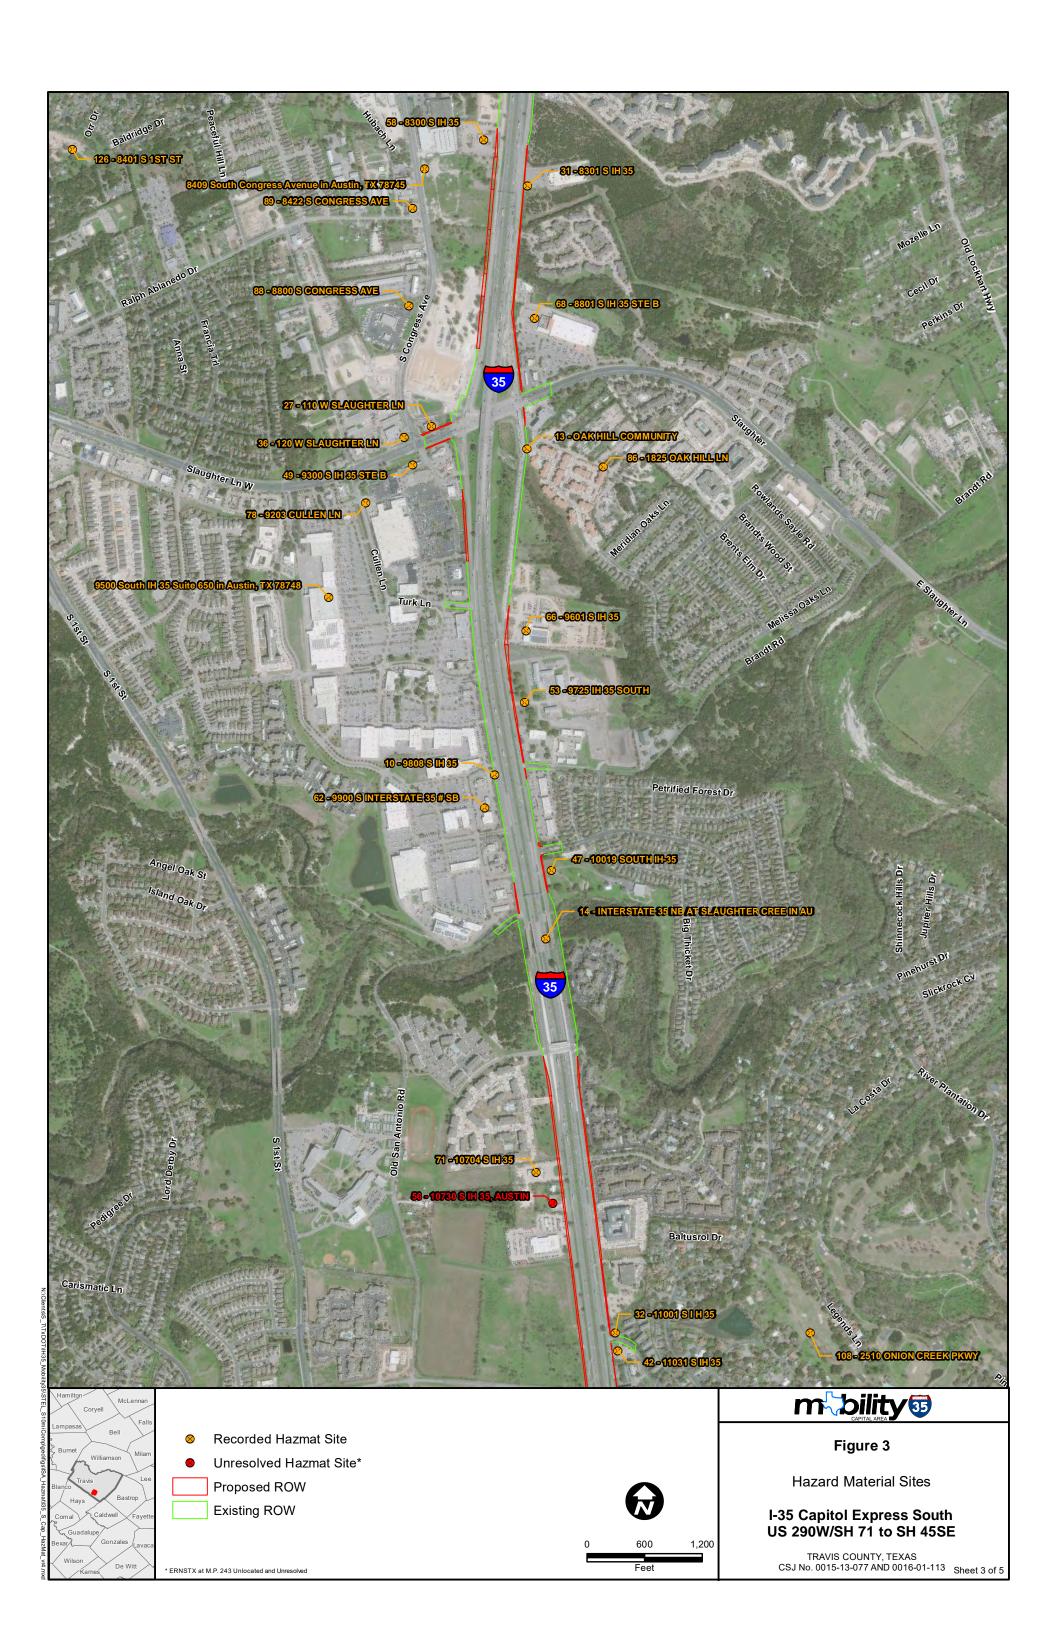


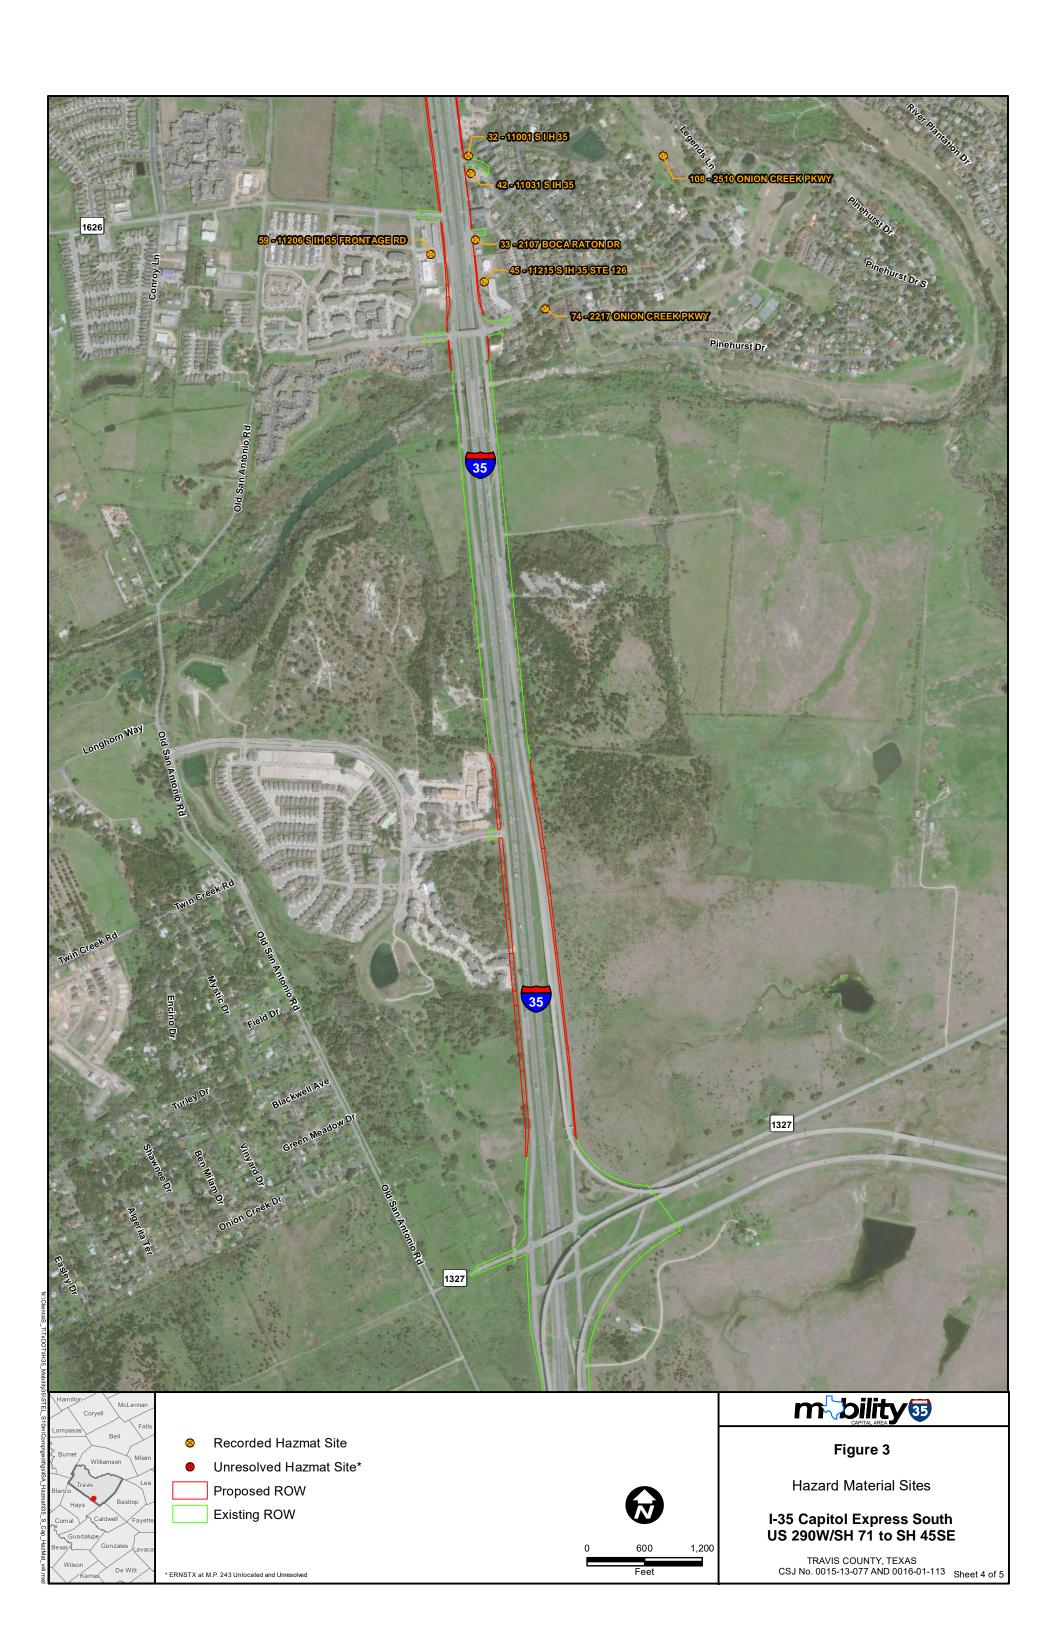


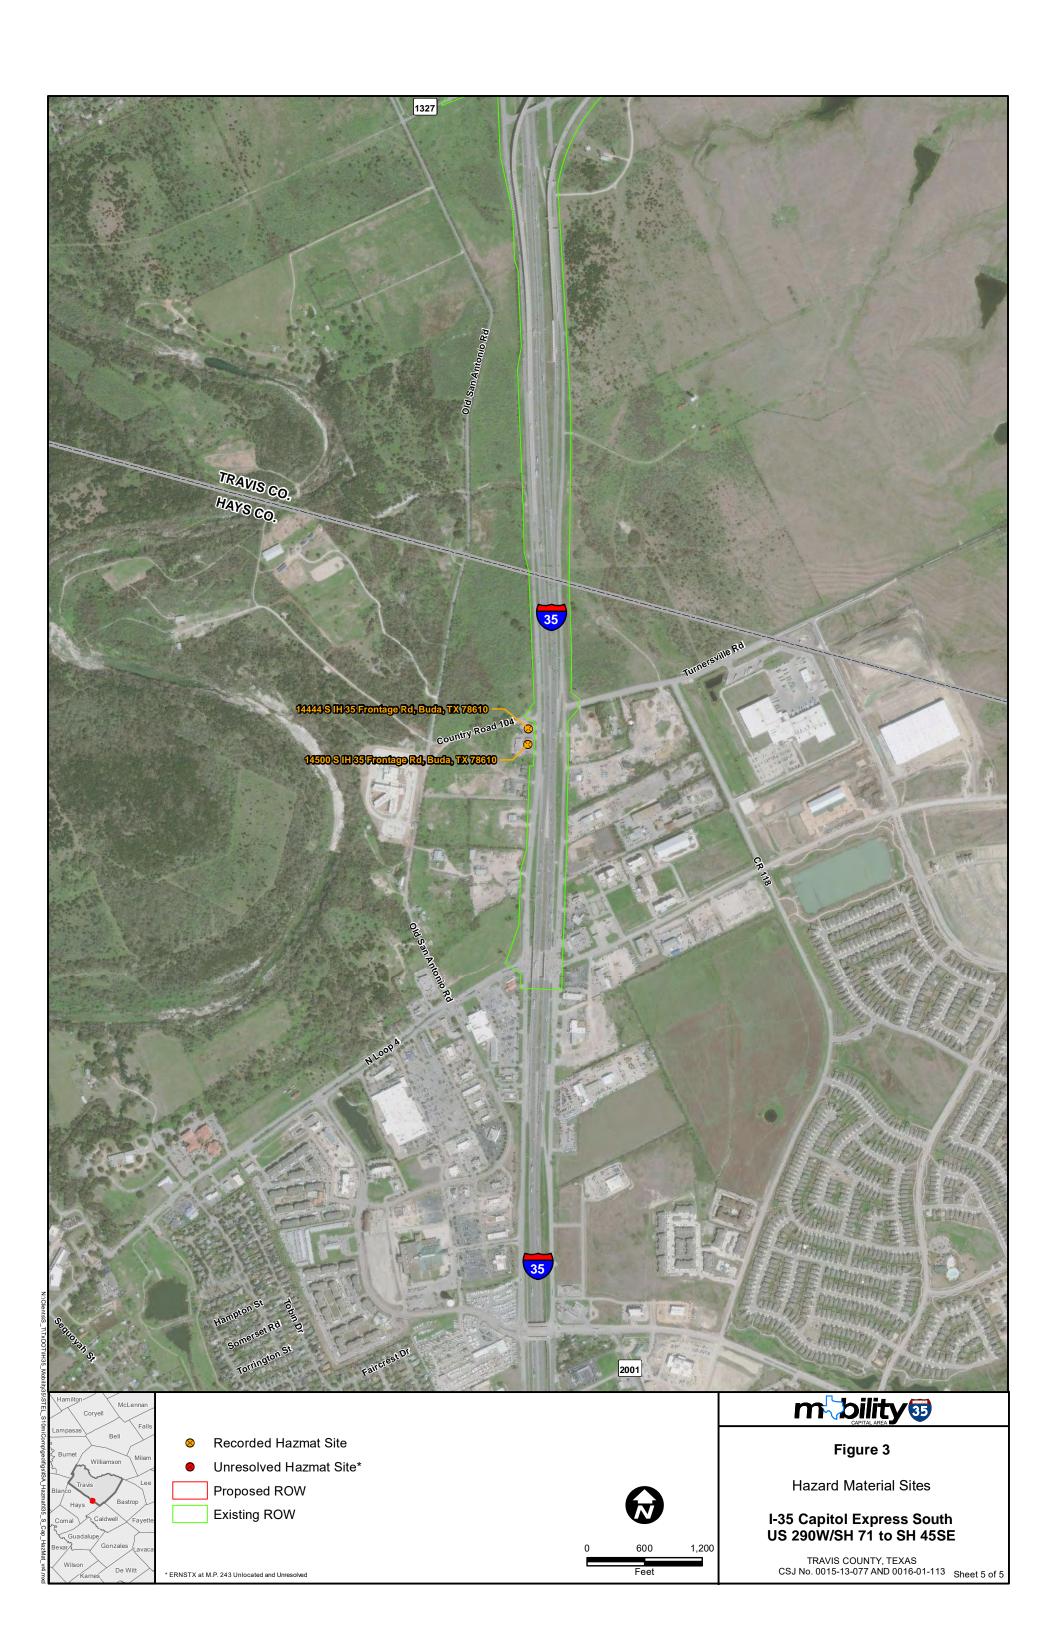



## Attachment B Layout & Typical Section

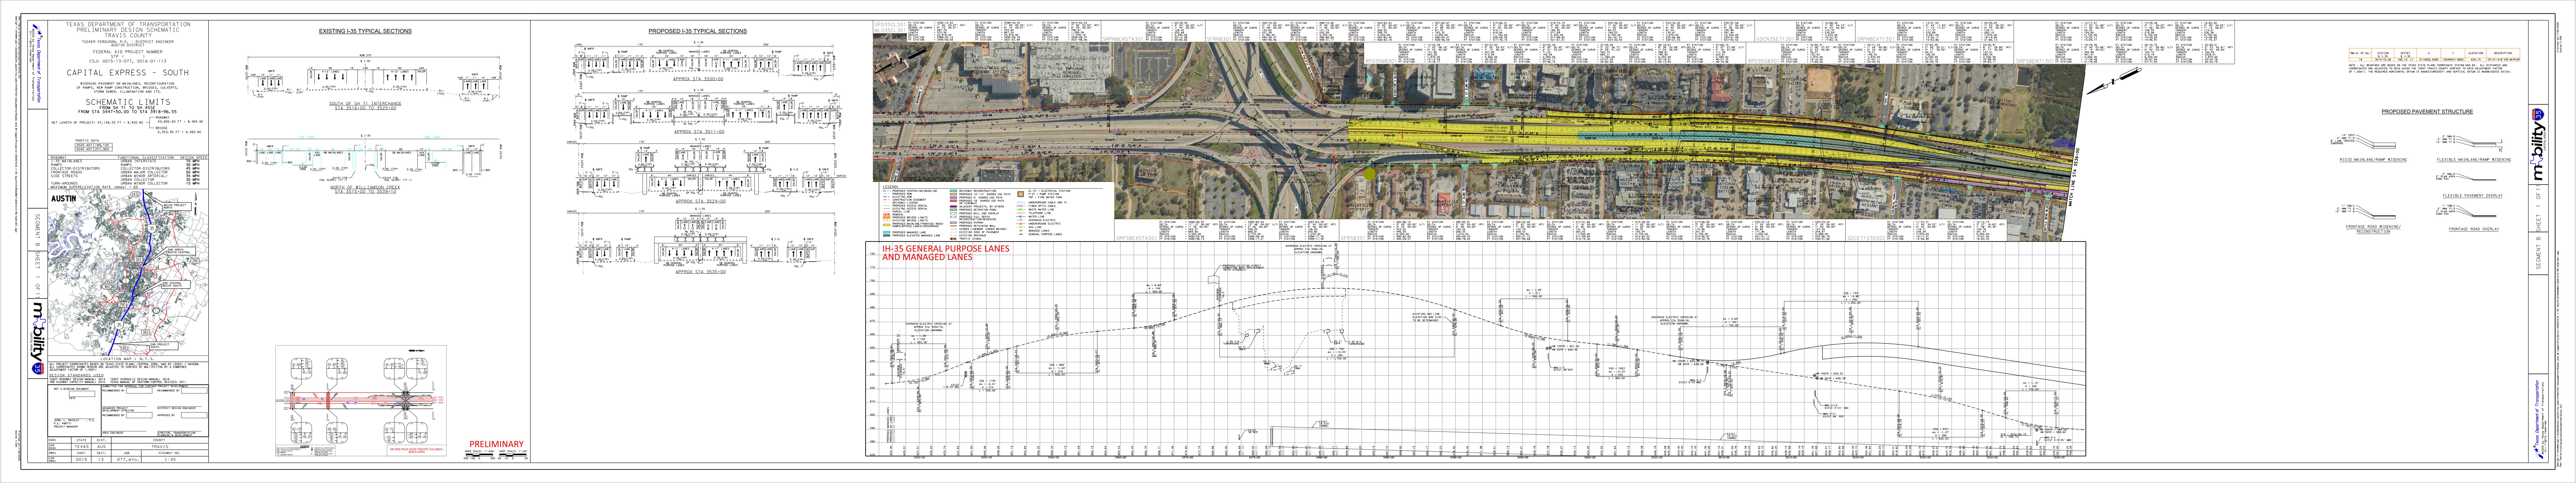


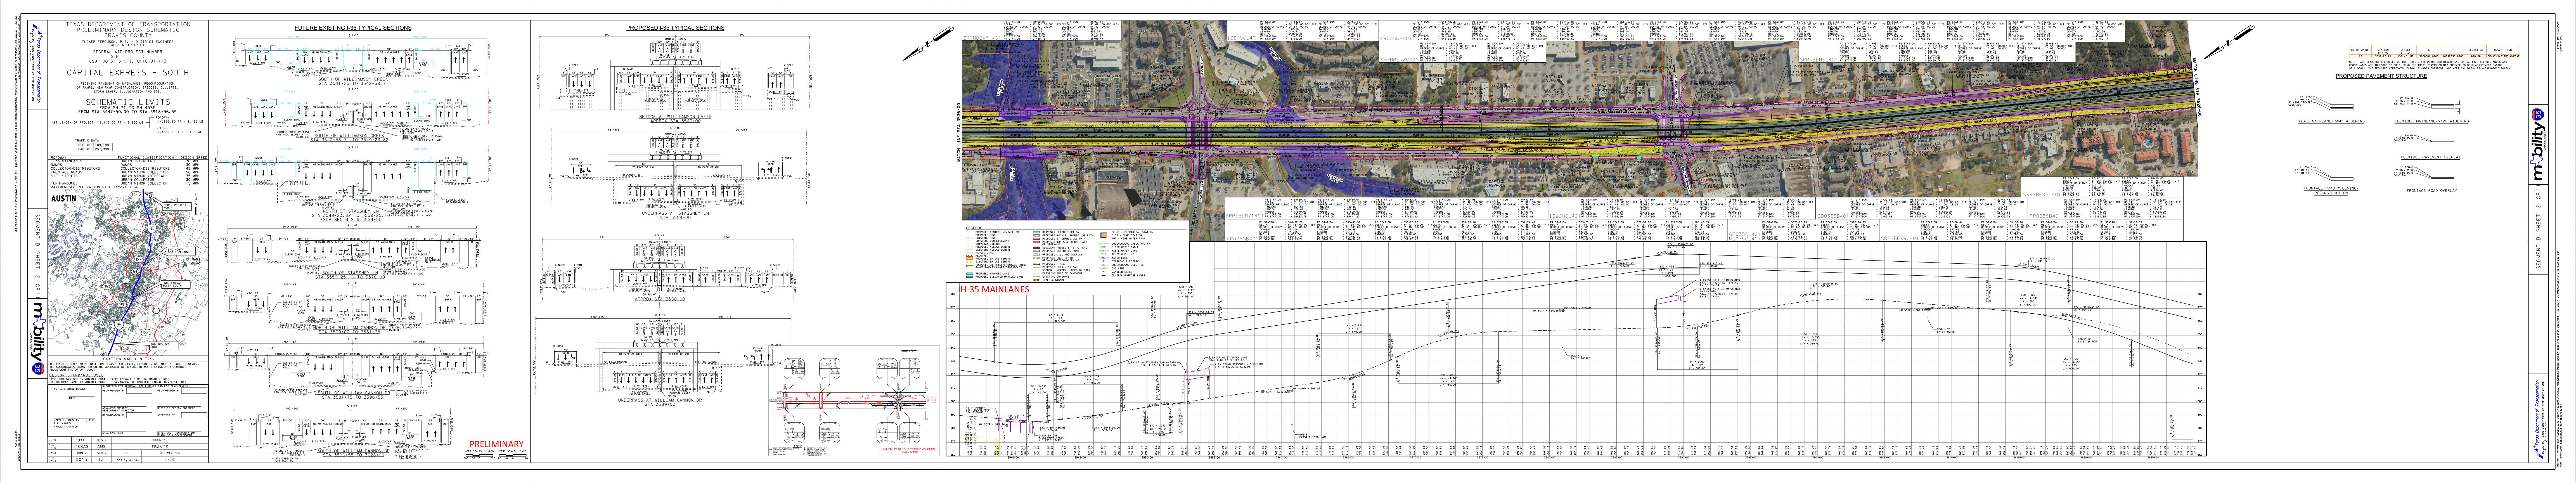

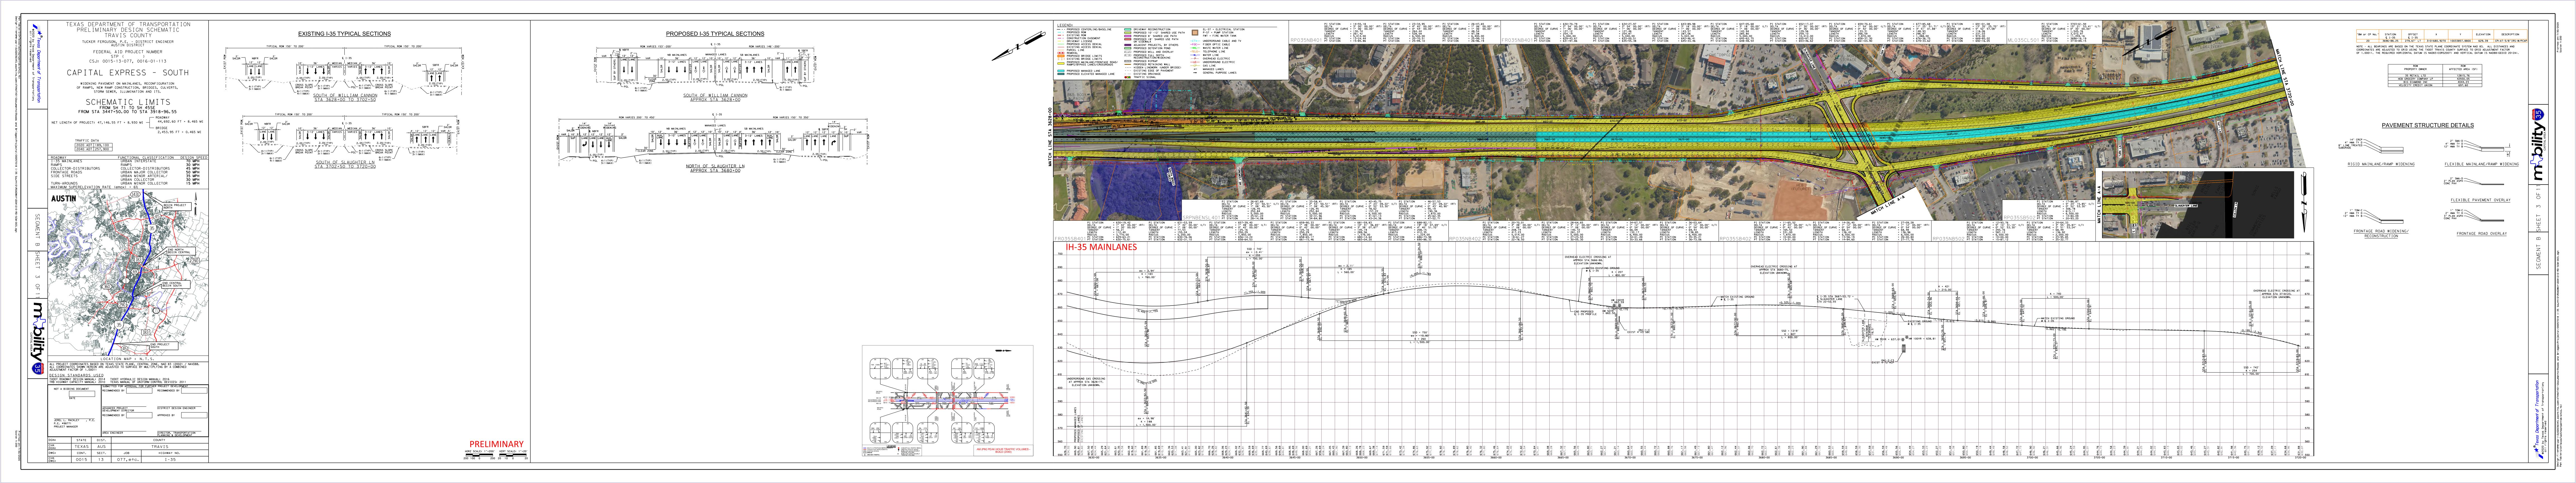


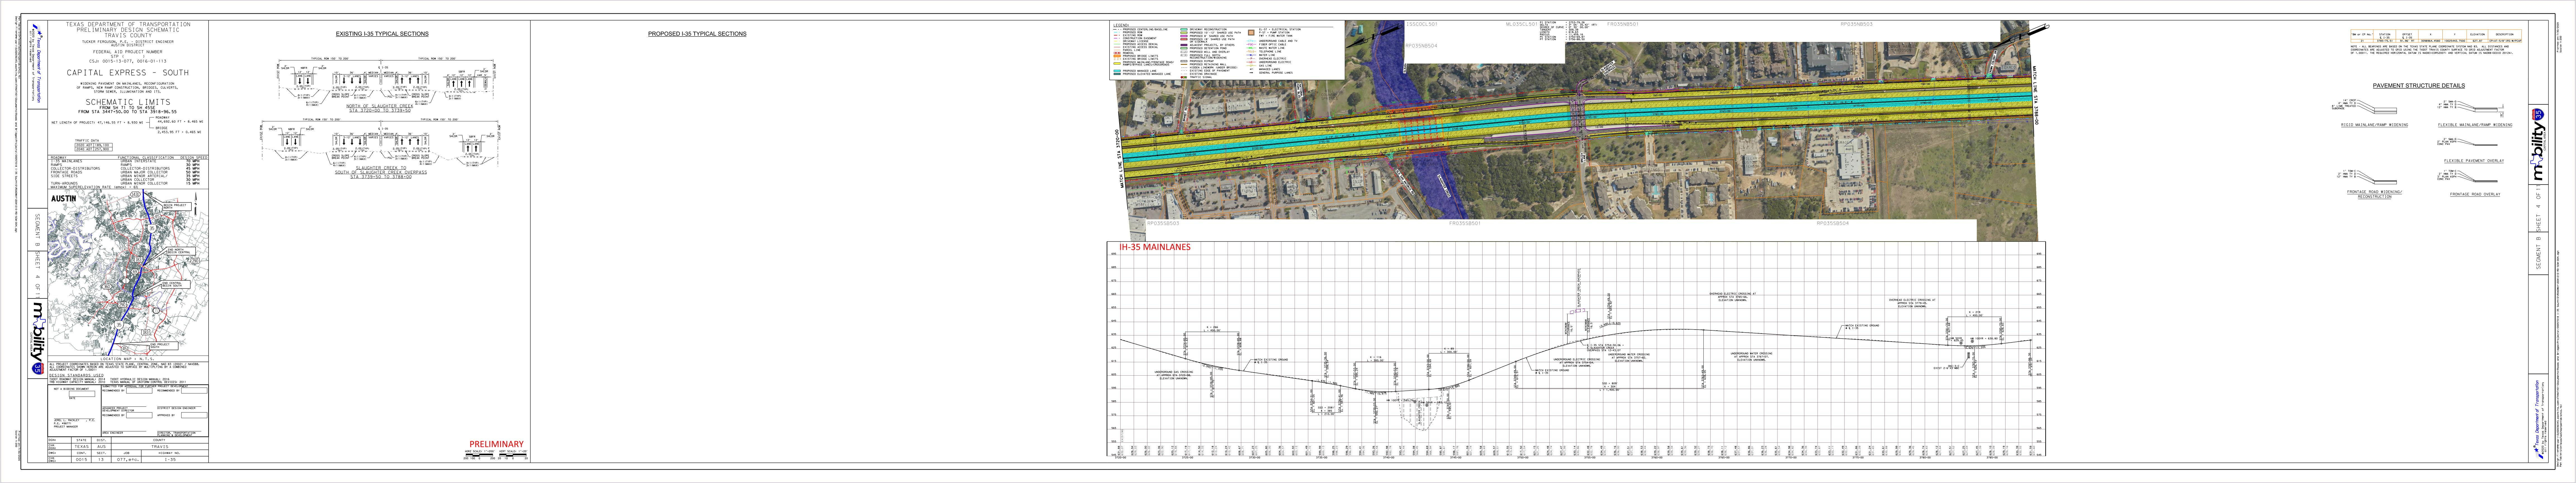


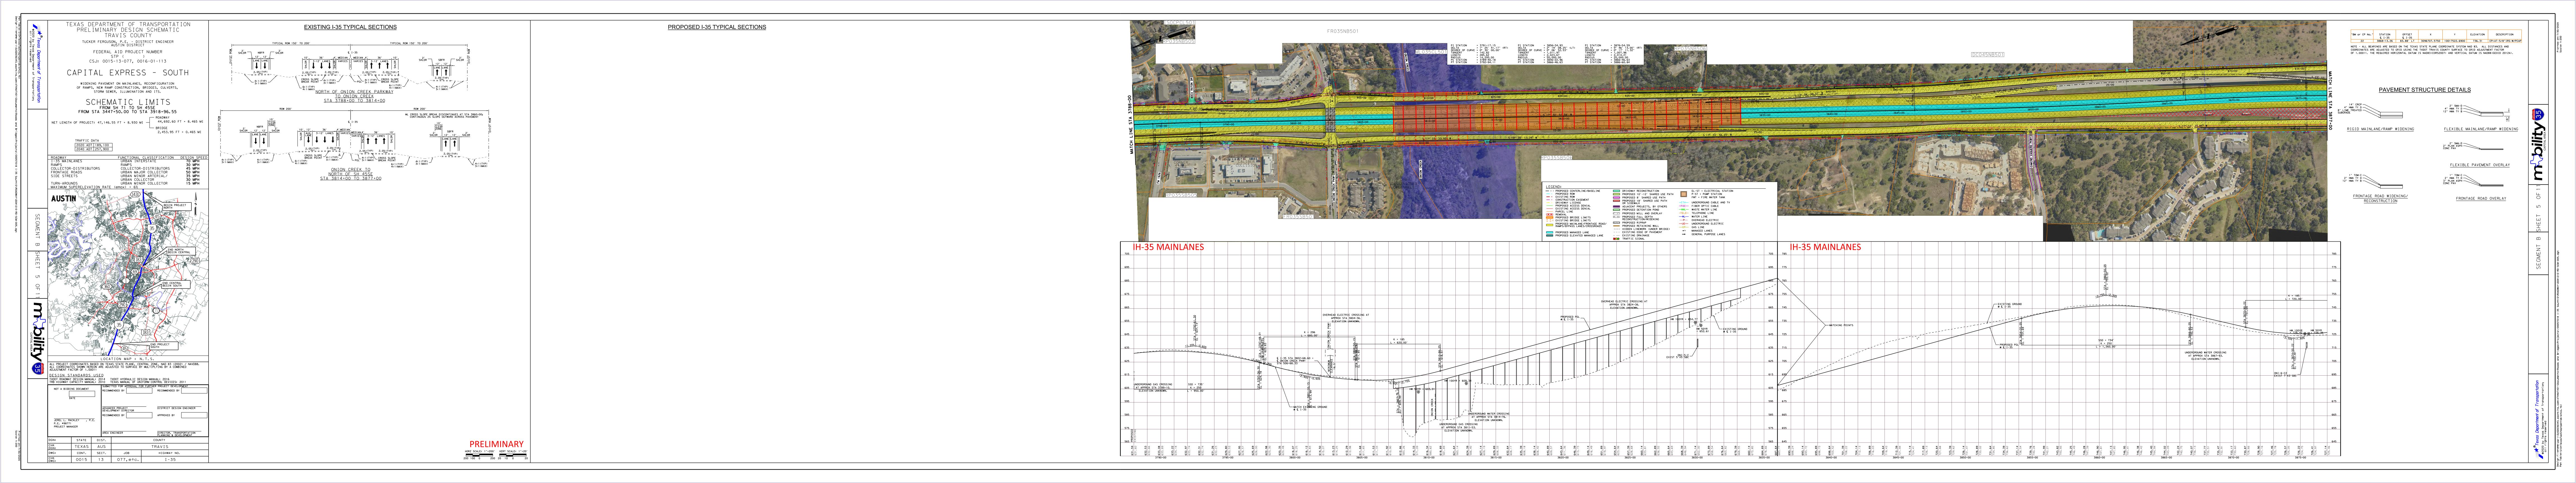

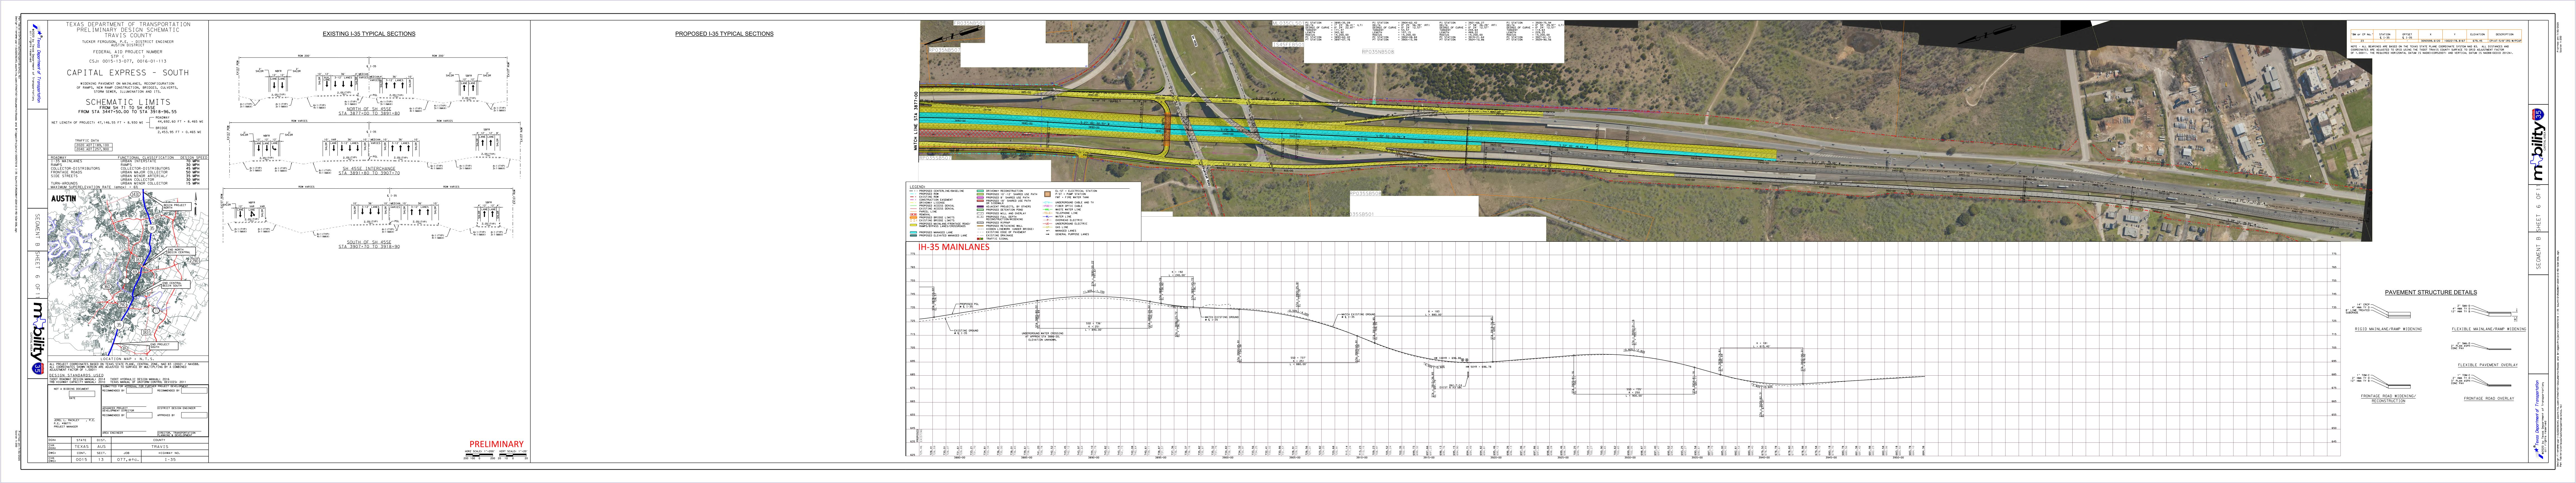


### **EXISTING I-35 TYPICAL SECTIONS**

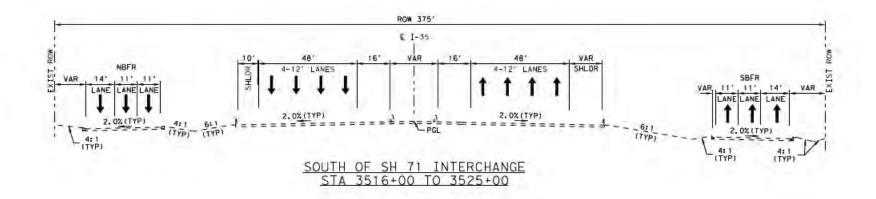


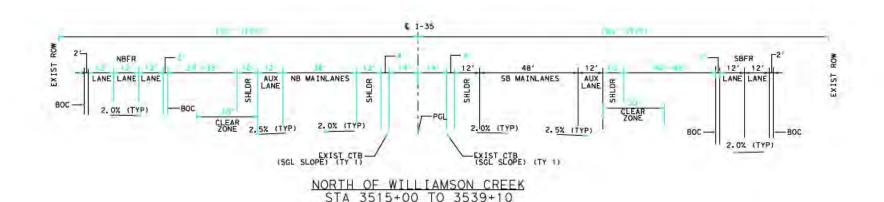


### PROPOSED I-35 TYPICAL SECTIONS

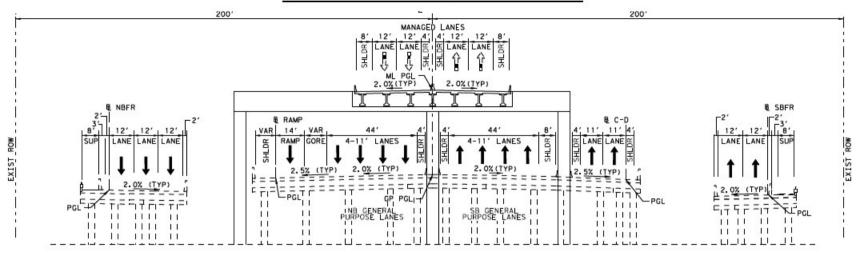

### BRIDGE AT WILLIAMSON CREEK APPROX STA 3540+00

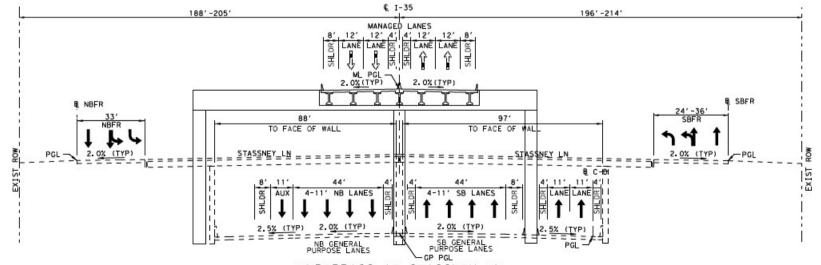

UNDERPASS AT STASSNEY LN STA 3554+00

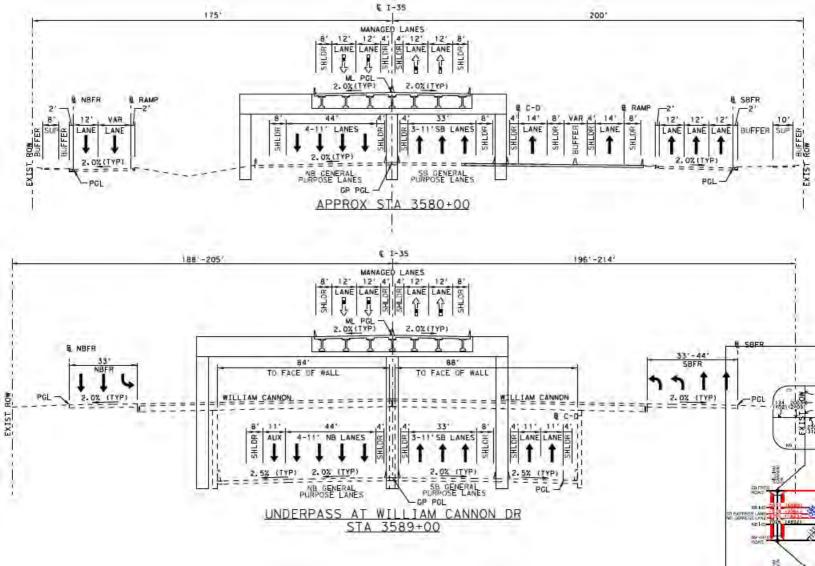

# Attachment C Regulatory Database Search



## E RecSearch Report

GeoLens by GeoSearch

Target Property:

Mobility 35 Capital Express South *I-35* Austin, Travis County, Texas 78745

Prepared For:

Atkins Global - Austin

Order #: 141197 Job #: 336212

Date: 01/31/2020

#### **Table of Contents**

Target Property Summary	1
Database Summary	2
Database Radius Summary	8
Radius Map	13
Ortho Map	14
Topographic Map	15
Located Sites Summary	15
Elevation Summary	39
Unlocated Sites Summary	917
Environmental Records Definitions	919
Unlocatable Report	See Attachmen
Zin Renort	See Attachmen

#### Disclaimer

This report was designed by GeoSearch to meet or exceed the records search requirements of the All Appropriate Inquiries Rule (40 CFR  $i \ge 1/2$ 312.26) and the current version of the ASTM International E1527, Standard Practice for Environmental Site Assessments: Phase I Environmental Site Assessment Process or, if applicable, the custom requirements requested by the entity that ordered this report. The records and databases of records used to compile this report were collected from various federal, state and local governmental entities. It is the goal of GeoSearch to meet or exceed the 40 CFR  $i \ge 1/2$ 312.26 and E1527 requirements for updating records by using the best available technology. GeoSearch contacts the appropriate governmental entities on a recurring basis. Depending on the frequency with which a record source or database of records is updated by the governmental entity, the data used to prepare this report may be updated monthly, quarterly, semi-annually, or annually.

The information provided in this report was obtained from a variety of public sources. GeoSearch cannot ensure and makes no warranty or representation as to the accuracy, reliability, quality, errors occurring from data conversion or the customer's interpretation of this report. This report was made by GeoSearch for exclusive use by its clients only. Therefore, this report may not contain sufficient information for other purposes or parties. GeoSearch and its partners, employees, officers And independent contractors cannot be held liable For actual, incidental, consequential, special or exemplary damages suffered by a customer resulting directly or indirectly from any information provided by GeoSearch.

#### **Target Property Summary**

#### **Target Property Information**

Mobility 35 Capital Express South *I-35* Austin, Texas 78745

#### Coordinates

Area centroid (-97.786935, 30.1562389) 620 feet above sea level

#### **USGS Quadrangle**

Buda, TX Oak Hill, TX

#### **Geographic Coverage Information**

County/Parish: Travis (TX), Hays (TX)

ZipCode(s): Buda TX: 78610 Manchaca TX: 78652

Austin TX: 78704, 78741, 78744, 78745, 78747, 78748

#### **FEDERAL LISTING**

#### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
EMERGENCY RESPONSE NOTIFICATION SYSTEM	<u>ERNSTX</u>	4	1	TP/AP
FEDERAL ENGINEERING INSTITUTIONAL CONTROL SITES	<u>EC</u>	0	0	TP/AP
LAND USE CONTROL INFORMATION SYSTEM	<u>LUCIS</u>	0	0	TP/AP
RCRA SITES WITH CONTROLS	<u>RCRASC</u>	0	0	TP/AP
RESOURCE CONSERVATION & RECOVERY ACT - GENERATOR	RCRAGR06	10	0	0.1250
RESOURCE CONSERVATION & RECOVERY ACT - NON- GENERATOR	RCRANGR06	28	0	0.1250
BROWNFIELDS MANAGEMENT SYSTEM	<u>BF</u>	1	0	0.5000
DELISTED NATIONAL PRIORITIES LIST	<u>DNPL</u>	0	0	0.5000
NO LONGER REGULATED RCRA NON-CORRACTS TSD FACILITIES	<u>NLRRCRAT</u>	1	0	0.5000
RESOURCE CONSERVATION & RECOVERY ACT - NON-CORRACTS TREATMENT, STORAGE & DISPOSAL FACILITIES	<u>RCRAT</u>	0	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM	<u>SEMS</u>	0	0	0.5000
SUPERFUND ENTERPRISE MANAGEMENT SYSTEM ARCHIVED SITE INVENTORY	<u>SEMSARCH</u>	2	0	0.5000
NATIONAL PRIORITIES LIST	<u>NPL</u>	0	0	1.0000
NO LONGER REGULATED RCRA CORRECTIVE ACTION FACILITIES	<u>NLRRCRAC</u>	0	0	1.0000
PROPOSED NATIONAL PRIORITIES LIST	<u>PNPL</u>	0	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - CORRECTIVE ACTION FACILITIES	RCRAC	1	0	1.0000
RESOURCE CONSERVATION & RECOVERY ACT - SUBJECT TO CORRECTIVE ACTION FACILITIES	RCRASUBC	0	0	1.0000
SUB-TOTAL		47	1	

#### Additional Environmental Records

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
AEROMETRIC INFORMATION RETRIEVAL SYSTEM / AIR FACILITY SUBSYSTEM	<u>AIRSAFS</u>	0	0	TP/AP
BIENNIAL REPORTING SYSTEM	<u>BRS</u>	0	0	TP/AP
CERCLIS LIENS	<u>SFLIENS</u>	0	0	TP/AP
CLANDESTINE DRUG LABORATORY LOCATIONS	<u>CDL</u>	0	0	TP/AP
EPA DOCKET DATA	<u>DOCKETS</u>	1	0	TP/AP
ENFORCEMENT AND COMPLIANCE HISTORY INFORMATION	ECHOR06	24	0	TP/AP
FACILITY REGISTRY SYSTEM	<u>FRSTX</u>	66	0	TP/AP

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
HAZARDOUS MATERIALS INCIDENT REPORTING SYSTEM	HMIRSR06	4	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM (FORMERLY DOCKETS)	<u>ICIS</u>	1	0	TP/AP
INTEGRATED COMPLIANCE INFORMATION SYSTEM NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	<u>ICISNPDES</u>	0	0	TP/AP
MATERIAL LICENSING TRACKING SYSTEM	<u>MLTS</u>	0	0	TP/AP
NATIONAL POLLUTANT DISCHARGE ELIMINATION SYSTEM	NPDESR06	0	0	TP/AP
PCB ACTIVITY DATABASE SYSTEM	<u>PADS</u>	0	0	TP/AP
PERMIT COMPLIANCE SYSTEM	PCSR06	0	0	TP/AP
SEMS LIEN ON PROPERTY	<u>SEMSLIENS</u>	0	0	TP/AP
SECTION SEVEN TRACKING SYSTEM	<u>SSTS</u>	0	0	TP/AP
TOXIC SUBSTANCE CONTROL ACT INVENTORY	<u>TSCA</u>	0	0	TP/AP
TOXICS RELEASE INVENTORY	<u>TRI</u>	0	0	TP/AP
ALTERNATIVE FUELING STATIONS	<u>ALTFUELS</u>	10	0	0.2500
FEMA OWNED STORAGE TANKS	<u>FEMAUST</u>	0	0	0.2500
HISTORICAL GAS STATIONS	<u>HISTPST</u>	0	0	0.2500
INTEGRATED COMPLIANCE INFORMATION SYSTEM DRYCLEANERS	<u>ICISCLEANERS</u>	0	0	0.2500
MINE SAFETY AND HEALTH ADMINISTRATION MASTER INDEX FILE	<u>MSHA</u>	0	0	0.2500
MINERAL RESOURCE DATA SYSTEM	<u>MRDS</u>	0	0	0.2500
OPEN DUMP INVENTORY	<u>ODI</u>	0	0	0.5000
SURFACE MINING CONTROL AND RECLAMATION ACT SITES	<u>SMCRA</u>	0	0	0.5000
URANIUM MILL TAILINGS RADIATION CONTROL ACT SITES	<u>USUMTRCA</u>	0	0	0.5000
DEPARTMENT OF DEFENSE SITES	<u>DOD</u>	0	0	1.0000
FORMER MILITARY NIKE MISSILE SITES	<u>NMS</u>	0	0	1.0000
FORMERLY USED DEFENSE SITES	<u>FUDS</u>	0	0	1.0000
FORMERLY UTILIZED SITES REMEDIAL ACTION PROGRAM	<u>FUSRAP</u>	0	0	1.0000
RECORD OF DECISION SYSTEM	RODS	0	0	1.0000
SUB-TOTAL		106	0	

#### STATE (TX) LISTING

#### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
STATE INSTITUTIONAL/ENGINEERING CONTROL SITES	SIEC01	2	0	TP/AP
PETROLEUM STORAGE TANKS	<u>PST</u>	61	0	0.2500
BROWNFIELDS SITE ASSESSMENTS	<u>BSA</u>	1	0	0.5000
CLOSED & ABANDONED LANDFILL INVENTORY	<u>CALF</u>	1	0	0.5000
LEAKING PETROLEUM STORAGE TANKS	<u>LPST</u>	28	0	0.5000
MUNICIPAL SOLID WASTE LANDFILL SITES	<u>MSWLF</u>	1	0	0.5000
RAILROAD COMMISSION VCP AND BROWNFIELD SITES	<u>RRCVCP</u>	О	0	0.5000
VOLUNTARY CLEANUP PROGRAM SITES	<u>VCP</u>	6	0	0.5000
STATE SUPERFUND SITES	<u>SF</u>	0	0	1.0000
SUB-TOTAL		100	0	

#### **Additional Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
GROUNDWATER CONTAMINATION CASES	<u>GWCC</u>	3	0	TP/AP
HISTORIC GROUNDWATER CONTAMINATION CASES	<u>HISTGWCC</u>	7	0	TP/AP
LAND APPLICATION PERMITS	<u>LANDAPP</u>	0	0	TP/AP
MUNICIPAL SETTING DESIGNATIONS	<u>MSD</u>	0	0	TP/AP
NOTICE OF VIOLATIONS	<u>NOV</u>	4	0	TP/AP
SPILLS LISTING	<u>SPILLS</u>	5	0	TP/AP
TCEQ LIENS	<u>LIENS</u>	0	0	TP/AP
TIER I I CHEMICAL REPORTING PROGRAM FACILITIES	<u>TIERII</u>	10	0	TP/AP
DRY CLEANER REGISTRATION DATABASE	<u>DCR</u>	4	0	0.2500
INDUSTRIAL AND HAZARDOUS WASTE SITES	<u>IHW</u>	49	0	0.2500
PERMITTED INDUSTRIAL HAZARDOUS WASTE SITES	<u>PIHW</u>	0	0	0.2500
AFFECTED PROPERTY ASSESSMENT REPORTS	<u>APAR</u>	6	0	0.5000
DRY CLEANER REMEDIATION PROGRAM SITES	<u>DCRPS</u>	0	0	0.5000
INNOCENT OWNER / OPERATOR DATABASE	<u>IOP</u>	1	0	0.5000
RADIOACTIVE WASTE SITES	<u>RWS</u>	0	0	0.5000
RECYCLING FACILITIES	<u>WMRF</u>	3	0	0.5000
SALT CAVERNS FOR PETROLEUM STORAGE	<u>STCV</u>	0	0	0.5000
INDUSTRIAL AND HAZARDOUS WASTE CORRECTIVE ACTION SITES	<u>IHWCA</u>	22	0	1.0000

SUB-TOTAL	114	0	

#### **LOCAL LISTING**

#### **Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
CITY OF AUSTIN HOSPITALS	<u>COAHOSPITALS</u>	0	0	0.2500
SUB-TOTAL		0	0	

#### **Standard Environmental Records**

Database	Acronym	Locatable	Unlocatable	Search Radius (miles)
CITY OF AUSTIN UNDERGROUND STORAGE TANKS	<u>AUSTINUST</u>	48	0	0.2500
SUB-TOTAL		48	0	

#### Additional Environmental Records

Database	Acronym	Locatable	Uniocatable	Search Radius (miles)
EDWARDS AQUIFER PERMITS	EAP	1	0	TP/AP
CITY OF AUSTIN HISTORICAL UNDERGROUND STORAGE TANKS	<u>AUSTINHISTUST</u>	0	0	0.2500
SUB-TOTAL		1	0	

#### TRIBAL LISTING

#### **Standard Environmental Records**

Database	Acronym	Locatable	Uniocatable	Search Radius (miles)
UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	<u>USTR06</u>	0	0	0.2500
LEAKING UNDERGROUND STORAGE TANKS ON TRIBAL LANDS	<u>LUSTR06</u>	0	0	0.5000
OPEN DUMP INVENTORY ON TRIBAL LANDS	<u>ODINDIAN</u>	0	0	0.5000
SUB-TOTAL		0	0	

#### **Additional Environmental Records**

Database	Acronym	Locatable	Uniocatable	Search Radius (miles)
INDIAN RESERVATIONS	INDIANRES	0	0	1.0000
SUB-TOTAL		0	0	
TOTAL		416	1	

#### **FEDERAL LISTING**

Standard environmental records are displayed in **bold**.

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
AIRSAFS	0.0200	0	NS	NS	NS	NS	NS	0
BRS	0.0200	0	NS	NS	NS	NS	NS	0
CDL	0.0200	0	NS	NS	NS	NS	NS	0
DOCKETS	0.0200	1	NS	NS	NS	NS	NS	1
EC	0.0200	0	NS	NS	NS	NS	NS	0
ECHOR06	0.0200	24	NS	NS	NS	NS	NS	24
ERNSTX	0.0200	4	NS	NS	NS	NS	NS	4
FRSTX	0.0200	66	NS	NS	NS	NS	NS	66
HMIRSR06	0.0200	4	NS	NS	NS	NS	NS	4
ICIS	0.0200	1	NS	NS	NS	NS	NS	1
ICISNPDES	0.0200	0	NS	NS	NS	NS	NS	0
LUCIS	0.0200	0	NS	NS	NS	NS	NS	o
MLTS	0.0200	0	NS	NS	NS	NS	NS	0
NPDESR06	0.0200	0	NS	NS	NS	NS	NS	0
PADS	0.0200	0	NS	NS	NS	NS	NS	0
PCSR06	0.0200	0	NS	NS	NS	NS	NS	0
RCRASC	0.0200	О	NS	NS	NS	NS	NS	О
SEMSLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SFLIENS	0.0200	0	NS	NS	NS	NS	NS	0
SSTS	0.0200	0	NS	NS	NS	NS	NS	0
TRI	0.0200	0	NS	NS	NS	NS	NS	0
TSCA	0.0200	0	NS	NS	NS	NS	NS	0
RCRAGR06	0.1250	4	6	NS	NS	NS	NS	10
RCRANGR06	0.1250	16	12	NS	NS	NS	NS	28
ALTFUELS	0.2500	1	6	3	NS	NS	NS	10
FEMAUST	0.2500	0	0	0	NS	NS	NS	0
HISTPST	0.2500	0	0	0	NS	NS	NS	0
ICISCLEANERS	0.2500	0	0	О	NS	NS	NS	0
MRDS	0.2500	0	0	О	NS	NS	NS	0
MSHA	0.2500	0	0	0	NS	NS	NS	0
BF	0.5000	О	О	О	1	NS	NS	1
DNPL	0.5000	О	О	О	О	NS	NS	О
NLRRCRAT	0.5000	О	1	О	О	NS	NS	1
ODI	0.5000	0	0	0	0	NS	NS	0
RCRAT	0.5000	0	О	o	o	NS	NS	o

8 of 937

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
SEMS	0.5000	0	0	0	0	NS	NS	o
SEMSARCH	0.5000	1	o	О	1	NS	NS	2
SMCRA	0.5000	0	0	0	0	NS	NS	0
USUMTRCA	0.5000	0	0	0	0	NS	NS	0
DOD	1.0000	0	0	0	0	0	NS	0
FUDS	1.0000	0	0	0	0	0	NS	0
FUSRAP	1.0000	0	0	0	0	0	NS	0
NLRRCRAC	1.0000	0	0	o	o	o	NS	o
NMS	1.0000	0	0	0	0	0	NS	0
NPL	1.0000	0	0	o	o	o	NS	o
PNPL	1.0000	О	0	О	О	o	NS	o
RCRAC	1.0000	0	o	О	1	o	NS	1
RCRASUBC	1.0000	o	o	О	О	o	NS	o
RODS	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		122	25	3	3	0	0	153

#### STATE (TX) LISTING

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
GWCC	0.0200	3	NS	NS	NS	NS	NS	3
HISTGWCC	0.0200	7	NS	NS	NS	NS	NS	7
LANDAPP	0.0200	0	NS	NS	NS	NS	NS	0
LIENS	0.0200	0	NS	NS	NS	NS	NS	0
MSD	0.0200	0	NS	NS	NS	NS	NS	0
NOV	0.0200	4	NS	NS	NS	NS	NS	4
SIEC01	0.0200	2	NS	NS	NS	NS	NS	2
SPILLS	0.0200	5	NS	NS	NS	NS	NS	5
TIERII	0.0200	10	NS	NS	NS	NS	NS	10
DCR	0.2500	2	1	1	NS	NS	NS	4
IHW	0.2500	20	18	11	NS	NS	NS	49
PIHW	0.2500	0	0	0	NS	NS	NS	0
PST	0.2500	28	17	16	NS	NS	NS	61
APAR	0.5000	0	1	0	5	NS	NS	6
BSA	0.5000	О	o	o	1	NS	NS	1
CALF	0.5000	О	o	1	О	NS	NS	1
DCRPS	0.5000	0	0	0	0	NS	NS	0
IOP	0.5000	0	0	0	1	NS	NS	1
LPST	0.5000	9	6	6	7	NS	NS	28
MSWLF	0.5000	О	o	1	О	NS	NS	1
RRCVCP	0.5000	О	o	О	О	NS	NS	0
RWS	0.5000	0	0	0	0	NS	NS	0
STCV	0.5000	0	0	0	0	NS	NS	0
VCP	0.5000	2	1	О	3	NS	NS	6
WMRF	0.5000	0	0	2	1	NS	NS	3
IHWCA	1.0000	2	7	1	4	8	NS	22
SF	1.0000	0	О	0	0	0	NS	0
SUB-TOTAL		94	51	39	22	8	0	214

#### **LOCAL LISTING**

Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
EAP	0.0200	1	NS	NS	NS	NS	NS	1
AUSTINHISTUST	0.2500	0	0	0	NS	NS	NS	0
AUSTINUST	0.2500	22	17	9	NS	NS	NS	48
COAHOSPITALS	0.2500	0	0	0	NS	NS	NS	0
SUB-TOTAL		23	17	9	0	0	0	49

#### TRIBAL LISTING

Standard environmental records are displayed in bold.


Acronym	Search Radius (miles)	TP/AP (0 - 0.02)	1/8 Mile (> TP/AP)	1/4 Mile (> 1/8)	1/2 Mile (> 1/4)	1 Mile (> 1/2)	> 1 Mile	Total
USTR06	0.2500	0	0	0	NS	NS	NS	0
LUSTR06	0.5000	0	0	0	О	NS	NS	o
ODINDIAN	0.5000	0	0	0	О	NS	NS	o
INDIANRES	1.0000	0	0	0	0	0	NS	0
SUB-TOTAL		0	0	0	0	0	0	0


TOTAL	239	93	51	25	8	0	416


NOTES:

NS = NOT SEARCHED

TP/AP = TARGET PROPERTY/ADJACENT PROPERTY

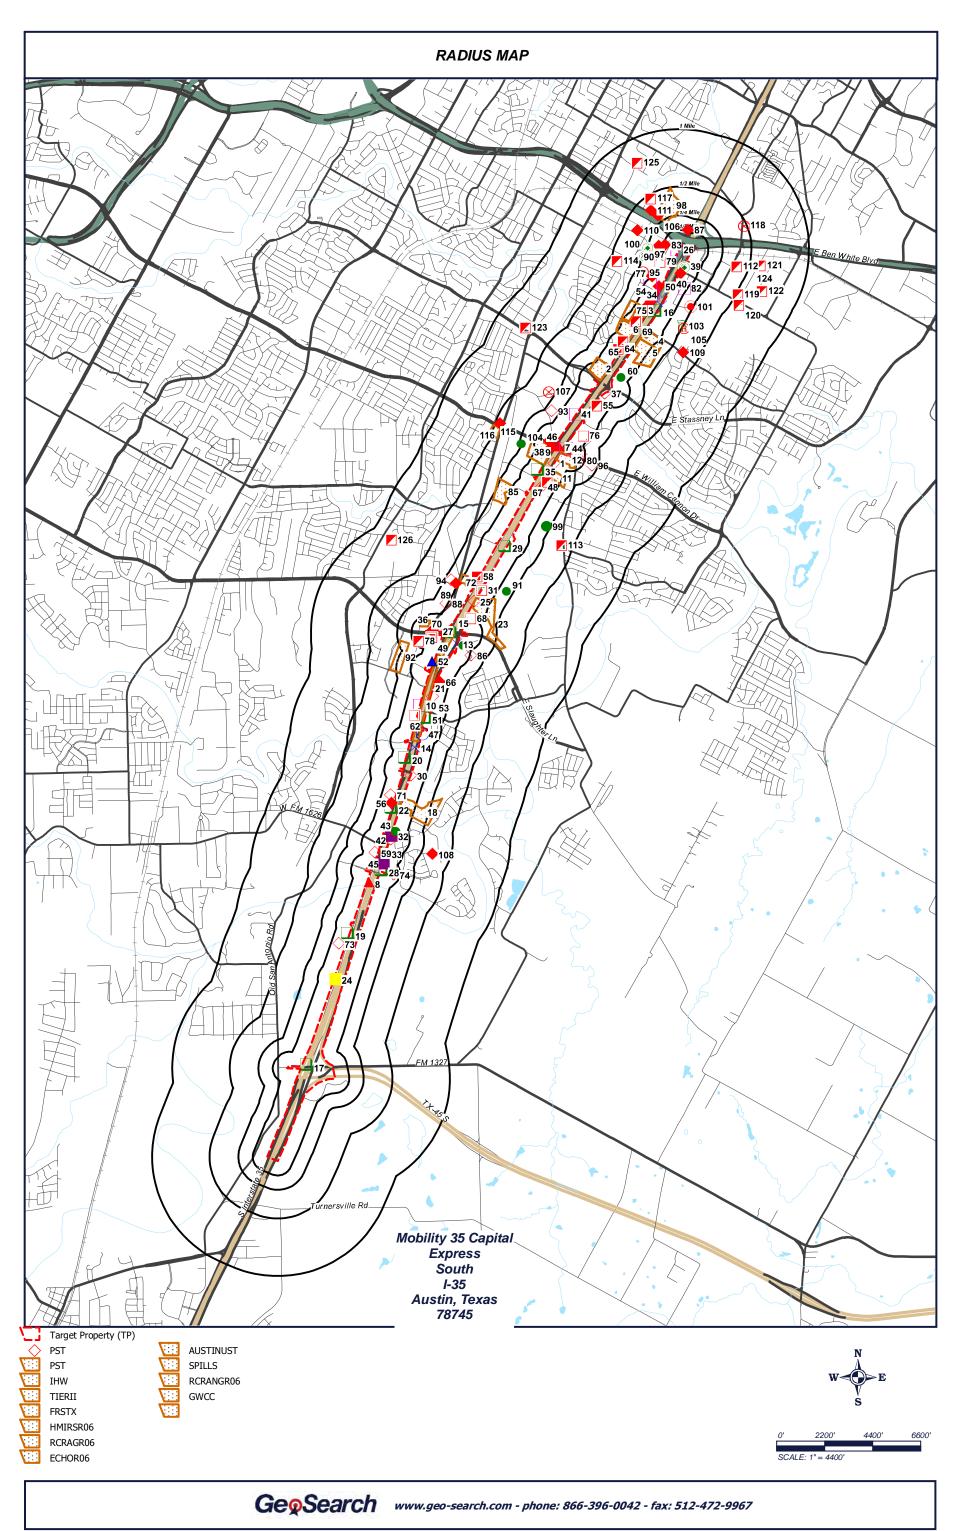

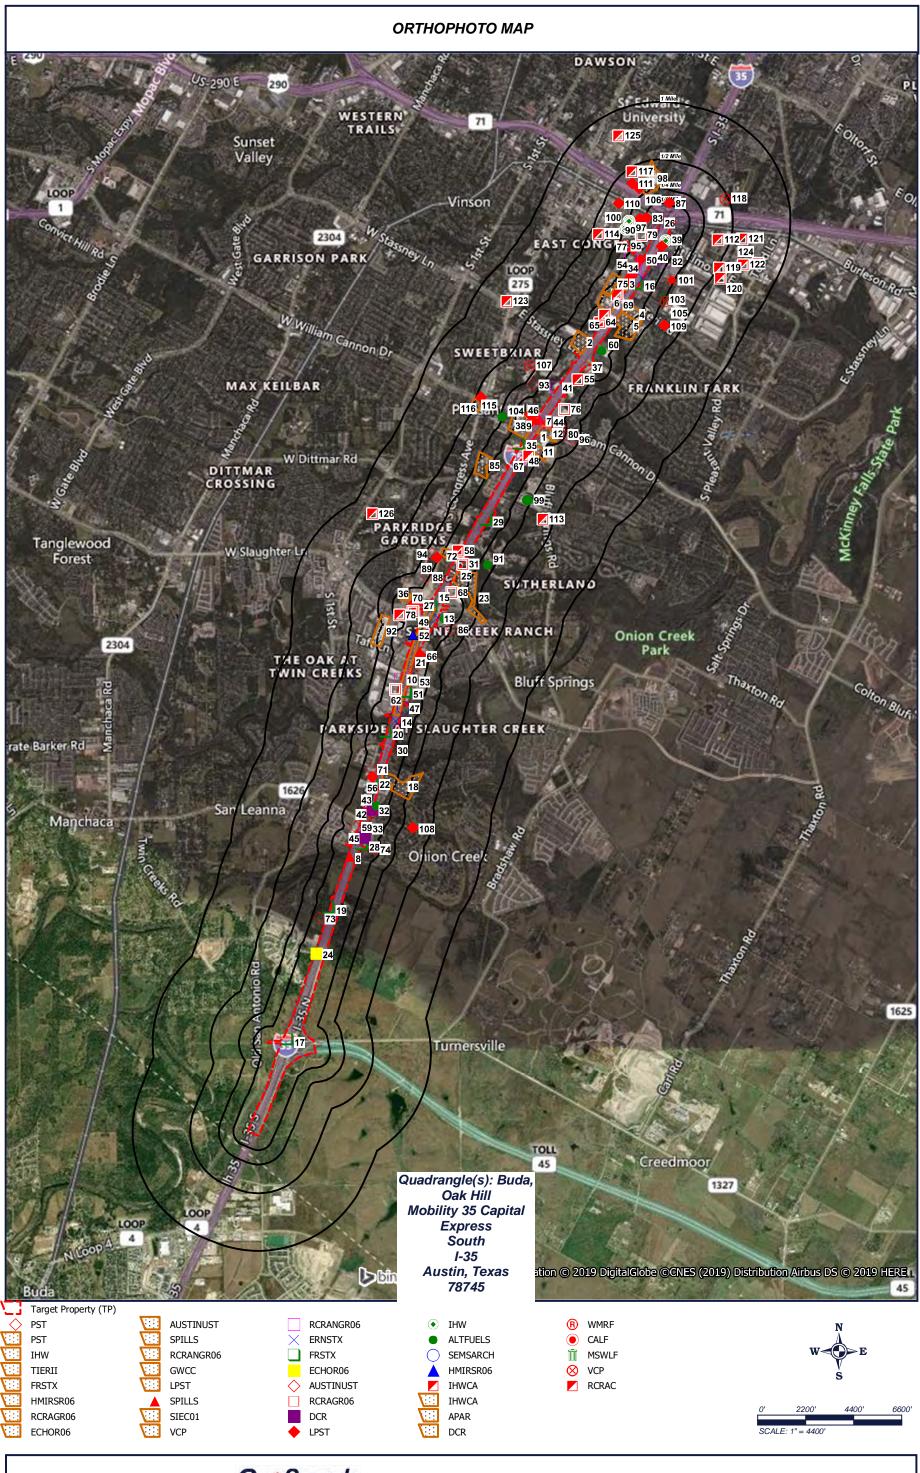

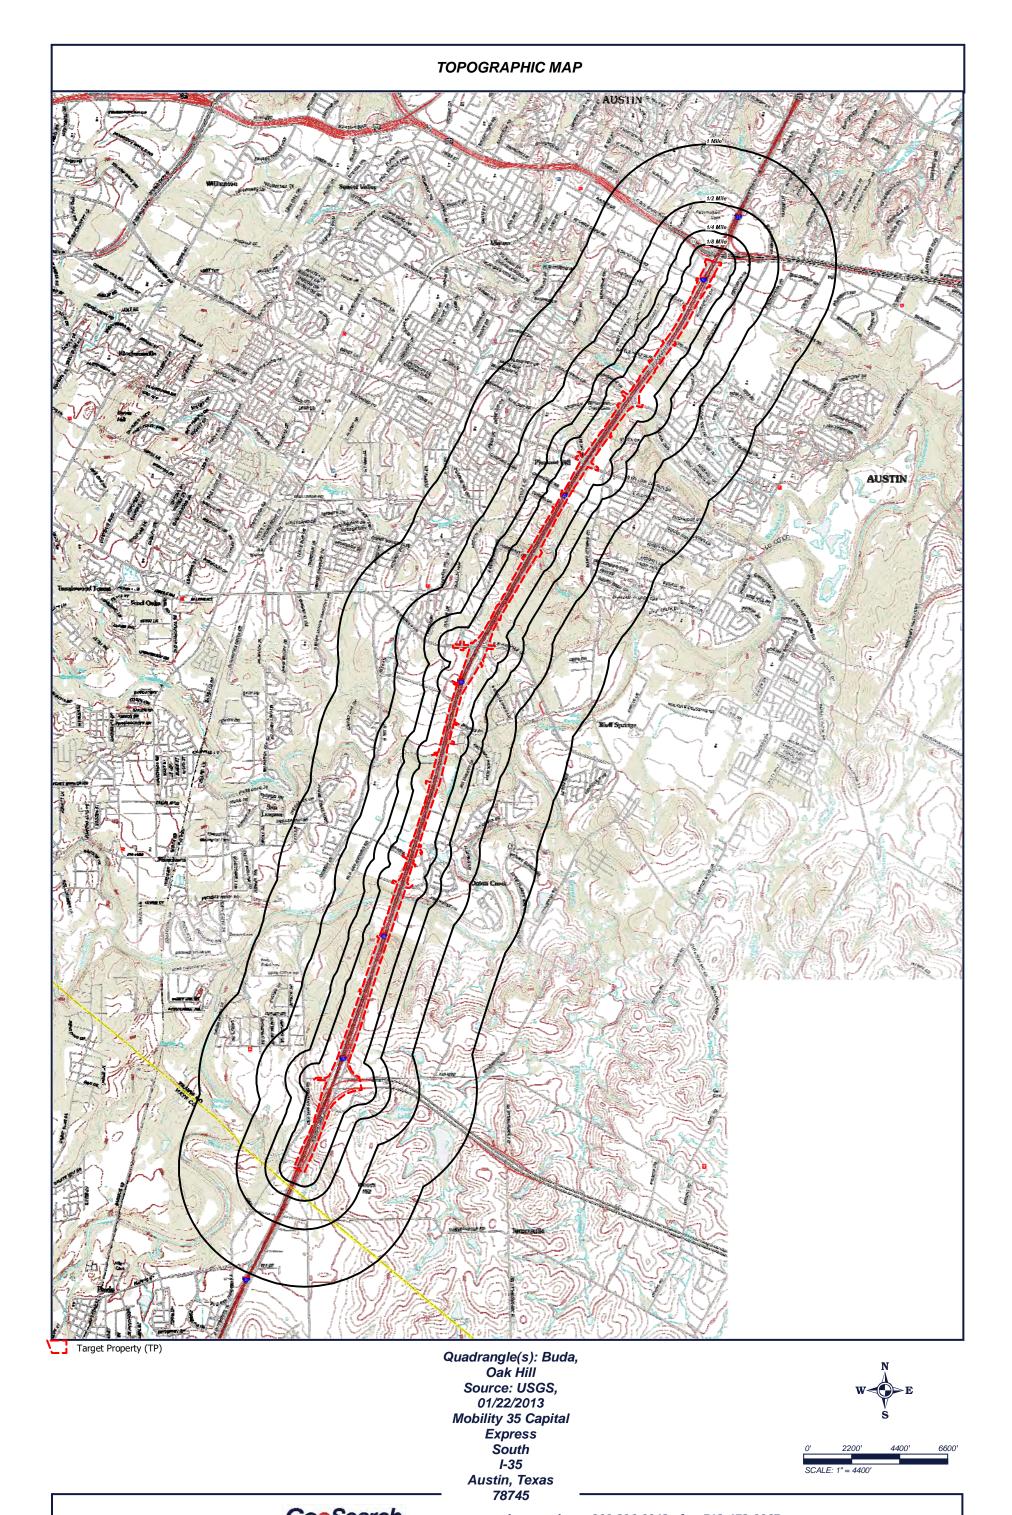

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
1	FRSTX	110070165488	Higher (678 ft.)	0.01 mi. ESE (53 ft.)	CHIEF AUTO PARTS 5880	6801 S IH 35 STE A, AUSTIN, TX 78744	<u>52</u>
1	FRSTX	110070165980	Higher (678 ft.)	TP	KMART 7511	6715 S IH 35, AUSTIN, TX 78744	<u>53</u>
1	PST	15802	Higher (678 ft.)	TP	KMART 7511	6715 S IH 35, AUSTIN, TX 78744	<u>54</u>
<u>2</u>	AUSTINUST	03248	Lower (605 ft.)	TP	FIESTA MART #64	5510 S IH 35, AUSTIN, TX 78745	<u>56</u>
2	ECHOR06	110070246893	Lower (605 ft.)	TP	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>57</u>
<u>2</u>	FRSTX	110033576100	Lower (605 ft.)	TP	FIESTA MART 64	5510 S I 35, AUSTIN, TX 78745	<u>58</u>
<u>2</u>	FRSTX	110037570456	Lower (605 ft.)	TP	LOWES OF SE AUSTIN TX 0689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>59</u>
2	FRSTX	110041726004	Lower (605 ft.)	TP	JIFFY LUBE 3036	5510 IH-BUILDING L SVC RD, AUSTIN, TX 78745	<u>60</u>
2	FRSTX	110070246893	Lower (605 ft.)	TP	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>61</u>
2	HMIRSR06	I-2001070056	Lower (605 ft.)	TP		5510 SOUTH IH 35, AUSTIN, TX	<u>62</u>
<u>2</u>	IHW	96959	Lower (605 ft.)	TP	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>64</u>
<u>2</u>	PST	73284	Lower (605 ft.)	TP	FIESTA MART 64	5510 S IH 35, AUSTIN, TX 78745	<u>66</u>
<u>2</u>	PST	79269	Lower (605 ft.)	TP	LOWES OF SE AUSTIN TX 0689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>72</u>
<u>2</u>	RCRAGR06	TXR000084398	Lower (605 ft.)	TP	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>74</u>
2	TIERII	3G2Z5Z07N1XR	Lower (605 ft.)	TP	JIFFY LUBE #3036	5510 IH-35 BUILDING L SVC RD, AUSTIN, TX 78745	<u>76</u>
2	TIERII	5NML27035G60	Lower (605 ft.)	TP	LOWE'S OF SOUTHEAST AUSTIN TX (#689)	5510 SOUTH IH35, AUSTIN, TX 78745	<u>77</u>
2	TIERII	8C8WWZ06B6N M	Lower (605 ft.)	TP	JIFFY LUBE #3036	5510 IH-35 BUILDING L SVC RD, AUSTIN, TX 78745	<u>79</u>
3	AUSTINUST	C0225	Higher (635 ft.)	TP	GEORGE COFFEY LINCOLN MERCURY	4800 S IH 35, AUSTIN, TX 78745	<u>80</u>
3	ECHOR06	110008164752	Higher (635 ft.)	TP	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>81</u>
<u>3</u>	FRSTX	110008164752	Higher (635 ft.)	TP	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>82</u>
<u>3</u>	FRSTX	110034339375	Higher (635 ft.)	TP	CHAMPION TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>83</u>
<u>3</u>	IHW	76563	Higher (635 ft.)	TP	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>84</u>
<u>3</u>	PST	56996	Higher (635 ft.)	TP	GEORGE COFFEY LINCOLN-MERCURY	4800 S IH 35, AUSTIN, TX 78745	<u>86</u>
<u>3</u>	PST	74857	Higher (635 ft.)	TP	CHAMPION TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>88</u>
<u>3</u>	RCRANGR06	TXD988047544	Higher (635 ft.)	TP	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>90</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
3	SPILLS	12/11/95003	Higher (635 ft.)	TP		4800 S. IH 35, AUSTIN TX, TX	<u>92</u>
<u>3</u>	TIERII	5NRYE0002UG 4	Higher (635 ft.)	TP	CHAMPION TOYOTA- SCION OF AUSTIN	4800 IH 35 SOUTH, AUSTIN, TX 78744	<u>93</u>
<u> </u>	TIERII	8CN176002GR X	Higher (635 ft.)	TP	CHAMPION TOYOTA	4800 SOUTH IH 35, AUSTIN, TX 78745	<u>94</u>
	ECHOR06	110008158894	Higher (640 ft.)	TP	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>95</u>
	FRSTX	110008158894	Higher (640 ft.)	TP	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>96</u>
	IHW	74715	Higher (640 ft.)	TP	WAL-MART STORES TEXAS 1253	5015 S IH 35, AUSTIN, TX 73301	<u>97</u>
!	PST	58390	Higher (640 ft.)	TP	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>98</u>
1	RCRANGR06	TXD982564130	Higher (640 ft.)	TP	WAL-MART STORES INC	5015 S IH 35, AUSTIN, TX 78744	<u>101</u>
<u> </u>	AUSTINUST	03256	Higher (628 ft.)	TP	SAM'S CLUB #8259	5107 S IH 35, AUSTIN, TX 78744	<u>102</u>
	ECHOR06	110035046303	Higher (628 ft.)	TP	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>103</u>
	FRSTX	110008168972	Higher (628 ft.)	TP	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>104</u>
	FRSTX	110035046303	Higher (628 ft.)	TP	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>105</u>
	FRSTX	110046259053	Higher (628 ft.)	TP	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>106</u>
	GWCC	1253086093	Higher (628 ft.)	TP	WALMART STORES	5107 S IH 35, AUSTIN, TX	<u>107</u>
	LPST	118721	Higher (628 ft.)	TP	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>108</u>
	PST	74524	Higher (628 ft.)	TP	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>112</u>
<u> </u>	RCRANGR06	TXR000007617	Higher (628 ft.)	TP	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>118</u>
i	TIERII	259JHP00J40U	Higher (628 ft.)	TP	SAM'S CLUB #8259 - OLD	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>120</u>
	ECHOR06	110008170996	Lower (615 ft.)	TP	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>122</u>
	FRSTX	110008170996	Lower (615 ft.)	TP	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>123</u>
	IHW	85498	Lower (615 ft.)	TP	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>124</u>
	PST	75074	Lower (615 ft.)	TP	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>126</u>
	RCRANGR06	TXR000025916	Lower (615 ft.)	TP	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>128</u>
	TIERII	5MREQ800K8Z 0	Lower (615 ft.)	TP	MAXWELL FORD	5000 SOUTH IH 35, AUSTIN, TX 78745	<u>130</u>
-	SPILLS	6/8/00001	Higher (663 ft.)	TP		SOUTH BOUND FRONTAGE @ 135 AND WILLIAM CANNON, AUSTIN, TX	132

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>8</u>	SPILLS	12/30/02007	Lower (595 ft.)	TP		NORTH IH 35 @ ONION CREEK, TX	<u>133</u>
<u>8</u>	SPILLS	13986	Lower (595 ft.)	TP		NORTH IH 35 @ ONION CREEK, AUSTIN, TX	<u>134</u>
3	SPILLS	8/10/99001	Lower (595 ft.)	TP		SOUTHBOUND FRONTAGE OF IH 35, SOUTH OF ONION CREEK, AUSTIN, TX	<u>135</u>
9	AUSTINUST	C0559	Higher (670 ft.)	TP	MICHAEL'S (FORMER WOOLCO)	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>136</u>
9	FRSTX	110034296679	Higher (670 ft.)	TP	CENTURY SOUTH SHOPPING CTR	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>137</u>
9	SIEC01	0611EC	Higher (670 ft.)	TP	CENTURY SOUTH SHOPPING CENTER	801 EAST WILLIAM CANNON DRIVE, AUSTIN, TX	<u>138</u>
9	VCP	0611	Higher (670 ft.)	TP	CENTURY SOUTH SHOPPING CENTER	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>140</u>
<u>10</u>	DOCKETS	06-1984-0050	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78745	<u>143</u>
<u>10</u>	ECHOR06	110005162206	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78748	<u>144</u>
<u>10</u>	ECHOR06	110008137471	Lower (619 ft.)	TP	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>145</u>
<u>10</u>	FRSTX	110005162206	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78748	<u>146</u>
<u>10</u>	FRSTX	110008137471	Lower (619 ft.)	TP	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>147</u>
<u>10</u>	FRSTX	110033783154	Lower (619 ft.)	TP	JANSSEN TRACT	9808 S I H 35, AUSTIN, TX 78748	<u>148</u>
<u>10</u>	HISTGWCC	30498	Lower (619 ft.)	TP	GAVLON INDUSTRIES INC	9808 S INTERREGIONAL HWY 35, 78745, AUSTIN, TX 78745	<u>149</u>
<u>10</u>	ICIS	110005162206	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78745	<u>150</u>
<u>10</u>	IHW	30498	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78748	<u>151</u>
<u>10</u>	IHW	66040	Lower (619 ft.)	TP	ASHLAND CHEMICAL AUSTIN	9806 S IH 35, AUSTIN, TX 78748	<u>153</u>
<u>10</u>	IHWCA	30498	Lower (619 ft.)	TP	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78748	<u>154</u>
<u>10</u>	RCRANGR06	TXD000719021	Lower (619 ft.)	TP	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>155</u>
<u>10</u>	RCRANGR06	TXD990707556	Lower (619 ft.)	TP	GAVLON INDUSTRIES INC	9808 S IH 35, AUSTIN, TX 78748	<u>159</u>
<u>10</u>	SIEC01	1707EC	Lower (619 ft.)	TP	JANSSEN TRACT	9808 SOUTH IH-35, AUSTIN, TX 78748	<u>161</u>
<u>10</u>	VCP	1707	Lower (619 ft.)	TP	JANSSEN TRACT	9808 S I H 35, AUSTIN, TX 78748	<u>163</u>
11	ECHOR06	110008169427	Higher (677 ft.)	TP	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>166</u>
<u>11</u>	FRSTX	110008169427	Higher (677 ft.)	TP	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>167</u>

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
11	IHW	84789	Higher (677 ft.)	TP	GILLMAN MITSUBISHI	6809 S IH 35, AUSTIN, TX 78744	<u>168</u>
<u>11</u>	RCRANGR06	TXR000010496	Higher (677 ft.)	TP	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>169</u>
<u>12</u>	TIERII	7Q9CWK03SA MR	Higher (676 ft.)	TP	HEB GROCERY COMPANY, LP - AUSTIN 02	6607 SOUTH IH 35, AUSTIN, TX 78744	<u>171</u>
<u>12</u>	TIERII	7QDZCB00S5X 5	Higher (676 ft.)	TP	HEB GROCERY COMPANY, LP - AUSTIN 02	6607 SOUTH IH 35, AUSTIN, TX 78744	<u>172</u>
<u>13</u>	ERNSTX	338220	Higher (639 ft.)	TP		OAK HILL COMMUNITY, AUSTIN, TX	<u>173</u>
<u>14</u>	ERNSTX	1010253	Lower (593 ft.)	TP	INTERSTATE 35 NB AT SLAUGHTER CREE IN AUSTIN, TX	INTERSTATE 35 NB AT SLAUGHTER CREE IN AU, AUSTIN, TX	<u>175</u>
14	HMIRSR06	E-2012050607	Lower (593 ft.)	TP		I-35 NB @ SLAUGHTER CREEK, AUSTIN, TX 78705	<u>177</u>
<u>15</u>	FRSTX	110070189793	Higher (642 ft.)	TP	TX-AUS-CSJ 0016-01- 117	SOUTH OF SLAUGHTER LANE ON IH35, AUSTIN, TX 78748	<u>179</u>
<u>16</u>	FRSTX	110070199345	Higher (642 ft.)	TP	STERLING ACURA PARKING LOT	4801 S IH 35, AUSTIN, TX 78744	<u>180</u>
17	FRSTX	110041897034	Higher (736 ft.)	TP	SOUTH I-35 WATER WASTEWATER PROGRAM- SEGMENT 9.0	SOUTH I-35 AND F.M. 1327, AUSTIN, TX 78747	<u>181</u>
<u>18</u>	FRSTX	110037199206	Higher (631 ft.)	TP	ALEXAN ONION CREEK	ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE, AUSTIN, TX 78747	<u>182</u>
<u>18</u>	FRSTX	110037202700	Higher (631 ft.)	TP	ALEXAN OINION CREEK WATERLINE	ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE, AUSTIN, TX 78747	<u>183</u>
<u>19</u>	FRSTX	110070554950	Higher (672 ft.)	TP	MANSIONS AT ONION CREEK	11922 S INTERSTATE 35, AUSTIN, TX 78747	<u>184</u>
<u>20</u>	ECHOR06	110070568935	Higher (641 ft.)	TP	LENOX SPRINGS II	10300 SOUTH IH 35, AUSTIN, TX 78748	<u>185</u>
<u>20</u>	FRSTX	110070568935	Higher (641 ft.)	TP	LENOX SPRINGS II	10300 SOUTH IH 35, AUSTIN, TX 78748	<u>186</u>
<u>21</u>	FRSTX	110037852115	Higher (647 ft.)	TP	TX DOT - AUS 0016- 01-096	ON IH 35 FROM SOUTH OF SLAUGHTER LANE TO OLD SAN A, AUSTIN, TX 78747	<u>187</u>
22	FRSTX	110070189193	Higher (637 ft.)	TP	STABLEWOOD EAST BOX CULVERT	10810 S IH-35 SOUTHBOUND FRONTAGE RD AUSTIN TX 787, AUSTIN, TX 78748	<u>188</u>
<u>23</u>	FRSTX	110034645515	Higher (631 ft.)	TP	CONTINENTAL 132 FUND THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>189</u>
<u>23</u>	FRSTX	110034668544	Higher (631 ft.)	TP	CRITERION ONION CREEK APARTMENTS THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>190</u>

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>23</u>	FRSTX	110035088197	Higher (631 ft.)	TP	WATERMARK CONSTRUCTION THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>191</u>
<u>24</u>	ECHOR06	110070362048	Higher (736 ft.)	TP	ENCLAVE AT ESTANCIA PHASES 1 2 AND 3 HB	WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE, AUSTIN, TX 78652	<u>192</u>
<u>24</u>	ECHOR06	110070377522	Higher (736 ft.)	TP	ENCLAVE AT ESTANCIA PHASE 1 AMENITY CENTER AND PHASE 3 LD	WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE, AUSTIN, TX 78652	<u>193</u>
<u>25</u>	AUSTINUST	EX047	Higher (659 ft.)	TP	VETERANS AFFAIRS	8503 S IH 35, AUSTIN, TX 78744	<u>194</u>
<u>26</u>	AUSTINUST	C0643	Higher (667 ft.)	TP	JOHN ROBERTS BMW	4108 S IH 35, AUSTIN, TX 78745	<u>195</u>
<u>26</u>	ECHOR06	110008160499	Higher (667 ft.)	0.014 mi. WNW (74 ft.)	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>196</u>
<u>26</u>	FRSTX	110008160499	Higher (667 ft.)	0.014 mi. WNW (74 ft.)	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>197</u>
<u> 26</u>	IHW	68652	Higher (667 ft.)	0.014 mi. WNW (74 ft.)	JOHN ROBERTS BMW OF AUSTIN	4108 S IH 35, AUSTIN, TX 78745	<u>198</u>
<u>26</u>	PST	14536	Higher (667 ft.)	0.014 mi. WNW (74 ft.)	JOHN ROBERTS BMW OF AUSTIN	4108 S IH 35, AUSTIN, TX 78745	<u>199</u>
<u>26</u>	PST	69274	Higher (667 ft.)	0.008 mi. WNW (42 ft.)	LEXUS OF AUSTIN	4107 SANTIAGO ST, AUSTIN, TX 78745	202
<u>26</u>	RCRANGR06	TXD988018099	Higher (667 ft.)	0.014 mi. WNW (74 ft.)	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>205</u>
<u>27</u>	AUSTINUST	03189	Higher (653 ft.)	0.008 mi. N (42 ft.)	CORNER STORE #1445	110 W SLAUGHTER LN, AUSTIN, TX 78745	<u>207</u>
<u>27</u>	FRSTX	110034530559	Higher (653 ft.)	0.008 mi. N (42 ft.)	VALERO CORNER STORE 1445	110 W SLAUGHTER LN, AUSTIN, TX 78748	<u>208</u>
<u>27</u>	HMIRSR06	E-2005040286	Higher (653 ft.)	0.008 mi. N (42 ft.)		110 WEST SLAUGHTER LANE, AUSTIN, TX 78748	<u>209</u>
<u>27</u>	PST	3625	Higher (653 ft.)	0.001 mi. N (5 ft.)	WATTINGER FACILITY	114 W SLAUGHTER LN, AUSTIN, TX 78748	<u>211</u>
<u>27</u>	PST	68212	Higher (653 ft.)	0.008 mi. N (42 ft.)	FAST MART 8186	110 W SLAUGHTER LN, AUSTIN, TX 78748	<u>213</u>
<u>28</u>	FRSTX	110035247499	Higher (633 ft.)	0.002 mi. NNE (11 ft.)	WSP DEVELOPMENT 10 ONION CREEK BUSINESS PARK	ON NE OF INTX OF IH35 & ONION CREEK PKWY, AUSTIN, TX 78747	220
<u>29</u>	FRSTX	110070164933	Higher (654 ft.)	0.002 mi. ESE (11 ft.)	STATE DEPT OF PUBLIC HWYS	7901 IH 35, AUSTIN, TX 78761	<u>221</u>
<u>30</u>	AUSTINUST	C0515	Higher (646 ft.)	0.002 mi. ESE (11 ft.)	DAIRY FARM	10415 S IH 35, AUSTIN, TX 78747	222



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>31</u>	ECHOR06	110070435052	Higher (668 ft.)	0.003 mi. ESE (16 ft.)	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	223
<u>31</u>	ECHOR06	TXR000084079	Higher (668 ft.)	0.003 mi. ESE (16 ft.)	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	224
<u>31</u>	FRSTX	110070435052	Higher (668 ft.)	0.003 mi. ESE (16 ft.)	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>225</u>
<u>81</u>	IHW	96643	Higher (668 ft.)	0.003 mi. ESE (16 ft.)	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>226</u>
<u>31</u>	RCRAGR06	TXR000084079	Higher (668 ft.)	0.003 mi. ESE (16 ft.)	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>228</u>
<u>32</u>	DCR	RN103979811	Higher (625 ft.)	0.003 mi. NNE (16 ft.)		11001 S IH 35, AUSTIN, TX 78747	230
<u>32</u>	FRSTX	110034090481	Higher (625 ft.)	0.003 mi. NNE (16 ft.)	JACK BROWN CLEANERS 28	11001 S I H 35, AUSTIN, TX 78747	232
33	AUSTINUST	01180	Higher (633 ft.)	0.003 mi. ESE (16 ft.)	ONION CREEK FOOD MART	2101 BOCA RATON DR, AUSTIN, TX 78747	233
<u>13</u>	FRSTX	110035023569	Higher (633 ft.)	0.003 mi. ESE (16 ft.)	UTOTEM	2107 BOCA RATON DR, AUSTIN, TX 78747	<u>234</u>
<u>33</u>	PST	39571	Higher (633 ft.)	0.003 mi. ESE (16 ft.)	ONION CREEK FOOD MART	2107 BOCA RATON DR, AUSTIN, TX 78747	<u>235</u>
<u>34</u>	ERNSTX	983133	Higher (642 ft.)	0.004 mi. ESE (21 ft.)		4701 SOUTH INTERSTATE 35, AUSTIN, TX	<u>241</u>
<u>35</u>	FRSTX	110034816135	Higher (680 ft.)	0.005 mi. WNW (26 ft.)	RIVER CITY COLLISION SERVICE	6900 S I H 35, AUSTIN, TX 78745	<u>243</u>
<u>36</u>	AUSTINUST	03278	Higher (653 ft.)	0.005 mi. W (26 ft.)	ON THE MOVE #11	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>244</u>
<u>86</u>	FRSTX	110035355059	Higher (653 ft.)	0.005 mi. W (26 ft.)	7-ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>245</u>
<u>36</u>	GWCC	118297	Higher (653 ft.)	0.005 mi. W (26 ft.)	CONGRESS SLAUGHTER LP	120 W SLAUGHTER LN, AUSTIN, AUSTIN, TX 78748	<u>246</u>
<u>36</u>	LPST	118297	Higher (653 ft.)	0.005 mi. W (26 ft.)	7 ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>247</u>
<u>36</u>	PST	75395	Higher (653 ft.)	0.005 mi. W (26 ft.)	7-ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>251</u>
<u>37</u>	AUSTINUST	03377	Lower (587 ft.)	0.005 mi. SE (26 ft.)	STASSNEY CROSSING C-STORE	5717 S IH 35 SVRD NB, AUSTIN, TX 78744	<u>256</u>
<u>37</u>	PST	85575	Lower (587 ft.)	0.005 mi. SE (26 ft.)	STASSNEY FOOD MART	5717 S INTERSTATE 35 BLDG D, AUSTIN, TX 78744	<u>257</u>
<u>38</u>	AUSTINUST	00303	Higher (673 ft.)	0.006 mi. WNW (32 ft.)	K & Z TOWN FOOD MART #23	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>263</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>38</u>	ECHOR06	110015665797	Higher (673 ft.)	0.008 mi. NW (42 ft.)	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>264</u>
<u>38</u>	FRSTX	110015665797	Higher (673 ft.)	0.008 mi. NW (42 ft.)	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>265</u>
<u>38</u>	FRSTX	110034006395	Higher (673 ft.)	0.008 mi. NW (42 ft.)	TOWN FOOD MART	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>266</u>
<u>88</u>	IHW	75654	Higher (673 ft.)	0.008 mi. NW (42 ft.)	STAR ENTERPRISES	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>267</u>
<u>8</u>	LPST	096235	Higher (673 ft.)	0.008 mi. NW (42 ft.)	SHOPPERS MART 23	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>268</u>
<u>8</u>	NOV	RN102321288	Higher (673 ft.)	0.008 mi. NW (42 ft.)	EXPRESS MART 8	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>272</u>
<u>8</u>	PST	34931	Higher (673 ft.)	0.008 mi. NW (42 ft.)	TOWN FOOD MART	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>273</u>
<u>88</u>	RCRANGR06	TXD987993565	Higher (673 ft.)	0.008 mi. NW (42 ft.)	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>280</u>
<u>9</u>	EAP	94051301	Higher (666 ft.)	0.006 mi. ESE (32 ft.)	WACKENHUT CORRECTIONS CORPORATION	1701 DIRECTORS BLVD, AUSTIN, TX 78744	<u>282</u>
<u>9</u>	FRSTX	110034243851	Higher (666 ft.)	0.006 mi. ESE (32 ft.)	WACKENHUT CORRECTIONS CORPORATION	1701 DIRECTORS BLVD, AUSTIN, TX 78744	<u>283</u>
<u>9</u>	IHW	37308	Higher (666 ft.)	0.006 mi. ESE (32 ft.)	CONTRACTORS INSURANCE EXCHANGE	1701 DIRECTORS BLVD STE 520, AUSTIN, TX 78744	<u>284</u>
<u>10</u>	AUSTINUST	00327	Higher (666 ft.)	0.011 mi. ESE (58 ft.)	CIRCLE K 2704677	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>285</u>
<u>0</u>	ECHOR06	110005119718	Higher (666 ft.)	0.011 mi. ESE (58 ft.)	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>286</u>
<u>0</u>	FRSTX	110005119718	Higher (666 ft.)	0.011 mi. ESE (58 ft.)	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>287</u>
<u>·0</u>	FRSTX	110033739355	Higher (666 ft.)	0.011 mi. ESE (58 ft.)	CIRCLE K STORE 2704677	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>288</u>
<u>0</u>	IHW	75642	Higher (666 ft.)	0.007 mi. ESE (37 ft.)	STAR ENTERPRISES	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>289</u>
<u>0</u>	LPST	100877	Higher (666 ft.)	0.007 mi. ESE (37 ft.)	TEXACO SERVICE 11	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>290</u>
<u>0</u>	PST	34920	Higher (666 ft.)	0.007 mi. ESE (37 ft.)	CIRCLE K STORE 2704677	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>298</u>
<u>10</u>	RCRANGR06	TXD987993763	Higher (666 ft.)	0.011 mi. ESE (58 ft.)	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>309</u>
<u>11</u>	ECHOR06	110008169891	Higher (640 ft.)	0.007 mi. WNW (37 ft.)	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	311



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>41</u>	FRSTX	110008169891	Higher (640 ft.)	0.007 mi. WNW (37 ft.)	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>312</u>
<u>41</u>	IHW	84575	Higher (640 ft.)	0.007 mi. WNW (37 ft.)	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>313</u>
<u>41</u>	RCRANGR06	TXR000015214	Higher (640 ft.)	0.007 mi. WNW (37 ft.)	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>315</u>
<u>42</u>	AUSTINUST	03288	Higher (625 ft.)	0.009 mi. ESE (48 ft.)	ONION CREEK TEXACO	11031 S IH 35, AUSTIN, TX 78747	<u>317</u>
<u>42</u>	FRSTX	110034639844	Higher (625 ft.)	0.009 mi. ESE (48 ft.)	ONION CREEK SELF SERVICE	11031 S IH 35, AUSTIN, TX 78747	<u>318</u>
<u>42</u>	NOV	RN102268521	Higher (625 ft.)	0.009 mi. ESE (48 ft.)	ONION CREEK SELF SERVICE	11031 S IH 35, AUSTIN, TX 78747	<u>319</u>
<u>42</u>	PST	62117	Higher (625 ft.)	0.009 mi. ESE (48 ft.)	ONION CREEK TEXACO	11031 S IH 35, AUSTIN, TX 78747	<u>320</u>
43	ALTFUELS	123584	Higher (629 ft.)	0.011 mi. ESE (58 ft.)	COWBOYHDAUSTIN	10917 S IH 35 FRONTAGE RD, AUSTIN, TX 78747	<u>327</u>
<u>44</u>	AUSTINUST	03038	Higher (678 ft.)	0.012 mi. NE (63 ft.)	7-ELEVEN #36587	6515 S IH 35, AUSTIN, TX 78744	<u>328</u>
<u>44</u>	ECHOR06	110008161489	Higher (678 ft.)	0.011 mi. NE (58 ft.)	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>329</u>
<u>44</u>	FRSTX	110008161489	Higher (678 ft.)	0.011 mi. NE (58 ft.)	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>330</u>
<u>44</u>	FRSTX	110034675812	Higher (678 ft.)	0.011 mi. NE (58 ft.)	7-ELEVEN STORE 36587	6515 S IH 35, AUSTIN, TX 78744	<u>331</u>
<u>44</u>	IHW	77277	Higher (678 ft.)	0.011 mi. NE (58 ft.)	EXXON MOBIL NO 60095	6515 S IH 35, AUSTIN, TX 78744	<u>332</u>
<u>44</u>	PST	48877	Higher (678 ft.)	0.011 mi. NE (58 ft.)	7-ELEVEN STORE 36587	6515 S IH 35, AUSTIN, TX 78744	<u>333</u>
<u>44</u>	RCRANGR06	TXD988032181	Higher (678 ft.)	0.011 mi. NE (58 ft.)	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>342</u>
<u>45</u>	DCR	RN105178545	Higher (632 ft.)	0.012 mi. ESE (63 ft.)		11215 S IH 35 STE 126, AUSTIN, TX 78747	344
<u>45</u>	FRSTX	110034479473	Higher (632 ft.)	0.012 mi. ESE (63 ft.)	DELUXE CLEANERS	11215 S IH 35 STE 126, AUSTIN, TX 78747	<u>346</u>
<u>46</u>	AUSTINUST	C0477	Higher (673 ft.)	0.014 mi. SSW (74 ft.)	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>347</u>
<u>46</u>	LPST	092956	Higher (673 ft.)	0.014 mi. SSW (74 ft.)	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>348</u>
<u>46</u>	LPST	107373	Higher (673 ft.)	0.014 mi. SSW (74 ft.)	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>352</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>46</u>	PST	48333	Higher (673 ft.)	0.014 mi. SSW (74 ft.)	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>356</u>
<u>47</u>	FRSTX	110031234466	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS- SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX 78747	<u>361</u>
<u>47</u>	FRSTX	110033732129	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	HILL COUNTRY SPRINGS	10019 S I H 35, AUSTIN, TX 78747	<u>362</u>
<u>47</u>	HISTGWCC	1199531976	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>363</u>
<u>47</u>	HISTGWCC	344774864	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>364</u>
<u>47</u>	HISTGWCC	355588453	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, AUSTIN, TX	<u>365</u>
<u>47</u>	HISTGWCC	432036810	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>366</u>
<u>47</u>	HISTGWCC	476641209	Lower (602 ft.)	0.014 mi. ESE (74 ft.)		10019 SOUTH IH-35, AUSTIN, TX	<u>367</u>
<u>47</u>	HISTGWCC	775652658	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>368</u>
<u>47</u>	NOV	RN101179521	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	HILL COUNTRY SPRINGS	AUSTIN, TX 78747	<u>369</u>
<u>47</u>	SEMSARCH	TXN000606811	Lower (602 ft.)	0.014 mi. ESE (74 ft.)	MARTINE SPRINGS- SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX 78747	<u>374</u>
<u>48</u>	AUSTINUST	C0588	Higher (663 ft.)	0.016 mi. ESE (84 ft.)	KOA KAMPGROUND	7009 S IH 35, AUSTIN, TX 78744	<u>375</u>
<u>48</u>	PST	35773	Higher (663 ft.)	0.016 mi. ESE (84 ft.)	KOA KAMPGROUND	7003 S IH 35, AUSTIN, TX 78744	<u>376</u>
<u>49</u>	AUSTINUST	03294	Higher (653 ft.)	0.017 mi. W (90 ft.)	MURPHY OIL USA #7211	9300 S IH 35, AUSTIN, TX 78748	<u>379</u>
<u>49</u>	ECHOR06	110035137376	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	380
<u>49</u>	FRSTX	110021017807	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART STORES TEXAS LLC	9300 S IH 35 BLDG B, AUSTIN, TX 78748	<u>381</u>
<u>49</u>	FRSTX	110034494287	Higher (653 ft.)	0.017 mi. W (90 ft.)	MURPHY USA 7211	127 SLAUGHTER LN W, AUSTIN, TX 78748	382



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>49</u>	FRSTX	110034893042	Higher (653 ft.)	0.017 mi. W (90 ft.)	TEXAS ROADHOUSE TEXAS ROADHOUSE AT SLAUGHTER CREEK SIDE PLAZ	9300 S IH 35, AUSTIN, TX 78748	<u>383</u>
<u>49</u>	FRSTX	110035129045	Higher (653 ft.)	0.017 mi. W (90 ft.)	SLAUGHTERWAY RETAIL CREEKSIDE PLAZA SHOPPING CENTER	9300 S IH 35, AUSTIN, TX 78748	<u>384</u>
<u>19</u>	FRSTX	110035137376	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>385</u>
<u>19</u>	FRSTX	110035163480	Higher (653 ft.)	0.017 mi. W (90 ft.)	VELOCITY CREDIT SLAUGHTER IH 35 COMMERCIAL PHASE 3	9300 S IH 35, AUSTIN, TX 78748	<u>386</u>
<u>49</u>	IHW	88775	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>387</u>
<u> 19</u>	PST	77256	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART SUPERCENTER 5317	9300 S IH 35, AUSTIN, TX 78748	<u>390</u>
<u>49</u>	PST	77299	Higher (653 ft.)	0.017 mi. W (90 ft.)	MURPHY USA 7211	9300 S IH 35 SERVICE RD BLDG J, AUSTIN, TX 78748	<u>393</u>
<u>19</u>	RCRAGR06	TXR000062943	Higher (653 ft.)	0.017 mi. W (90 ft.)	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>399</u>
<u>0</u>	AUSTINUST	02620	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>402</u>
<u>0</u>	ECHOR06	110005076906	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>403</u>
<u>0</u>	FRSTX	110005076906	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>404</u>
<u>0</u>	IHW	72965	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>405</u>
<u>50</u>	IHW	73885	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDS MAZDA	PO BOX 17667, AUSTIN, TX 78760	<u>406</u>
<u>50</u>	LPST	100559	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDS MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>407</u>
<u>0</u>	NOV	RN100676451	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>410</u>
<u>i0</u>	PST	51500	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	ROGER BEASLEY MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>411</u>
<u>50</u>	RCRANGR06	TXD360678486	Higher (658 ft.)	0.017 mi. WNW (90 ft.)	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>417</u>
<u>51</u>	FRSTX	110033551323	Lower (616 ft.)	0.017 mi. ESE (90 ft.)	10001 SOUTH IH 35 INVESTMENTS PARKSIDE PAVILION OFFICE CENTE	10001 S IH 35, AUSTIN, TX 78747	419



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>51</u>	FRSTX	110033904620	Lower (616 ft.)	0.017 mi. ESE (90 ft.)	HARVEY CLEARY BUILDERS PARKSIDE PAVILLION	10001 S IH 35, AUSTIN, TX 78747	<u>420</u>
<u>52</u>	HMIRSR06	E-2012100335	Higher (652 ft.)	0.017 mi. WNW (90 ft.)		9400 SOUTH IH 35 NORTHBOUND LN, AUSTIN, TX	<u>421</u>
<u>53</u>	FRSTX	110035115853	Higher (641 ft.)	0.018 mi. ESE (95 ft.)	SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC	9725 S IH 35, AUSTIN, TX 78744	<u>423</u>
<u>53</u>	PST	78027	Higher (641 ft.)	0.018 mi. ESE (95 ft.)	SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC	9725 S IH 35, AUSTIN, TX 78744	<u>424</u>
<u>53</u>	TIERII	2TZK4X05KP3G	Higher (641 ft.)	0.018 mi. ESE (95 ft.)	TXDOT-AUSTIN- SPECIAL CREW MAINTENANCE	9725 IH 35 SOUTH, AUSTIN, TX 78744	<u>426</u>
<u>54</u>	AUSTINUST	C0616	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NATIONAL TIRE WAREHOUSE	4720 S IH 35, AUSTIN, TX 78745	<u>433</u>
<u>54</u>	ECHOR06	110005072287	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>434</u>
<u>54</u>	FRSTX	110005072287	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>435</u>
<u>54</u>	FRSTX	110034434583	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NTW	4720 S I H 35, AUSTIN, TX 78745	<u>436</u>
<u>54</u>	IHW	73493	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	ONION CREEK VOLKSWAGEN	4720 S IH 35, AUSTIN, TX 78745	<u>437</u>
<u>54</u>	LPST	110718	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NTW	4720 S IH 35, AUSTIN, TX 78745	<u>438</u>
<u>54</u>	PST	10845	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NTW	4720 S IH 35, AUSTIN, TX 78745	<u>449</u>
<u>54</u>	RCRAGR06	TXD118926419	Higher (644 ft.)	0.018 mi. WNW (95 ft.)	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>461</u>
<u>55</u>	IHWCA	T3130	Lower (609 ft.)	0.02 mi. ESE (106 ft.)	SOUTH POINT NISSAN PREOWEND	6001 S IH 35, AUSTIN, TX 78744	<u>463</u>
<u>56</u>	AUSTINUST	OJ041	Higher (637 ft.)	0.02 mi. WNW (106 ft.)	CRUMLEY'S GROCERY	10730 S IH 35, AUSTIN, TX 78748	<u>464</u>
<u>56</u>	ERNSTX	563116	Higher (637 ft.)	0.02 mi. WNW (106 ft.)	ONION CREEK LIQUOR STORE, NW CORNER OF BUILDING	10730 SOUTH INTERSTATE HWY 35, AUSTIN, TX	<u>465</u>
<u>56</u>	GWCC	108986	Higher (637 ft.)	0.02 mi. WNW (106 ft.)	TEX CON OIL CO	10730 S IH 35, AUSTIN, TX 78748	<u>467</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>56</u>	LPST	108986	Higher (637 ft.)	0.02 mi. WNW (106 ft.)	FORMER CRUMLEYS GROCERY	10730 S IH 35, AUSTIN, TX 78748	<u>468</u>
<u>56</u>	PST	38365	Higher (637 ft.)	0.02 mi. WNW (106 ft.)	D E CRUMLEY GROC	IH 35, AUSTIN, TX 78744	<u>472</u>
<u>57</u>	AUSTINUST	C0208	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC	4610 S IH 35, AUSTIN, TX 78745	<u>476</u>
<u>57</u>	ECHOR06	110008151034	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>477</u>
<u>57</u>	ECHOR06	110008155655	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>478</u>
<u>57</u>	ECHOR06	110008170629	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>479</u>
<u>57</u>	FRSTX	110008151034	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>480</u>
<u>57</u>	FRSTX	110008155655	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>481</u>
<u>57</u>	FRSTX	110008170629	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>482</u>
<u>57</u>	IHW	68657	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>483</u>
<u>57</u>	IHW	75066	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>484</u>
<u>57</u>	PST	4419	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC	4610 S IH 35, AUSTIN, TX 78745	<u>486</u>
<u>57</u>	RCRANGR06	TXD121514178	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>490</u>
<u>57</u>	RCRANGR06	TXD981590862	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>492</u>
<u>57</u>	RCRANGR06	TXR000022236	Higher (644 ft.)	0.02 mi. WNW (106 ft.)	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>494</u>
<u>58</u>	AUSTINUST	A0002	Higher (683 ft.)	0.024 mi. WNW (127 ft.)	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>496</u>
<u>58</u>	IHWCA	T1680	Higher (683 ft.)	0.024 mi. WNW (127 ft.)	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>497</u>
<u>58</u>	PST	59868	Higher (683 ft.)	0.024 mi. WNW (127 ft.)	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>498</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>58</u>	RCRANGR06	TXD988064614	Higher (683 ft.)	0.024 mi. WNW (127 ft.)	DAVE TRANSPORTATION SERVICES INC	8300 IH 35 S ACCESS RD, AUSTIN, TX 78745	<u>500</u>
<u>59</u>	AUSTINUST	03394	Higher (631 ft.)	0.024 mi. WNW (127 ft.)	CORNER STORE #1570	11206 S IH 35, AUSTIN, TX 78748	<u>501</u>
<u>59</u>	PST	87533	Higher (631 ft.)	0.024 mi. WNW (127 ft.)	CIRCLE K STORE 2741570	11206 S IH 35 FRONTAGE RD, AUSTIN, TX 78748	<u>502</u>
<u> </u>	ALTFUELS	96817	Lower (586 ft.)	0.024 mi. SE (127 ft.)	BMW SOUTH AUS	5501 S IH 35 FRONTAGE RD, AUSTIN, TX 78744	<u>507</u>
<u>61</u>	ALTFUELS	68637	Higher (639 ft.)	0.026 mi. S (137 ft.)	U-HAUL	9001 I-35 S, AUSTIN, TX 78744	<u>508</u>
<u>62</u>	AUSTINUST	03348	Lower (619 ft.)	0.027 mi. WNW (143 ft.)	SAM'S CLUB GAS STATION #8259	9900 S IH 35 SVRD SB, AUSTIN, TX 78748	<u>509</u>
<u>62</u>	IHW	96156	Lower (619 ft.)	0.027 mi. WNW (143 ft.)	SAMS CLUB 8259	9900 S INTERSTATE 35 # SB, AUSTIN, TX 78748	<u>510</u>
<u>62</u>	PST	84284	Lower (619 ft.)	0.027 mi. WNW (143 ft.)	SAMS CLUB 8259	9900 S IH 35 SVRD STE J, AUSTIN, TX 78748	<u>513</u>
<u>52</u>	RCRAGR06	TXR000080384	Lower (619 ft.)	0.027 mi. WNW (143 ft.)	SAMS CLUB 8259	9900 SOUTH INTERSTATE HIGHWAY 35 SERVICE ROAD SB, AUSTIN, TX 78748	<u>520</u>
<u>63</u>	AUSTINUST	C0435	Higher (635 ft.)	0.028 mi. WNW (148 ft.)	LIPSHY	4738 S IH 35, AUSTIN, TX 78745	<u>523</u>
<u>63</u>	IHW	81580	Higher (635 ft.)	0.028 mi. WNW (148 ft.)	EASY WHEELS	4738 S IH 35, AUSTIN, TX 78745	<u>524</u>
<u>63</u>	LPST	107587	Higher (635 ft.)	0.028 mi. WNW (148 ft.)	LIPSHY MOTOR CARS	4738 S IH 35, AUSTIN, TX 78745	<u>525</u>
<u>63</u>	PST	36926	Higher (635 ft.)	0.028 mi. WNW (148 ft.)	LIPSHY MOTOR CARS	4738 S IH 35, AUSTIN, TX 78745	<u>528</u>
<u>63</u>	RCRANGR06	TX0000062042	Higher (635 ft.)	0.028 mi. WNW (148 ft.)	LIPSHY MOTORCARS INC	4738 S IH 35, AUSTIN, TX 78745	<u>531</u>
<u>64</u>	IHW	74959	Lower (600 ft.)	0.028 mi. WNW (148 ft.)	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>533</u>
<u>64</u>	IHWCA	74959	Lower (600 ft.)	0.028 mi. WNW (148 ft.)	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>534</u>
<u>64</u>	RCRANGR06	TXD987984374	Lower (600 ft.)	0.028 mi. WNW (148 ft.)	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>535</u>
<u>65</u>	AUSTINUST	02014	Lower (600 ft.)	0.034 mi. WNW (180 ft.)	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>537</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>65</u>	IHW	72465	Lower (600 ft.)	0.034 mi. WNW (180 ft.)	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>538</u>
<u>65</u>	IHWCA	72465	Lower (600 ft.)	0.034 mi. WNW (180 ft.)	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>539</u>
<u>65</u>	PST	53069	Lower (600 ft.)	0.034 mi. WNW (180 ft.)	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>540</u>
<u>65</u>	RCRANGR06	TXD981914450	Lower (600 ft.)	0.034 mi. WNW (180 ft.)	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>543</u>
<u>66</u>	AUSTINUST	C0178	Higher (640 ft.)	0.035 mi. ESE (185 ft.)	HOLT CO	9601 S IH 35, AUSTIN, TX 78744	<u>545</u>
<u>66</u>	IHW	68602	Higher (640 ft.)	0.038 mi. ESE (201 ft.)	HOLT CAT	9601 S IH 35, AUSTIN, TX 78744	<u>546</u>
<u>66</u>	LPST	095789	Higher (640 ft.)	0.038 mi. ESE (201 ft.)	HOLT MACHINERY CO	9601 S IH 35, AUSTIN, TX 78744	<u>548</u>
<u>66</u>	LPST	096361	Higher (640 ft.)	0.038 mi. ESE (201 ft.)	HOLT MACHINERY CO	9601 S IH 35, AUSTIN, TX 78744	<u>553</u>
<u>66</u>	PST	40963	Higher (640 ft.)	0.038 mi. ESE (201 ft.)	HOLT CAT AUSTIN	9601 S IH 35, AUSTIN, TX 78744	<u>558</u>
<u>66</u>	RCRAGR06	TXD026020156	Higher (640 ft.)	0.038 mi. ESE (201 ft.)	HOLT CAT	9601 S IH 35, AUSTIN, TX 78744	<u>564</u>
<u>67</u>	AUSTINUST	C0680	Higher (663 ft.)	0.036 mi. S (190 ft.)	PRESTIGE SOUTH CHRYSLER	6905 S IH 35, AUSTIN, TX 78744	<u>566</u>
<u>67</u>	IHW	75334	Higher (663 ft.)	0.036 mi. S (190 ft.)	MAXWELL CHRYSLER PLYMOUTH DODGE	6905 S IH 35, AUSTIN, TX 78744	<u>567</u>
<u>67</u>	IHWCA	75334	Higher (663 ft.)	0.036 mi. S (190 ft.)	MAXWELL CHRYSLER PLYMOUTH DODGE	6905 S IH 35, AUSTIN, TX 78744	<u>569</u>
<u>67</u>	PST	71778	Higher (663 ft.)	0.036 mi. S (190 ft.)	PRESTIGE SOUTH CHRYSLER PLYMOUTH	6905 S IH 35, AUSTIN, TX 78744	<u>570</u>
<u>67</u>	RCRANGR06	TXD988020749	Higher (663 ft.)	0.036 mi. S (190 ft.)	MAXWELL CHRYSLER PLYMOUTH DODGE INC	6905 S IH 35, AUSTIN, TX 78744	<u>572</u>
<u>68</u>	AUSTINUST	03284	Higher (660 ft.)	0.039 mi. ESE (206 ft.)	CIRCLE K 2704673	8801, AUSTIN, TX 78744	<u>574</u>
<u>68</u>	IHW	88388	Higher (660 ft.)	0.039 mi. ESE (206 ft.)	HOME DEPOT USA HD6563	8801 S IH 35, AUSTIN, TX 78744	<u>575</u>
<u>68</u>	PST	76336	Higher (660 ft.)	0.039 mi. ESE (206 ft.)	CIRCLE K STORE 2704673	8801 S IH 35 STE B, AUSTIN, TX 78744	<u>591</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>68</u>	RCRAGR06	TXR000060087	Higher (660 ft.)	0.039 mi. ESE (206 ft.)	HOME DEPOT USA HD6563	8801 S IH 35, AUSTIN, TX 78744	<u>597</u>
<u>69</u>	ALTFUELS	39114	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CLAY COOLEY NISSAN	4914 S IH-35, AUSTIN, TX 78745	<u>611</u>
<u>69</u>	ALTFUELS	48318	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CLAY COOLEY NISSAN	4914 S IH-35, AUSTIN, TX 78745	<u>612</u>
<u>69</u>	ALTFUELS	79015	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CLAY COOLEY NISSAN	4914 S IH 35 FRONTAGE RD, AUSTIN, TX 78745	<u>613</u>
<u>69</u>	ALTFUELS	79047	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CLAY COOLEY NISSAN	4914 S IH 35 FRONTAGE RD, AUSTIN, TX 78745	<u>614</u>
<u>69</u>	IHW	85133	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CEN-TEX NISSAN	4914 S IH 35, AUSTIN, TX 78745	<u>615</u>
<u>69</u>	IHWCA	85133	Higher (627 ft.)	0.039 mi. NNW (206 ft.)	CEN-TEX NISSAN	4914 S IH 35, AUSTIN, TX 78745	<u>616</u>
<u>70</u>	IHW	20760	Higher (659 ft.)	0.041 mi. N (216 ft.)	ANTIQUE STREET LAMS CULLEN LANE	9005 CULLEN LN, AUSTIN, TX 78748	<u>617</u>
<u>70</u>	IHW	82165	Higher (659 ft.)	0.041 mi. N (216 ft.)	HOLT CUSTOMS	9005B CULLEN LN, AUSTIN, TX 78748	<u>619</u>
<u>70</u>	RCRANGR06	TXD988059861	Higher (659 ft.)	0.041 mi. N (216 ft.)	HOLT CUSTOMS INC	9005B CULLEN LN, AUSTIN, TX 78748	<u>620</u>
<u>71</u>	PST	79939	Higher (638 ft.)	0.045 mi. WNW (238 ft.)	PCW CONSTRUCTION	10704 S IH 35, AUSTIN, TX 78748	<u>622</u>
<u>72</u>	APAR	T1674	Higher (686 ft.)	0.056 mi. NW (296 ft.)	AARONS AUTO PARTS AUSTIN	8409 S CONGRESS AVE, AUSTIN, TX 78745	<u>624</u>
<u>72</u>	IHWCA	T1674	Higher (686 ft.)	0.056 mi. NW (296 ft.)	AARONS AUTO PARTS	8409 S CONGRESS AVE, AUSTIN, TX 78745	<u>625</u>
<u>73</u>	AUSTINUST	03395	Higher (703 ft.)	0.059 mi. WNW (312 ft.)	MACLEOD RANCH	11922, AUSTIN, TX 78748	<u>626</u>
<u>74</u>	AUSTINUST	C0536	Higher (622 ft.)	0.072 mi. E (380 ft.)	ADAM'S EXTRACT	2217 ONION CREEK PKWY, AUSTIN, TX 78747	<u>627</u>
<u>74</u>	PST	55718	Higher (622 ft.)	0.072 mi. E (380 ft.)	ADAMS EXTRACT	2217 ONION CREEK PKWY, AUSTIN, TX 78747	<u>628</u>
<u>75</u>	IHW	85794	Higher (646 ft.)	0.072 mi. NW (380 ft.)	CHAMPION TOYOTA	4901 WEIDEMAR LN, AUSTIN, TX 78745	<u>631</u>
<u>75</u>	RCRANGR06	TXR000010009	Higher (646 ft.)	0.072 mi. NW (380 ft.)	CHAMPION TOYOTA	4901 WEIDEMAR LANE, AUSTIN, TX 78745	<u>632</u>
<u>76</u>	RCRAGR06	TXR000067637	Higher (667 ft.)	0.074 mi. ESE (391 ft.)	TARGET STORE 0683	6405 S IH 35, AUSTIN, TX 78744	<u>634</u>
<u>77</u>	AUSTINUST	C0087	Higher (655 ft.)	0.08 mi. NW (422 ft.)	NIGHTHAWK FROZEN FOODS	1120 SHELBY LN, AUSTIN, TX 78745	<u>636</u>
<u>77</u>	IHW	74979	Higher (655 ft.)	0.08 mi. NW (422 ft.)	B&B BODY AND PAINT	1120 SHELBY LN, AUSTIN, TX 78745	<u>637</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>77</u>	PST	14471	Higher (655 ft.)	0.08 mi. NW (422 ft.)	NIGHT HAWK FROZEN FOODS	1120 SHELBY LN, AUSTIN, TX 78745	<u>639</u>
77	RCRANGR06	TXD177592896	Higher (655 ft.)	0.08 mi. NW (422 ft.)	GARLYN SHELTON MAZDA	1120A SHELBY LN, AUSTIN, TX 78745	<u>642</u>
77	RCRANGR06	TXR000012336	Higher (655 ft.)	0.08 mi. NW (422 ft.)	B&B BODY AND PAINT	1120 SHELBY LANE, AUSTIN, TX 78745	<u>644</u>
<u>78</u>	IHWCA	T1726	Higher (655 ft.)	0.081 mi. SW (428 ft.)	POMPA TRUCKING AUSTIN	9203 CULLEN LN, AUSTIN, TX 78748	<u>646</u>
<u>'9</u>	DCR	RN100582568	Higher (669 ft.)	0.086 mi. WNW (454 ft.)	SE-P OPERATING	919 E SAINT ELMO RD, AUSTIN, TX 78745	<u>647</u>
<u>'9</u>	IHW	86102	Higher (669 ft.)	0.086 mi. WNW (454 ft.)	ESE-T OPERATING	919 E SAINT ELMO RD, AUSTIN, TX 78745	<u>649</u>
<u>79</u>	RCRAGR06	TXR000031443	Higher (669 ft.)	0.086 mi. WNW (454 ft.)	ESE-T OPERATING LP	919 E ST ELMO, AUSTIN, TX 78745	<u>651</u>
<u>30</u>	AUSTINUST	01170	Higher (663 ft.)	0.103 mi. ESE (544 ft.)	CANNON FOOD MART	1719 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>653</u>
<u>30</u>	PST	11313	Higher (663 ft.)	0.093 mi. ESE (491 ft.)	CANNON FOOD MART	1719 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>654</u>
<u>31</u>	AUSTINUST	02002	Higher (663 ft.)	0.093 mi. E (491 ft.)	CORNER STORE NO. 2194	1706 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>659</u>
<u>31</u>	PST	24541	Higher (663 ft.)	0.093 mi. E (491 ft.)	CIRCLE K STORE 2742194	1706 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>660</u>
<u>32</u>	AUSTINUST	03093	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	COA SERVICE CENTER #8	4411 MEINARDUS DR, AUSTIN, TX 78744	<u>667</u>
<u>32</u>	IHW	81607	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	ST ELMO SERVICE CENTER	4411 MEINARDUS DR STE A, AUSTIN, TX 78744	<u>668</u>
<u>32</u>	IHW	84139	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	SERVICE CENTER 8	4411 MEINARDUS DR STE B, AUSTIN, TX 78744	<u>672</u>
<u>32</u>	NLRRCRAT	TXR000024232	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	CITY OF AUSTIN	4411 MEINARDUS DR BLDG B, AUSTIN, TX 78744	<u>674</u>
<u>32</u>	PST	47046	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	SERVICE CENTER 8	4411 MEINARDUS DR STE D, AUSTIN, TX 78744	<u>676</u>
<u>2</u>	RCRANGR06	TX0000365957	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	ST ELMO SERVICE CENTER	4411 MEINARDUS DR STE A, AUSTIN, TX 78744	<u>683</u>
<u>2</u>	RCRANGR06	TXR000024232	Higher (659 ft.)	0.105 mi. ESE (554 ft.)	CITY OF AUSTIN	4411 MEINARDUS DR BLDG B, AUSTIN, TX 78744	<u>685</u>
33	AUSTINUST	03079	Higher (676 ft.)	0.111 mi. W (586 ft.)	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>687</u>
<u>33</u>	IHW	68954	Higher (676 ft.)	0.111 mi. W (586 ft.)	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>688</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>83</u>	LPST	105202	Higher (676 ft.)	0.111 mi. W (586 ft.)	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>689</u>
<u>83</u>	PST	1284	Higher (676 ft.)	0.111 mi. W (586 ft.)	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>692</u>
<u>33</u>	VCP	0586	Higher (676 ft.)	0.111 mi. W (586 ft.)	JOHN ROBERTS BMW/LEXUS OF AUST	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>695</u>
<u>34</u>	AUSTINUST	C0170	Higher (665 ft.)	0.112 mi. WNW (591 ft.)	CARMAX	4400 S IH 35, AUSTIN, TX 78745	<u>697</u>
<u>34</u>	IHW	68643	Higher (665 ft.)	0.112 mi. WNW (591 ft.)	HENDRIX GMC TRUCKS	4400 S IH 35, AUSTIN, TX 78745	<u>698</u>
<u>84</u>	LPST	109366	Higher (665 ft.)	0.112 mi. WNW (591 ft.)	HENDRIX GMC TRUCKS INC	4400 S IH 35, AUSTIN, TX 78745	<u>700</u>
<u>84</u>	PST	1280	Higher (665 ft.)	0.112 mi. WNW (591 ft.)	CARMAX 7190	4400 S IH 35, AUSTIN, TX 78745	<u>703</u>
<u>34</u>	RCRANGR06	TXD982289449	Higher (665 ft.)	0.112 mi. WNW (591 ft.)	HENDRIX GMC TRUCKS INC	4400 S IH 35, AUSTIN, TX 78745	<u>707</u>
<u>35</u>	AUSTINUST	C0379	Higher (660 ft.)	0.117 mi. WNW (618 ft.)	C J C HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>709</u>
<u>85</u>	IHW	32601	Higher (660 ft.)	0.117 mi. WNW (618 ft.)	COMMEMORATIVE BRANDS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>710</u>
<u>35</u>	LPST	105722	Higher (660 ft.)	0.117 mi. WNW (618 ft.)	C J C HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>717</u>
<u>35</u>	PST	6726	Higher (660 ft.)	0.116 mi. WNW (612 ft.)	CJC HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>719</u>
<u>35</u>	RCRAGR06	TXD026028357	Higher (660 ft.)	0.117 mi. WNW (618 ft.)	COMMEMORATIVE BRANDS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>721</u>
<u> 86</u>	PST	58587	Higher (649 ft.)	0.134 mi. E (708 ft.)	L&T WAGGONER TRUCKING	1825 OAK HILL LN, AUSTIN, TX 78744	<u>725</u>
<u>37</u>	AUSTINUST	C0360	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	SHOPPERS MART #16	4036 S IH 35, AUSTIN, TX 78704	<u>728</u>
<u> 37</u>	IHW	75644	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	STAR ENTERPRISES	4036 S IH 35, AUSTIN, TX 78704	<u>729</u>
<u>87</u>	LPST	091948	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>730</u>
<u>37</u>	LPST	105181	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>734</u>
<u>37</u>	PST	34925	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>738</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>87</u>	PST	36927	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	TEXAS ALTERNATOR STARTER SERVICE	1230 E BEN WHITE BLVD, AUSTIN, TX 78742	<u>743</u>
<u>87</u>	PST	41169	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	TEXAS ALTERNATOR STARTER SERVICE	1230 E BEN WHITE BLVD, AUSTIN, TX 78742	<u>745</u>
<u>87</u>	PST	65826	Higher (667 ft.)	0.139 mi. NNE (734 ft.)	OLD FUELING FACILITY	1240 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>747</u>
<u>88</u>	AUSTINUST	03314	Higher (672 ft.)	0.139 mi. WNW (734 ft.)	PENSKE TRUCK LEASING	8800 S CONGRESS AVE, AUSTIN, TX 78748	<u>751</u>
<u>88</u>	PST	79443	Higher (672 ft.)	0.139 mi. WNW (734 ft.)	PENSKE TRUCK LEASING AUSTIN CONGRESS	8800 S CONGRESS AVE, AUSTIN, TX 78745	<u>752</u>
<u>89</u>	AUSTINUST	00639	Higher (686 ft.)	0.145 mi. WNW (766 ft.)	SHOP N CARRY FOOD #1	8422 S CONGRESS AVE, AUSTIN, TX 78748	<u>757</u>
<u>89</u>	LPST	092335	Higher (686 ft.)	0.145 mi. WNW (766 ft.)	SHOP N CARRY FOOD STORE	8514 S CONGRESS AVE, AUSTIN, TX 78745	<u>758</u>
<u>89</u>	LPST	111287	Higher (686 ft.)	0.145 mi. WNW (766 ft.)	SHOP N CARRY FOOD STORE	8514 S CONGRESS AVE, AUSTIN, TX 78745	<u>764</u>
<u>89</u>	LPST	120751	Higher (686 ft.)	0.143 mi. WNW (755 ft.)	SHOP N CARRY FOODS	8422 S CONGRESS AVE, AUSTIN, TX 78745	<u>770</u>
<u>89</u>	PST	10996	Higher (686 ft.)	0.145 mi. WNW (766 ft.)	SHOP N CARRY FOODS	8422 S CONGRESS AVE, AUSTIN, TX 78745	<u>776</u>
<u>90</u>	AUSTINUST	C0595	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIAL METALS	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>785</u>
<u>90</u>	IHW	66013	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIAL METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>786</u>
<u>90</u>	IHWCA	66013	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIALS METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>787</u>
<u>90</u>	LPST	109572	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIALS METALS AUSTIN INC	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>788</u>
<u>90</u>	PST	12220	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIALS METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>793</u>
<u>90</u>	WMRF	20052	Higher (676 ft.)	0.164 mi. W (866 ft.)	COMMERCIAL METALS INC.	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>799</u>
<u>91</u>	ALTFUELS	96900	Higher (688 ft.)	0.166 mi. ESE (876 ft.)	WEINSTEIN	8003 S IH 35 FRONTAGE RD, AUSTIN, TX 78744	<u>805</u>
<u>92</u>	DCR	RN105548309	Higher (648 ft.)	0.167 mi. WSW (882 ft.)		9500 S INTERSTATE 35 STE 650, AUSTIN, TX 78748	806
<u>92</u>	IHW	90839	Higher (648 ft.)	0.167 mi. WSW (882 ft.)	TARGET STORE T2288	9500 S IH 35 STE G, AUSTIN, TX 78748	808

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>93</u>	PST	89791	Higher (635 ft.)	0.189 mi. WNW (998 ft.)	CAPITOL CHEVROLET PARTS BUILDING	700 N BLUFF DR, AUSTIN, TX 78745	<u>812</u>
<u>94</u>	AUSTINUST	C0321	Higher (691 ft.)	0.193 mi. WNW (1019 ft.)	WATTINGER CO., INC.	114 RALPH ABLANEDO DR, AUSTIN, TX 78748	<u>814</u>
<u>95</u>	IHW	32713	Higher (665 ft.)	0.196 mi. WNW (1035 ft.)	AUSTIN CIRCUITS INC.	900 SHELBY LN, AUSTIN, TX 78745	<u>815</u>
<u>95</u>	IHW	68794	Higher (665 ft.)	0.196 mi. WNW (1035 ft.)	JOSCO PRODUCTS	900 SHELBY LN, AUSTIN, TX 78745	<u>816</u>
<u>95</u>	IHW	73860	Higher (665 ft.)	0.196 mi. WNW (1035 ft.)	M&M MACHINE WORKS	900 SHELBY LN STE 6, AUSTIN, TX 78745	<u>817</u>
<u>95</u>	WMRF	20364	Higher (665 ft.)	0.196 mi. WNW (1035 ft.)	JOSCO PRODUCTS	900 SHELBT LN, AUSTIN, TX 78745	<u>818</u>
<u>96</u>	AUSTINUST	03212	Higher (670 ft.)	0.2 mi. ESE (1056 ft.)	7-ELEVEN STORE #35792	1901 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>820</u>
<u>96</u>	PST	69489	Higher (670 ft.)	0.2 mi. ESE (1056 ft.)	7-ELEVEN 35792	1901 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>821</u>
<u>97</u>	AUSTINUST	C0084	Higher (671 ft.)	0.202 mi. WNW (1067 ft.)	CENTEX MATERIALS INC	817 E ST ELMO RD, AUSTIN, TX 78745	<u>827</u>
<u>97</u>	IHW	66591	Higher (671 ft.)	0.202 mi. WNW (1067 ft.)	CENTEX MATERIALS	810 E SAINT ELMO RD, AUSTIN, TX 78745	<u>828</u>
<u>97</u>	PST	57261	Higher (671 ft.)	0.202 mi. WNW (1067 ft.)	CENTEX MATERIALS	FAREWELL, AUSTIN, TX 78768	<u>830</u>
<u>97</u>	PST	57263	Higher (671 ft.)	0.202 mi. WNW (1067 ft.)	CENTEX MATERIALS SOUTH	817 E SAINT ELMO RD, AUSTIN, TX 78745	<u>832</u>
<u>98</u>	AUSTINUST	03297	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	MURPHY OIL USA #7209	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>834</u>
<u>98</u>	AUSTINUST	N0139	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	S W BELL	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>835</u>
<u>98</u>	IHW	73960	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	AGUIRRE PAINT & BODY	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>836</u>
<u>98</u>	IHW	89168	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	WALMART SUPERCENTER 1253	710 E BEN WHITE BLVD, AUSTIN, TX 78704	837
<u>98</u>	PST	20858	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	SOUTHWESTERN BELL TELEPHONE	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>840</u>
<u>98</u>	PST	35793	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	SOUTHWESTERN BELL	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>843</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>98</u>	PST	77251	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	WAL-MART SUPERCENTER 1253	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>846</u>
<u>98</u>	PST	77388	Higher (658 ft.)	0.208 mi. NNW (1098 ft.)	MURPHY USA 7209	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>849</u>
99	ALTFUELS	81476	Higher (654 ft.)	0.218 mi. ESE (1151 ft.)	CONCORD STATION	7331 BLUFF SPRINGS RD, AUSTIN, TX 78744	<u>855</u>
100	IHW	66344	Higher (669 ft.)	0.231 mi. WNW (1220 ft.)	R & T PAINT & BODY SHOP	711 E SAINT ELMO RD, AUSTIN, TX 78745	<u>856</u>
<u>101</u>	CALF	890	Higher (651 ft.)	0.231 mi. ESE (1220 ft.)	MCGUIRE	E OF IH 35 AND W OF FRIEDRICH LN, S OF E ST. ELMO. (4500 BLK OF FRIEDRICH), TX	<u>857</u>
102	IHW	66359	Higher (671 ft.)	0.242 mi. WNW (1278 ft.)	CARRIAGE BODY SHOP	707 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>858</u>
<u>103</u>	MSWLF	67008	Higher (657 ft.)	0.243 mi. ESE (1283 ft.)	STERLING ACURA OF AUSTIN PARKING LOT EXPANSION	4720 FREIDRICH LANE, AUSTIN, TX 78744	<u>859</u>
104	ALTFUELS	68824	Higher (675 ft.)	0.247 mi. WNW (1304 ft.)	PRESIDIUM	409 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>860</u>
<u>105</u>	WMRF	31145	Higher (657 ft.)	0.272 mi. ESE (1436 ft.)	AXCESS TECHNOLOGIES LLP	4801 FREIDRICH LANE, AUSTIN, TX 78744	<u>861</u>
<u>106</u>	LPST	105147	Higher (673 ft.)	0.307 mi. NW (1621 ft.)	CHISHOLM CORNER STORE 7	600 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>863</u>
107	APAR	2074	Higher (657 ft.)	0.31 mi. WNW (1637 ft.)	MULDOON INTERESTS	6210 CROW LN, AUSTIN, TX 78745	<u>867</u>
<u>107</u>	VCP	2074	Higher (657 ft.)	0.31 mi. WNW (1637 ft.)	MULDOON INTERESTS	6210 CROW LN, AUSTIN, TX 78745	<u>868</u>
<u>108</u>	LPST	104683	Lower (595 ft.)	0.343 mi. ESE (1811 ft.)	ONION CREEK CLUB	2510 ONION CREEK PKWY, AUSTIN, TX 78747	<u>871</u>
<u>109</u>	LPST	100905	Higher (636 ft.)	0.36 mi. ESE (1901 ft.)	METRO MARTS 2 FORMER 7 ELEVEN	2008 TERI RD, AUSTIN, TX 78744	<u>873</u>
<u>110</u>	LPST	100669	Higher (673 ft.)	0.378 mi. WNW (1996 ft.)	WENCO DISTRIBUTING	600 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>878</u>
111	APAR	2025	Higher (668 ft.)	0.391 mi. NW (2064 ft.)	BEN WHITE LOTS 1,2,3,4,5	500 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>881</u>
<u>111</u>	IOP	0580	Higher (668 ft.)	0.391 mi. NW (2064 ft.)	KMS RETAIL PAYLOAD PASS	500 E BEN WHITE BLVD, AUSTIN, TX 78704	882
<u>111</u>	LPST	107201	Higher (668 ft.)	0.382 mi. NW (2017 ft.)	FORMER TRUCK CITY DEALERSHIP	502 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>883</u>
<u>111</u>	VCP	2025	Higher (668 ft.)	0.391 mi. NW (2064 ft.)	BEN WHITE LOTS 1,2,3,4,5	500 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>884</u>

Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
112	IHWCA	20619	Higher (657 ft.)	0.396 mi. ESE (2091 ft.)	AMBION	2130 WOODWARD ST STE 200, AUSTIN, TX 78744	<u>886</u>
<u>113</u>	IHWCA	66261	Higher (642 ft.)	0.41 mi. ESE (2165 ft.)	MODERN METAL FINISHING AUSTIN	7432 BLUFF SPRINGS RD, AUSTIN, TX 78744	<u>887</u>
114	IHWCA	66010	Higher (656 ft.)	0.437 mi. WNW (2307 ft.)	CEN-TEX PLATING	509 E SAINT ELMO RD, AUSTIN, TX 78745	888
<u>115</u>	LPST	105550	Higher (664 ft.)	0.442 mi. WNW (2334 ft.)	AUSTIN FOUR CORNERS OLD STOP N GO	111 W WILLIAM CANNON DR, AUSTIN, TX 78745	<u>889</u>
<u>116</u>	LPST	117722	Higher (664 ft.)	0.461 mi. WNW (2434 ft.)	FORMER 7 ELEVEN STORE 20079	6702 S CONGRESS AVE, AUSTIN, TX 78745	<u>893</u>
117	IHWCA	31593	Higher (653 ft.)	0.469 mi. NW (2476 ft.)	CAPITOL METAL FINISHING AUSTIN	3909 WAREHOUSE ROW, AUSTIN, TX 78704	897
<u>117</u>	RCRAC	TXD048452064	Higher (653 ft.)	0.469 mi. NW (2476 ft.)	CAPITOL METAL FINISHING INC	3909 WAREHOUSE ROW, AUSTIN, TX 78704	<u>898</u>
<u>117</u>	SEMSARCH	TXD048452064	Higher (653 ft.)	0.469 mi. NW (2476 ft.)	CAPITOL METAL FINISHING, INC.	3909 A WAREHOUSE ROW, AUSTIN, TX 78767	<u>901</u>
118	APAR	1505	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	AFCU 2000 WOODWARD	2000 WOODWARD ST, AUSTIN, TX 78741	902
<u>118</u>	APAR	G0066	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	VACANT PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	903
<u>118</u>	APAR	G66	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	VACANT PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	<u>904</u>
<u>118</u>	BF	10958	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	AFCU 2000 WOODWARD STREET LOT 2	2000 WOODWARD STREET, AUSTIN, TX 78741	<u>905</u>
<u>118</u>	BSA	G066	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	<u>907</u>
<u>118</u>	VCP	1505	Higher (645 ft.)	0.479 mi. ENE (2529 ft.)	AFCU 2000 WOODWARD	2000 WOODWARD ST, AUSTIN, TX 78741	<u>908</u>
119	IHWCA	20722	Higher (645 ft.)	0.516 mi. ESE (2724 ft.)	CRYSTAL SEMICONDUCTOR	4210 S INDUSTRIAL DR, AUSTIN, TX 78744	<u>910</u>
<u>120</u>	IHWCA	95386	Higher (638 ft.)	0.563 mi. ESE (2973 ft.)	ARTHROCARE	2301 E SAINT ELMO RD STE 110, AUSTIN, TX 78744	<u>911</u>
<u>121</u>	IHWCA	84908	Higher (657 ft.)	0.592 mi. E (3126 ft.)	AIR PRODUCTS AND CHEMICALS AUSTIN	2307 BUSINESS CENTER DR, AUSTIN, TX 78744	912
122	IHWCA	84092	Higher (652 ft.)	0.687 mi. ESE (3627 ft.)	BOC EDWARDS KACHINA	4117 COMMERCIAL CENTER DR BLDG 5, AUSTIN, TX 78744	<u>913</u>
123	IHWCA	T2087	Higher (640 ft.)	0.744 mi. WNW (3928 ft.)	PROPOSED CVS PHARMACY	5526 S CONGRESS AVE, AUSTIN, TX 78745	<u>914</u>



Map ID#	Database Name	Site ID#	Relative Elevation	Distance From Site	Site Name	Address	PAGE #
<u>124</u>	IHWCA	76613	Higher (653 ft.)	0.795 mi. ESE (4198 ft.)	AUSTIN SCIENTIFIC	4114 TODD LN, AUSTIN, TX 78744	<u>915</u>
<u>125</u>	IHWCA	38485	Higher (672 ft.)	0.798 mi. NNW (4213 ft.)	MAJESTIC PRODUCTS AUSTIN	118 E ALPINE RD, AUSTIN, TX 78704	916
<u>126</u>	IHWCA	T2228	Higher (704 ft.)	0.822 mi. WNW (4340 ft.)	UNDEVELOPED PROPERTY - 8401 S FIRST ST - AUSTIN TX	8401 S 1ST ST, AUSTIN, TX 78748	917

Elevations are collected from the USGS 3D Elevation Program 1/3 arc-second (approximately 10 meters) layer hosted at the NGTOC. .

### **Target Property Elevation: 620 ft.**

NOTE: Standard environmental records are displayed in **bold**.

### **EQUAL/HIGHER ELEVATION**

Map ID#	Database Name	Elevation	Site Name	Address	Page #
1	FRSTX	678 ft.	CHIEF AUTO PARTS 5880	6801 S IH 35 STE A, AUSTIN, TX 78744	<u>52</u>
1	FRSTX	678 ft.	KMART 7511	6715 S IH 35, AUSTIN, TX 78744	<u>53</u>
<u>1</u>	PST	678 ft.	KMART 7511	6715 S IH 35, AUSTIN, TX 78744	<u>54</u>
3	AUSTINUST	635 ft.	GEORGE COFFEY LINCOLN MERCURY	4800 S IH 35, AUSTIN, TX 78745	<u>80</u>
<u>3</u>	ECHOR06	635 ft.	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>81</u>
<u>3</u>	FRSTX	635 ft.	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>82</u>
<u>3</u>	FRSTX	635 ft.	CHAMPION TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>83</u>
<u>3</u>	IHW	635 ft.	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>84</u>
<u>3</u>	PST	635 ft.	GEORGE COFFEY LINCOLN- MERCURY	4800 S IH 35, AUSTIN, TX 78745	<u>86</u>
<u>3</u>	PST	635 ft.	CHAMPION TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>88</u>
<u>3</u>	RCRANGR06	635 ft.	RED MCCOMBS TOYOTA	4800 S IH 35, AUSTIN, TX 78745	<u>90</u>
<u>3</u>	SPILLS	635 ft.		4800 S. IH 35, AUSTIN TX, TX	<u>92</u>
<u>3</u>	TIERII	635 ft.	CHAMPION TOYOTA-SCION OF AUSTIN	4800 IH 35 SOUTH, AUSTIN, TX 78744	<u>93</u>
<u>3</u>	TIERII	635 ft.	CHAMPION TOYOTA	4800 SOUTH IH 35, AUSTIN, TX 78745	<u>94</u>
4	ECHOR06	640 ft.	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>95</u>
<u>4</u>	FRSTX	640 ft.	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>96</u>
<u>4</u>	IHW	640 ft.	WAL-MART STORES TEXAS 1253	5015 S IH 35, AUSTIN, TX 73301	<u>97</u>
<u>4</u>	PST	640 ft.	WAL-MART STORE 1253	5015 S IH 35, AUSTIN, TX 78744	<u>98</u>
<u>4</u>	RCRANGR06	640 ft.	WAL-MART STORES INC	5015 S IH 35, AUSTIN, TX 78744	<u>101</u>
<u>5</u>	AUSTINUST	628 ft.	SAM'S CLUB #8259	5107 S IH 35, AUSTIN, TX 78744	<u>102</u>
<u>5</u>	ECHOR06	628 ft.	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>103</u>
<u>5</u>	FRSTX	628 ft.	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>104</u>
<u>5</u>	FRSTX	628 ft.	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>105</u>
<u>5</u>	FRSTX	628 ft.	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>106</u>
<u>5</u>	GWCC	628 ft.	WALMART STORES INC	5107 S IH 35, AUSTIN, TX	<u>107</u>
<u>5</u>	LPST	628 ft.	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>108</u>
<u>5</u>	PST	628 ft.	SAMS CLUB 8259	5107 S IH 35, AUSTIN, TX 78744	<u>112</u>
<u>5</u>	RCRANGR06	628 ft.	SAMS CLUB NO 8259	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>118</u>
<u>5</u>	TIERII	628 ft.	SAM'S CLUB #8259 - OLD	5107 I-35 SOUTH, AUSTIN, TX 78744	<u>120</u>
7	SPILLS	663 ft.		SOUTH BOUND FRONTAGE @ 135 AND WILLIAM CANNON, AUSTIN, TX	<u>132</u>
<u>9</u>	AUSTINUST	670 ft.	MICHAEL'S (FORMER WOOLCO)	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>136</u>
9	FRSTX	670 ft.	CENTURY SOUTH SHOPPING CTR	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>137</u>
<u>9</u>	SIEC01	670 ft.	CENTURY SOUTH SHOPPING CENTER	801 EAST WILLIAM CANNON DRIVE, AUSTIN, TX	<u>138</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>9</u>	VCP	670 ft.	CENTURY SOUTH SHOPPING CENTER	801 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>140</u>
11	ECHOR06	677 ft.	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>166</u>
<u>11</u>	FRSTX	677 ft.	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>167</u>
<u>11</u>	IHW	677 ft.	GILLMAN MITSUBISHI	6809 S IH 35, AUSTIN, TX 78744	<u>168</u>
<u>11</u>	RCRANGR06	677 ft.	GILLMAN IMPORTS OF AUSTIN INC	6809 S IH 35, AUSTIN, TX 78744	<u>169</u>
<u>12</u>	TIERII	676 ft.	HEB GROCERY COMPANY, LP - AUSTIN 02	6607 SOUTH IH 35, AUSTIN, TX 78744	<u>171</u>
<u>12</u>	TIERII	676 ft.	HEB GROCERY COMPANY, LP - AUSTIN 02	6607 SOUTH IH 35, AUSTIN, TX 78744	<u>172</u>
<u>13</u>	ERNSTX	639 ft.		OAK HILL COMMUNITY, AUSTIN, TX	<u>173</u>
<u>15</u>	FRSTX	642 ft.	TX-AUS-CSJ 0016-01-117	SOUTH OF SLAUGHTER LANE ON IH35, AUSTIN, TX 78748	<u>179</u>
<u>16</u>	FRSTX	642 ft.	STERLING ACURA PARKING LOT	4801 S IH 35, AUSTIN, TX 78744	<u>180</u>
17	FRSTX	736 ft.	SOUTH I-35 WATER WASTEWATER PROGRAM- SEGMENT 9.0	SOUTH I-35 AND F.M. 1327, AUSTIN, TX 78747	<u>181</u>
<u>18</u>	FRSTX	631 ft.	ALEXAN ONION CREEK	ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE, AUSTIN, TX 78747	<u>182</u>
<u>18</u>	FRSTX	631 ft.	ALEXAN OINION CREEK WATERLINE	ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE, AUSTIN, TX 78747	<u>183</u>
<u>19</u>	FRSTX	672 ft.	MANSIONS AT ONION CREEK	11922 S INTERSTATE 35, AUSTIN, TX 78747	<u>184</u>
<u>20</u>	ECHOR06	641 ft.	LENOX SPRINGS II	10300 SOUTH IH 35, AUSTIN, TX 78748	<u>185</u>
<u>20</u>	FRSTX	641 ft.	LENOX SPRINGS II	10300 SOUTH IH 35, AUSTIN, TX 78748	<u>186</u>
<u>21</u>	FRSTX	647 ft.	TX DOT - AUS 0016-01-096	ON IH 35 FROM SOUTH OF SLAUGHTER LANE TO OLD SAN A, AUSTIN, TX 78747	<u>187</u>
<u>22</u>	FRSTX	637 ft.	STABLEWOOD EAST BOX CULVERT	10810 S IH-35 SOUTHBOUND FRONTAGE RD AUSTIN TX 787, AUSTIN, TX 78748	<u>188</u>
<u>23</u>	FRSTX	631 ft.	CONTINENTAL 132 FUND THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>189</u>
<u>23</u>	FRSTX	631 ft.	CRITERION ONION CREEK APARTMENTS THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>190</u>
<u>23</u>	FRSTX	631 ft.	WATERMARK CONSTRUCTION THE SPRINGS AT ONION CREEK	8515 S I H 35, AUSTIN, TX 78744	<u>191</u>
<u>24</u>	ECHOR06	736 ft.	ENCLAVE AT ESTANCIA PHASES 1 2 AND 3 HB	WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE, AUSTIN, TX 78652	<u>192</u>
<u>24</u>	ECHOR06	736 ft.	ENCLAVE AT ESTANCIA PHASE 1 AMENITY CENTER AND PHASE 3 LD	WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE, AUSTIN, TX 78652	<u>193</u>
<u>25</u>	AUSTINUST	659 ft.	VETERANS AFFAIRS	8503 S IH 35, AUSTIN, TX 78744	<u>194</u>
<u>26</u>	AUSTINUST	667 ft.	JOHN ROBERTS BMW	4108 S IH 35, AUSTIN, TX 78745	<u>195</u>
<u> 26</u>	ECHOR06	667 ft.	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>196</u>
<u>26</u>	FRSTX	667 ft.	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>197</u>
<u> 26</u>	IHW	667 ft.	JOHN ROBERTS BMW OF AUSTIN	4108 S IH 35, AUSTIN, TX 78745	<u>198</u>
<u>26</u>	PST	667 ft.	JOHN ROBERTS BMW OF AUSTIN	4108 S IH 35, AUSTIN, TX 78745	<u>199</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>26</u>	PST	667 ft.	LEXUS OF AUSTIN	4107 SANTIAGO ST, AUSTIN, TX 78745	<u>202</u>
<u>26</u>	RCRANGR06	667 ft.	JOHN ROBERTS AUSTIN INC	4108 S IH 35, AUSTIN, TX 78745	<u>205</u>
<u>27</u>	AUSTINUST	653 ft.	CORNER STORE #1445	110 W SLAUGHTER LN, AUSTIN, TX 78745	<u>207</u>
<u>27</u>	FRSTX	653 ft.	VALERO CORNER STORE 1445	110 W SLAUGHTER LN, AUSTIN, TX 78748	<u>208</u>
<u>27</u>	HMIRSR06	653 ft.		110 WEST SLAUGHTER LANE, AUSTIN, TX 78748	<u>209</u>
<u>27</u>	PST	653 ft.	WATTINGER FACILITY	114 W SLAUGHTER LN, AUSTIN, TX 78748	<u>211</u>
<u>27</u>	PST	653 ft.	FAST MART 8186	110 W SLAUGHTER LN, AUSTIN, TX 78748	<u>213</u>
<u>28</u>	FRSTX	633 ft.	WSP DEVELOPMENT 10 ONION CREEK BUSINESS PARK	ON NE OF INTX OF IH35 & ONION CREEK PKWY, AUSTIN, TX 78747	<u>220</u>
<u>29</u>	FRSTX	654 ft.	STATE DEPT OF PUBLIC HWYS	7901 IH 35, AUSTIN, TX 78761	<u>221</u>
<u>30</u>	AUSTINUST	646 ft.	DAIRY FARM	10415 S IH 35, AUSTIN, TX 78747	<u>222</u>
<u>31</u>	ECHOR06	668 ft.	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>223</u>
<u>31</u>	ECHOR06	668 ft.	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>224</u>
<u>31</u>	FRSTX	668 ft.	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>225</u>
<u>31</u>	IHW	668 ft.	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>226</u>
<u>31</u>	RCRAGR06	668 ft.	RANGE AT AUSTIN	8301 S IH 35, AUSTIN, TX 78744	<u>228</u>
<u>32</u>	DCR	625 ft.		11001 S IH 35, AUSTIN, TX 78747	<u>230</u>
<u>32</u>	FRSTX	625 ft.	JACK BROWN CLEANERS 28	11001 S I H 35, AUSTIN, TX 78747	<u>232</u>
<u>33</u>	AUSTINUST	633 ft.	ONION CREEK FOOD MART	2101 BOCA RATON DR, AUSTIN, TX 78747	<u>233</u>
<u>33</u>	FRSTX	633 ft.	UTOTEM	2107 BOCA RATON DR, AUSTIN, TX 78747	<u>234</u>
<u>33</u>	PST	633 ft.	ONION CREEK FOOD MART	2107 BOCA RATON DR, AUSTIN, TX 78747	<u>235</u>
<u>34</u>	ERNSTX	642 ft.		4701 SOUTH INTERSTATE 35, AUSTIN, TX	<u>241</u>
<u>35</u>	FRSTX	680 ft.	RIVER CITY COLLISION SERVICE	6900 S I H 35, AUSTIN, TX 78745	<u>243</u>
<u>36</u>	AUSTINUST	653 ft.	ON THE MOVE #11	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>244</u>
<u>36</u>	FRSTX	653 ft.	7-ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>245</u>
<u>36</u>	GWCC	653 ft.	CONGRESS SLAUGHTER LP	120 W SLAUGHTER LN, AUSTIN, AUSTIN, TX 78748	<u>246</u>
<u>36</u>	LPST	653 ft.	7 ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>247</u>
<u>36</u>	PST	653 ft.	7-ELEVEN 39068	120 W SLAUGHTER LN, AUSTIN, TX 78748	<u>251</u>
<u>38</u>	AUSTINUST	673 ft.	K & Z TOWN FOOD MART #23	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>263</u>
<u>38</u>	ECHOR06	673 ft.	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>264</u>
<u>38</u>	FRSTX	673 ft.	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>265</u>
<u>38</u>	FRSTX	673 ft.	TOWN FOOD MART	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>266</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>38</u>	IHW	673 ft.	STAR ENTERPRISES	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>267</u>
<u>38</u>	LPST	673 ft.	SHOPPERS MART 23	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>268</u>
<u>38</u>	NOV	673 ft.	EXPRESS MART 8	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>272</u>
<u>38</u>	PST	673 ft.	TOWN FOOD MART	800 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>273</u>
<u>38</u>	RCRANGR06	673 ft.	STAR ENTERPRISES INC	800 E WILLIAM CANON DR, AUSTIN, TX 78745	<u>280</u>
<u>39</u>	EAP	666 ft.	WACKENHUT CORRECTIONS CORPORATION	1701 DIRECTORS BLVD, AUSTIN, TX 78744	<u>282</u>
<u>39</u>	FRSTX	666 ft.	WACKENHUT CORRECTIONS CORPORATION	1701 DIRECTORS BLVD, AUSTIN, TX 78744	<u>283</u>
<u>39</u>	IHW	666 ft.	CONTRACTORS INSURANCE EXCHANGE	1701 DIRECTORS BLVD STE 520, AUSTIN, TX 78744	<u>284</u>
<u>40</u>	AUSTINUST	666 ft.	CIRCLE K 2704677	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>285</u>
<u>40</u>	ECHOR06	666 ft.	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>286</u>
<u>40</u>	FRSTX	666 ft.	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>287</u>
<u>40</u>	FRSTX	666 ft.	CIRCLE K STORE 2704677	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>288</u>
<u>40</u>	IHW	666 ft.	STAR ENTERPRISES	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>289</u>
<u>40</u>	LPST	666 ft.	TEXACO SERVICE 11	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>290</u>
<u>40</u>	PST	666 ft.	CIRCLE K STORE 2704677	1601 E SAINT ELMO RD, AUSTIN, TX 78744	<u>298</u>
<u>40</u>	RCRANGR06	666 ft.	STAR ENTERPRISES INC	1601 E ST ELMO RD, AUSTIN, TX 78744	<u>309</u>
<u>41</u>	ECHOR06	640 ft.	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>311</u>
<u>41</u>	FRSTX	640 ft.	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>312</u>
<u>41</u>	IHW	640 ft.	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>313</u>
<u>41</u>	RCRANGR06	640 ft.	CAPITOL CHEVROLET	6200 S IH 35, AUSTIN, TX 78745	<u>315</u>
<u>42</u>	AUSTINUST	625 ft.	ONION CREEK TEXACO	11031 S IH 35, AUSTIN, TX 78747	<u>317</u>
<u>42</u>	FRSTX	625 ft.	ONION CREEK SELF SERVICE	11031 S IH 35, AUSTIN, TX 78747	<u>318</u>
<u>42</u>	NOV	625 ft.	ONION CREEK SELF SERVICE	11031 S IH 35, AUSTIN, TX 78747	<u>319</u>
<u>42</u>	PST	625 ft.	ONION CREEK TEXACO	11031 S IH 35, AUSTIN, TX 78747	<u>320</u>
<u>43</u>	ALTFUELS	629 ft.	COWBOYHDAUSTIN	10917 S IH 35 FRONTAGE RD, AUSTIN, TX 78747	<u>327</u>
<u>44</u>	AUSTINUST	678 ft.	7-ELEVEN #36587	6515 S IH 35, AUSTIN, TX 78744	<u>328</u>
<u>44</u>	ECHOR06	678 ft.	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>329</u>
<u>44</u>	FRSTX	678 ft.	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>330</u>
<u>44</u>	FRSTX	678 ft.	7-ELEVEN STORE 36587	6515 S IH 35, AUSTIN, TX 78744	<u>331</u>
<u>44</u>	IHW	678 ft.	EXXON MOBIL NO 60095	6515 S IH 35, AUSTIN, TX 78744	<u>332</u>
<u>44</u>	PST	678 ft.	7-ELEVEN STORE 36587	6515 S IH 35, AUSTIN, TX 78744	<u>333</u>
<u>44</u>	RCRANGR06	678 ft.	EXXON MOBIL CORPORATION	6515 S IH 35, AUSTIN, TX 78744	<u>342</u>
<u>45</u>	DCR	632 ft.		11215 S IH 35 STE 126, AUSTIN, TX 78747	<u>344</u>
<u>45</u>	FRSTX	632 ft.	DELUXE CLEANERS	11215 S IH 35 STE 126, AUSTIN, TX 78747	<u>346</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>46</u>	AUSTINUST	673 ft.	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>347</u>
<u>46</u>	LPST	673 ft.	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>348</u>
<u>46</u>	LPST	673 ft.	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>352</u>
<u>46</u>	PST	673 ft.	TEXACO ONE STOP	6500 S IH 35, AUSTIN, TX 78745	<u>356</u>
<u>48</u>	AUSTINUST	663 ft.	KOA KAMPGROUND	7009 S IH 35, AUSTIN, TX 78744	<u>375</u>
<u>48</u>	PST	663 ft.	KOA KAMPGROUND	7003 S IH 35, AUSTIN, TX 78744	<u>376</u>
<u>49</u>	AUSTINUST	653 ft.	MURPHY OIL USA #7211	9300 S IH 35, AUSTIN, TX 78748	<u>379</u>
<u>49</u>	ECHOR06	653 ft.	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>380</u>
<u>49</u>	FRSTX	653 ft.	WAL-MART STORES TEXAS LLC	9300 S IH 35 BLDG B, AUSTIN, TX 78748	<u>381</u>
<u>49</u>	FRSTX	653 ft.	MURPHY USA 7211	127 SLAUGHTER LN W, AUSTIN, TX 78748	<u>382</u>
<u>49</u>	FRSTX	653 ft.	TEXAS ROADHOUSE TEXAS ROADHOUSE AT SLAUGHTER CREEK SIDE PLAZ	9300 S IH 35, AUSTIN, TX 78748	<u>383</u>
<u>49</u>	FRSTX	653 ft.	SLAUGHTERWAY RETAIL CREEKSIDE PLAZA SHOPPING CENTER	9300 S IH 35, AUSTIN, TX 78748	<u>384</u>
<u>49</u>	FRSTX	653 ft.	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>385</u>
<u>49</u>	FRSTX	653 ft.	VELOCITY CREDIT SLAUGHTER IH 35 COMMERCIAL PHASE 3	9300 S IH 35, AUSTIN, TX 78748	<u>386</u>
<u>49</u>	IHW	653 ft.	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>387</u>
<u>49</u>	PST	653 ft.	WAL-MART SUPERCENTER 5317	9300 S IH 35, AUSTIN, TX 78748	<u>390</u>
<u>49</u>	PST	653 ft.	MURPHY USA 7211	9300 S IH 35 SERVICE RD BLDG J, AUSTIN, TX 78748	<u>393</u>
<u>49</u>	RCRAGR06	653 ft.	WAL-MART SUPERCENTER 5317	9300 S IH 35 STE B, AUSTIN, TX 78748	<u>399</u>
<u>50</u>	AUSTINUST	658 ft.	MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>402</u>
<u>50</u>	ECHOR06	658 ft.	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>403</u>
<u>50</u>	FRSTX	658 ft.	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>404</u>
<u>50</u>	IHW	658 ft.	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>405</u>
<u>50</u>	IHW	658 ft.	FRIENDLY OLDS MAZDA	PO BOX 17667, AUSTIN, TX 78760	<u>406</u>
<u>50</u>	LPST	658 ft.	FRIENDLY OLDS MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>407</u>
<u>50</u>	NOV	658 ft.	MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>410</u>
<u>50</u>	PST	658 ft.	ROGER BEASLEY MAZDA SOUTH	4506 S IH 35, AUSTIN, TX 78745	<u>411</u>
<u>50</u>	RCRANGR06	658 ft.	FRIENDLY OLDSMOBILE MAZDA	4506 S IH 35, AUSTIN, TX 78745	<u>417</u>
<u>52</u>	HMIRSR06	652 ft.		9400 SOUTH IH 35 NORTHBOUND LN, AUSTIN, TX	<u>421</u>
<u>53</u>	FRSTX	641 ft.	SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC	9725 S IH 35, AUSTIN, TX 78744	<u>423</u>
<u>53</u>	PST	641 ft.	SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC	9725 S IH 35, AUSTIN, TX 78744	<u>424</u>
<u>53</u>	TIERII	641 ft.	TXDOT-AUSTIN-SPECIAL CREW MAINTENANCE	9725 IH 35 SOUTH, AUSTIN, TX 78744	<u>426</u>
<u>54</u>	AUSTINUST	644 ft.	NATIONAL TIRE WAREHOUSE	4720 S IH 35, AUSTIN, TX 78745	<u>433</u>
<u>54</u>	ECHOR06	644 ft.	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>434</u>
<u>54</u>	FRSTX	644 ft.	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>435</u>
<u>54</u>	FRSTX	644 ft.	NTW	4720 S I H 35, AUSTIN, TX 78745	<u>436</u>
<u>54</u>	IHW	644 ft.	ONION CREEK VOLKSWAGEN	4720 S IH 35, AUSTIN, TX 78745	<u>437</u>
<u>54</u>	LPST	644 ft.	NTW	4720 S IH 35, AUSTIN, TX 78745	<u>438</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>54</u>	PST	644 ft.	NTW	4720 S IH 35, AUSTIN, TX 78745	<u>449</u>
<u>54</u>	RCRAGR06	644 ft.	NATIONAL TIRE & BATTERY #8686	4720 S IH 35, AUSTIN, TX 78745	<u>461</u>
<u>56</u>	AUSTINUST	637 ft.	CRUMLEY'S GROCERY	10730 S IH 35, AUSTIN, TX 78748	<u>464</u>
<u>56</u>	ERNSTX	637 ft.	ONION CREEK LIQUOR STORE, NW CORNER OF BUILDING	10730 SOUTH INTERSTATE HWY 35, AUSTIN, TX	<u>465</u>
<u>56</u>	GWCC	637 ft.	TEX CON OIL CO	10730 S IH 35, AUSTIN, TX 78748	<u>467</u>
<u>56</u>	LPST	637 ft.	FORMER CRUMLEYS GROCERY	10730 S IH 35, AUSTIN, TX 78748	<u>468</u>
<u>56</u>	PST	637 ft.	D E CRUMLEY GROC	IH 35, AUSTIN, TX 78744	<u>472</u>
<u>57</u>	AUSTINUST	644 ft.	SOUTHPOINT PONTIAC	4610 S IH 35, AUSTIN, TX 78745	<u>476</u>
<u>57</u>	ECHOR06	644 ft.	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>477</u>
<u>57</u>	ECHOR06	644 ft.	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>478</u>
<u>57</u>	ECHOR06	644 ft.	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>479</u>
<u>57</u>	FRSTX	644 ft.	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>480</u>
<u>57</u>	FRSTX	644 ft.	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>481</u>
<u>57</u>	FRSTX	644 ft.	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>482</u>
<u>57</u>	IHW	644 ft.	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>483</u>
<u>57</u>	IHW	644 ft.	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>484</u>
<u>57</u>	PST	644 ft.	SOUTHPOINT PONTIAC	4610 S IH 35, AUSTIN, TX 78745	<u>486</u>
<u>57</u>	RCRANGR06	644 ft.	SOUTHPOINT PONTIAC JEEP EAGLE	4610 S IH 35, AUSTIN, TX 78745	<u>490</u>
<u>57</u>	RCRANGR06	644 ft.	LONE STAR PORSCHE AUDI	4700 S IH 35, AUSTIN, TX 78745	<u>492</u>
<u>57</u>	RCRANGR06	644 ft.	CEN-TEX NISSAN INC	4610 S IH 35, AUSTIN, TX 78745	<u>494</u>
<u>58</u>	AUSTINUST	683 ft.	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>496</u>
<u>58</u>	IHWCA	683 ft.	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>497</u>
<u>58</u>	PST	683 ft.	DAVE TRANSPORTATION SERVICES	8300 S IH 35, AUSTIN, TX 78745	<u>498</u>
<u>58</u>	RCRANGR06	683 ft.	DAVE TRANSPORTATION SERVICES INC	8300 IH 35 S ACCESS RD, AUSTIN, TX 78745	<u>500</u>
<u>59</u>	AUSTINUST	631 ft.	CORNER STORE #1570	11206 S IH 35, AUSTIN, TX 78748	<u>501</u>
<u>59</u>	PST	631 ft.	CIRCLE K STORE 2741570	11206 S IH 35 FRONTAGE RD, AUSTIN, TX 78748	<u>502</u>
<u>61</u>	ALTFUELS	639 ft.	U-HAUL	9001 I-35 S, AUSTIN, TX 78744	<u>508</u>
<u>63</u>	AUSTINUST	635 ft.	LIPSHY	4738 S IH 35, AUSTIN, TX 78745	<u>523</u>
<u>63</u>	IHW	635 ft.	EASY WHEELS	4738 S IH 35, AUSTIN, TX 78745	<u>524</u>
<u>63</u>	LPST	635 ft.	LIPSHY MOTOR CARS	4738 S IH 35, AUSTIN, TX 78745	<u>525</u>
<u>63</u>	PST	635 ft.	LIPSHY MOTOR CARS	4738 S IH 35, AUSTIN, TX 78745	<u>528</u>
<u>63</u>	RCRANGR06	635 ft.	LIPSHY MOTORCARS INC	4738 S IH 35, AUSTIN, TX 78745	<u>531</u>
<u>66</u>	AUSTINUST	640 ft.	HOLT CO	9601 S IH 35, AUSTIN, TX 78744	<u>545</u>
<u>66</u>	IHW	640 ft.	HOLT CAT	9601 S IH 35, AUSTIN, TX 78744	<u>546</u>
<u>66</u>	LPST	640 ft.	HOLT MACHINERY CO	9601 S IH 35, AUSTIN, TX 78744	<u>548</u>
<u>66</u>	LPST	640 ft.	HOLT MACHINERY CO	9601 S IH 35, AUSTIN, TX 78744	<u>553</u>
<u>66</u>	PST	640 ft.	HOLT CAT AUSTIN	9601 S IH 35, AUSTIN, TX 78744	<u>558</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>66</u>	RCRAGR06	640 ft.	HOLT CAT	9601 S IH 35, AUSTIN, TX 78744	<u>564</u>
<u>67</u>	AUSTINUST	663 ft.	PRESTIGE SOUTH CHRYSLER	6905 S IH 35, AUSTIN, TX 78744	<u>566</u>
<u>67</u>	IHW	663 ft.	MAXWELL CHRYSLER PLYMOUTH DODGE	6905 S IH 35, AUSTIN, TX 78744	<u>567</u>
<u>67</u>	IHWCA	663 ft.	MAXWELL CHRYSLER PLYMOUTH DODGE	6905 S IH 35, AUSTIN, TX 78744	<u>569</u>
<u>67</u>	PST	663 ft.	PRESTIGE SOUTH CHRYSLER PLYMOUTH	6905 S IH 35, AUSTIN, TX 78744	<u>570</u>
<u>67</u>	RCRANGR06	663 ft.	MAXWELL CHRYSLER PLYMOUTH DODGE INC	6905 S IH 35, AUSTIN, TX 78744	<u>572</u>
<u>68</u>	AUSTINUST	660 ft.	CIRCLE K 2704673	8801, AUSTIN, TX 78744	<u>574</u>
<u>68</u>	IHW	660 ft.	HOME DEPOT USA HD6563	8801 S IH 35, AUSTIN, TX 78744	<u>575</u>
<u>68</u>	PST	660 ft.	CIRCLE K STORE 2704673	8801 S IH 35 STE B, AUSTIN, TX 78744	<u>591</u>
<u>68</u>	RCRAGR06	660 ft.	HOME DEPOT USA HD6563	8801 S IH 35, AUSTIN, TX 78744	<u>597</u>
<u>69</u>	ALTFUELS	627 ft.	CLAY COOLEY NISSAN	4914 S IH-35, AUSTIN, TX 78745	<u>611</u>
<u>69</u>	ALTFUELS	627 ft.	CLAY COOLEY NISSAN	4914 S IH-35, AUSTIN, TX 78745	<u>612</u>
<u>69</u>	ALTFUELS	627 ft.	CLAY COOLEY NISSAN	4914 S IH 35 FRONTAGE RD, AUSTIN, TX 78745	<u>613</u>
<u>69</u>	ALTFUELS	627 ft.	CLAY COOLEY NISSAN	4914 S IH 35 FRONTAGE RD, AUSTIN, TX 78745	<u>614</u>
<u>69</u>	IHW	627 ft.	CEN-TEX NISSAN	4914 S IH 35, AUSTIN, TX 78745	<u>615</u>
<u>69</u>	IHWCA	627 ft.	CEN-TEX NISSAN	4914 S IH 35, AUSTIN, TX 78745	<u>616</u>
<u>70</u>	IHW	659 ft.	ANTIQUE STREET LAMS CULLEN LANE	9005 CULLEN LN, AUSTIN, TX 78748	<u>617</u>
<u>70</u>	IHW	659 ft.	HOLT CUSTOMS	9005B CULLEN LN, AUSTIN, TX 78748	<u>619</u>
<u>70</u>	RCRANGR06	659 ft.	HOLT CUSTOMS INC	9005B CULLEN LN, AUSTIN, TX 78748	<u>620</u>
<u>71</u>	PST	638 ft.	PCW CONSTRUCTION	10704 S IH 35, AUSTIN, TX 78748	<u>622</u>
<u>72</u>	APAR	686 ft.	AARONS AUTO PARTS AUSTIN	8409 S CONGRESS AVE, AUSTIN, TX 78745	<u>624</u>
<u>72</u>	IHWCA	686 ft.	AARONS AUTO PARTS	8409 S CONGRESS AVE, AUSTIN, TX 78745	<u>625</u>
<u>73</u>	AUSTINUST	703 ft.	MACLEOD RANCH	11922, AUSTIN, TX 78748	<u>626</u>
<u>74</u>	AUSTINUST	622 ft.	ADAM'S EXTRACT	2217 ONION CREEK PKWY, AUSTIN, TX 78747	<u>627</u>
<u>74</u>	PST	622 ft.	ADAMS EXTRACT	2217 ONION CREEK PKWY, AUSTIN, TX 78747	<u>628</u>
<u>75</u>	IHW	646 ft.	CHAMPION TOYOTA	4901 WEIDEMAR LN, AUSTIN, TX 78745	<u>631</u>
<u>75</u>	RCRANGR06	646 ft.	CHAMPION TOYOTA	4901 WEIDEMAR LANE, AUSTIN, TX 78745	<u>632</u>
<u>76</u>	RCRAGR06	667 ft.	TARGET STORE 0683	6405 S IH 35, AUSTIN, TX 78744	<u>634</u>
<u>77</u>	AUSTINUST	655 ft.	NIGHTHAWK FROZEN FOODS	1120 SHELBY LN, AUSTIN, TX 78745	<u>636</u>
<u>77</u>	IHW	655 ft.	B&B BODY AND PAINT	1120 SHELBY LN, AUSTIN, TX 78745	<u>637</u>
<u>77</u>	PST	655 ft.	NIGHT HAWK FROZEN FOODS	1120 SHELBY LN, AUSTIN, TX 78745	<u>639</u>
<u>77</u>	RCRANGR06	655 ft.	GARLYN SHELTON MAZDA	1120A SHELBY LN, AUSTIN, TX 78745	<u>642</u>
<u>77</u>	RCRANGR06	655 ft.	B&B BODY AND PAINT	1120 SHELBY LANE, AUSTIN, TX 78745	<u>644</u>
<u>78</u>	IHWCA	655 ft.	POMPA TRUCKING AUSTIN	9203 CULLEN LN, AUSTIN, TX 78748	<u>646</u>
<u>79</u>	DCR	669 ft.	SE-P OPERATING	919 E SAINT ELMO RD, AUSTIN, TX 78745	<u>647</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>79</u>	IHW	669 ft.	ESE-T OPERATING	919 E SAINT ELMO RD, AUSTIN, TX 78745	<u>649</u>
<u>79</u>	RCRAGR06	669 ft.	ESE-T OPERATING LP	919 E ST ELMO, AUSTIN, TX 78745	<u>651</u>
<u>80</u>	AUSTINUST	663 ft.	CANNON FOOD MART	1719 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>653</u>
<u>80</u>	PST	663 ft.	CANNON FOOD MART	1719 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>654</u>
<u>31</u>	AUSTINUST	663 ft.	CORNER STORE NO. 2194	1706 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>659</u>
<u>81</u>	PST	663 ft.	CIRCLE K STORE 2742194	1706 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>660</u>
<u>82</u>	AUSTINUST	659 ft.	COA SERVICE CENTER #8	4411 MEINARDUS DR, AUSTIN, TX 78744	<u>667</u>
<u>32</u>	IHW	659 ft.	ST ELMO SERVICE CENTER	4411 MEINARDUS DR STE A, AUSTIN, TX 78744	<u>668</u>
<u>32</u>	IHW	659 ft.	SERVICE CENTER 8	4411 MEINARDUS DR STE B, AUSTIN, TX 78744	<u>672</u>
<u>82</u>	NLRRCRAT	659 ft.	CITY OF AUSTIN	4411 MEINARDUS DR BLDG B, AUSTIN, TX 78744	<u>674</u>
<u>82</u>	PST	659 ft.	SERVICE CENTER 8	4411 MEINARDUS DR STE D, AUSTIN, TX 78744	<u>676</u>
<u>32</u>	RCRANGR06	659 ft.	ST ELMO SERVICE CENTER	4411 MEINARDUS DR STE A, AUSTIN, TX 78744	<u>683</u>
<u>82</u>	RCRANGR06	659 ft.	CITY OF AUSTIN	4411 MEINARDUS DR BLDG B, AUSTIN, TX 78744	<u>685</u>
33	AUSTINUST	676 ft.	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>687</u>
<u>33</u>	IHW	676 ft.	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>688</u>
33	LPST	676 ft.	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>689</u>
33	PST	676 ft.	HOWDY HONDA	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>692</u>
<u>33</u>	VCP	676 ft.	JOHN ROBERTS BMW/LEXUS OF AUST	4110 SANTIAGO ST, AUSTIN, TX 78745	<u>695</u>
34	AUSTINUST	665 ft.	CARMAX	4400 S IH 35, AUSTIN, TX 78745	<u>697</u>
<u> 4</u>	IHW	665 ft.	HENDRIX GMC TRUCKS	4400 S IH 35, AUSTIN, TX 78745	<u>698</u>
<u>34</u>	LPST	665 ft.	HENDRIX GMC TRUCKS INC	4400 S IH 35, AUSTIN, TX 78745	<u>700</u>
<u>34</u>	PST	665 ft.	CARMAX 7190	4400 S IH 35, AUSTIN, TX 78745	<u>703</u>
<u>34</u>	RCRANGR06	665 ft.	HENDRIX GMC TRUCKS INC	4400 S IH 35, AUSTIN, TX 78745	<u>707</u>
<u>35</u>	AUSTINUST	660 ft.	C J C HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>709</u>
<u>85</u>	IHW	660 ft.	COMMEMORATIVE BRANDS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>710</u>
<u> 35</u>	LPST	660 ft.	C J C HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>717</u>
<u> 35</u>	PST	660 ft.	CJC HOLDINGS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>719</u>
<u> </u>	RCRAGR06	660 ft.	COMMEMORATIVE BRANDS	7211 CIRCLE S RD, AUSTIN, TX 78745	<u>721</u>
<u> 36</u>	PST	649 ft.	L&T WAGGONER TRUCKING	1825 OAK HILL LN, AUSTIN, TX 78744	<u>725</u>
<u>37</u>	AUSTINUST	667 ft.	SHOPPERS MART #16	4036 S IH 35, AUSTIN, TX 78704	<u>728</u>
<u>87</u>	IHW	667 ft.	STAR ENTERPRISES	4036 S IH 35, AUSTIN, TX 78704	<u>729</u>
<del>37</del>	LPST	667 ft.	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>730</u>
<u>87</u>	LPST	667 ft.	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>734</u>
<u>87</u>	PST	667 ft.	SHOPPERS MART 16	4036 S IH 35, AUSTIN, TX 78704	<u>738</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>87</u>	PST	667 ft.	TEXAS ALTERNATOR STARTER SERVICE	1230 E BEN WHITE BLVD, AUSTIN, TX 78742	<u>743</u>
<u>87</u>	PST	667 ft.	TEXAS ALTERNATOR STARTER SERVICE	1230 E BEN WHITE BLVD, AUSTIN, TX 78742	<u>745</u>
<u>87</u>	PST	667 ft.	OLD FUELING FACILITY	1240 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>747</u>
<u>88</u>	AUSTINUST	672 ft.	PENSKE TRUCK LEASING	8800 S CONGRESS AVE, AUSTIN, TX 78748	<u>751</u>
<u>88</u>	PST	672 ft.	PENSKE TRUCK LEASING AUSTIN CONGRESS	8800 S CONGRESS AVE, AUSTIN, TX 78745	<u>752</u>
<u>89</u>	AUSTINUST	686 ft.	SHOP N CARRY FOOD #1	8422 S CONGRESS AVE, AUSTIN, TX 78748	<u>757</u>
<u>89</u>	LPST	686 ft.	SHOP N CARRY FOOD STORE	8514 S CONGRESS AVE, AUSTIN, TX 78745	<u>758</u>
<u>89</u>	LPST	686 ft.	SHOP N CARRY FOOD STORE	8514 S CONGRESS AVE, AUSTIN, TX 78745	<u>764</u>
<u>89</u>	LPST	686 ft.	SHOP N CARRY FOODS	8422 S CONGRESS AVE, AUSTIN, TX 78745	<u>770</u>
<u>89</u>	PST	686 ft.	SHOP N CARRY FOODS	8422 S CONGRESS AVE, AUSTIN, TX 78745	<u>776</u>
<u>90</u>	AUSTINUST	676 ft.	COMMERCIAL METALS	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>785</u>
90	IHW	676 ft.	COMMERCIAL METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>786</u>
90	IHWCA	676 ft.	COMMERCIALS METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>787</u>
<u>90</u>	LPST	676 ft.	COMMERCIALS METALS AUSTIN INC	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>788</u>
<u>90</u>	PST	676 ft.	COMMERCIALS METALS AUSTIN	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>793</u>
90	WMRF	676 ft.	COMMERCIAL METALS INC.	710 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>799</u>
91	ALTFUELS	688 ft.	WEINSTEIN	8003 S IH 35 FRONTAGE RD, AUSTIN, TX 78744	<u>805</u>
92	DCR	648 ft.		9500 S INTERSTATE 35 STE 650, AUSTIN, TX 78748	<u>806</u>
<u>92</u>	IHW	648 ft.	TARGET STORE T2288	9500 S IH 35 STE G, AUSTIN, TX 78748	<u>808</u>
<u>93</u>	PST	635 ft.	CAPITOL CHEVROLET PARTS BUILDING	700 N BLUFF DR, AUSTIN, TX 78745	<u>812</u>
94	AUSTINUST	691 ft.	WATTINGER CO., INC.	114 RALPH ABLANEDO DR, AUSTIN, TX 78748	<u>814</u>
<u>95</u>	IHW	665 ft.	AUSTIN CIRCUITS INC.	900 SHELBY LN, AUSTIN, TX 78745	<u>815</u>
<u>95</u>	IHW	665 ft.	JOSCO PRODUCTS	900 SHELBY LN, AUSTIN, TX 78745	<u>816</u>
<u>95</u>	IHW	665 ft.	M&M MACHINE WORKS	900 SHELBY LN STE 6, AUSTIN, TX 78745	<u>817</u>
<u>95</u>	WMRF	665 ft.	JOSCO PRODUCTS	900 SHELBT LN, AUSTIN, TX 78745	<u>818</u>
<u>96</u>	AUSTINUST	670 ft.	7-ELEVEN STORE #35792	1901 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>820</u>
<u>96</u>	PST	670 ft.	7-ELEVEN 35792	1901 E WILLIAM CANNON DR, AUSTIN, TX 78744	<u>821</u>
<u>97</u>	AUSTINUST	671 ft.	CENTEX MATERIALS INC	817 E ST ELMO RD, AUSTIN, TX 78745	<u>827</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>97</u>	IHW	671 ft.	CENTEX MATERIALS	810 E SAINT ELMO RD, AUSTIN, TX 78745	828
<u>97</u>	PST	671 ft.	CENTEX MATERIALS	FAREWELL, AUSTIN, TX 78768	<u>830</u>
<u>97</u>	PST	671 ft.	CENTEX MATERIALS SOUTH	817 E SAINT ELMO RD, AUSTIN, TX 78745	<u>832</u>
<u>98</u>	AUSTINUST	658 ft.	MURPHY OIL USA #7209	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>834</u>
<u>98</u>	AUSTINUST	658 ft.	S W BELL	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>835</u>
<u>98</u>	IHW	658 ft.	AGUIRRE PAINT & BODY	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>836</u>
<u>98</u>	IHW	658 ft.	WALMART SUPERCENTER 1253	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>837</u>
<u>98</u>	PST	658 ft.	SOUTHWESTERN BELL TELEPHONE	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>840</u>
<u>98</u>	PST	658 ft.	SOUTHWESTERN BELL	3909 PAYLOAD PASS, AUSTIN, TX 78704	<u>843</u>
<u>98</u>	PST	658 ft.	WAL-MART SUPERCENTER 1253	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>846</u>
<u>98</u>	PST	658 ft.	MURPHY USA 7209	710 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>849</u>
<u>99</u>	ALTFUELS	654 ft.	CONCORD STATION	7331 BLUFF SPRINGS RD, AUSTIN, TX 78744	<u>855</u>
100	IHW	669 ft.	R & T PAINT & BODY SHOP	711 E SAINT ELMO RD, AUSTIN, TX 78745	<u>856</u>
<u>101</u>	CALF	651 ft.	MCGUIRE	E OF IH 35 AND W OF FRIEDRICH LN, S OF E ST. ELMO. (4500 BLK OF FRIEDRICH), TX	<u>857</u>
<u>102</u>	IHW	671 ft.	CARRIAGE BODY SHOP	707 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>858</u>
<u>103</u>	MSWLF	657 ft.	STERLING ACURA OF AUSTIN PARKING LOT EXPANSION	4720 FREIDRICH LANE, AUSTIN, TX 78744	<u>859</u>
104	ALTFUELS	675 ft.	PRESIDIUM	409 E WILLIAM CANNON DR, AUSTIN, TX 78745	<u>860</u>
<u>105</u>	WMRF	657 ft.	AXCESS TECHNOLOGIES LLP	4801 FREIDRICH LANE, AUSTIN, TX 78744	<u>861</u>
<u>106</u>	LPST	673 ft.	CHISHOLM CORNER STORE 7	600 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>863</u>
107	APAR	657 ft.	MULDOON INTERESTS	6210 CROW LN, AUSTIN, TX 78745	<u>867</u>
<u>107</u>	VCP	657 ft.	MULDOON INTERESTS	6210 CROW LN, AUSTIN, TX 78745	<u>868</u>
<u>109</u>	LPST	636 ft.	METRO MARTS 2 FORMER 7 ELEVEN	2008 TERI RD, AUSTIN, TX 78744	<u>873</u>
<u>110</u>	LPST	673 ft.	WENCO DISTRIBUTING	600 INDUSTRIAL BLVD, AUSTIN, TX 78745	<u>878</u>
111	APAR	668 ft.	BEN WHITE LOTS 1,2,3,4,5	500 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>881</u>
<u>111</u>	IOP	668 ft.	KMS RETAIL PAYLOAD PASS	500 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>882</u>
<u>111</u>	LPST	668 ft.	FORMER TRUCK CITY DEALERSHIP	502 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>883</u>
<u>111</u>	VCP	668 ft.	BEN WHITE LOTS 1,2,3,4,5	500 E BEN WHITE BLVD, AUSTIN, TX 78704	<u>884</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>112</u>	IHWCA	657 ft.	AMBION	2130 WOODWARD ST STE 200, AUSTIN, TX 78744	<u>886</u>
113	IHWCA	642 ft.	MODERN METAL FINISHING AUSTIN	7432 BLUFF SPRINGS RD, AUSTIN, TX 78744	<u>887</u>
<u>114</u>	IHWCA	656 ft.	CEN-TEX PLATING	509 E SAINT ELMO RD, AUSTIN, TX 78745	888
<u>115</u>	LPST	664 ft.	AUSTIN FOUR CORNERS OLD STOP N GO	111 W WILLIAM CANNON DR, AUSTIN, TX 78745	<u>889</u>
<u>116</u>	LPST	664 ft.	FORMER 7 ELEVEN STORE 20079	6702 S CONGRESS AVE, AUSTIN, TX 78745	<u>893</u>
117	IHWCA	653 ft.	CAPITOL METAL FINISHING AUSTIN	3909 WAREHOUSE ROW, AUSTIN, TX 78704	<u>897</u>
<u>117</u>	RCRAC	653 ft.	CAPITOL METAL FINISHING INC	3909 WAREHOUSE ROW, AUSTIN, TX 78704	<u>898</u>
<u>117</u>	SEMSARCH	653 ft.	CAPITOL METAL FINISHING, INC.	3909 A WAREHOUSE ROW, AUSTIN, TX 78767	<u>901</u>
118	APAR	645 ft.	AFCU 2000 WOODWARD	2000 WOODWARD ST, AUSTIN, TX 78741	902
<u>118</u>	APAR	645 ft.	VACANT PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	903
<u>118</u>	APAR	645 ft.	VACANT PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	<u>904</u>
<u>118</u>	BF	645 ft.	AFCU 2000 WOODWARD STREET LOT 2	2000 WOODWARD STREET, AUSTIN, TX 78741	<u>905</u>
<u>118</u>	BSA	645 ft.	AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY	2000 WOODWARD ST, AUSTIN, TX 78741	<u>907</u>
<u>118</u>	VCP	645 ft.	AFCU 2000 WOODWARD	2000 WOODWARD ST, AUSTIN, TX 78741	<u>908</u>
119	IHWCA	645 ft.	CRYSTAL SEMICONDUCTOR	4210 S INDUSTRIAL DR, AUSTIN, TX 78744	910
120	IHWCA	638 ft.	ARTHROCARE	2301 E SAINT ELMO RD STE 110, AUSTIN, TX 78744	<u>911</u>
121	IHWCA	657 ft.	AIR PRODUCTS AND CHEMICALS AUSTIN	2307 BUSINESS CENTER DR, AUSTIN, TX 78744	<u>912</u>
122	IHWCA	652 ft.	BOC EDWARDS KACHINA	4117 COMMERCIAL CENTER DR BLDG 5, AUSTIN, TX 78744	<u>913</u>
123	IHWCA	640 ft.	PROPOSED CVS PHARMACY	5526 S CONGRESS AVE, AUSTIN, TX 78745	<u>914</u>
<u>124</u>	IHWCA	653 ft.	AUSTIN SCIENTIFIC	4114 TODD LN, AUSTIN, TX 78744	<u>915</u>
<u>125</u>	IHWCA	672 ft.	MAJESTIC PRODUCTS AUSTIN	118 E ALPINE RD, AUSTIN, TX 78704	<u>916</u>
<u>126</u>	IHWCA	704 ft.	UNDEVELOPED PROPERTY - 8401 S FIRST ST - AUSTIN TX	8401 S 1ST ST, AUSTIN, TX 78748	<u>917</u>

## **LOWER ELEVATION**

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>2</u>	AUSTINUST	605 ft.	FIESTA MART #64	5510 S IH 35, AUSTIN, TX 78745	<u>56</u>
2	ECHOR06	605 ft.	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>57</u>
2	FRSTX	605 ft.	FIESTA MART 64	5510 S I 35, AUSTIN, TX 78745	58



Map ID#	Database Name	Elevation	Site Name	Address	Page #
2	FRSTX	605 ft.	LOWES OF SE AUSTIN TX 0689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>59</u>
<u>2</u>	FRSTX	605 ft.	JIFFY LUBE 3036	5510 IH-BUILDING L SVC RD, AUSTIN, TX 78745	<u>60</u>
2	FRSTX	605 ft.	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>61</u>
<u>2</u>	HMIRSR06	605 ft.		5510 SOUTH IH 35, AUSTIN, TX	<u>62</u>
2	IHW	605 ft.	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>64</u>
<u>2</u>	PST	605 ft.	FIESTA MART 64	5510 S IH 35, AUSTIN, TX 78745	<u>66</u>
<u>2</u>	PST	605 ft.	LOWES OF SE AUSTIN TX 0689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>72</u>
<u>2</u>	RCRAGR06	605 ft.	LOWES OF SE AUSTIN 689	5510 S INTERSTATE 35, AUSTIN, TX 78745	<u>74</u>
2	TIERII	605 ft.	JIFFY LUBE #3036	5510 IH-35 BUILDING L SVC RD, AUSTIN, TX 78745	<u>76</u>
2	TIERII	605 ft.	LOWE'S OF SOUTHEAST AUSTIN TX (#689)	5510 SOUTH IH35, AUSTIN, TX 78745	<u>77</u>
2	TIERII	605 ft.	JIFFY LUBE #3036	5510 IH-35 BUILDING L SVC RD, AUSTIN, TX 78745	<u>79</u>
<u>6</u>	ECHOR06	615 ft.	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>122</u>
<u>6</u>	FRSTX	615 ft.	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>123</u>
<u>6</u>	IHW	615 ft.	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>124</u>
<u>6</u>	PST	615 ft.	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>126</u>
<u>6</u>	RCRANGR06	615 ft.	MAXWELL FORD	5000 S IH 35, AUSTIN, TX 78745	<u>128</u>
<u>6</u>	TIERII	615 ft.	MAXWELL FORD	5000 SOUTH IH 35, AUSTIN, TX 78745	<u>130</u>
<u>8</u>	SPILLS	595 ft.		NORTH IH 35 @ ONION CREEK, TX	<u>133</u>
<u>8</u>	SPILLS	595 ft.		NORTH IH 35 @ ONION CREEK, AUSTIN, TX	<u>134</u>
8	SPILLS	595 ft.		SOUTHBOUND FRONTAGE OF IH 35, SOUTH OF ONION CREEK, AUSTIN, TX	<u>135</u>
<u>10</u>	DOCKETS	619 ft.	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78745	<u>143</u>
<u>10</u>	ECHOR06	619 ft.	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78748	<u>144</u>
<u>10</u>	ECHOR06	619 ft.	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>145</u>
<u>10</u>	FRSTX	619 ft.	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78748	<u>146</u>
<u>10</u>	FRSTX	619 ft.	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>147</u>
<u>10</u>	FRSTX	619 ft.	JANSSEN TRACT	9808 S I H 35, AUSTIN, TX 78748	<u>148</u>
<u>10</u>	HISTGWCC	619 ft.	GAVLON INDUSTRIES INC	9808 S INTERREGIONAL HWY 35, 78745, AUSTIN, TX 78745	<u>149</u>
<u>10</u>	ICIS	619 ft.	GAVLON INDUSTRIES	9808 SOUTH IH 35, AUSTIN, TX 78745	<u>150</u>
<u>10</u>	IHW	619 ft.	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78748	<u>151</u>
<u>10</u>	IHW	619 ft.	ASHLAND CHEMICAL AUSTIN	9806 S IH 35, AUSTIN, TX 78748	<u>153</u>
<u>10</u>	IHWCA	619 ft.	GAVLON INDUSTRIES	9808 S IH 35, AUSTIN, TX 78748	<u>154</u>
<u>10</u>	RCRANGR06	619 ft.	ASHLAND CHEMICAL COMPANY	9806 S IH 35, AUSTIN, TX 78745	<u>155</u>
<u>10</u>	RCRANGR06	619 ft.	GAVLON INDUSTRIES INC	9808 S IH 35, AUSTIN, TX 78748	<u>159</u>
<u>10</u>	SIEC01	619 ft.	JANSSEN TRACT	9808 SOUTH IH-35, AUSTIN, TX 78748	<u>161</u>
<u>10</u>	VCP	619 ft.	JANSSEN TRACT	9808 S I H 35, AUSTIN, TX 78748	<u>163</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>14</u>	ERNSTX	593 ft.	INTERSTATE 35 NB AT SLAUGHTER CREE IN AUSTIN, TX	INTERSTATE 35 NB AT SLAUGHTER CREE IN AU, AUSTIN, TX	<u>175</u>
14	HMIRSR06	593 ft.		I-35 NB @ SLAUGHTER CREEK, AUSTIN, TX 78705	<u>177</u>
<u>37</u>	AUSTINUST	587 ft.	STASSNEY CROSSING C-STORE	5717 S IH 35 SVRD NB, AUSTIN, TX 78744	<u>256</u>
<u>37</u>	PST	587 ft.	STASSNEY FOOD MART	5717 S INTERSTATE 35 BLDG D, AUSTIN, TX 78744	<u>257</u>
<u>47</u>	FRSTX	602 ft.	MARTINE SPRINGS-SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX 78747	<u>361</u>
<u>47</u>	FRSTX	602 ft.	HILL COUNTRY SPRINGS	10019 S I H 35, AUSTIN, TX 78747	<u>362</u>
<u>47</u>	HISTGWCC	602 ft.	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>363</u>
<u>47</u>	HISTGWCC	602 ft.	MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>364</u>
<u>47</u>	HISTGWCC	602 ft.	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, AUSTIN, TX	<u>365</u>
<u>47</u>	HISTGWCC	602 ft.	MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>366</u>
<u>47</u>	HISTGWCC	602 ft.		10019 SOUTH IH-35, AUSTIN, TX	<u>367</u>
<u>47</u>	HISTGWCC	602 ft.	MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX	<u>368</u>
<u>47</u>	NOV	602 ft.	HILL COUNTRY SPRINGS	AUSTIN, TX 78747	<u>369</u>
<u>47</u>	SEMSARCH	602 ft.	MARTINE SPRINGS-SLAUGHTER CREEK GROUNDWATER PLUME	10019 SOUTH IH-35, AUSTIN, TX 78747	<u>374</u>
<u>51</u>	FRSTX	616 ft.	10001 SOUTH IH 35 INVESTMENTS PARKSIDE PAVILION OFFICE CENTE	10001 S IH 35, AUSTIN, TX 78747	419
<u>51</u>	FRSTX	616 ft.	HARVEY CLEARY BUILDERS PARKSIDE PAVILLION	10001 S IH 35, AUSTIN, TX 78747	<u>420</u>
<u>55</u>	IHWCA	609 ft.	SOUTH POINT NISSAN PREOWEND	6001 S IH 35, AUSTIN, TX 78744	<u>463</u>
<u>60</u>	ALTFUELS	586 ft.	BMW SOUTH AUS	5501 S IH 35 FRONTAGE RD, AUSTIN, TX 78744	<u>507</u>
<u>62</u>	AUSTINUST	619 ft.	SAM'S CLUB GAS STATION #8259	9900 S IH 35 SVRD SB, AUSTIN, TX 78748	<u>509</u>
<u>62</u>	IHW	619 ft.	SAMS CLUB 8259	9900 S INTERSTATE 35 # SB, AUSTIN, TX 78748	<u>510</u>
<u>62</u>	PST	619 ft.	SAMS CLUB 8259	9900 S IH 35 SVRD STE J, AUSTIN, TX 78748	<u>513</u>
<u>62</u>	RCRAGR06	619 ft.	SAMS CLUB 8259	9900 SOUTH INTERSTATE HIGHWAY 35 SERVICE ROAD SB, AUSTIN, TX 78748	<u>520</u>
<u>64</u>	IHW	600 ft.	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>533</u>
<u>64</u>	IHWCA	600 ft.	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>534</u>
<u>64</u>	RCRANGR06	600 ft.	SOUTH FORK HYUNDAI	5306 S IH 35, AUSTIN, TX 78745	<u>535</u>
<u>65</u>	AUSTINUST	600 ft.	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>537</u>
<u>65</u>	IHW	600 ft.	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>538</u>
<u>65</u>	IHWCA	600 ft.	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>539</u>
<u>65</u>	PST	600 ft.	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>540</u>
<u>65</u>	RCRANGR06	600 ft.	SOUTH STAR DODGE	5210 S IH 35, AUSTIN, TX 78745	<u>543</u>

Map ID#	Database Name	Elevation	Site Name	Address	Page #
<u>108</u>	LPST	595 ft.	ONION CREEK CLUB	2510 ONION CREEK PKWY, AUSTIN, TX	<u>871</u>

**MAP ID# 1** 

Distance from Property: 0.01 mi. (53 ft.) ESE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110070165488

NAME: CHIEF AUTO PARTS 5880

LOCATION ADDRESS: 6801 S IH 35 STE A

**AUSTIN, TX 78744-4818** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**MAP ID# 1** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 678 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110070165980

NAME: KMART 7511

LOCATION ADDRESS: 6715 S IH 35

**AUSTIN, TX 78744-4801** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

## Petroleum Storage Tanks (PST)

CONTACT INFORMATION

ORGANIZATION: KMART 7511

PHONE: (512) 4473217 0

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: LA TOCHER

TITLE: MGR

**MAP ID# 1** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 678 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 15802

NAME: KMART 7511 ADDRESS: 6715 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1989 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/15/1986 SIGNATURE NAME & TITLE: J B RONAN, ASST CONTROLLER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600876494 NAME: US REALTY 87 ASSOCIATE

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 09/01/1989

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986 EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 1000

GeoSearch www.geo-search.com 888-396-0042

## Petroleum Storage Tanks (PST)

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/01/1988** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 141875

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### FACILITY INFORMATION

GEOSEARCH ID: 03248

UST ID #: 03248

NAME: FIESTA MART #64
ADDRESS: 5510 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110070246893 REGISTRY ID: 110070246893 NAME: LOWES OF SE AUSTIN 689 ADDRESS: 5510 S INTERSTATE 35 **AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

FACILITY INFORMATION
REGISTRY ID: 110033576100
NAME: FIESTA MART 64

LOCATION ADDRESS: 5510 S I 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**ALBERTSONS EXPRESS 4093** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

## FACILITY INFORMATION

REGISTRY ID: 110037570456

NAME: LOWES OF SE AUSTIN TX 0689
LOCATION ADDRESS: 5510 S INTERSTATE 35
AUSTIN, TX 78745-3290

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**LOWES OF SE AUSTIN TX 0689** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

5211 - LUMBER AND OTHER BUILDING MATERIALS DEALERS

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**444110 - HOME CENTERS.** 

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

FACILITY INFORMATION
REGISTRY ID: 110041726004

NAME: JIFFY LUBE 3036

LOCATION ADDRESS: 5510 IH-BUILDING L SVC RD

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: JIFFY LUBE 3036

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

7549 - AUTOMOTIVE SERVICES, EXCEPT REPAIR AND CARWASHES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

811191 - AUTOMOTIVE OIL CHANGE AND LUBRICATION SHOPS.

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

# FACILITY INFORMATION REGISTRY ID: 110070246893

NAME: LOWES OF SE AUSTIN 689

LOCATION ADDRESS: 5510 S INTERSTATE 35

**AUSTIN, TX 78745-3290** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

44411 - HOME CENTERS

**Back to Report Summary** 

## Hazardous Materials Incident Reporting System (HMIRSR06)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

#### **INCIDENT INFORMATION**

REPORT #: I-2001070056

REPORT SUBMISSION SOURCE: NOT REPORTED
REPORT TYPE: A HAZARDOUS MATERIAL INCIDENT

NRC REPORT NUMBER: NOT REPORTED

FEDERAL DOT REPORT NUMBER: NOT REPORTED

FEDERAL AGENCY NAME: NOT REPORTED

DATE: 6/19/2001
INCIDENT LOCATION:
5510 SOUTH IH 35
AUSTIN, TX
TRAVIS

**CARRIER INFORMATION** 

NAME: YRC INC.

ADDRESS: 10990 ROE AVE

OVERLAND PARK, KS 66211-1213

MODE OF TRANSPORTATION: **HIGHWAY** TRANSPORTATION PHASE: **UNLOADING** 

### **COMMODITY DETAILS**

IDENTIFICATION NUMBER: UN1824

COMMODITY SHIPPING NAME: SODIUM HYDROXIDE SOLUTION

TRADE NAME: **SODIUM HYDROXIDE SOLUTION**QUANTITY RELEASED: **1 LIQUID - GALLON** 

PACKAGING: NON-BULK

HAZARDOUS CLASS: CORROSIVE MATERIAL

.

### **FAILURE DESCRIPTION**

WHAT FAILED: 103; 103 BASIC MATERIAL; BASIC MATERIAL

HOW FAILED: 304; 305 - CRACKED; CRUSHED

**FAILURE CAUSE DESCRIPTION:** 

 ${\bf 517; 517 \text{-} IMPROPER\ PREPARATION\ FOR\ TRANSPORTATION; IMPROPER\ PREPARATION\ FOR\ TRANSPORTATION}$ 

**DESCRIPTION OF EVENTS:** 

WHILE UNLOADING ONE BOX WAS DISCOVERED CRUSHED BY OTHER FREIGHT. ONE INNER BOTTLE WAS LEAKING. THE SPILLAGE WAS NEUTRALIZED WITH AMPHOMAG AND DISPOSED OF PROPERLY. THE REMAINING BOTTLES WERE REPACKED AND THE SHIPMENT WAS FORWARDED TO THE CONSIGNEE. THE SHIPPER WAS NOTIFIED.

RECOMMENDATIONS/ACTIONS TAKEN:

NO ACTION OR RECOMMENDATION REPORTED

#### **INCIDENT DETAILS**

SPILLAGE RESULT IDENTIFIED: NOT REPORTED
FIRE RESULT IDENTIFIED: NOT REPORTED
EXPLOSION RESULT IDENTIFIED: NOT REPORTED



## Hazardous Materials Incident Reporting System (HMIRSR06)

WATER SEWER RESULT IDENTIFIED: NOT REPORTED
GAS DISPERSION RESULT IDENTIFIED: NOT REPORTED

ENVIRONMENTAL DAMAGE RESULT IDENTIFIED: NOT REPORTED

OTHER CLEANUP IDENTIFIED: NOT REPORTED
FIRE EMS REPORT IDENTIFIED: NOT REPORTED
FIRE EMS EMS REPORT NUMBER: NOT REPORTED
POLICE REPORT NUMBER: NOT REPORTED
POLICE REPORT IDENTIFIED: NOT REPORTED
IN HOUSE CLEANUP IDENTIFIED: NOT REPORTED

NO RELEASE RESULT IDENTIFIED: NOT REPORTED

## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### **FACILITY INFORMATION**

REGISTRATION#: 96959 EPA ID: TXR000084398

TNRCC ID #: 132298

NAME: LOWES OF SE AUSTIN 689 ADDRESS: 5510 S INTERSTATE 35

**AUSTIN, TX 78745** 

CONTACT: BOBBI TENBORG

PHONE: **704-7582955** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 05/07/2018

### **ACTIVITIES**

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 399971

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS

WASTE ID: 399972

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING CORROSIVES

WASTE ID: 399973

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

### OWNER INFORMATION

NAME: LOWES HOME CENTERS LLC

ADDRESS: 1000 LOWES BLVD STOP A3WLP

**MOORESVILLE, NC 28117** 

PHONE: 1-758-7582955



Order# 141197 Job# 336212 64 of 937

## Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS

WASTE ID: 399974

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS

WASTE ID: 399975

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVES - ACIDIC

WASTE ID: 399976

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVES - BASIC

WASTE ID: 399977

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLUORESCENT BULBS - BROKEN

WASTE ID: 397938

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS

## Petroleum Storage Tanks (PST)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### **FACILITY INFORMATION**

ID#: 73284

NAME: FIESTA MART 64 ADDRESS: 5510 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11
TYPE: RETAIL

BEGIN DATE: 05/31/2000

STATUS: **ACTIVE**EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/10/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/07/2019 SIGNATURE NAME & TITLE: KAUSHIK PAUL, DIR OF RETAIL SUPP

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604930842
NAME: FIESTA MART LLC

CONTACT ADDRESS: 5235 KATY FWY

**HOUSTON TX 77007** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/27/2015
CONTACT ROLE: OWNOPRCON
CONTACT NAME: WAYNE PETERSON
CONTACT TITLE: NOT REPORTED
ORGANIZATION: FIESTA MART LLC

PHONE: **(713)** 8668342 0 FAX: **NOT REPORTED** 

EMAIL: PETERSONW@FIESTAMART.COM

OWNER NUMBER: CN601379498

NAME: THE GROCERS SUPPLY CO INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/29/2006

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

## Petroleum Storage Tanks (PST)

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604930842

NAME: FIESTA MART LLC

CONTACT ADDRESS: 5235 KATY FWY

**HOUSTON TX 77007** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/27/2015

CONTACT ROLE: OWNOPRCON
CONTACT NAME: WAYNE PETERSON
CONTACT TITLE: NOT REPORTED
ORGANIZATION: FIESTA MART LLC

PHONE: **(713)** 8668342 0 FAX: **NOT REPORTED** 

EMAIL: PETERSONW@FIESTAMART.COM
OPERATOR NUMBER: CN600595599

NAME: FIESTA MART INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/30/2006

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 320668 SIGNATURE DATE: 05/07/2019

SIGNATURE NAME & TITLE: KAUSHIK PAUL, DIR OF RETAIL SUPP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 303309
SIGNATURE DATE: 04/27/2018

SIGNATURE NAME & TITLE: SID KESWANI, CEO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 287279
SIGNATURE DATE: 05/09/2017

SIGNATURE NAME & TITLE: WAYNE PETERSON, VP/CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 278243
SIGNATURE DATE: 09/23/2016



Order# 141197 Job# 336212 67 of 937

SIGNATURE NAME & TITLE: WAYNE PETERSON, VP/CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 259677
SIGNATURE DATE: 08/24/2015

SIGNATURE NAME & TITLE: JAMES PESSAGNO, DIR OF RISK MGMT

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246622
SIGNATURE DATE: 01/12/2015

SIGNATURE NAME & TITLE: JIM ARNOLD, SR VP REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246523
SIGNATURE DATE: 12/03/2014

SIGNATURE NAME & TITLE: JIM ARNOLD, SR VP REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 232141
SIGNATURE DATE: 02/03/2014

SIGNATURE NAME & TITLE: JIM ARNOLD, SR VP OF REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191730
SIGNATURE DATE: 02/15/2013

SIGNATURE NAME & TITLE: JIM ARNOLD, VP OF REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191729
SIGNATURE DATE: 03/30/2012

SIGNATURE NAME & TITLE: JIM ARNOLD, VP OF REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191728
SIGNATURE DATE: 01/28/2011

SIGNATURE NAME & TITLE: JIM ARNOLD, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191727
SIGNATURE DATE: 02/01/2010

SIGNATURE NAME & TITLE: JIM ARNOLD, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191726
SIGNATURE DATE: 01/30/2009

SIGNATURE NAME & TITLE: JIM ARNOLD, VP REAL ESTATE

FILING STATUS: RENEWAL



Order# 141197 Job# 336212 68 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191725
SIGNATURE DATE: 01/29/2009

SIGNATURE NAME & TITLE: JIM ARNOLD, VP REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191724
SIGNATURE DATE: 04/12/2007

SIGNATURE NAME & TITLE: JIM ARNOLD, VP REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191723
SIGNATURE DATE: 03/14/2006

SIGNATURE NAME & TITLE: DOUG KASEFANG, DIR OF AFFAIRS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191722
SIGNATURE DATE: 02/22/2005

SIGNATURE NAME & TITLE: BARBARA RUSSELL, DIR OF AFFAIRS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191721
SIGNATURE DATE: 02/05/2004

SIGNATURE NAME & TITLE: BARBARA RUSSELL, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191720
SIGNATURE DATE: 02/25/2003

SIGNATURE NAME & TITLE: BARBARA RUSSELL, DIR ENV AFFAIRS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191719
SIGNATURE DATE: 02/26/2002

SIGNATURE NAME & TITLE: BARBARA RUSSELL, DIR ENV REAL ESTATE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191718
SIGNATURE DATE: 07/25/2000

SIGNATURE NAME & TITLE: C LEE MUMFORD, VP

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 191717
SIGNATURE DATE: 07/24/2000

SIGNATURE NAME & TITLE: C LEE MUMFORD, VP

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 



Order# 141197 Job# 336212 69 of 937

#### NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/31/2000 REGISTRATION DATE: 06/26/2000

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/31/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 170917

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 15000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET @<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

**CONTAINMENT** 

EXTERNAL CONTAINMENT: PIPE SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/31/2000 REGISTRATION DATE: 06/26/2000

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/31/2000

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

TANK SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 170918

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND

CONTAINMENT

EXTERNAL CONTAINMENT: PIPE SYNTHETIC TANK-PIT/PIPING-TRENCH LINER

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 71 of 937

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### **FACILITY INFORMATION**

ID#: 79269

NAME: LOWES OF SE AUSTIN TX 0689 ADDRESS: 5510 S INTERSTATE 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11
TYPE: RETAIL

BEGIN DATE: 04/20/2000

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/16/2008
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/11/2008
SIGNATURE NAME & TITLE: W LAYNE ADAMS, VP RETAIL FAC MGMT

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601551385

NAME: LOWES HOME CENTERS LLC

CONTACT ADDRESS: PO BOX 1111

NORTH WILKESBORO NC 28656

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/20/2000

CONTACT ROLE: OWNCON

CONTACT NAME: TIM L COOKSEY

CONTACT TITLE: COMP MGR

ORGANIZATION: LOWES HOME CENTERS INC

PHONE: (336) 6684622 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN601551385 NAME: LOWES HOME CENTERS LLC CONTACT ADDRESS: PO BOX 1111

NORTH WILKESBORO NC 28659

TYPE: CORPORATION/COMPANY

BEGIN DATE: **04/20/2000**CONTACT ROLE: **OPRCON** 

CONTACT NAME: J DANIEL PARDUE CONTACT TITLE: NOT REPORTED

### **CONTACT INFORMATION**

NAME: **NOT REPORTED**TITLE: **NOT REPORTED** 

ORGANIZATION: LOWES OF SE AUSTIN TX 0689
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

72 of 937

PHONE: (512) 4410329 0

ORGANIZATION: LOWES HOME CENTERS INC

PHONE: **(336) 6584000 0** FAX: **(336) 6582616** 

EMAIL: TRAVIS.J.SPICER@LOWES.COM

### **SELF-CERTIFICATION**

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 209915 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 068901 REGISTRATION DATE: 05/12/2008

INSTALLATION DATE: 04/20/2000 STATUS BEGIN DATE: 04/20/2000

TANK CAPACITY (GAL): 1500 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

#### **MATERIAL OF CONSTRUCTION**

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXR000084398 OWNER TYPE: PRIVATE

NAME: LOWES OF SE AUSTIN 689 OWNER NAME: LOWES HOME CENTERS LLC

ADDRESS: 5510 S INTERSTATE 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745-3290 OPERATOR NAME: LOWES HOME CENTERS LLC

CONTACT NAME: BOBBI TENBORG

CONTACT ADDRESS: 1000 LOWES BLVD STOP A3WLP

MOORESVILLE NC 28117-8520

CONTACT PHONE: 704-758-2955

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/21/2018

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

BOBBI TENBORG ENV COMPLIANCE SUPERVISOR 03/21/2018

**INDUSTRY CLASSIFICATION (NAICS)** 

44411 - HOME CENTERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 05/17/2018

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE:  ${f NO}$ 

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO TRANSPORTER: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D005 BARIUM
D006 CADMIUM
D007 CHROMIUM



Order# 141197 Job# 336212 74 of 937

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

D008 LEAD
D009 MERCURY
D011 SILVER

D016 2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)

D018 BENZENE

D035 METHYL ETHYL KETONE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

#### SITE INFORMATION

UNIQUE ID: 3G2Z5Z07N1XR

SITE ID: FATR20093G2Z5Z07N1XR

NAME: JIFFY LUBE #3036

ADDRESS: 5510 IH-35 BUILDING L SVC RD

**AUSTIN, TX 78745** 

SIGNED DATE: 2/4/2010

VALIDATION REPORT: THIS FACILITY PASSED ALL VALIDATION CHECKS.

MAILING ADDRESS: 11308 DAVENPORT ST
OMAHA, NE 68154

#### SITE DETAILS

SITE TYPE: AUTO SERV, EXC REP & CARWASHES

SITE TYPE: AUTOMOTIVE OIL CHANGE AND LUBRICATION SHOPS

SITE TYPE: AUTO SERV, EXC REP & CARWASHES

SITE TYPE: AUTOMOTIVE OIL CHANGE AND LUBRICATION SHOPS

SITE TYPE: AUTO SERV, EXC REP & CARWASHES

CHEMICAL LOCATION:

INSIDE RETAIL STORE (GARAGE AREA)
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

INSIDE RETAIL STORE (GARAGE AREA)
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

INSIDE RETAIL STORE (GARAGE AREA)
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL NAME: MOTOR OIL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: MOTOR OIL
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: MOTOR OIL
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

**Back to Report Summary** 

Order# 141197 Job# 336212 76 of 937

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

#### **SITE INFORMATION**

UNIQUE ID: 5NML27035G60

SITE ID: FATR20125NML27035G60

NAME: LOWE'S OF SOUTHEAST AUSTIN TX (#689)

ADDRESS: 5510 SOUTH IH35
AUSTIN, TX 78745

SIGNED DATE: 2/25/2013

VALIDATION REPORT: NOT REPORTED

MAILING ADDRESS: LOWE'S HOME CENTERS, INC., 1605 CURTIS BRIDGE ROAD, C/O: A2ELP

**WILKESBORO, NC 28697** 

#### SITE DETAILS

SITE TYPE: LUMBER & BUILD MATERIAL DEALER

SITE TYPE: HOME CENTERS

SITE TYPE: LUMBER & BUILD MATERIAL DEALER

SITE TYPE: HOME CENTERS

SITE TYPE: LUMBER & BUILD MATERIAL DEALER

SITE TYPE: HOME CENTERS

SITE TYPE: LUMBER & BUILD MATERIAL DEALER

SITE TYPE: **HOME CENTERS**CHEMICAL LOCATION:

OUTSIDE STORE, EAST OF BUILDING CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**OUTSIDE, EAST OF BUILDING** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

OUTSIDE STORE, EAST OF BUILDING
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

OUTSIDE STORE, EAST OF BUILDING
CHEMICAL AMOUNT: NOT REPORTED
CHEMICAL NAME: DIESEL FUEL
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: **DIESEL FUEL**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL FUEL

Order# 141197 Job# 336212 77 of 937

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

**MAP ID# 2** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 605 ft. (Lower than TP)

### **SITE INFORMATION**

UNIQUE ID: 8C8WWZ06B6NM

SITE ID: FATR20128C8WWZ06B6NM

NAME: JIFFY LUBE #3036

ADDRESS: 5510 IH-35 BUILDING L SVC RD

**AUSTIN, TX 78745** 

SIGNED DATE: 2/8/2013

VALIDATION REPORT: NOT REPORTED

MAILING ADDRESS: 105 DECKER COURT, STE 900

**IRVING, TX 75062** 

#### SITE DETAILS

SITE TYPE: AUTOMOTIVE OIL CHANGE AND LUBRICATION SHOPS

SITE TYPE: AUTO SERV, EXC REP & CARWASHES

CHEMICAL LOCATION:

INSIDE RETAIL STORE (GARAGE AREA)
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

INSIDE RETAIL STORE (GARAGE AREA)
CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL NAME: MOTOR OIL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: MOTOR OIL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: YES MIXTURE: NOT REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: C0225

UST ID #: C0225

NAME: GEORGE COFFEY LINCOLN MERCURY

ADDRESS: 4800 S IH 35 AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C
HISTORICAL RECORD?: NO
COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110008164752 REGISTRY ID: 110008164752 NAME: RED MCCOMBS TOYOTA

ADDRESS: 4800 S IH 35 **AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

# Facility Registry System (FRSTX)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

#### **FACILITY INFORMATION**

REGISTRY ID: 110008164752

NAME: RED MCCOMBS TOYOTA

LOCATION ADDRESS: 4800 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**MCCOMBS TOYOTA-AUSTIN** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

# Facility Registry System (FRSTX)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

REGISTRY ID: 110034339375
NAME: CHAMPION TOYOTA

LOCATION ADDRESS: 4800 S IH 35

**AUSTIN, TX 78745-2440** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: CHAMPION TOYOTA

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

83 of 937

Order# 141197 Job# 336212

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 76563 EPA ID: TXD988047544 NAME: RED MCCOMBS TOYOTA

TNRCC ID #: 30878 ADDRESS: 4800 S IH 35

NAME: **RED MCCOMBS TOYOTA**AUSTIN, TX 78745

ADDRESS: 4800 S IH 35 PHONE: 1-512-4404500

AUSTIN, TX 78745

CONTACT: PAUL CLARKE PHONE: 512-4404500

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/08/2005

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 59519

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 59520

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: **59521** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 141197 Job# 336212 84 of 937

# Industrial and Hazardous Waste Sites (IHW)

WASTE IS TREATED OFF SITE:  $\mathbf{YES}$ 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 56996

NAME: GEORGE COFFEY LINCOLN-MERCURY

ADDRESS: 4800 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING
BEGIN DATE: 12/05/1990
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 11/30/1990 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 11/29/1990 SIGNATURE NAME & TITLE: W C FAULKKNER, BRANCH MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600133243

NAME: FORD MOTOR CREDIT COMPANY LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **12/05/1990** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1989 REGISTRATION DATE: 11/30/1990
TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

CONTACT INFORMATION

NAME: NOT REPORTED
TITLE: NOT REPORTED

ORGANIZATION: GEORGE COFFEY LINCOLN-MERCURY
MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4449637 0

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **01/16/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 126993

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

VAPOR MONITORING, GROUNDWATER MONITORING

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 87 of 937

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 74857

NAME: CHAMPION TOYOTA ADDRESS: 4800 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 10/19/2001 STATUS: ACTIVE

EXEMPT STATUS: **NO** RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/16/2002 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 01/14/2002

SIGNATURE NAME & TITLE: TRUETT BUDD, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600778039
NAME: ON-SITE FUELS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/19/2001

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 18727

APPLICATION RECEIVED DATE: 11/20/2003

SCHEDULE CONSTRUCTION DATE: 12/08/2003

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

### **CONTACT INFORMATION**

NAME: PAUL CLARKE
TITLE: NOT REPORTED

ORGANIZATION: CHAMPION TOYOTA

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: **(512) 4404500 0** 



Order# 141197 Job# 336212 88 of 937

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 199126 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 01/18/2002

INSTALLATION DATE: 10/19/2001 STATUS BEGIN DATE: 10/19/2001

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXD988047544 OWNER TYPE: PRIVATE

NAME: RED MCCOMBS TOYOTA OWNER NAME: RED MCCOMBS TOYOTA

ADDRESS: 4800 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: RED MCCOMBS TOYOTA

CONTACT NAME: PAUL CLARKE
CONTACT ADDRESS: 4800 S IH 35

**AUSTIN TX 78745** 

CONTACT PHONE: 512-440-4500

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/14/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 02/17/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

 D006
 CADMIUM

 D007
 CHROMIUM

 D008
 LEAD

 D018
 BENZENE

 D022
 CHLOROFORM

D039 TETRACHLOROETHYLENE

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

F004 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND

THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

# Spills Listing (SPILLS)

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **INCIDENT INFORMATION**

GEOSEARCH ID: 12/11/95003
INCIDENT #: 12/11/95003
SPILL DATE: 12/11/95
SPILL LOCATION / COUNTY:
4800 S. IH 35, AUSTIN TX / TX

RESPONSIBLE PARTY: APPLE TPYOTA

MATERIAL SPILLED / AMOUNT: LUBE OIL / 300 GALS

AFFECTED WATERWAY: NONE
AMOUNT IN WATER: NONE
BASIN: COLORADO RIVER

COMMENTS: **NOT REPORTED** 

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

#### SITE INFORMATION

UNIQUE ID: 5NRYE0002UG4

SITE ID: FATR20115NRYE0002UG4

NAME: CHAMPION TOYOTA-SCION OF AUSTIN

ADDRESS: 4800 IH 35 SOUTH AUSTIN, TX 78744

SIGNED DATE: 02-28-2012

VALIDATION REPORT: NOT REPORTED MAILING ADDRESS: NOT REPORTED

### **SITE DETAILS**

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: AUTOMOBILE AND OTHER MOTOR VEHICLE WHOLESALER

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: AUTOMOBILE AND OTHER MOTOR VEHICLE WHOLESALERS

CHEMICAL LOCATION:

WEST OF THE SOUTH END OF SERVICE SHOP

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

WEST OF THE SOUTH END OF SERVICE SHOP

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: 25236 POUNDS

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES** 

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: 25236 POUNDS

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

**Back to Report Summary** 

93 of 937

**MAP ID# 3** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 635 ft. (Higher than TP)

### **SITE INFORMATION**

UNIQUE ID: 8CN176002GRX

SITE ID: FATR20118CN176002GRX

NAME: CHAMPION TOYOTA
ADDRESS: 4800 SOUTH IH 35
AUSTIN, TX 78745

SIGNED DATE: 1-20-2012

VALIDATION REPORT: AN OWNER/OPERATOR CONTACT RECORD IS REQUIRED. AN EMERGENCY CONTACT RECORD IS REQUIRED. NONE WERE FOUND. ----------- VALIDATION ERRORS FOR CHEMICAL: GASOLINE CAS# IS REQUIRED FOR EHS

CHEMICALS. ONE OF THE CHECK BOXES, PURE OR MIXTURE, MUST BE CHECKED. MA

MAILING ADDRESS: NOT REPORTED

### **SITE DETAILS**

SITE TYPE: ALL OTHER AUTOMOTIVE REPAIR AND MAINTENANCE

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 4** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 640 ft. (Higher than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110008158894 REGISTRY ID: 110008158894 NAME: WAL-MART STORE 1253

ADDRESS: 5015 S IH 35 **AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

# Facility Registry System (FRSTX)

**MAP ID# 4** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** REGISTRY ID: 110008158894

NAME: WAL-MART STORE 1253 LOCATION ADDRESS: 5015 S IH 35

**AUSTIN, TX 78744-2701** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S: WAL-MART STORES INC WAL-MART STORE 1253** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 4** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 74715 EPA ID: TXD982564130 NAME: WAL-MART STORES INC

TNRCC ID #: 29083 ADDRESS: 702 SW 8TH ST

NAME: WAL-MART STORES TEXAS 1253 BENTONVILLE, AR 72712

ADDRESS: 5015 S IH 35 PHONE: 1-512-4437877

**AUSTIN, TX 73301** 

CONTACT: ADOLPH STEPHENS

PHONE: 512-4437877

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/10/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 56539

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 56540

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



**MAP ID# 4** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 640 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 58390

NAME: WAL-MART STORE 1253

ADDRESS: 5015 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS REGION: 11

TYPE: RETAIL

BEGIN DATE: 05/28/1991

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/24/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/24/1991

SIGNATURE NAME & TITLE: ZEB LAVZON, BUYER ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: (479) 2042231 0 FAX: (479) 2775844

EMAIL: TERESA.PRUITT@WAL-MART.COM

**OPERATOR** 

OPERATOR NUMBER: CN603246240 NAME: WAL-MART STORES TEXAS LLC CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

### CONTACT INFORMATION

NAME: SHEILA DEARING

TITLE: LIC MGR

ORGANIZATION: WAL-MART STORE 1253

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (479) 2042188 0

GeoSearch www.geo-search.com 888-396-0042

98 of 937

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: **(479) 2042231 0** FAX: **(479) 2775844** 

EMAIL: TERESA.PRUITT@WAL-MART.COM

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/01/1988 REGISTRATION DATE: 05/24/1991

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/01/1993** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117435

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 99 of 937

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 09/29/2004

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **IN USE** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 117436

TANK ID: 1

COMPARTMENT LETTER: A

SUBSTANCES: **OIL WATER SEPARATOR** OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 4** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 640 ft. (Higher than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXD982564130 OWNER TYPE: NOT REPORTED

NAME: WAL-MART STORES INC OWNER NAME: WAL-MART STORES INC

ADDRESS: 5015 S IH 35 OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78744 OPERATOR NAME: NOT REPORTED

CONTACT NAME: ADOLPH STEPHENS
CONTACT ADDRESS: 702 SW 8TH ST

**BENTONVILLE AK 72712** 

CONTACT PHONE: 512-443-7877

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 07/27/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

- HAZARDOUS WASTE

- NO HAZARDOUS WASTE INFORMATION REPORTED -

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 101 of 937

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 03256

UST ID #: 03256

NAME: SAM'S CLUB #8259
ADDRESS: 5107 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110035046303 REGISTRY ID: 110035046303 NAME: SAMS CLUB 8259 ADDRESS: 5107 S IH 35 **AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

# FACILITY INFORMATION REGISTRY ID: 110008168972

NAME: SAMS CLUB NO 8259

LOCATION ADDRESS: 5107 I-35 SOUTH

**AUSTIN, TX 78744** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: SAMS CLUB NO 8259

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - RESOURCE CONSERVATION AND RECOVERY ACT INFORMATION SYSTEM

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110035046303

NAME: SAMS CLUB 8259

LOCATION ADDRESS: 5107 S IH 35

**AUSTIN, TX 78744-2736** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: SAMS CLUB 8259 SAMS CLUB NO 8259

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY
TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

# FACILITY INFORMATION REGISTRY ID: 110046259053

NAME: SAMS CLUB NO 8259

LOCATION ADDRESS: 5107 I-35 SOUTH

**AUSTIN, TX 78744** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: SAMS CLUB NO 8259

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - RESOURCE CONSERVATION AND RECOVERY ACT INFORMATION SYSTEM

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

# **Groundwater Contamination Cases (GWCC)**

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

# FACILITY INFORMATION

FILE NUMBER: 1253086093

FILE NAME: WALMART STORES INC LOCATION: 5107 S IH 35, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION/PETROLEUM STORAGE TANK REIMBURSEMENT PROGRAM

DATE OF CONTAMINATION

CONFIRMATION BY AGENCY: 01/13/12 CONTAMINANT(S): GASOLINE

ENFORCEMENT STATUS: STAFF ACTION: THE AGENCY INITIATES AN ACTION TO ADDRESS A CONTAMINATION INCIDENT.

ACTIVITY STATUS: ACTION COMPLETED: THE REMEDY IS CONSIDERED COMPLETE.

NEW CASE?: NO

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 118721

LPST ID: 118721

FACILITY ID: 74524

NAME: SAMS CLUB 8259

ADDRESS: 5107 S IH 35

**AUSTIN, TX 78744** 

#### **LEAKING TANK DETAILS**

LPST ID: 118721

NAME: SAMS CLUB 8259

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/13/12

REPORTED DATE: 12/09/2011
ENTERED DATE: 01/13/2012
CLOSURE DATE: 01/13/2012

PRP INFORMATION
NAME: SAMS CLUB

ADDRESS: ADDRESS NOT REPORTED

**BENTONVILLE AR 72716** 

CONTACT: **NOT REPORTED** PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 166030

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/07/2011** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 166031

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY



OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 166032

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: **74524** 

NAME: SAMS CLUB 8259 ADDRESS: 5107 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS REGION: 11 TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/07/2001 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/31/2001

SIGNATURE NAME & TITLE: DAN GROSS, EPA MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600761597

NAME: SAMS EAST INC

CONTACT ADDRESS: 8725 ROSEHILL RD STE 450

**LENEXA KS 66215** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/11/2001

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: SAMS EAST INC

PHONE: (877) 8295505 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600761597

NAME: SAMS EAST INC

CONTACT ADDRESS: 8725 ROSEHILL RD STE 450

**LENEXA KS 66215** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/11/2001

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: SAMS CLUB 8259

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4440363 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: SAMS EAST INC

PHONE: (877) 8295505 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 201635 SIGNATURE DATE: 08/02/2011

SIGNATURE NAME & TITLE: TONYA REESE, LIC SUPPORT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201634
SIGNATURE DATE: 08/03/2010

SIGNATURE NAME & TITLE: TONYA REESE, LIC SUPPORT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201633
SIGNATURE DATE: 09/17/2009

SIGNATURE NAME & TITLE: LYNETTE CLEMENT, LICENSE COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201632
SIGNATURE DATE: 07/29/2008

SIGNATURE NAME & TITLE: VICKY SINCLAIR, LIC COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201631
SIGNATURE DATE: 09/20/2007

SIGNATURE NAME & TITLE: VICKY SINCLAIR, LIC COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201630
SIGNATURE DATE: 08/29/2006

SIGNATURE NAME & TITLE: SHEILA DEARING, LICENSE ANALYST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201629
SIGNATURE DATE: 08/10/2005

SIGNATURE NAME & TITLE: SHEILA DEARING, LIC AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201628
SIGNATURE DATE: 07/29/2004

SIGNATURE NAME & TITLE: JANET LYNN, DIR OF LICENSING

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201627
SIGNATURE DATE: 08/12/2003



Order# 141197 Job# 336212 113 of 937

SIGNATURE NAME & TITLE: DANIEL GROSS, EPA MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201626
SIGNATURE DATE: 08/06/2002

SIGNATURE NAME & TITLE: DANIEL GROSS, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 201625
SIGNATURE DATE: 08/31/2001

SIGNATURE NAME & TITLE: DAN GROSS, EPA MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 17852
APPLICATION RECEIVED DATE: 09/30/2011
SCHEDULE CONSTRUCTION DATE: 10/31/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

PERMANENTLY REMOVE (3) 20K GALLON UST'S INSTALLED IN 2001 AND REGISTERED WITH TC EQ UNDER 74524

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/07/2011** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 166030

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY

WALL/JACKET



Order# 141197 Job# 336212 114 of 937

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED\_

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO.

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/07/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 166031

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP



Order# 141197 Job# 336212 115 of 937

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO.

LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 07/27/2001 REGISTRATION DATE: 09/07/2001

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/07/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 166032

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 



Order# 141197 Job# 336212 116 of 937

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

GROUNDWATER MONITORING, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXR000007617 OWNER TYPE: PRIVATE

NAME: SAMS CLUB NO 8259

ADDRESS: 5107 I-35 SOUTH

OPERATOR TYPE: NOT REPORTED

OPERATOR NAME: NOT REPORTED

CONTACT NAME: JUSTIN WILSON CONTACT ADDRESS: P.O. BOX 8041

**BENTONVILLE AR 72716-8041** 

CONTACT PHONE: 512-444-0363

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 10/18/1996

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

JUSTIN WILSON SR MGR 05/17/2012

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 06/21/2012

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D008 LEAD

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

### Tier I I Chemical Reporting Program Facilities (TIERII)

**MAP ID# 5** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 628 ft. (Higher than TP)

#### SITE INFORMATION

UNIQUE ID: 259JHP00J40U

SITE ID: FATR2011259JHP00J40U

NAME: SAM'S CLUB #8259 - OLD

ADDRESS: 5107 I-35 SOUTH

AUSTIN, TX 78744

SIGNED DATE: 1/26/2012

VALIDATION REPORT: NOT REPORTED MAILING ADDRESS: P.O. BOX 8041

**BENTONVILLE, AR 72712-8041** 

#### SITE DETAILS

SITE TYPE: MISCELLANEOUS GENERAL STORES
SITE TYPE: WAREHOUSE CLUBS AND SUPERSTORES
SITE TYPE: MISCELLANEOUS GENERAL STORES
SITE TYPE: WAREHOUSE CLUBS AND SUPERSTORES
SITE TYPE: MISCELLANEOUS GENERAL STORES
SITE TYPE: WAREHOUSE CLUBS AND SUPERSTORES
SITE TYPE: WAREHOUSE CLUBS AND SUPERSTORES
SITE TYPE: WAREHOUSE CLUBS AND SUPERSTORES

CHEMICAL LOCATION: MAINTENANCE DEPT.

CHEMICAL AMOUNT: 27325 POUNDS

CHEMICAL LOCATION: MAINTENANCE DEPT.

CHEMICAL AMOUNT: 2540 POUNDS

CHEMICAL LOCATION: MAINTENANCE DEPT.

CHEMICAL AMOUNT: 2540 POUNDS

CHEMICAL LOCATION: MAINTENANCE DEPT.

CHEMICAL AMOUNT: 2540 POUNDS

CHEMICAL NAME: BATTERIES - LEAD-ACID BATTERIES

MAXIMUM AMOUNT: 27325 POUNDS

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: YES

PURE: **NOT REPORTED** MIXTURE: **YES** 

CHEMICAL NAME: BATTERY ELECTROLYTE 35% SULFURIC ACID SOLUTION

MAXIMUM AMOUNT: 2540 POUNDS

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES** 

CHEMICAL NAME: BATTERY ELECTROLYTE 35% SULFURIC ACID SOLUTION

MAXIMUM AMOUNT: 2540 POUNDS

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: BATTERY ELECTROLYTE 35% SULFURIC ACID SOLUTION

Order# 141197 Job# 336212 120 of 937

# Tier I I Chemical Reporting Program Facilities (TIERII)

MAXIMUM AMOUNT: 2540 POUNDS

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES** MIXTURE CHEMICAL: **SULFURIC ACID** 

MIXTURE CHEMICAL: LEAD

MIXTURE CHEMICAL: SULFURIC ACID SOLUTION

MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: SULFURIC ACID SOLUTION

MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: SULFURIC ACID SOLUTION

MIXTURE CHEMICAL: WATER

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

#### **FACILITY INFORMATION**

UNIQUE ID: 110008170996 REGISTRY ID: 110008170996 NAME: MAXWELL FORD ADDRESS: 5000 S IH 35 **AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

FACILITY INFORMATION
REGISTRY ID: 110008170996
NAME: MAXWELL FORD

LOCATION ADDRESS: 5000 S IH 35

**AUSTIN, TX 78745-2442** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: MAXWELL FORD

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

5012 - AUTOMOBILES AND OTHER MOTOR VEHICLES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

423110 - AUTOMOBILE AND OTHER MOTOR VEHICLE MERCHANT WHOLESALERS

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 85498 EPA ID: TXR000025916 NAME: MCMORRIS

TNRCC ID #: 107045 ADDRESS: NOT REPORTED

NAME: MAXWELL FORD

ADDRESS: 5000 S IH 35 PHONE: NOT REPORTED

**AUSTIN, TX 78745** 

CONTACT: **NOT REPORTED** PHONE: **512-4435000-2748** 

BUSINESS DESCRIPTION: AUTOMOBILE DEALER 12/20/2002 NOW QUALIFY AS CESQG JH

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/17/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 172048

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT WASTE & PAINT RELATED MATERIALS FROM CLEANING PAINT GUNS &

EQUIPMENT.

WASTE ID: 166998

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: PARTS WASHER SOLVENT FOR CLEANING OF AUTOMOBILE PARTS. INITIAL

GENERATION 1/98.
WASTE ID: 166999

WASTE CODE STATUS: INACTIVE



Order# 141197 Job# 336212 124 of 937

# Industrial and Hazardous Waste Sites (IHW)

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CARBURATOR CLEANER (IMMERSION CLEANER) FOR CLEANING OF AUTOMOBILE

PARTS.

WASTE ID: 167000

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: AQUEOUS PARTS WASHER FOR CLEANING OF AUTOMOBILE PARTS WITH AN

AQUEOUS SOLUTION.

WASTE ID: 167001

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AQUEOUS PARTS BRAKE CLEANER FOR CLEANING OF AUTOMOBILE BRAKE

PARTS.

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

#### **FACILITY INFORMATION**

ID#: 75074

NAME: MAXWELL FORD ADDRESS: 5000 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 08/31/1987

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

#### **APPLICATION INFORMATION:**

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/16/2002 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/13/2002

SIGNATURE NAME & TITLE: TRUETT BUDD, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

#### **OWNER**

OWNER NUMBER: CN600778039 NAME: ON-SITE FUELS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

#### **OPERATOR**

NO OPERATOR INFORMATION REPORTED

#### **SELF-CERTIFICATION**

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 18414 APPLICATION RECEIVED DATE: 08/26/2004 SCHEDULE CONSTRUCTION DATE: 09/13/2004

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

#### CONTACT INFORMATION

NAME: TOMMY PEREZ TITLE: NOT REPORTED

ORGANIZATION: MAXWELL FORD

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4435000 0



126 of 937

#### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 199727 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/16/2002

INSTALLATION DATE: 03/01/2002 STATUS BEGIN DATE: 03/01/2002

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: NO CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: YES

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

OWNER TYPE: PRIVATE

OWNER NAME: MCMORRISBILL

OPERATOR NAME: MCMORRISBILL

OPERATOR TYPE: PRIVATE

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXR000025916

NAME: MAXWELL FORD

ADDRESS: 5000 S IH 35

**AUSTIN, TX 78745** 

CONTACT NAME: SERVICE MANAGER
CONTACT ADDRESS: PO BOX 17728
AUSTIN TX 78760

CONTACT PHONE: 512-443-5000

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/27/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

#### 42111 - AUTOMOBILE AND OTHER MOTOR VEHICLE WHOLESALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM
D008 LEAD
D018 BENZENE

D027 1,4-DICHLOROBENZENE
D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE



Order# 141197 Job# 336212 128 of 937

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

### Tier I I Chemical Reporting Program Facilities (TIERII)

**MAP ID# 6** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 615 ft. (Lower than TP)

#### SITE INFORMATION

UNIQUE ID: 5MREQ800K8Z0

SITE ID: FATR20125MREQ800K8Z0

NAME: MAXWELL FORD
ADDRESS: 5000 SOUTH IH 35
AUSTIN, TX 78745

SIGNED DATE: 2/27/2013

VALIDATION REPORT: NOT REPORTED
MAILING ADDRESS: NOT REPORTED

#### **SITE DETAILS**

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: NEW CAR DEALER

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: NEW CAR DEALER

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: **NEW CAR DEALER** 

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: NEW CAR DEALER

SITE TYPE: MOTOR VEH. DEALERS (NEW/USED)

SITE TYPE: NEW CAR DEALER

CHEMICAL LOCATION:

IN PARKING LOT NEXT TO SERVICE DEPT.

CHEMICAL AMOUNT: 4000 POUNDS

CHEMICAL LOCATION:

IN PARKING LOT NEXT TO SERVICE DEPT.

CHEMICAL AMOUNT: 4000 POUNDS

CHEMICAL LOCATION:

IN PARKING LOT NEXT TO SERVICE DEPT.

CHEMICAL AMOUNT: 4000 POUNDS

CHEMICAL LOCATION:

IN PARKING LOT NEXT TO SERVICE DEPT.

CHEMICAL AMOUNT: 4000 POUNDS

CHEMICAL LOCATION:

IN PARKING LOT NEXT TO SERVICE DEPT.

CHEMICAL AMOUNT: 4000 POUNDS

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: GASOLINE



Order# 141197 Job# 336212 130 of 937

# Tier I I Chemical Reporting Program Facilities (TIERII)

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES** 

CHEMICAL NAME: GASOLINE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

**Back to Report Summary** 

131 of 937

**MAP ID# 7** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 663 ft. (Higher than TP)

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 6/8/00001
INCIDENT #: 6/8/00001
SPILL DATE: 06/08/00
SPILL LOCATION / COUNTY:

SOUTH BOUND FRONTAGE @ 135 AND WILLIAM CANNON, AUSTIN / TX

RESPONSIBLE PARTY: MARTIN BROWER CO.
MATERIAL SPILLED / AMOUNT: DIESEL / 70 GAL

AFFECTED WATERWAY: NONE
AMOUNT IN WATER: NOT REPORTED

BASIN: COLORADO

COMMENTS: **NOT REPORTED** 

**MAP ID# 8** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 595 ft. (Lower than TP)

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 12/30/02007
INCIDENT #: 12/30/02007
SPILL DATE: 12/30/02
SPILL LOCATION / COUNTY:

NORTH IH 35 @ ONION CREEK / TX

RESPONSIBLE PARTY: GAINEY TRANSPORTATION SERVICES MATERIAL SPILLED / AMOUNT: DIESEL FUEL / 70 GALLONS

AFFECTED WATERWAY: NOT REPORTED AMOUNT IN WATER: NOT REPORTED

BASIN: NOT REPORTED

COMMENTS:

ABSORBENT WAS PLACE ON THE FUEL ON THE ROAD. ABSORBENT WAS THEN REMOVED. CONTAMINATED ARE WAS COVERED DUE TO RAIN. SOIL WAS THEN REMOVED BY GRONES ENVIRONMENTAL. ERICK KAUFFMAN AND TOM BASHARA FROM THE CITY OF AUSTIN WATERSHED PROTECTION WERE ONSITE.

**MAP ID# 8** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 595 ft. (Lower than TP)

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 13986
INCIDENT #: 13986
SPILL DATE: 12/30/02
SPILL LOCATION / COUNTY:

NORTH IH 35 @ ONION CREEK / TX

RESPONSIBLE PARTY: NORTH IH 35 @ ONION CREEK

REGULATED ENTITY #: RN102985462

CUSTOMER: GAINEY TRANSPORTATION SERVICES INC
MATERIAL SPILLED / AMOUNT: DIESEL FUEL / 70 GALLONS

MEDIA: **WATER**NATURE: **QUALITY** 

WATER BODY: NOT REPORTED

AIR SOURCE: TRUCK

DISPUTED STATUS: PUBLIC AUTO

DISPUTED DATE: 01/09/03
INCIDENT STATUS: CLOSED

CLASS: 003 - OIL MINOR <24B/1,000G

COMMENTS:

ABSORBENT WAS PLACE ON THE FUEL ON THE ROAD. ABSORBENT WAS THEN REMOVED. CONTAMINATED ARE WAS COVERED DUE TO RAIN. SOIL WAS THEN REMOVED BY GRONES ENVIRONMENTAL. ERICK KAUFFMAN AND TOM BASHARA FROM THE CITY OF AUSTIN WATERSHED PROTECTION WERE ONSITE.

**MAP ID# 8** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 595 ft. (Lower than TP)

#### **INCIDENT INFORMATION**

GEOSEARCH ID: 8/10/99001
INCIDENT #: 8/10/99001
SPILL DATE: 08/10/99
SPILL LOCATION / COUNTY:

SOUTHBOUND FRONTAGE OF IH 35, SOUTH OF ONION CREEK, AUSTIN / TX

RESPONSIBLE PARTY: CENTEX MATERIALS

MATERIAL SPILLED / AMOUNT: DIESEL FUEL / 150 GAL

AFFECTED WATERWAY: NONE
AMOUNT IN WATER: NOT REPORTED

BASIN: COLORADO

COMMENTS: **NOT REPORTED** 

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 9** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 670 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: C0559

UST ID #: C0559

NAME: MICHAEL'S (FORMER WOOLCO)
ADDRESS: 801 E WILLIAM CANNON DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 9** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 670 ft. (Higher than TP)

# FACILITY INFORMATION

REGISTRY ID: 110034296679

NAME: CENTURY SOUTH SHOPPING CTR

LOCATION ADDRESS: 801 E WILLIAM CANNON DR

**AUSTIN, TX 78745-6646** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

CENTURY SOUTH SHOPPING CTR
PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

### State Institutional/Engineering Control Sites (SIEC01)

**MAP ID# 9** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 670 ft. (Higher than TP)

#### SITE INFORMATION

GEOSEARCH ID: 0611EC

NAME: CENTURY SOUTH SHOPPING CENTER

ADDRESS: 801 EAST WILLIAM CANNON DRIVE

**AUSTIN TX** 

ACRES: 19.758

FACILITY TYPE: DRY CLEANERS
APPLICATION DATE: 9/15/97
DATE OF AGREEMENT: 9/22/97

CERTIFICATE OF COMPLETION DATE: 1/14/1999

TYPE OF CERTIFICATE ISSUED: FINAL

TYPE LEAD: MANAGER PHASE: COMPLETED

CONTAMINANT/S: CHLORINATED SOLVENTS, METALS, TPH

MEDIA AFFECTED: SOILS/GROUNDWATER

REMEDY: LOW YIELD GW

CONTROL: NONRESIDENTIAL, NO GROUNDWATER USE TNRCC SOLID WASTE REGISTRATION #: NOT REPORTED

LPST #: NOT REPORTED

EPA CERCLIS #: NOT REPORTED
EPA RCRIS #: NOT REPORTED

PROGRAM: VOLUNTARY CLEANUP PROGRAM

ASSOC. VCP ID: NOT REPORTED
PROJECT NUMBER: NOT REPORTED
FORMER FACILITY TYPE: NOT REPORTED
SITE ADDRESS DESCRIPTION: NOT REPORTED

NEAR CITY NAME: NOT REPORTED

CASHIER RECEIVED DATE: NOT REPORTED

APPLICATION ACCEPTANCE DATE: NOT REPORTED

VCP APPLICATION ACCEPTED: NOT REPORTED

REGION NOTIFIED OF APPLICATION: NOT REPORTED

TCEQ REGION NAME: NOT REPORTED

SWR NUMBER: NOT REPORTED

AIR TARGET COC CLASS: NOT REPORTED

GROUNDWATER TARGET COC CLASS: NOT REPORTED SEDIMENT TARGET COC CLASS: NOT REPORTED SOILS TARGET COC CLASS: NOT REPORTED

SURFACE WATER TARGET COC CLASS: NOT REPORTED

ABOVE RES. CRITICAL PCL: NOT REPORTED

ABOVE RES. CRITICAL PCL OFFSITE: NOT REPORTED

IOP ID: NOT REPORTED
FILE MEDIA: NOT REPORTED

#### APPLICANT INFORMATION

ORGANIZATION: KEYSTONE-AUSTIN PROPERTY

HOLDING CORPORATION

KEVIN W. ARCHER (VICE PRESIDENT,

**PROPERTY MANAGEMENT)** 

3267 BEE CAVES ROAD, SUITE 118

**AUSTIN TX 78746-6654** 

PHONE: 512-328-2020

CONSOLTANTPATTORNEY INFORMATION

ORGANIZATION: FULBRIGHT & JAWORSKI, L.L.P.

JANET L. MCQUAID (ATTORNEY) 600 CONGRESS AVENUE, SUITE 2400

**AUSTIN TX 78701** 

PHONE: **512-322-2429** FAX: **NOT REPORTED** 

# State Institutional/Engineering Control Sites (SIEC01)

FILE LOCATION:

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEMDITATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

SEDIMENT REMEDIAL METHOD:

AIR INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED GROUNDWATER INSTITUTIONAL ENGINEERING CONTROL: NOT

**REPORTED** 

SEDIMENT INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED SOIL INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED SURFACE WATER INSTITUTIONAL ENGINEERING CONTROL: NOT

REPORTED

COC DATE: **NOT REPORTED**CCOC DATE: **NOT REPORTED** 

**MAP ID# 9** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 670 ft. (Higher than TP)

### **FACILITY INFORMATION**

PROGRAM ID#: 0611

NAME: CENTURY SOUTH SHOPPING CENTER

ADDRESS: 801 E WILLIAM CANNON DR

**AUSTIN TX 78745** 

ADDRESS DESCRIPTION: 801 EAST WILLIAM CANNON DRIVE

ASSOCIATED VCP ID(s): 611

PCA NUMBER: 31521

PROJECT NUMBER: 315210

LEGAL ID: 1000522

REGULATED ENTITY REFERENCE NUMBER (RN): RN102743697 CURRENT FACILITY TYPE: RETAIL STORE/SHOPPING CENTER

FORMER FACILITY TYPE: NOT REPORTED

PROJECT MANAGER: RSCHARLA

PROJECT PHASE: COMPLETED

ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 09/15/1997

APPLICATION RECEIVED DATE: 09/15/1997

APPLICATION ACCEPTANCE DATE: 10/15/1997

VCP APPLICATION ACCEPTED: YES

AGREEMENT ACCEPTANCE DATE: NOT REPORTED
REGION NOTIFIED OF APPLICATION: 09/15/1997
TCEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: TPH; METALS; CHLORINATED SOLVENTS

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: TPH; CHLORINATED SOLVENTS; METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

 ${\tt ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE:} \ \ \textbf{NOT REPORTED}$ 

LPST NO: **NOT REPORTED**IOP ID: **NOT REPORTED** 

EPA CERCLIS #: NOT REPORTED
EPA RCRIS #: NOT REPORTED

FILE MEDIA: MICROFILM
FILE LOCATION: CR
SITE SIZE: 19.758

Order# 141197 Job# 336212 140 of 937

TYPE OF REMEDY: NOT REPORTED

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 01/14/1999

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: RRR

APPLICABLE STANDARDS: 3

APPLICABLE TRRP TIER: NOT REPORTED

AFFILIATED CUSTOMER(S)

CN NUMBER: **CN603010695** RN NUMBER: **RN102743697** 

CUSTOMER NAME: KEYSTONE AUSTIN PROPERTY HOLDING CORP

ROLE CD: BILLCONT

CONTACT NAME: ARCHER, KEVIN CONTACT TITLE: NOT REPORTED

ORGANIZATION NAME: KEYSTONE AUSTIN PROPERTY HOLDING CORP

MAILING ADDRESS: 3267 BEE CAVES RD

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78746** 

CONTACT PHONE: (512) 328-2020

-----

CN NUMBER: **CN600411128** RN NUMBER: **RN102743697** 

CUSTOMER NAME: KEYSTONE-AUSTIN PROPERTY HOLDING CORP

ROLE CD: BILLCONT

CONTACT NAME: ARCHER, KEVIN CONTACT TITLE: NOT REPORTED

ORGANIZATION NAME: KEYSTONE AUSTIN PROPERTY HOLDING CORP

MAILING ADDRESS: 3267 BEE CAVES RD

MAILING CITY NAME: AUSTIN

MAILING STATE: TX
MAILING ZIPCODE: 78746

CONTACT PHONE: (512) 328-2020

Order# 141197 Job# 336212 141 of 937

### EPA Docket Data (DOCKETS)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

#### **SITE INFORMATION**

This is an Administrative Action

CIVIL COURT CASE: 06-1984-0050 CASE NAME: GAVLON INDUSTRIES

FILE DATE: 04/27/1984 CONCLUSION DATE: NOT REPORTED

FIRST DEFENDANT: **GAVLON INDUSTRIES** SECOND DEFENDANT: **NOT REPORTED** 

DEFENDENTS FOR THIS CASE: 1 FACILITIES INVOLVED: 1

LAWS: RCRA 3008

VIOLATIONS: NOT REPORTED POLLUTANTS: NOT REPORTED

FIRST INVOLVED FACILITY NAME: GAVLON INDUSTRIES

ADDRESS: AUSTIN CITY: 9808 S IH 35

COUNTY: NOT REPORTED

STATE: TX ZIP: 78745

PENALTY (\$): 6000 SUPERFUND COST AWARDED (\$): NONE JUDICIAL DISTRICT: NOT REPORTED DOCKET NUMBER: VI-416-H

RESULT: UNKNOWN

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110005162206 REGISTRY ID: 110005162206 NAME: GAVLON INDUSTRIES ADDRESS: 9808 SOUTH IH 35 **AUSTIN, TX 78748** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) W Elevation: 619 ft. (Lower than TP)

### **FACILITY INFORMATION** UNIQUE ID: 110008137471

REGISTRY ID: 110008137471

NAME: ASHLAND CHEMICAL COMPANY

ADDRESS: 9806 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

# FACILITY INFORMATION REGISTRY ID: 110005162206

NAME: GAVLON INDUSTRIES

LOCATION ADDRESS: 9808 SOUTH IH 35

**AUSTIN, TX 78748** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S:
GAVLON INDUSTRIES

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

**ICIS - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY** 

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

2851 - PAINTS, VARNISHES, LACQUERS, ENAMELS, AND ALLIED PRODUCTS

9999 - NONCLASSIFIABLE ESTABLISHMENTS

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) W Elevation: 619 ft. (Lower than TP)

# FACILITY INFORMATION

REGISTRY ID: 110008137471

NAME: ASHLAND CHEMICAL COMPANY
LOCATION ADDRESS: 9806 S IH 35
AUSTIN, TX 78745

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S:
ASHLAND CHEMICAL CO

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

147 of 937

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

FACILITY INFORMATION
REGISTRY ID: 110033783154

NAME: JANSSEN TRACT

LOCATION ADDRESS: 9808 S I H 35

**AUSTIN, TX 78748-2503** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: JANSSEN TRACT

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Historic Groundwater Contamination Cases (HISTGWCC)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

#### **FACILITY INFORMATION**

FILE NUMBER: 30498

FILE NAME: GAVLON INDUSTRIES INC

LOCATION: 9808 S INTERREGIONAL HWY 35, AUSTIN 78745

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION

CONTAMINANT: PAINT SOLVENTS, BENZENE ENFORCEMENT STATUS: NOT REPORTED ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2000

DATA QUALITY CODE: NOT REPORTED

### Integrated Compliance Information System (formerly DOCKETS) (ICIS)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

#### SITE INFORMATION

GEOSEARCH ID: 110005162206
REGISTRY ID: 110005162206
NAME: GAVLON INDUSTRIES
ADDRESS: 9808 SOUTH IH 35
AUSTIN TX 78745

STANDARD INDUSTRIAL CLASSIFICATION: PAINTS, VARNISHES, LACQUERS, ENAMELS, AND ALLIED PRODUCTS

**REGIONAL DOCKETS** 

VI-416-H

**RELATED ACTIVITIES** 

- NO RELATED ACTIVITIES REPORTED

**VIOLATIONS** 

- NO VIOLATIONS REPORTED

CASE IDENTIFIER

CASE NUMBER: 06-1984-0050

FISCAL YEAR: 1984

CASE NAME: GAVLON INDUSTRIES

ACTIVITY TYPE: ADMINISTRATIVE - FORMAL

ACTIVITY STATUS: CLOSED

ACTIVITY STATUS DATE: 8/22/1984

LEAD: EPA

CASE STATUS DATE: 8/22/1984

DOJ DOCKET NUMBER: NOT REPORTED ENFORCEMENT OUTCOME: UNKNOWN

MULTIMEDIA FLAG: **N** ENFORCEMENT SUMMARY:

THEY HAVE AN UNDERGROUND TANK THAT THEY USED TO STORE HW. THEY DO NOT INSPECT THIS UNDERGROUND TANK AND HAVE SENT 2 SHIPMENTS OF HW FROM THIS TANK TO AN UNPERMITED DISPOSAL FACILITY. THEREFORE, THEY DO NOT QUALIFY FOR 90 DAY STORAGE EXEMPTION AND ARE A TSD.

ACTION REQUESTED: \* C.O. FOR FAILURE TO FILE

FEDERAL PART A AND NOTIFY AS A TSD.

**ENFORCEMENT TYPE** 

ENFORCEMENT TYPE: RCRA 3008A AO FOR COMP AND/OR PENALTY

**POLLUTANTS CITED** 

POLLUTANT DESCRIPTION: NONE

**Back to Report Summary** 

OWNER INFORMATION

ADDRESS: PO BOX 17307

PHONE: 1-512-2821115

NAME: GAVLON INDUSTRIES INC

**AUSTIN, TX 78760** 

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

REGISTRATION#: 30498 EPA ID: TXD990707556

TNRCC ID #: 8063

NAME: GAVLON INDUSTRIES

ADDRESS: 9808 S IH 35

**AUSTIN, TX 78748** 

CONTACT: CHERI MCKNIGHT

PHONE: 512-2821115

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: LARGE QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/08/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 261171

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261377

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261378

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GeoSearch www.geo-search.com 888-396-0042

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261379

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 261380

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 9879

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 9880

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**WASTE ID: 9881** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 9882

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) W Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

REGISTRATION#: 66040 EPA ID: TXD000719021

TNRCC ID #: 21343

NAME: ASHLAND CHEMICAL AUSTIN

ADDRESS: 9806 S IH 35

**AUSTIN, TX 78748** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: NO WASTE RECEIVER: YES WASTE TRANSPORTER: YES TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/03/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE NO RECORDS** 

**Back to Report Summary** 

OWNER INFORMATION

NAME: ASHLAND CHEMICAL COMPANY

ADDRESS: 9806 S IH 35

**AUSTIN, TX 78747** 

PHONE: NOT REPORTED

Order# 141197 Job# 336212 153 of 937

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

PROGRAM ID: 30498
RN NUMBER: RN100728054
NAME: GAVLON INDUSTRIES
ADDRESS: 9808 S IH 35

**AUSTIN, TX 78748** 

STATUS: **INACTIVE**STATUS DATE: **10/3/00** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: 9808 S IH 35, AUSTIN, TX

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) W Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD000719021 OWNER TYPE: PRIVATE

NAME: ASHLAND CHEMICAL COMPANY OWNER NAME: ASHLAND CHEMICAL COMPANY

ADDRESS: 9806 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: ASHLAND CHEMICAL COMPANY

CONTACT NAME: ENVIRONMENTAL MANAGER

CONTACT ADDRESS: 9806 S IH 35

**AUSTIN TX 78747** 

CONTACT PHONE: **NOT REPORTED**NON-NOTIFIER: **NOT A NON-NOTIFIER**DATE RECEIVED BY AGENCY: **02/14/2001** 

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

ENVIRONMENTAL MANAGER UNKNOWN 02/14/2001

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/30/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D000

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE
D003 REACTIVE WASTE



Order# 141197 Job# 336212 155 of 937

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE F002 CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE: ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001.F004. AND F005: AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES. THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL F003 BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES. F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES. P022 **CARBON DISULFIDE** P029 **COPPER CYANIDE** P029 **COPPER CYANIDE CU(CN)** P053 P090 U001 **ACETALDEHYDE (I)** U001 ETHANAL (I) U002 2-PROPANONE (I) U002 **ACETONE (I)** U004 **ACETOPHENONE** U004 ETHANONE, 1-PHENYL-U012 ANILINE (I,T) U012 **BENZENAMINE (I,T)** U019 **BENZENE (I,T)** U028 1,2-BENZENEDICARBOXYLIC ACID, BIS(2-ETHYLHEXYL) ESTER U028 **DIETHYLHEXYL PHTHALATE** U031 1-BUTANOL (I) U031 **N-BUTYL ALCOHOL (I)** U037 **BENZENE, CHLORO-**U037 **CHLOROBENZENE** U044 **CHLOROFORM** U044 METHANE, TRICHLORO-U054 U055 BENZENE, (1-METHYLETHYL)- (I) U055 **CUMENE (I)** U056 **BENZENE, HEXAHYDRO- (I)** U056 **CYCLOHEXANE (I)** U057 **CYCLOHEXANONE (I)** U069 1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER U069 **DIBUTYL PHTHALATE** U070 **BENZENE, 1,2-DICHLORO-**



U070	O-DICHLOROBENZENE
U071	BENZENE, 1,3-DICHLORO-
U071	M-DICHLOROBENZENE
U072	BENZENE, 1,4-DICHLORO-
U072	P-DICHLOROBENZENE
U088	1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER
U088	DIETHYL PHTHALATE
U092	DIMETHYLAMINE (I)
U092	METHANAMINE, N-METHYL- (I)
U102	1,2-BENZENEDICARBOXYLIC ACID, DIMETHYL ESTER
U102	DIMETHYL PHTHALATE
U103	DIMETHYL SULFATE
U103	SULFURIC ACID, DIMETHYL ESTER
U107	1,2-BENZENEDICARBOXYLIC ACID, DIOCTYL ESTER
U107	DI-N-OCTYL PHTHALATE
U108	1,4-DIETHYLENEOXIDE
U108	1,4-DIOXANE
U110	1-PROPANIMINE, N-PROPYL-(I)
U110	DIPROPYLAMINE (I)
U112	ACETIC ACID, ETHYL ESTER (I)
U112	ETHYL ACETATE (I)
U117	ETHANE, 1,1'-OXYBIS-(I)
U117	ETHYL ETHER (I)
U122	FORMALDEHYDE
U123	FORMIC ACID (C,T)
U125	2-FURANCARBOXALDEHYDE (I)
U125	FURFURAL (I)
U134	HYDROFLUORIC ACID (C,T)
U134	HYDROGEN FLUORIDE (C,T)
U140	1-PROPANOL, 2-METHYL- (I,T)
U140	ISOBUTYL ALCOHOL (I,T)
U147	2,5-FURANDIONE
U147	MALEIC ANHYDRIDE
U154	METHANOL (I)
U154	METHYL ALCOHOL (I)
U159	2-BUTANONE (I,T)
U159	METHYL ETHYL KETONE (MEK) (I,T)
U160	2-BUTANONE, PEROXIDE (R,T)
U160	METHYL ETHYL KETONE PEROXIDE (R,T)
U165	NAPHTHALENE
U171	2-NITROPROPANE (I,T)
U171	PROPANE, 2-NITRO- (I,T)
U189	PHOSPHORUS SULFIDE (R)
U189	SULFUR PHOSPHIDE (R)

1,3-ISOBENZOFURANDIONE

U190

U190	PHTHALIC ANHYDRIDE
U194	1-PROPANAMINE (I,T)
U194	N-PROPYLAMINE (I,T)
U210	ETHENE, TETRACHLORO-
U211	CARBON TETRACHLORIDE
U211	METHANE, TETRACHLORO-
U213	FURAN, TETRAHYDRO-(I)
U213	TETRAHYDROFURAN (I)
U219	THIOUREA
U220	BENZENE, METHYL-
U220	TOLUENE
U223	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T)
U223	TOLUENE DIISOCYANATE (R,T)
U226	ETHANE, 1,1,1-TRICHLORO-
U226	METHYL CHLOROFORM
U228	ETHENE, TRICHLORO-
U228	TRICHLOROETHYLENE
U239	BENZENE, DIMETHYL- (I,T)
U239	XYLENE (I)
<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -	
CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -	
CORRECTIVE ACTION EVENT	

Back to Report Summary

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXD990707556 OWNER TYPE: PRIVATE

NAME: GAVLON INDUSTRIES INC OWNER NAME: GAVLON INDUSTRIES INC

ADDRESS: 9808 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78748 OPERATOR NAME: GAVLON INDUSTRIES INC

CONTACT NAME: CHERI MCKNIGHT
CONTACT ADDRESS: PO BOX 17307
AUSTIN TX 78760

CONTACT PHONE: **512-282-1115** 

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/23/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

32551 - PAINT AND COATING MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 02/17/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

03/05/1993 NRR NON-FINANCIAL RECORD REVIEW
01/26/1993 FCI FOCUSED COMPLIANCE INSPECTION
01/14/1993 CDI CASE DEVELOPMENT INSPECTION

07/02/1982 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE 06/24/1982 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

**VIOLATIONS** 

03/05/1993 264.A TSD - GENERAL

03/05/1993 XXS STATE STATUTE OR REGULATION

07/02/1982 262.A GENERATORS - GENERAL 06/24/1982 262.A GENERATORS - GENERAL

**ENFORCEMENTS** 



05/20/1993 120 WRITTEN INFORMAL 04/08/1993 141 NOT REPORTED

08/22/1984 310 FINAL 3008(A) COMPLIANCE ORDER 04/27/1984 210 INITIAL 3008(A) COMPLIANCE

HAZARDOUS WASTE

K078

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

### State Institutional/Engineering Control Sites (SIEC01)

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

#### SITE INFORMATION

GEOSEARCH ID: 1707EC

NAME: JANSSEN TRACT

ADDRESS: 9808 SOUTH IH-35

AUSTIN TX

ACRES: 5.58

FACILITY TYPE: USED CAR DEALERSHIP

APPLICATION DATE: 6/10/04

DATE OF AGREEMENT: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 2/23/2005

TYPE OF CERTIFICATE ISSUED: FINAL

TYPE LEAD: **OWNER** PHASE: **COMPLETED** 

CONTAMINANT/S: VOCS, METALS

MEDIA AFFECTED: SOILS/GROUNDWATER

REMEDY: NOT REPORTED

CONTROL: NO GROUNDWATER USE

TNRCC SOLID WASTE REGISTRATION #: 30498

LPST #: NOT REPORTED

EPA CERCLIS #: TXD990707556

EPA RCRIS #: NOT REPORTED

PROGRAM: VOLUNTARY CLEANUP PROGRAM

ASSOC. VCP ID: NOT REPORTED
PROJECT NUMBER: NOT REPORTED
FORMER FACILITY TYPE: NOT REPORTED
SITE ADDRESS DESCRIPTION: NOT REPORTED

NEAR CITY NAME: NOT REPORTED

CASHIER RECEIVED DATE: NOT REPORTED

APPLICATION ACCEPTANCE DATE: NOT REPORTED

VCP APPLICATION ACCEPTED: NOT REPORTED

REGION NOTIFIED OF APPLICATION: NOT REPORTED

TCEQ REGION NAME: NOT REPORTED

SWR NUMBER: NOT REPORTED

AIR TARGET COC CLASS: NOT REPORTED

GROUNDWATER TARGET COC CLASS: NOT REPORTED SEDIMENT TARGET COC CLASS: NOT REPORTED SOILS TARGET COC CLASS: NOT REPORTED

SURFACE WATER TARGET COC CLASS: NOT REPORTED

ABOVE RES. CRITICAL PCL: NOT REPORTED

ABOVE RES. CRITICAL PCL OFFSITE: NOT REPORTED

IOP ID: **NOT REPORTED**FILE MEDIA: **NOT REPORTED** 

FILE LOCATION:

#### **APPLICANT INFORMATION**

ORGANIZATION: ELDON AND DAWN JANSSEN

ELDON JANSSEN (OWNER) 10115 BRADSHAW ROAD

**AUSTIN TX 78747** 

PHONE: **512-282-5850** FAX: **512-282-2278** 

#### **CONSULTANT/ATTORNEY INFORMATION**

ORGANIZATION: TMS ENVIRONMENTAL
HARVEY GRAY (CONSULTANT)
3003 DAWN DRIVE, SUITE 102
GEORGETOWN TX 78628

PHONE: **512-930-0557**FAX: **NOT REPORTED** 

## State Institutional/Engineering Control Sites (SIEC01)

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEMDITATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

SEDIMENT REMEDIAL METHOD:

AIR INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED GROUNDWATER INSTITUTIONAL ENGINEERING CONTROL: NOT

**REPORTED** 

SEDIMENT INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED SOIL INSTITUTIONAL ENGINEERING CONTROL: NOT REPORTED SURFACE WATER INSTITUTIONAL ENGINEERING CONTROL: NOT

REPORTED

COC DATE: NOT REPORTED
CCOC DATE: NOT REPORTED

**MAP ID# 10** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 619 ft. (Lower than TP)

### **FACILITY INFORMATION**

PROGRAM ID#: 1707

NAME: JANSSEN TRACT ADDRESS: 9808 S I H 35

**AUSTIN TX 78748** 

ADDRESS DESCRIPTION: NOT REPORTED

ASSOCIATED VCP ID(s): 1707

PCA NUMBER: 33907

PROJECT NUMBER: 339070

LEGAL ID: 10657043

REGULATED ENTITY REFERENCE NUMBER (RN): RN104316088

CURRENT FACILITY TYPE: AUTO DEALERSHIP; MFG

FORMER FACILITY TYPE: NOT REPORTED

PROJECT MANAGER: DSCHLEMA
PROJECT PHASE: COMPLETED
ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 06/10/2004

APPLICATION RECEIVED DATE: 06/10/2004

APPLICATION ACCEPTANCE DATE: 06/22/2004

VCP APPLICATION ACCEPTED: NOT REPORTED

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 06/10/2004
TCEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: 30498

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED
GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: METALS
SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE: NOT REPORTED

LPST NO: **NOT REPORTED**IOP ID: **NOT REPORTED** 

EPA CERCLIS #: TXD990707556
EPA RCRIS #: NOT REPORTED

FILE MEDIA: PAPER

FILE LOCATION: 200-44/D; D/211

SITE SIZE: 5.58

Order# 141197 Job# 336212 163 of 937

TYPE OF REMEDY: NOT REPORTED

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 02/23/2005

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: RRR

APPLICABLE STANDARDS: 3

APPLICABLE TRRP TIER: NOT REPORTED

#### **AFFILIATED CUSTOMER(S)**

CN NUMBER: **CN602737314** RN NUMBER: **RN104316088** 

CUSTOMER NAME: DAWN, JANSSEN

ROLE CD: BILLCONT

CONTACT NAME: **JANSSEN, ELDON**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION NAME: ELDON AND DAWN JANSSEN

MAILING ADDRESS: 10115 BRADSHAW RD

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78747** 

CONTACT PHONE: (512) 282-5850

-----

CN NUMBER: **CN602737306** RN NUMBER: **RN104316088** 

CUSTOMER NAME: ELDON, ELDON

ROLE CD: BILLCONT

CONTACT NAME: JANSSEN, ELDON CONTACT TITLE: NOT REPORTED

ORGANIZATION NAME: ELDON AND DAWN JANSSEN

MAILING ADDRESS: 10115 BRADSHAW RD

MAILING CITY NAME: AUSTIN

MAILING STATE: TX
MAILING ZIPCODE: 78747

CONTACT PHONE: (512) 282-5850

Order# 141197 Job# 336212 164 of 937

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 11** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 677 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110008169427 REGISTRY ID: 110008169427

NAME: GILLMAN IMPORTS OF AUSTIN INC

ADDRESS: 6809 S IH 35 **AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 11** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 677 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110008169427

NAME: GILLMAN IMPORTS OF AUSTIN INC

LOCATION ADDRESS: 6809 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

GILLMAN MITSUBISHI OF AUSTIN

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

**MAP ID# 11** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 677 ft. (Higher than TP)

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 84789 EPA ID: TXR000010496 NAME: GILLMAN

TNRCC ID #: 104645 ADDRESS: NOT REPORTED

NAME: GILLMAN MITSUBISHI

ADDRESS: 6809 S IH 35 PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: JEFFREY D OCHOA

PHONE: **512-4446044** 

BUSINESS DESCRIPTION: MITSUBISHI AUTOMOBILE NEW CAR DEALERSHIP - SERVICE, REPAIR OF AUTOMOBILES.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: CLOSED

AMOUNT OF WASTE GENERATED: NOT A HW GENERATOR GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/21/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: **155066** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED WASTE OIL - DRAINED OR REMOVED FOR THE PURPOSE OF ADDING NEW

OIL TO ENGINE,

**Back to Report Summary** 

Order# 141197 Job# 336212 168 of 937

**MAP ID# 11** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 677 ft. (Higher than TP)

#### **FACILITY INFORMATION**

EPA ID#: TXR000010496 OWNER TYPE: PRIVATE

NAME: GILLMAN IMPORTS OF AUSTIN INC OWNER NAME: GILLMANRAMSEY

ADDRESS: **6809 S IH 35** OPERATOR TYPE: **PRIVATE** 

AUSTIN, TX 78744 OPERATOR NAME: GILLMANRAMSEY
CONTACT NAME: JEFFREY D OCHOA
CONTACT ADDRESS: 6809 S IH 35

AUSTIN TX 78744

CONTACT PHONE: 512-444-6044

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/31/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

JEFFREY D OCHOA UNKNOWN 08/31/2005

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 09/29/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

UNKN

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

<u>CORRECTIVE ACTION AREA</u> - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

GeoSearch www.geo-search.com 888-396-0042

### Tier I I Chemical Reporting Program Facilities (TIERII)

**MAP ID# 12** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 676 ft. (Higher than TP)

#### SITE INFORMATION

UNIQUE ID: 7Q9CWK03SAMR

SITE ID: FATR20127Q9CWK03SAMR

NAME: HEB GROCERY COMPANY, LP - AUSTIN 02

ADDRESS: 6607 SOUTH IH 35
AUSTIN, TX 78744

SIGNED DATE: 2/25/2013

VALIDATION REPORT: NOT REPORTED

MAILING ADDRESS: 5105 RITTIMAN ROAD

SAN ANTONIO, TX 78218

#### SITE DETAILS

SITE TYPE: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVEN

SITE TYPE: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES SITE TYPE: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES

CHEMICAL LOCATION:

STORED IN LEAD ACID BATTERIES IN WAREROOM

CHEMICAL AMOUNT: 600 POUNDS

CHEMICAL LOCATION:

STORED IN LEAD ACID BATTERIES IN WAREROOM

CHEMICAL AMOUNT: 600 POUNDS

CHEMICAL LOCATION:

STORED IN LEAD ACID BATTERIES IN WAREROOM

CHEMICAL AMOUNT: 1300 POUNDS

CHEMICAL NAME: SULFURIC ACID (AQUEOUS)

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES CHEMICAL NAME: SULFURIC ACID (AQUEOUS)

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES CHEMICAL NAME: SULFURIC ACID (AQUEOUS)

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

### Tier I I Chemical Reporting Program Facilities (TIERII)

**MAP ID# 12** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 676 ft. (Higher than TP)

#### **SITE INFORMATION**

UNIQUE ID: 7QDZCB00S5X5

SITE ID: FATR20107QDZCB00S5X5

NAME: HEB GROCERY COMPANY, LP - AUSTIN 02

ADDRESS: 6607 SOUTH IH 35
AUSTIN, TX 78744

SIGNED DATE: 2/28/2011

VALIDATION REPORT: NOT REPORTED

MAILING ADDRESS: 5105 RITTIMAN ROAD

SAN ANTONIO, TX 78218

#### **SITE DETAILS**

SITE TYPE: SUPERMARKETS AND OTHER GROCERY (EXCEPT CONVENIENCE) STORES

CHEMICAL LOCATION:

STORED IN LEAD ACID BATTERIES IN WAREROOM

CHEMICAL AMOUNT: 600 POUNDS

CHEMICAL NAME: SULFURIC ACID (AQUEOUS)

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

### Emergency Response Notification System (ERNSTX)

**MAP ID# 13** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 639 ft. (Higher than TP)

GSID#: 338220

NRC REPORT #: 338220

INCIDENT LOCATION: NOT REPORTED
INCIDENT ADDRESS: OAK HILL COMMUNITY

**AUSTIN, TX** 

INCIDENT COUNTY: TRAVIS

#### **INCIDENT INFORMATION**

NRC REPORT #: 338220

DESCRIPTION OF INCIDENT: BOTTLE OF AMMONIUM SULFIDE / DUMPING

TYPE OF INCIDENT: FIXED

CAUSE: **DUMPING** 

DATE/TIME: 4/25/1996 4:00:00 PM

DISCOVERED/OCCURED/PLANNED: DISCOVERED

POTENTIAL FLAG: NOT REPORTED

#### REPORT RECEIPT AND SUSPECTED RESPONSIBLE PARTY INFORMATION

NRC REPORT #: 338220

DATE/TIME RECEIVED: 4/25/1996
DATE/TIME COMPLETE: 4/25/1996

CALL TYPE: **INCIDENT**SOURCE: **UNAVAILABLE** 

RESPONSIBLE COMPANY: NOT REPORTED ADDRESS: ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

RESPONSIBLE COMPANY ORGANIZATION TYPE: UNKNOWN

#### **INCIDENT DETAILS**

NRC REPORT #: 338220 FIRE INVOLVED: NO

EVACUATION RADIUS: NOT REPORTED

ANY INJURIES: UNKNOWN
ANY EVACUATIONS: YES
ANY FATALITIES: UNKNOWN

ANY DAMAGES: NO

DAMAGE AMOUNT: NOT REPORTED
MEDIUM DESCRIPTION: LAND
ADDITIONAL MEDIUM INFO: SOIL
BODY OF WATER: NOT REPORTED
TRIBUTARY OF: NOT REPORTED
RELEASE SECURED: UNKNOWN

ESTIMATED DURATION OF RELEASE: NOT REPORTED

RELEASE RATE: NOT REPORTED

REMEDIAL ACTION: BOTTLE HAS BEEN RECOVERED / TNRCC CONTRACTOR WAS CALLEDNO RELEASE TOOK PLACE /

**BOTTLE WAS DUMPED ONTO A LAWN** 

STATE AGENCY ON SCENE: NOT REPORTED



Order# 141197 Job# 336212 173 of 937

### Emergency Response Notification System (ERNSTX)

STATE AGENCY REPORT #: NOT REPORTED
OTHER AGENCY NOTIFIED: NOT REPORTED
WATER SUPPLY CONTAMINATED: UNKNOWN

COMMUNITY IMPACT: NO

ADDITIONAL INFO: SEVERAL HOMES WERE EVACUATED / APPROXIMATELY 25 RESIDENTS EVACUATED

STATE AGENCY NOTIFIED: NOT REPORTED FEDERAL AGENCY NOTIFIED: NOT REPORTED

OFFSHORE: NO

### **INFORMATION SPECIFIC TO EACH TYPE OF INCIDENT**

- NO INFORMATION REPORTED -

#### **MATERIALS INVOLVED**

- NO MATERIALS INVOLVED -

#### OTHER MATERIALS INVOLVED

- NO OTHER MATERIALS INVOLVED -

#### **TRAINS DETAILS**

- NO TRAIN DETAILS REPORTED -

#### **TRAIN DERAILED UNITS**

- NO TRAIN DERAILED UNITS REPORTED -

#### **VESSEL DETAILS**

- NO VESSEL DETAILS REPORTED -

#### **MOBILE DETAILS**

- NO MOBILE DETAILS REPORTED -

### Emergency Response Notification System (ERNSTX)

**MAP ID# 14** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 593 ft. (Lower than TP)

GSID#: 1010253

NRC REPORT #: 1010253

INCIDENT LOCATION: INTERSTATE 35 NB AT SLAUGHTER CREE IN AUSTIN, TX

INCIDENT ADDRESS: INTERSTATE 35 NB AT SLAUGHTER CREE IN AU

**AUSTIN, TX** 

INCIDENT COUNTY: TRAVIS

#### **INCIDENT INFORMATION**

NRC REPORT #: 1010253

DESCRIPTION OF INCIDENT: VEHICLE REARENDED FERRELLGAS BOBTAIL TANKER TRUCK. THE HOSE WHICH CONTAINED 10 GAL OR LESS OF LPG WAS DAMAGED CAUSING A RELEASE OF PROPANE. THE ROADWAY WAS CLOSED DUE TO THE PROPANE RELEASE. THERE WAS NO DAMAGE TO THE STRUCTURAL CONTAINER OR PIPES ON TH

TYPE OF INCIDENT: MOBILE

CAUSE: OTHER

DATE/TIME: 5/1/2012 1:40:00 PM

DISCOVERED/OCCURED/PLANNED: DISCOVERED

POTENTIAL FLAG: NO

#### REPORT RECEIPT AND SUSPECTED RESPONSIBLE PARTY INFORMATION

NRC REPORT #: 1010253

DATE/TIME RECEIVED: 5/1/2012
DATE/TIME COMPLETE: 5/1/2012

CALL TYPE: **INCIDENT**SOURCE: **WEB REPORT** 

RESPONSIBLE COMPANY: FERRELLGAS
ADDRESS: ADDRESS NOT REPORTED

**LIBERY MO 64068** 

RESPONSIBLE COMPANY ORGANIZATION TYPE: PRIVATE ENTERPRISE

#### **INCIDENT DETAILS**

NRC REPORT #: 1010253
FIRE INVOLVED: NO

**EVACUATION RADIUS: NOT REPORTED** 

ANY INJURIES: YES
ANY EVACUATIONS: NO
ANY FATALITIES: NO
ANY DAMAGES: NO

DAMAGE AMOUNT: NOT REPORTED

MEDIUM DESCRIPTION: AIR

ADDITIONAL MEDIUM INFO: NOT REPORTED

BODY OF WATER: NOT REPORTED
TRIBUTARY OF: NOT REPORTED

RELEASE SECURED: YES

ESTIMATED DURATION OF RELEASE: 45

RELEASE RATE: NOT REPORTED

REMEDIAL ACTION: NO INFORMATION PROVIDED

Order# 141197 Job# 336212 175 of 937

## Emergency Response Notification System (ERNSTX)

STATE AGENCY ON SCENE: NOT REPORTED
STATE AGENCY REPORT #: NOT REPORTED
OTHER AGENCY NOTIFIED: NOT REPORTED
WATER SUPPLY CONTAMINATED: UNKNOWN
COMMUNITY MARKET. NOT REPORTED

COMMUNITY IMPACT: NOT REPORTED ADDITIONAL INFO: \*\*\*WEB REPORT\*\*\*\*

STATE AGENCY NOTIFIED: TX RAIL ROAD COMMISION

FEDERAL AGENCY NOTIFIED: NOT REPORTED

OFFSHORE: NO

### **INFORMATION SPECIFIC TO EACH TYPE OF INCIDENT**

- NO INFORMATION REPORTED -

#### **MATERIALS INVOLVED**

NRC REPORT #: 1010253 CHRIS CODE: PRP CAS #: NOT REPORTED

MATERIAL RELEASED/AMOUNT: PROPANE / 10 GALLON(S)

IF REACHED WATER: NO

AMOUNT IN WATER: NOT REPORTED

### **OTHER MATERIALS INVOLVED**

- NO OTHER MATERIALS INVOLVED -

#### **TRAINS DETAILS**

- NO TRAIN DETAILS REPORTED -

#### TRAIN DERAILED UNITS

- NO TRAIN DERAILED UNITS REPORTED -

### **VESSEL DETAILS**

- NO VESSEL DETAILS REPORTED -

#### **MOBILE DETAILS**

- NO MOBILE DETAILS REPORTED -

## Hazardous Materials Incident Reporting System (HMIRSR06)

**MAP ID# 14** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 593 ft. (Lower than TP)

#### **INCIDENT INFORMATION**

REPORT #: E-2012050607

REPORT SUBMISSION SOURCE: NOT REPORTED
REPORT TYPE: A HAZARDOUS MATERIAL INCIDENT

NRC REPORT NUMBER: 1010253

FEDERAL DOT REPORT NUMBER: NOT REPORTED

FEDERAL AGENCY NAME: NOT REPORTED

DATE: **5/1/2012**INCIDENT LOCATION:

I-35 NB @ SLAUGHTER CREEK

**AUSTIN, TX 78705** 

**TRAVIS** 

**CARRIER INFORMATION** 

NAME: FERRELLGAS L.P. ADDRESS: 1 LIBERTY PLZ

LIBERTY, MO 64068-2971

MODE OF TRANSPORTATION: **HIGHWAY** TRANSPORTATION PHASE: **IN TRANSIT** 

### **COMMODITY DETAILS**

IDENTIFICATION NUMBER: UN1075 COMMODITY SHIPPING NAME: LPG

TRADE NAME: PROPANE

QUANTITY RELEASED: 1.3368 GCF

PACKAGING: CARGO TANK MOTOR VEHICLE (CTMV)

HAZARDOUS CLASS: FLAMMABLE GAS

.

#### **FAILURE DESCRIPTION**

WHAT FAILED: 125 HOSE
HOW FAILED: 305 - CRUSHED
FAILURE CAUSE DESCRIPTION:

537 - VEHICULAR CRASH OR ACCIDENT DAMAGE

DESCRIPTION OF EVENTS:

DRIVER WAS TRAVELING NORTHBOUND ON I-35 AT OR NEAR SLAUGHTER LANE. THE DRIVER WAS OPERATING THE VEHICLE AT OR UNDER THE POSTED SPEED LIMIT. THE OTHER VEHICLE STRUCK THE BOBTAIL FROM BEHIND. THE HOSE WAS DAMAGED CAUSING THE RELEASE OF 10 GALLONS OR LESS.

RECOMMENDATIONS/ACTIONS TAKEN:

OUR EMPLOYEES RECEIVE RECURRENT TRAINING FOR INCIDENTS SUCH AS THESE. OUR EMPLOYEE FOLLOWED PROTOCOL.

### **INCIDENT DETAILS**

SPILLAGE RESULT IDENTIFIED: NOT REPORTED FIRE RESULT IDENTIFIED: NOT REPORTED



# Hazardous Materials Incident Reporting System (HMIRSR06)

EXPLOSION RESULT IDENTIFIED: **NOT REPORTED**WATER SEWER RESULT IDENTIFIED: **NOT REPORTED**GAS DISPERSION RESULT IDENTIFIED: **NOT REPORTED** 

ENVIRONMENTAL DAMAGE RESULT IDENTIFIED: NOT REPORTED

NO RELEASE RESULT IDENTIFIED: NOT REPORTED
OTHER CLEANUP IDENTIFIED: NOT REPORTED
FIRE EMS REPORT IDENTIFIED: NOT REPORTED
FIRE EMS EMS REPORT NUMBER: NOT REPORTED
POLICE REPORT NUMBER: NOT REPORTED
IN HOUSE CLEANUP IDENTIFIED: NOT REPORTED

**MAP ID# 15** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 642 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110070189793

NAME: TX-AUS-CSJ 0016-01-117

LOCATION ADDRESS: SOUTH OF SLAUGHTER LANE ON IH35

**AUSTIN, TX 78748** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**MAP ID# 16** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 642 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110070199345

NAME: STERLING ACURA PARKING LOT LOCATION ADDRESS: 4801 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**MAP ID# 17** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 736 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110041897034

NAME: SOUTH I-35 WATER WASTEWATER PROGRAM- SEGMENT 9.0

LOCATION ADDRESS: SOUTH I-35 AND F.M. 1327

**AUSTIN, TX 78747** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**SOUTH I-35 WATER WASTEWATER PROGRAM- SEGMENT 9.0** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1623 - WATER, SEWER, PIPELINE, AND COMMUNICATIONS AND POWER LINE CONSTRUCTION

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 18** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 631 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110037199206

NAME: ALEXAN ONION CREEK

LOCATION ADDRESS: ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE

**AUSTIN, TX 78747** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALEXAN ONION CREEK

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

**MAP ID# 18** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 631 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110037202700

NAME: ALEXAN OINION CREEK WATERLINE

LOCATION ADDRESS: ALONG IH 35 BETWEEN ONION CREEK AND SLAUGHTER CREE

**AUSTIN, TX 78747** 

COUNTY: **TRAVIS** EPA REGION: **06** 

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

ALEXAN OINION CREEK WATERLINE
PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1623 - WATER, SEWER, PIPELINE, AND COMMUNICATIONS AND POWER LINE CONSTRUCTION

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 19** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 672 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110070554950

NAME: MANSIONS AT ONION CREEK

LOCATION ADDRESS: 11922 S INTERSTATE 35

**AUSTIN, TX 78747** 

COUNTY: NOT REPORTED

EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

NPDES - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 20** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 641 ft. (Higher than TP)

### **FACILITY INFORMATION**

UNIQUE ID: 110070568935 REGISTRY ID: 110070568935 NAME: LENOX SPRINGS II ADDRESS: 10300 SOUTH IH 35 **AUSTIN, TX 78748** 

COUNTY: NOT REPORTED

FACILITY LINK: Facility Detail Report

**MAP ID# 20** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 641 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110070568935

NAME: LENOX SPRINGS II LOCATION ADDRESS: 10300 SOUTH IH 35

**AUSTIN, TX 78748** 

COUNTY: NOT REPORTED

EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

NPDES - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**MAP ID# 21** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 647 ft. (Higher than TP)

### **FACILITY INFORMATION**

REGISTRY ID: 110037852115 NAME: TX DOT - AUS 0016-01-096

LOCATION ADDRESS: ON IH 35 FROM SOUTH OF SLAUGHTER LANE TO OLD SAN A

**AUSTIN, TX 78747** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: TX DOT - AUS 0016-01-096

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1611 - HIGHWAY AND STREET CONSTRUCTION, EXCEPT ELEVATED HIGHWAYS

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 22** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 637 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110070189193

NAME: STABLEWOOD EAST BOX CULVERT

LOCATION ADDRESS: 10810 S IH-35 SOUTHBOUND FRONTAGE RD AUSTIN TX 787

**AUSTIN, TX 78748** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1623 - WATER, SEWER, PIPELINE, AND COMMUNICATIONS AND POWER LINE CONSTRUCTION

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**Back to Report Summary** 

188 of 937

**MAP ID# 23** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 631 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110034645515

NAME: CONTINENTAL 132 FUND THE SPRINGS AT ONION CREEK

LOCATION ADDRESS: 8515 S I H 35

**AUSTIN, TX 78744-6716** 

COUNTY: **TRAVIS** EPA REGION: **06** 

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**CONTINENTAL 132 FUND THE SPRINGS AT ONION CREEK** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 23** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 631 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110034668544

NAME: CRITERION ONION CREEK APARTMENTS THE SPRINGS AT ONION CREEK

LOCATION ADDRESS: 8515 SIH 35

**AUSTIN, TX 78744-6716** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

CRITERION ONION CREEK APARTMENTS THE SPRINGS AT ONION CREEK

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1522 - GENERAL CONTRACTORS-RESIDENTIAL BUILDINGS, OTHER THAN SINGLE-FAMILY

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

190 of 937

**MAP ID# 23** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 631 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110035088197

NAME: WATERMARK CONSTRUCTION THE SPRINGS AT ONION CREEK

LOCATION ADDRESS: 8515 SIH 35

**AUSTIN, TX 78744-6716** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

WATERMARK CONSTRUCTION THE SPRINGS AT ONION CREEK

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1522 - GENERAL CONTRACTORS-RESIDENTIAL BUILDINGS, OTHER THAN SINGLE-FAMILY

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

191 of 937

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 24** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 736 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110070362048 REGISTRY ID: 110070362048

NAME: ENCLAVE AT ESTANCIA PHASES 1 2 AND 3 HB

ADDRESS: WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE

**AUSTIN, TX 78652** COUNTY: NOT REPORTED

FACILITY LINK: Facility Detail Report

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 24** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 736 ft. (Higher than TP)

### **FACILITY INFORMATION** UNIQUE ID: 110070377522 REGISTRY ID: 110070377522

NAME: ENCLAVE AT ESTANCIA PHASE 1 AMENITY CENTER AND PHASE 3 LD ADDRESS: WEST OF THE INTERSECTION OF IH-35 AND CAMINO VAQUE

**AUSTIN, TX 78652** COUNTY: TRAVIS COUNTY FACILITY LINK: Facility Detail Report

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 25** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 659 ft. (Higher than TP)

### FACILITY INFORMATION

GEOSEARCH ID: EX047

UST ID #: EX047

NAME: VETERANS AFFAIRS
ADDRESS: 8503 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: X

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 26** 

Distance from Property: 0 mi. (0 ft.) X Elevation: 667 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: C0643

UST ID #: C0643

NAME: JOHN ROBERTS BMW
ADDRESS: 4108 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C
HISTORICAL RECORD?: NO
COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 26** 

Distance from Property: 0.014 mi. (74 ft.) WNW

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110008160499 REGISTRY ID: 110008160499

NAME: JOHN ROBERTS AUSTIN INC

ADDRESS: 4108 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 26** 

Distance from Property: 0.014 mi. (74 ft.) WNW

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008160499

NAME: **JOHN ROBERTS AUSTIN INC** LOCATION ADDRESS: **4108 S IH 35** 

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S:
JOHN ROBERTS BMW

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

44111 - NEW CAR DEALERS

# Industrial and Hazardous Waste Sites (IHW)

OWNER INFORMATION

PHONE: 1-512-4478000

NAME: JOHN ROBERTS AUSTIN INC

ADDRESS: 9910 STONELAKE BLVD

**AUSTIN, TX 78759** 

**MAP ID# 26** 

Distance from Property: 0.014 mi. (74 ft.) WNW

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRATION#: 68652 EPA ID: TXD988018099

TNRCC ID #: 23589

NAME: JOHN ROBERTS BMW OF AUSTIN

ADDRESS: 4108 S IH 35

**AUSTIN, TX 78745** 

CONTACT: JACK JONES

PHONE: 512-4478000

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES

WASTE RECEIVER: NO WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/08/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 139081

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: 48355

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

198 of 937

**MAP ID# 26** 

Distance from Property: 0.014 mi. (74 ft.) WNW

Elevation: 667 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 14536

NAME: JOHN ROBERTS BMW OF AUSTIN

ADDRESS: 4108 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 08/12/1986 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/17/1986

SIGNATURE NAME & TITLE: V L ROBERTS, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600286637 NAME: JOHN ROBERTS AUSTIN INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/12/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600286637 NAME: JOHN ROBERTS AUSTIN INC

CONTACT ADDRESS: 9910 STONELAKE BLVD

**AUSTIN TX 78759** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/12/1986 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

### **CONTACT INFORMATION**

NAME: M SIEMSEN TITLE: SVC MGR

ORGANIZATION: JOHN ROBERTS BMW OF AUSTIN MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4478000 0

199 of 937

ORGANIZATION: JOHN ROBERTS AUSTIN INC

PHONE: (512) 4478000 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1982 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 275 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/17/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 41380

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 275

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 200 of 937

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 26** 

Distance from Property: 0.008 mi. (42 ft.) WNW

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **69274** 

NAME: LEXUS OF AUSTIN

ADDRESS: 4107 SANTIAGO ST

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/28/1997 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 01/27/1997

SIGNATURE NAME & TITLE: HARVEY R GRAY, PRES. ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600320691

NAME: ROBERTS

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

OWNER NUMBER: CN601419401

NAME: ROBERTS

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: INDIVIDUAL
BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED

CONTACT INFORMATION

NAME: JOHN ROBERTS
TITLE: NOT REPORTED

ORGANIZATION: LEXUS OF AUSTIN

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (512) 3274117 0

GeoSearch www.geo-search.com 888-396-0042

FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1989 REGISTRATION DATE: 01/28/1997

TANK CAPACITY (GAL): 560 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/17/1997** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 172242

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 560

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 203 of 937

# ABOVEGROUND STORAGE TANK INFORMATION NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 26** 

Distance from Property: 0.014 mi. (74 ft.) WNW

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD988018099 OWNER TYPE: PRIVATE

NAME: JOHN ROBERTS AUSTIN INC OWNER NAME: JOHN ROBERTS AUSTIN INC

ADDRESS: 4108 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: JOHN ROBERTS AUSTIN INC

CONTACT NAME: JACK JONES

CONTACT ADDRESS: 9910 STONELAKE BLVD

**AUSTIN TX 78759** 

CONTACT PHONE: 512-447-8000

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/27/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

44111 - NEW CAR DEALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D018 BENZENE

D039 TETRACHLOROETHYLENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 27** 

Distance from Property: 0.008 mi. (42 ft.) N

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03189

UST ID #: 03189

NAME: CORNER STORE #1445
ADDRESS: 110 W SLAUGHTER LN

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 27** 

Distance from Property: 0.008 mi. (42 ft.) N

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110034530559

NAME: VALERO CORNER STORE 1445

LOCATION ADDRESS: 110 W SLAUGHTER LN

**AUSTIN, TX 78748-1700** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**VALERO CORNER STORE 1445** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Hazardous Materials Incident Reporting System (HMIRSR06)

**MAP ID# 27** 

Distance from Property: 0.008 mi. (42 ft.) N

Elevation: 653 ft. (Higher than TP)

INCIDENT INFORMATION

REPORT #: E-2005040286

REPORT SUBMISSION SOURCE: NOT REPORTED REPORT TYPE: A HAZARDOUS MATERIAL INCIDENT

NRC REPORT NUMBER: NOT REPORTED

FEDERAL DOT REPORT NUMBER: NOT REPORTED

FEDERAL AGENCY NAME: NOT REPORTED

DATE: 4/1/2005 INCIDENT LOCATION:

110 WEST SLAUGHTER LANE

**AUSTIN, TX 78748** 

**TRAVIS** 

**CARRIER INFORMATION** 

NAME: MISSION PETROLEUM CARRIERS INC.

ADDRESS: 8450 MOSLEY RD

HOUSTON, TX 77075-1114

MODE OF TRANSPORTATION: HIGHWAY TRANSPORTATION PHASE: UNLOADING

### **COMMODITY DETAILS**

IDENTIFICATION NUMBER: UN1203

COMMODITY SHIPPING NAME: GASOLINE INCLUDES GASOLINE MIXED WITH ETHYL ALCOHOL WITH NOT MORE THAN 10%

**ALCOHOL** 

TRADE NAME: NOT REPORTED

QUANTITY RELEASED: 1 LIQUID - GALLON

PACKAGING: CARGO TANK MOTOR VEHICLE (CTMV) HAZARDOUS CLASS: FLAMMABLE - COMBUSTIBLE LIQUID

### **FAILURE DESCRIPTION**

WHAT FAILED: ;; HOW FAILED: ;-;

FAILURE CAUSE DESCRIPTION:

529; 515 - OVERFILLED; HUMAN ERROR

**DESCRIPTION OF EVENTS:** 

DRIVER OVERFILLED TANK. DRIVER DID NOT CHECK THE CORRECT TANK CHART FOR THIS TANK. THE ORDER DID NOT FIT. THE SPILL WAS CLEANED UP WITH ABSORBENT PADS AND QUICK DRY BY THE DRIVER. THE CONTAMINTED ITEMS WERE BROUGHT BACK TO THE TERMINAL FOR PROPER DISPOSAL. APPROX. 1 GALLON OF DIESEL SPILLED.

RECOMMENDATIONS/ACTIONS TAKEN:

DRIVER RECEIVED A WRITTEN WARNING AND WAS COUNSELED ON PROPER DELIVERY PROCEDURES.

**INCIDENT DETAILS** 

SPILLAGE RESULT IDENTIFIED: NOT REPORTED FIRE RESULT IDENTIFIED: NOT REPORTED



209 of 937

# Hazardous Materials Incident Reporting System (HMIRSR06)

EXPLOSION RESULT IDENTIFIED: **NOT REPORTED**WATER SEWER RESULT IDENTIFIED: **NOT REPORTED**GAS DISPERSION RESULT IDENTIFIED: **NOT REPORTED** 

ENVIRONMENTAL DAMAGE RESULT IDENTIFIED: NOT REPORTED

NO RELEASE RESULT IDENTIFIED: NOT REPORTED
OTHER CLEANUP IDENTIFIED: NOT REPORTED
FIRE EMS REPORT IDENTIFIED: NOT REPORTED
FIRE EMS EMS REPORT NUMBER: NOT REPORTED
POLICE REPORT NUMBER: NOT REPORTED
IN HOUSE CLEANUP IDENTIFIED: NOT REPORTED

CONTACT INFORMATION

ORGANIZATION: WATTINGER FACILITY

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: TOM WATTINGER

PHONE: (512) 2820616 0

TITLE: VP

**MAP ID# 27** 

Distance from Property: 0.001 mi. (5 ft.) N

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **3625** 

NAME: WATTINGER FACILITY

ADDRESS: 114 W SLAUGHTER LN

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: OTHER

BEGIN DATE: 06/16/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/10/1986

SIGNATURE NAME & TITLE: TOM WATTINGER, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600783971
NAME: WATTINGER COMPANY INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/16/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/29/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 12523

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

CONNECTORS & VALVES:

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 27** 

Distance from Property: 0.008 mi. (42 ft.) N

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 68212

NAME: FAST MART 8186

ADDRESS: 110 W SLAUGHTER LN

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 12/31/1995

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/26/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/21/2019 SIGNATURE NAME & TITLE: DENNIE MATHES, CORP ENV COMP MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603378738

NAME: QUIK-WAY RETAIL ASSOCIATES II LTD

CONTACT ADDRESS: 8350 N CENTRAL EXPY STE M1015

DALLAS TX 75206

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/06/2017 CONTACT ROLE: OWNCON CONTACT NAME: ALAN GOLMAN

CONTACT TITLE: AGENT

ORGANIZATION: QUIKWAY RETAIL ASSOCIATES II LTD

PHONE: (214) 3797030 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

OWNER NUMBER: CN604312421 NAME: BIG DIAMOND LLC

CONTACT ADDRESS: 1 VALERO WAY STE 200

**SAN ANTONIO TX 78249** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013 CONTACT ROLE: OWNCON CONTACT NAME: GEORGE GALE CONTACT TITLE: NOT REPORTED ORGANIZATION: BIG DIAMOND LLC

PHONE: 2106922287 0

CONTACT INFORMATION

NAME: DENNIE MATHES TITLE: NOT REPORTED

ORGANIZATION: FAST MART 8186

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (214) 3290385 0

GeoSearch www.geo-search.com 888-396-0042

213 of 937

FAX: NOT REPORTED

EMAIL: GEORGE.GALE@CSTBRANDS.COM

**OPERATOR** 

OPERATOR NUMBER: CN603378738

NAME: QUIK-WAY RETAIL ASSOCIATES II LTD

CONTACT ADDRESS: 8350 N CENTRAL EXPY STE M2185

DALLAS TX 75206

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/06/2017
CONTACT ROLE: OPRCON
CONTACT NAME: BOB LEA
CONTACT TITLE: NOT REPORTED

ORGANIZATION: QUIK-WAY RETAIL ASSOCIATES II LTD

PHONE: (214) 5579224 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN604312421

NAME: BIG DIAMOND LLC

CONTACT ADDRESS: 1 VALERO WAY

**SAN ANTONIO TX 78249** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013
CONTACT ROLE: OPRCON

CONTACT NAME: DOUGLAS MILLER
CONTACT TITLE: VICE PRESIDENT
ORGANIZATION: BIG DIAMOND LLC

PHONE: **(210) 6922240 0** FAX: **NOT REPORTED** 

EMAIL: DOUGLAS.MILLER@CSTBRANDS.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 317143 SIGNATURE DATE: 02/21/2019

SIGNATURE NAME & TITLE: DENNIE MATHES, CORP ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 301093
SIGNATURE DATE: 03/15/2018

SIGNATURE NAME & TITLE: DENNIE MATHES, DIR OF ENV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 294646
SIGNATURE DATE: 10/02/2017

SIGNATURE NAME & TITLE: DENNIE MATHES, DIRECTOR OF ENVIRONMENTAL

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292493
SIGNATURE DATE: 08/24/2017



SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 276034
SIGNATURE DATE: 08/22/2016

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 257932
SIGNATURE DATE: 08/25/2015

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 242710
SIGNATURE DATE: 08/29/2014

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 226370
SIGNATURE DATE: 09/04/2013

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168290
SIGNATURE DATE: 09/04/2012

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168289
SIGNATURE DATE: 08/24/2011

SIGNATURE NAME & TITLE: KENT HAMEL, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168288
SIGNATURE DATE: 08/24/2010

SIGNATURE NAME & TITLE: KENT HAMEL, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168287
SIGNATURE DATE: 08/28/2009

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168286
SIGNATURE DATE: 08/29/2008

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168285
SIGNATURE DATE: 03/20/2008

SIGNATURE NAME & TITLE: TERRY HANKINS, O & E SPECIALIST

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168284
SIGNATURE DATE: 08/28/2007

SIGNATURE NAME & TITLE: KENT HAMEL, COMPLIANCE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168283
SIGNATURE DATE: 08/02/2006

SIGNATURE NAME & TITLE: KENT HAMEL, O&E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168282
SIGNATURE DATE: 07/27/2005

SIGNATURE NAME & TITLE: KENT HAMEL, O & E SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168281
SIGNATURE DATE: 08/09/2004

SIGNATURE NAME & TITLE: KENT HAMEL, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168280
SIGNATURE DATE: 08/05/2003

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168279
SIGNATURE DATE: 07/24/2002

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 168278
SIGNATURE DATE: 12/29/2000

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O & E SPEC

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 15904

APPLICATION RECEIVED DATE: 12/12/2008

SCHEDULE CONSTRUCTION DATE: 12/18/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 



NOTIFICATION CONSTRUCTION ID: 15905
APPLICATION RECEIVED DATE: 03/05/2002
SCHEDULE CONSTRUCTION DATE: 03/25/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/31/1995 REGISTRATION DATE: 01/25/1996

TANK CAPACITY (GAL): 15104 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/31/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178001

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 15104

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 12/31/1995 REGISTRATION DATE: 01/25/1996

TANK CAPACITY (GAL): 11873 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/31/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178002

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11873

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/31/1995 REGISTRATION DATE: 01/25/1996

TANK CAPACITY (GAL): 5929 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/31/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES



#### **TANK DETAILS**

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 178003

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5929

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Facility Registry System (FRSTX)

**MAP ID# 28** 

Distance from Property: 0.002 mi. (11 ft.) NNE

Elevation: 633 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110035247499

NAME: WSP DEVELOPMENT 10 ONION CREEK BUSINESS PARK LOCATION ADDRESS: ON NE OF INTX OF IH35 & ONION CREEK PKWY

**AUSTIN, TX 78747** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

WSP DEVELOPMENT 10 ONION CREEK BUSINESS PARK

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 29** 

Distance from Property: 0.002 mi. (11 ft.) ESE

Elevation: 654 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110070164933

NAME: STATE DEPT OF PUBLIC HWYS

LOCATION ADDRESS: 7901 IH 35

**AUSTIN, TX 78761** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 30** 

Distance from Property: 0.002 mi. (11 ft.) ESE

Elevation: 646 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0515

UST ID #: C0515

NAME: DAIRY FARM

ADDRESS: 10415 S IH 35

AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 31** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 668 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110070435052 REGISTRY ID: 110070435052 NAME: RANGE AT AUSTIN ADDRESS: 8301 S IH 35 **AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 31** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 668 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: TXR000084079 REGISTRY ID: TXR000084079 NAME: RANGE AT AUSTIN ADDRESS: 8301 S IH 35

AUSTIN, TX 78744-6717

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

### Facility Registry System (FRSTX)

**MAP ID# 31** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 668 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110070435052

NAME: RANGE AT AUSTIN

LOCATION ADDRESS: 8301 S IH 35

**AUSTIN, TX 78744-6717** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

**RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY** 

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

327992 - GROUND OR TREATED MINERAL AND EARTH MANUFACTURING.

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 31** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 668 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 96643 EPA ID: TXR000084079

NAME: PATRIOT ENTERTAINMENT LLC

TNRCC ID #: 131982

ADDRESS: 8301 S IH 35

NAME: RANGE AT AUSTIN

AUSTIN, TX 78744

ADDRESS: 8301 S IH 35

PHONE: 1-737-8023700

**AUSTIN, TX 78744** 

CONTACT: GRANT SHAW

PHONE: **737-8023700** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES

WASTE GENERATOR. TE

WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/08/2019

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 400965

WASTE CODE STATUS: INACTIVE

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LEAD WASTE IN FILTERS, LEAD WITH WATER; ONE TIME SHIPMENT.

WASTE ID: 390664

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LEAD CONTAMINATED AIR FILTERS FROM VENTILATION SYSTEM

WASTE ID: 400965

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



# Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: LEAD WASTE IN FILTERS, LEAD WITH WATER

### Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 31** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 668 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000084079 OWNER TYPE: PRIVATE

NAME: RANGE AT AUSTIN OWNER NAME: PATRIOT ENTERTAINMENT LLC

ADDRESS: 8301 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744-6717 OPERATOR NAME: PATRIOT ENTERTAINMENT LLC

CONTACT NAME: **GRANT SHAW**CONTACT ADDRESS: **8301 S IH 35** 

**AUSTIN TX 78744-6717** 

CONTACT PHONE: 737-802-3700

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/20/2018

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

GRANT SHAW OWNER OPERATOR 03/20/2018

**INDUSTRY CLASSIFICATION (NAICS)** 

327992 - GROUND OR TREATED MINERAL AND EARTH MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 04/09/2018

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D007 CHROMIUM D008 LEAD

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

### Dry Cleaner Registration Database (DCR)

**MAP ID# 32** 

Distance from Property: 0.003 mi. (16 ft.) NNE

Elevation: 625 ft. (Higher than TP)

**FACILITY INFORMATION** 

LOCATION NUMBER: RN103979811

CUSTOMER #: CN600264543
REGISTRATION ID: DCR12329

REGULATED ENTITY NAME: JACK BROWN CLEANERS 28

NAME: NOT REPORTED
ADDRESS: 11001 S IH 35

**AUSTIN, TX 78747** 

COUNTY: TRAVIS

ACCOUNT NUMBER: 24000524 REGION: REGION 11 - AUSTIN

PRINCIPAL NAME: JACK BROWN CLEANERS INC

ADDRESS: PO BOX 28159

**AUSTIN, TX 78755** 

EMAIL ADDRESS: PAULBJBC@AOL.COM

PHONE NUMBER: 512-4511333

SITE TYPE: DROP STATION REGISTRATION

SITE STATUS: ACTIVE
ELIGIBLE ANSWER: YES
GROSS RECEIPT: > \$150,000
FISCAL YEAR: FY2019
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

230 of 937

# Dry Cleaner Registration Database (DCR)

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2006
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2005
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED



### Facility Registry System (FRSTX)

**MAP ID# 32** 

Distance from Property: 0.003 mi. (16 ft.) NNE

Elevation: 625 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110034090481

NAME: JACK BROWN CLEANERS 28 LOCATION ADDRESS: 11001 S I H 35

**AUSTIN, TX 78747-1709** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**JACK BROWN CLEANERS 28** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 33** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 633 ft. (Higher than TP)

FACILITY INFORMATION
GEOSEARCH ID: 01180

UST ID #: 01180

NAME: ONION CREEK FOOD MART ADDRESS: 2101 BOCA RATON DR

AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 33** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 633 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110035023569

NAME: UTOTEM

LOCATION ADDRESS: 2107 BOCA RATON DR

**AUSTIN, TX 78747-1629** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

UTOTEM

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 33** 

Distance from Property: 0.003 mi. (16 ft.) ESE

Elevation: 633 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 39571

NAME: ONION CREEK FOOD MART

ADDRESS: 2107 BOCA RATON DR

**AUSTIN, TX 78747** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 01/14/1987

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/28/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/28/2019

SIGNATURE NAME & TITLE: AMIRALI MAKNOJIA, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603571266 NAME: MOMIN GOLDEN INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/01/2008

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603681321

NAME: ANJIA GOLDEN INC

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 10/14/2008

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: AMIRALI MAKANOJIA

TITLE: PRES

ORGANIZATION: ONION CREEK FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 6528462 0

GeoSearch www.geo-search.com 888-396-0042

235 of 937

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED EMAIL: NOT REPORTED SELF-CERTIFICATION

SELF-CERTIFICATION ID: 322536 SIGNATURE DATE: 06/28/2019

SIGNATURE NAME & TITLE: AMIRALI MAKNOJIA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 312052
SIGNATURE DATE: 10/18/2018

SIGNATURE NAME & TITLE: AMIRALI MAKNOLJA, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 286787
SIGNATURE DATE: 05/16/2017

SIGNATURE NAME & TITLE: AMIRALI MAKNOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 272368
SIGNATURE DATE: 07/18/2016

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 254394
SIGNATURE DATE: 06/15/2015

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 239298
SIGNATURE DATE: 07/23/2014

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 222065
SIGNATURE DATE: 07/12/2013

SIGNATURE NAME & TITLE: AMIR ALI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63458
SIGNATURE DATE: 04/25/2012

SIGNATURE NAME & TITLE: AMIRALI MAKNOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63457
SIGNATURE DATE: 06/20/2011



SIGNATURE NAME & TITLE: MEHDI ALI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63456
SIGNATURE DATE: 05/05/2010

SIGNATURE NAME & TITLE: MEHDI ALI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63455
SIGNATURE DATE: 04/15/2009

SIGNATURE NAME & TITLE: MEHOT ALI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63454
SIGNATURE DATE: 04/14/2009

SIGNATURE NAME & TITLE: MEHDI ALI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63453
SIGNATURE DATE: 04/29/2008

SIGNATURE NAME & TITLE: SIMON NAJM, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63452
SIGNATURE DATE: 04/15/2007

SIGNATURE NAME & TITLE: SIMON NAJM, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63451
SIGNATURE DATE: 04/10/2006

SIGNATURE NAME & TITLE: SIMON NAJM, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63450
SIGNATURE DATE: 05/01/2005

SIGNATURE NAME & TITLE: SIMON NAJM, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63449
SIGNATURE DATE: 04/19/2004

SIGNATURE NAME & TITLE: SIMON NAJM, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63448
SIGNATURE DATE: 05/16/2003

SIGNATURE NAME & TITLE: SIMON NAJM, PRES

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63447
SIGNATURE DATE: 04/15/2002

SIGNATURE NAME & TITLE: SIMON NAJA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63446
SIGNATURE DATE: 04/29/2001

SIGNATURE NAME & TITLE: SIMON NAJM, PRESIDENT

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1979

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 54729

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 



Order# 141197 Job# 336212 238 of 937

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1979

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 54730

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 141197 Job# 336212 239 of 937

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1979

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 54731

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

WATERIAL. FRE

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

### Emergency Response Notification System (ERNSTX)

**MAP ID# 34** 

Distance from Property: 0.004 mi. (21 ft.) ESE

Elevation: 642 ft. (Higher than TP)

GSID#: 983133

NRC REPORT #: 983133

INCIDENT LOCATION: NOT REPORTED

INCIDENT ADDRESS: 4701 SOUTH INTERSTATE 35

**AUSTIN, TX** 

INCIDENT COUNTY: TRAVIS

#### **INCIDENT INFORMATION**

NRC REPORT #: 983133

DESCRIPTION OF INCIDENT: CALLER REPORTED THAT SOME EMPLOYEES WERE AT A RED ROOF INN HOTEL FOR THE NIGHT AND SOMEONE BROKE INTO THEIR TRUCK AND STOLE A RADIOGRAPHY CAMERA. THE CAMERA IS INSIDE A CASE THAT PREVENTS THE RADIOLOGICAL MATERIAL INSIDE BUT IF REMOVED IT WILL BE RELEASED

TYPE OF INCIDENT: FIXED

CAUSE: OTHER

DATE/TIME: 7/19/2011 9:04:00 AM

DISCOVERED/OCCURED/PLANNED: DISCOVERED

POTENTIAL FLAG: YES

#### REPORT RECEIPT AND SUSPECTED RESPONSIBLE PARTY INFORMATION

NRC REPORT #: 983133

DATE/TIME RECEIVED: **7/19/2011**DATE/TIME COMPLETE: **7/19/2011** 

CALL TYPE: **INCIDENT** SOURCE: **TELEPHONE** 

RESPONSIBLE COMPANY: NOT REPORTED ADDRESS: ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

RESPONSIBLE COMPANY ORGANIZATION TYPE: UNKNOWN

#### **INCIDENT DETAILS**

NRC REPORT #: 983133
FIRE INVOLVED: NO

**EVACUATION RADIUS: NOT REPORTED** 

ANY INJURIES: NO
ANY EVACUATIONS: NO
ANY FATALITIES: NO
ANY DAMAGES: NO

DAMAGE AMOUNT: NOT REPORTED
MEDIUM DESCRIPTION: UNKNOWN
ADDITIONAL MEDIUM INFO: UNKNOWN
BODY OF WATER: NOT REPORTED
TRIBUTARY OF: NOT REPORTED
RELEASE SECURED: UNKNOWN

ESTIMATED DURATION OF RELEASE: NOT REPORTED

RELEASE RATE: NOT REPORTED

REMEDIAL ACTION: INVESTIGATION UNDERWAY, CALLED LOCAL LAW ENFORCEMENT

### Emergency Response Notification System (ERNSTX)

STATE AGENCY ON SCENE: NONE
STATE AGENCY REPORT #: 47070, I-8871
OTHER AGENCY NOTIFIED: NOT REPORTED
WATER SUPPLY CONTAMINATED: UNKNOWN

COMMUNITY IMPACT: NOT REPORTED

ADDITIONAL INFO: NONE

STATE AGENCY NOTIFIED: USDA, NRC FEDERAL AGENCY NOTIFIED: FEMA, DHHS

OFFSHORE: NO

#### **INFORMATION SPECIFIC TO EACH TYPE OF INCIDENT**

- NO INFORMATION REPORTED -

#### **MATERIALS INVOLVED**

NRC REPORT #: 983133 CHRIS CODE: RAM CAS #: NOT REPORTED

MATERIAL RELEASED/AMOUNT: RADIOACTIVE MATERIAL (GAMMA RAYS) / UNKNOWN AMOUNT

IF REACHED WATER: NO

AMOUNT IN WATER: NOT REPORTED

#### **OTHER MATERIALS INVOLVED**

- NO OTHER MATERIALS INVOLVED -

#### **TRAINS DETAILS**

- NO TRAIN DETAILS REPORTED -

#### TRAIN DERAILED UNITS

- NO TRAIN DERAILED UNITS REPORTED -

#### **VESSEL DETAILS**

- NO VESSEL DETAILS REPORTED -

#### **MOBILE DETAILS**

- NO MOBILE DETAILS REPORTED -

# Facility Registry System (FRSTX)

**MAP ID# 35** 

Distance from Property: 0.005 mi. (26 ft.) WNW

Elevation: 680 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110034816135

NAME: RIVER CITY COLLISION SERVICE LOCATION ADDRESS: 6900 S I H 35

**AUSTIN, TX 78745-5742** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**RIVER CITY COLLISION SERVICE** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

243 of 937

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 36** 

Distance from Property: 0.005 mi. (26 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03278

UST ID #: 03278

NAME: ON THE MOVE #11

ADDRESS: 120 W SLAUGHTER LN

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 36** 

Distance from Property: 0.005 mi. (26 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110035355059 NAME: **7-ELEVEN** 39068

LOCATION ADDRESS: 120 W SLAUGHTER LN

**AUSTIN, TX 78748-1700** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: ON THE MOVE 11

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

245 of 937

# **Groundwater Contamination Cases (GWCC)**

**MAP ID# 36** 

Distance from Property: 0.005 mi. (26 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 118297

FILE NAME: CONGRESS SLAUGHTER LP LOCATION: 120 W SLAUGHTER LN, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION/PETROLEUM STORAGE TANK REIMBURSEMENT PROGRAM

DATE OF CONTAMINATION

CONFIRMATION BY AGENCY: **04/29/10** CONTAMINANT(S): **GASOLINE** 

ENFORCEMENT STATUS: STAFF ACTION: THE AGENCY INITIATES AN ACTION TO ADDRESS A CONTAMINATION INCIDENT.

ACTIVITY STATUS: ACTION COMPLETED: THE REMEDY IS CONSIDERED COMPLETE.

NEW CASE?: NO

### Leaking Petroleum Storage Tanks (LPST)

**MAP ID# 36** 

Distance from Property: 0.005 mi. (26 ft.) W

Elevation: 653 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 118297

LPST ID: **118297**FACILITY ID: **75395**NAME: **7 ELEVEN 39068** 

ADDRESS: 120 W SLAUGHTER LN

**AUSTIN, TX 78748** 

#### **LEAKING TANK DETAILS**

LPST ID: 118297

NAME: 7 ELEVEN 39068

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 4/29/10

REPORTED DATE: 02/24/2010
ENTERED DATE: 04/29/2010
CLOSURE DATE: 07/14/2010

**PRP INFORMATION** 

NAME: CONGRESS SLAUGHTER LP
ADDRESS: ADDRESS NOT REPORTED
SAN ANTONIO TX 78230

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 247 of 937

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 171879

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 171880

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

Order# 141197 Job# 336212 248 of 937

### MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 171881

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 



Order# 141197 Job# 336212 249 of 937

### **NOT REPORTED**

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 36** 

Distance from Property: 0.005 mi. (26 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **75395** 

NAME: 7-ELEVEN 39068 ADDRESS: 120 W SLAUGHTER LN

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 07/26/2002 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/25/2002 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/25/2002

SIGNATURE NAME & TITLE: MAX MCBRAYER, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603647330
NAME: CONGRESS SLAUGHTER LP

CONTACT ADDRESS: 12050 VANCE JACKSON RD STE 102

**SAN ANTONIO TX 78230** 

TYPE: **PARTNERSHIP**BEGIN DATE: **08/14/2009**CONTACT ROLE: **OWNCON** 

CONTACT NAME: JASON LINAHAN CONTACT TITLE: NOT REPORTED

ORGANIZATION: CONGRESS SLAUGHTER LP

PHONE: (210) 5250131 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN603647330
NAME: CONGRESS SLAUGHTER LP

CONTACT ADDRESS: 12050 VANCE JACKSON RD STE 102

SAN ANTONIO TX 78230

TYPE: PARTNERSHIP
BEGIN DATE: 08/14/2009
CONTACT ROLE: OPRCON

CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: PEGGIE BETZ

TITLE: GAS ENV COMP SPEC ORGANIZATION: 7-ELEVEN 39068

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (972) 8287805 0

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 251 of 937

ORGANIZATION: CONGRESS SLAUGHTER LP

PHONE: NOT REPORTED FAX: NOT REPORTED EMAIL: NOT REPORTED SELF-CERTIFICATION

SELF-CERTIFICATION ID: 208051 SIGNATURE DATE: 07/01/2009

SIGNATURE NAME & TITLE: SCOTT JOHNSON, GAS & ENV COMP MGR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208050
SIGNATURE DATE: 02/03/2009

SIGNATURE NAME & TITLE: RONNIE MICHAELS, GM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208049
SIGNATURE DATE: 12/21/2007

SIGNATURE NAME & TITLE: RONNIE MICHAELS, DM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208048
SIGNATURE DATE: 12/20/2007

SIGNATURE NAME & TITLE: RONNIE MICHAELS, DM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208047
SIGNATURE DATE: 09/02/2005

SIGNATURE NAME & TITLE: JAY SEEWALD, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208046
SIGNATURE DATE: 01/19/2005

SIGNATURE NAME & TITLE: LISA A CIOTOLI, DIRECTOR OF ENVIRON

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208045
SIGNATURE DATE: 01/08/2004

SIGNATURE NAME & TITLE: MAX MCBRAYER JR, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208044
SIGNATURE DATE: 02/28/2003

SIGNATURE NAME & TITLE:  ${f MAX\ MCBRAYER\ JR,\ VP}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 208043
SIGNATURE DATE: 09/25/2002

SIGNATURE NAME & TITLE: MAX MCBRAYER JR, VICE PRESIDENT

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 19008

APPLICATION RECEIVED DATE: 07/16/2002

SCHEDULE CONSTRUCTION DATE: 08/15/2002

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 19009

APPLICATION RECEIVED DATE: 10/05/2009

SCHEDULE CONSTRUCTION DATE: 10/05/2009

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 171879

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED



Order# 141197 Job# 336212 253 of 937

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY STATUS: REMOVED FROM GROUND

STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** MATERIAL: **COMPOSITE** 

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 171880

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG



Order# 141197 Job# 336212 254 of 937

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/26/2002 REGISTRATION DATE: 09/26/2002

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/11/2009

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 171881

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Back to Report Summary



# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 37** 

Distance from Property: 0.005 mi. (26 ft.) SE

Elevation: 587 ft. (Lower than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03377

UST ID #: 03377

NAME: STASSNEY CROSSING C-STORE ADDRESS: 5717 S IH 35 SVRD NB

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 37** 

Distance from Property: 0.005 mi. (26 ft.) SE

Elevation: 587 ft. (Lower than TP)

**FACILITY INFORMATION** 

ID#: 85575

NAME: STASSNEY FOOD MART

ADDRESS: 5717 S INTERSTATE 35 BLDG D

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 05/24/2013

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/30/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/26/2019

SIGNATURE NAME & TITLE: SOMI MAREDIA, REP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN605654128 NAME: STASSNEY FOOD MART INC

CONTACT ADDRESS: 5717 S INTERSTATE 35 BLDG D

**AUSTIN TX 78744** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/15/2019

CONTACT ROLE: OWNOPRCON CONTACT NAME: KARIM ALI CONTACT TITLE: NOT REPORTED

ORGANIZATION: STASSNEY FOOD MART INC

PHONE: (512) 5772993 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

OWNER NUMBER: CN604257253 NAME: NM PATEL GOLDEN INC

CONTACT ADDRESS: 5717 S INTERSTATE 35 BLDG D

**AUSTIN TX 78744** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/24/2013

CONTACT ROLE: OWNOPRCON

CONTACT NAME: AMIRALI MAKANOJIA

CONTACT TITLE: NOT REPORTED

ORGANIZATION: N M PATEL GOLDEN INC

PHONE: (512) 6528462 0

**CONTACT INFORMATION** 

NAME: KARIM ALI

TITLE: NOT REPORTED

ORGANIZATION: STASSNEY FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 5772993 0

GeoSearch www.geo-search.com 888-396-0042

257 of 937

FAX: NOT REPORTED

EMAIL: SAGAR364@AOL.COM
OWNER NUMBER: CN604257253
NAME: N M PATEL GOLDEN INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN605654128
NAME: STASSNEY FOOD MART INC

CONTACT ADDRESS: 5717 S INTERSTATE 35 BLDG D

**AUSTIN TX 78744** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/15/2019

CONTACT ROLE: OWNOPRCON
CONTACT NAME: KARIM ALI
CONTACT TITLE: NOT REPORTED

ORGANIZATION: STASSNEY FOOD MART INC

PHONE: (512) 5772993 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

OPERATOR NUMBER: CN604257253
NAME: NM PATEL GOLDEN INC

CONTACT ADDRESS: 5717 S INTERSTATE 35 BLDG D

AUSTIN TX 78744

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/24/2013

CONTACT ROLE: OWNOPRCON

CONTACT NAME: AMIRALI MAKANOJIA
CONTACT TITLE: NOT REPORTED

ORGANIZATION: N M PATEL GOLDEN INC

PHONE: **(512) 6528462 0** FAX: **NOT REPORTED** 

EMAIL: SAGAR364@AOL.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 320175 SIGNATURE DATE: 04/26/2019

SIGNATURE NAME & TITLE: SOMI MAREDIA, REP

FILING STATUS: INITIAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 312051
SIGNATURE DATE: 10/12/2018

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291224
SIGNATURE DATE: 08/22/2017

SIGNATURE NAME & TITLE: AMIR MAKANOJIA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 276146
SIGNATURE DATE: 07/27/2016

SIGNATURE NAME & TITLE: AMIR MAKANOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 258857
SIGNATURE DATE: 09/10/2015

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 244180
SIGNATURE DATE: 10/10/2014

SIGNATURE NAME & TITLE: AMIRALI MAKNOJIA, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 237231
SIGNATURE DATE: 05/20/2014

SIGNATURE NAME & TITLE: AMIRALI MAKANOJIA, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 23327

APPLICATION RECEIVED DATE: 01/07/2013

SCHEDULE CONSTRUCTION DATE: 01/23/2013

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION: NEW UST INSTALLATION, PIPING AND DISPENSERS ETC.

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 05/24/2013 REGISTRATION DATE: 06/02/2014

TANK CAPACITY (GAL): 26000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/24/2013

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DETAILS

MATERIAL:



Order# 141197 Job# 336212 259 of 937

### **COMPOSITE**

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), EXTERNAL NONMETTALIC JACKET

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 187166

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 14000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

### **PIPING SYSTEMS**

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

### **NOT REPORTED**

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 05/24/2013 REGISTRATION DATE: 06/02/2014

TANK CAPACITY (GAL): 26000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/24/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**COMPOSITE** 

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), EXTERNAL NONMETTALIC JACKET

**EXTERNAL CONTAINMENT:** 

Order# 141197 Job# 336212 260 of 937

### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 187167

TANK ID: 1

COMPARTMENT LETTER: **B** SUBSTANCES: **GASOLINE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 3
INSTALLATION DATE: 05/24/2013 REGISTRATION DATE: 06/02/2014

TANK CAPACITY (GAL): 26000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/24/2013

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), EXTERNAL NONMETTALIC JACKET

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 261 of 937

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 189005

TANK ID: 1

COMPARTMENT LETTER: C SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

### **PIPING SYSTEMS**

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

### **NOT REPORTED**

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 38** 

Distance from Property: 0.006 mi. (32 ft.) WNW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 00303

UST ID #: 00303

NAME: K & Z TOWN FOOD MART #23
ADDRESS: 800 E WILLIAM CANNON DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110015665797 REGISTRY ID: 110015665797 NAME: STAR ENTERPRISES INC ADDRESS: 800 E WILLIAM CANON DR

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Facility Registry System (FRSTX)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110015665797

NAME: STAR ENTERPRISES INC

LOCATION ADDRESS: 800 E WILLIAM CANON DR

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: STAR ENTERPRISE

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Facility Registry System (FRSTX)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** REGISTRY ID: 110034006395

NAME: TOWN FOOD MART

LOCATION ADDRESS: 800 E WILLIAM CANNON DR

**AUSTIN, TX 78745-5738** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S: EXPRESS MART 8** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

5541 - GASOLINE SERVICE STATIONS

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 75654 EPA ID: TXD987993565 NAME: STAR ENTERPRISES INC

TNRCC ID #: 30001 ADDRESS: PO BOX 2099

NAME: STAR ENTERPRISES HOUSTON, TX 77252

ADDRESS: 800 E WILLIAM CANNON DR PHONE: 1-214-6500200

**AUSTIN, TX 78745** 

CONTACT: DAVID GUMBLEY

PHONE: **214-6500200** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/27/2007

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 58179

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 141197 Job# 336212 267 of 937

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 096235

LPST ID: **096235**FACILITY ID: **34931** 

NAME: SHOPPERS MART 23

ADDRESS: 800 E WILLIAM CANNON DR

**AUSTIN, TX 78745** 

### **LEAKING TANK DETAILS**

LPST ID: 096235

NAME: SHOPPERS MART 23

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/24/90

REPORTED DATE: 07/16/1990 ENTERED DATE: 07/24/1990 CLOSURE DATE: 11/13/1990

**PRP INFORMATION** 

NAME: STAR ENTERPRISES INC

ADDRESS: ADDRESS NOT REPORTED

**IRVING TX 75015** 

CONTACT: **NOT REPORTED** PHONE: **NOT REPORTED** 

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 268 of 937

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 123204

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 123206

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

Order# 141197 Job# 336212 269 of 937

### SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 123205

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

Order# 141197 Job# 336212 270 of 937

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123203

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 271 of 937

## Notice of Violations (NOV)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

### SITE INFORMATION

REFERENCE #: RN102321288
CUSTOMER #: CN601144694
NAME: EXPRESS MART 8

ADDRESS: 800 E WILLIAM CANNON DR

CITY: AUSTIN
STATE: TX

ZIPCODE: **78745-5738**COUNTY: **TRAVIS** 

BUSINESS: CONVENIENCE STORE CONTACT: PAUL PEMBERTON

**SITE DETAILS** 

VIOLATION ISSUED: 01/11/06 CATEGORY: MODERATE

MEDIA: **WASTE** STATUS: **RESOLVED** 

ALLEGATION:

FAILURE TO ENSURE THAT THE RECTIFIER (IMPRESSED CURRENT SYSTEMS) AND OTHER SYSTEM COMPONENTS ARE OPERATING PROPERLY BY INSPECTING THE RECTIFIER AND COMPONENTS AT LEAST ONCE EVERY SIXTY DAYS.

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 01/11/06 CATEGORY: MODERATE

MEDIA: **WASTE** STATUS: **RESOLVED** 

ALLEGATION:

FAILURE TO ENSURE THAT THE RECTIFIER (IMPRESSED CURRENT SYSTEMS) AND OTHER SYSTEM COMPONENTS ARE OPERATING PROPERLY BY INSPECTING THE RECTIFIER AND COMPONENTS AT LEAST ONCE EVERY SIXTY DAYS.

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

**Back to Report Summary** 



**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 34931

NAME: TOWN FOOD MART

ADDRESS: 800 E WILLIAM CANNON DR

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11

TYPE: RETAIL

BEGIN DATE: 12/10/1986

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/01/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/30/2019 SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF ENV COMP

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600918452

NAME: TEXAS ENTERPRISES INC

CONTACT ADDRESS: PO BOX 6156

**AUSTIN TX 78762** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/14/2012

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **PAUL PEMBERTON**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: TEXAS ENTERPRISES INC

PHONE: (512) 3852020 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600918452

NAME: TEXAS ENTERPRISES INC

CONTACT ADDRESS: PO BOX 6156

**AUSTIN TX 78762** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/14/2012

CONTACT ROLE: OWNOPRCON
CONTACT NAME: PAUL PEMBERTON
CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: PAUL PEMBERTON

TITLE: DIR OF MAINT

ORGANIZATION: TOWN FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 3852020 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: TEXAS ENTERPRISES INC

PHONE: (512) 3852020 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 324439 SIGNATURE DATE: 07/30/2019

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF ENV COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 308580
SIGNATURE DATE: 08/21/2018

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF ENV COMPLIANCE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292041
SIGNATURE DATE: 08/23/2017

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF ENVIRONMENTAL COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274761
SIGNATURE DATE: 08/08/2016

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF MAINT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 259990
SIGNATURE DATE: 08/27/2015

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF MAINT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 242155
SIGNATURE DATE: 07/24/2014

SIGNATURE NAME & TITLE: PAUL PEMBERTON, DIR OF MAINT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224732
SIGNATURE DATE: 08/15/2013

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124009
SIGNATURE DATE: 06/29/2012

SIGNATURE NAME & TITLE: FORD SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124008
SIGNATURE DATE: 05/31/2012

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124007
SIGNATURE DATE: 06/08/2011

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124006
SIGNATURE DATE: 07/09/2010

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124005
SIGNATURE DATE: 06/18/2009

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124004
SIGNATURE DATE: 05/16/2008

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124003
SIGNATURE DATE: 06/04/2007

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124002
SIGNATURE DATE: 07/01/2006

SIGNATURE NAME & TITLE: FORD SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124001
SIGNATURE DATE: 06/30/2005

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 124000
SIGNATURE DATE: 06/24/2004

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 123999
SIGNATURE DATE: 07/01/2003

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRES

FILING STATUS: INITIAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 123998
SIGNATURE DATE: 03/04/2003

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 123997
SIGNATURE DATE: 03/01/2002

SIGNATURE NAME & TITLE: GEORGE CARTWRIGHT, SHE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 123996
SIGNATURE DATE: 11/27/2000

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COOR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 12246

APPLICATION RECEIVED DATE: 03/22/2001

SCHEDULE CONSTRUCTION DATE: 03/26/2001

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123203

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000



Order# 141197 Job# 336212 276 of 937

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL: COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123204

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 141197 Job# 336212 277 of 937

**NOT REPORTED** 

PIPING RELEASE DETECTION:

SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL: COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123205

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986



Order# 141197 Job# 336212 278 of 937

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 123206

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 38** 

Distance from Property: 0.008 mi. (42 ft.) NW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD987993565 OWNER TYPE: PRIVATE

NAME: STAR ENTERPRISES INC OWNER NAME: STAR ENTERPRISES INC

ADDRESS: 800 E WILLIAM CANON DR OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: STAR ENTERPRISES INC

CONTACT NAME: DAVID GUMBLEY

CONTACT ADDRESS: 800 E WILLIAM CANNON DR

**AUSTIN TX 78745** 

CONTACT PHONE: 214-650-0200

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/27/2007

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

DAVID GUMBLEY MANAGER 03/27/2007 SONTINA BIENVENU RDC SUPERVISOR 06/03/2002

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/12/2007

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

## Edwards Aquifer Permits (EAP)

**MAP ID# 39** 

Distance from Property: 0.006 mi. (32 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**SITE INFORMATION** 

EDWARDS ID#: 94051301 ENTITY ID#: RN104441464

NAME: WACKENHUT CORRECTIONS CORPORATION

ADDRESS: 1701 DIRECTORS BLVD

CITY: AUSTIN **ZIPCODE: 78744** COUNTY: HAYS

**INVESTIGATION/S** 

NO INVESTIGATION INFORMATION REPORTED

**COMPLIANCE** 

NO COMPLIANCE INFORMATION REPORTED

**PLAN** 

PROJECT AREA (Acres): NOT REPORTED FEE RECEIVED DATE: NOT REPORTED

FEE AMOUNT: NOT REPORTED

### **OWNER INFORMATION**

NAME: WACKENHUT CORRECTIONS CORPORATION

ADDRESS: NOT REPORTED CITY: NOT REPORTED STATE: NOT REPORTED ZIPCODE: NOT REPORTED

## Facility Registry System (FRSTX)

**MAP ID# 39** 

Distance from Property: 0.006 mi. (32 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110034243851

NAME: WACKENHUT CORRECTIONS CORPORATION

LOCATION ADDRESS: 1701 DIRECTORS BLVD

**AUSTIN, TX 78744-1144** 

COUNTY: HAYS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**WACKENHUT CORRECTIONS CORPORATION** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

9223 - CORRECTIONAL INSTITUTIONS

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

922140 - CORRECTIONAL INSTITUTIONS.

#### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 39** 

Distance from Property: 0.006 mi. (32 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRATION#: 37308 EPA ID: NOT REPORTED

TNRCC ID #: 13995

NAME: CONTRACTORS INSURANCE EXCHANGE

ADDRESS: 1701 DIRECTORS BLVD STE 520

**AUSTIN, TX 78744** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT REPORTED

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/23/2002

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE NO RECORDS** 

**Back to Report Summary** 

OWNER INFORMATION

NAME: CONTRACTORS INSURANCE EXCHANGE

ADDRESS: 1701 DIRECTORS BLVD STE 520

**AUSTIN, TX 78744** 

PHONE: NOT REPORTED

Order# 141197 Job# 336212 284 of 937

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 40** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 00327

UST ID #: 00327

NAME: CIRCLE K 2704677 ADDRESS: 1601 E ST ELMO RD

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 40** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110005119718 REGISTRY ID: 110005119718 NAME: STAR ENTERPRISES INC ADDRESS: 1601 E ST ELMO RD **AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

### Facility Registry System (FRSTX)

**MAP ID# 40** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110005119718

NAME: STAR ENTERPRISES INC

LOCATION ADDRESS: 1601 E ST ELMO RD

**AUSTIN, TX 78744** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: STAR ENTERPRISE

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 40** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110033739355

NAME: CIRCLE K STORE 2704677

LOCATION ADDRESS: 1601 E SAINT ELMO RD

**AUSTIN, TX 78744-1005** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**TEXACO SERVICE STATION** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 40** 

Distance from Property: 0.007 mi. (37 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 75642 EPA ID: TXD987993763 NAME: STAR ENTERPRISE GENERAL PARTNERSHIP

TNRCC ID #: 29989 ADDRESS: NOT REPORTED

NAME: STAR ENTERPRISES

ADDRESS: 1601 E SAINT ELMO RD PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: DAVID GUMBLEY

PHONE: **214-6500200** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/26/2007

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 58167

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 40** 

Distance from Property: 0.007 mi. (37 ft.) ESE

Elevation: 666 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 100877

LPST ID: **100877**FACILITY ID: **34920** 

NAME: TEXACO SERVICE 11

ADDRESS: 1601 E SAINT ELMO RD

**AUSTIN, TX 78744** 

#### **LEAKING TANK DETAILS**

LPST ID: 100877

NAME: TEXACO SERVICE 11

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/4/91

REPORTED DATE: 11/06/1991 ENTERED DATE: 12/04/1991 CLOSURE DATE: 05/07/1999

**PRP INFORMATION** 

NAME: STAR ENTERPRISES INC

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77090** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 123165

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123163

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123167

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)



Order# 141197 Job# 336212 292 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

STEEL CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123162

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES



Order# 141197 Job# 336212 293 of 937

#### **TANK DETAILS**

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 123166

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1984** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG



Order# 141197 Job# 336212 294 of 937

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123161

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123168

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET,SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL
SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT
SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123164

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 40** 

Distance from Property: 0.007 mi. (37 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 34920

NAME: CIRCLE K STORE 2704677 ADDRESS: 1601 E SAINT ELMO RD

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11 TYPE: RETAIL

BEGIN DATE: 05/08/1986

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/25/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/18/2017

SIGNATURE NAME & TITLE: MINDY SZANISZLO, ENV SPEC

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600134456 NAME: CIRCLE K STORES INC CONTACT ADDRESS: PO BOX 52085

PHOENIX AZ 85072

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/2012 CONTACT ROLE: OWNOPRCON CONTACT NAME: VERONICA RIVERA

CONTACT TITLE: ENV SPEC

ORGANIZATION: CIRCLE K STORES INC

PHONE: (602) 7288000 0 FAX: NOT REPORTED

EMAIL: ESS-WESTCOAST@CIRCLEK.COM

**OPERATOR** 

OPERATOR NUMBER: CN600134456 NAME: CIRCLE K STORES INC CONTACT ADDRESS: PO BOX 52085

PHOENIX AZ 85072

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/2012

CONTACT ROLE: OWNOPRCON CONTACT NAME: VERONICA RIVERA

CONTACT TITLE: ENV SPEC

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: CIRCLE K STORES INC

PHONE: **(602) 7288000 0** FAX: **NOT REPORTED** 

EMAIL: ESS-WESTCOAST@CIRCLEK.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 326747 SIGNATURE DATE: 09/19/2019

SIGNATURE NAME & TITLE: ANNETTE S TOALE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 311455
SIGNATURE DATE: 10/01/2018

SIGNATURE NAME & TITLE: ANNETTE S TOALE, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 293884
SIGNATURE DATE: 09/18/2017

SIGNATURE NAME & TITLE: MINDY SZANISZLO, ENV SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 277149
SIGNATURE DATE: 09/16/2016

SIGNATURE NAME & TITLE: MINDY SZANISZLO, ENV COMP COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 259347
SIGNATURE DATE: 09/01/2015

SIGNATURE NAME & TITLE: MINDY SZANISZLO, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 241428
SIGNATURE DATE: 08/27/2014

SIGNATURE NAME & TITLE: SREENATH THOTA, ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 226426
SIGNATURE DATE: 08/14/2013

SIGNATURE NAME & TITLE: RUTH BULMER, SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128495
SIGNATURE DATE: 08/08/2012

SIGNATURE NAME & TITLE: RUTH BULMER, SPEC ENV COMPL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128494
SIGNATURE DATE: 05/25/2012

Order# 141197 Job# 336212 299 of 937

SIGNATURE NAME & TITLE: RUTH BULMER, SPEC ENV COMP

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128493
SIGNATURE DATE: 06/08/2011

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128492
SIGNATURE DATE: 06/29/2010

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128491
SIGNATURE DATE: 06/09/2009

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128490
SIGNATURE DATE: 05/16/2008

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128489
SIGNATURE DATE: 05/18/2007

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128488
SIGNATURE DATE: 07/01/2006

SIGNATURE NAME & TITLE: FORD SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128487
SIGNATURE DATE: 06/23/2005

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128486
SIGNATURE DATE: 06/24/2004

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128485
SIGNATURE DATE: 07/01/2003

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRES

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 300 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128484
SIGNATURE DATE: 06/30/2003

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128483
SIGNATURE DATE: 02/25/2003

SIGNATURE NAME & TITLE: SCOTT HAGGERTON, HSE COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128482
SIGNATURE DATE: 03/01/2002

SIGNATURE NAME & TITLE: GEORGE CARTWRIGHT, SHE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 128481
SIGNATURE DATE: 11/27/2000

SIGNATURE NAME & TITLE: RIRENEAU, SH & E COMP COOR

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 12243

APPLICATION RECEIVED DATE: 03/16/2005

SCHEDULE CONSTRUCTION DATE: 04/11/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

NOTIFICATION CONSTRUCTION ID: 26177

APPLICATION RECEIVED DATE: 07/29/2014

SCHEDULE CONSTRUCTION DATE: 07/31/2014

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVE DAMAGES MANHOLE ON REGULAR TANK. INSTALL NEW SPILL BUCKET AND 12" MANHOLE OVER PROBE RISER.

**UNDERGROUND STORAGE TANK** 

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1984** REGISTRATION DATE: **05/08/1986** 

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 



Order# 141197 Job# 336212 301 of 937

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123161

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 123162

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

Order# 141197 Job# 336212 302 of 937

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/30/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123163

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 



Order# 141197 Job# 336212 303 of 937

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/30/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123164

TANK ID: 4A

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123165

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINMENT BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET,SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:



Order# 141197 Job# 336212 305 of 937

#### **FRP**

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 123166

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG



Order# 141197 Job# 336212 306 of 937

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123167

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINMENT BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/01/1992 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/01/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123168

TANK ID: 4

COMPARTMENT LETTER: A



Order# 141197 Job# 336212 307 of 937

SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET,SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 40** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 666 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD987993763 OWNER TYPE: PRIVATE

NAME: STAR ENTERPRISES INC OWNER NAME: STAR ENTERPRISES INC

ADDRESS: 1601 E ST ELMO RD OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744 OPERATOR NAME: STAR ENTERPRISES INC

CONTACT NAME: DAVID GUMBLEY

CONTACT ADDRESS: 1601 E SAINT ELMO RD

**AUSTIN TX 78744** 

CONTACT PHONE: 214-650-0200

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 03/26/2007

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

DAVID GUMBLEY ENVIRONMENTAL M 03/26/2007 SONDRA BIENVENU RDC SUPERVISOR 06/03/2002

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/12/2007

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION EVENT
NO CORRECTIVE ACTION EVENT(S) REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 41** 

Distance from Property: 0.007 mi. (37 ft.) WNW

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110008169891 REGISTRY ID: 110008169891 NAME: CAPITOL CHEVROLET ADDRESS: 6200 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

### Facility Registry System (FRSTX)

**MAP ID# 41** 

Distance from Property: 0.007 mi. (37 ft.) WNW

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008169891

NAME: CAPITOL CHEVROLET

LOCATION ADDRESS: 6200 S IH 35

**AUSTIN, TX 78745-4531** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: CAPITOL CHEVROLET

**CAPITOL CHEVROLET-GEO INC** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY
TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

5511 - MOTOR VEHICLE DEALERS (NEW AND USED)

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**441110 - NEW CAR DEALERS.** 

44111 - NEW CAR DEALERS

44111 - NEW CAR DEALERS

#### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 41** 

Distance from Property: 0.007 mi. (37 ft.) WNW

Elevation: 640 ft. (Higher than TP)

FACILITY INFORMATION

OWNER INFORMATION

REGISTRATION#: 84575 EPA ID: TXR000015214 NAME: CAPITOL CHEVROLET INC

TNRCC ID #: 103916 ADDRESS: PO BOX 1988

NAME: CAPITOL CHEVROLET AUSTIN, TX 78767

ADDRESS: 6200 S IH 35 PHONE: 1-512-4448888

**AUSTIN, TX 78745** 

CONTACT: GARY HOOPER

PHONE: **512-4448888** 

BUSINESS DESCRIPTION: SELLING AND MAINTAINING NEW AND USED CARS, TOP AND BODY REPAIR AND PAINT SHOP.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/25/2019

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 149658

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE / USED MOTOR OIL DRAINED FROM AUTOMOBILES. 6/24/96.

WASTE ID: 149659

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: DRAINING OF AUTOMOBILE RADIATORS, ETHYLENE GLYCOL ANTIFREEZE 6/24/96.

WASTE ID: 149661

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 313 of 937

### Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: WASTE PAINT THINNER OR PETROLEUM DISTILLATES (NAPHTHA) USED IN

#### **CLEANUP OF PAINTI**

WASTE ID: 149662

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE PAINT SLUDGE, PAINT, AND PAINT SOLVENTS FROM PAINT SPRAY BOOTH

#### **OPERATION.6**

WASTE ID: 149663

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TEKUSOLVTT - OLEFIN BLEND PARTS CLEANER CONTAMINATED WITH NON-

#### **HAZARDOUS INGREDIE**

WASTE ID: 149668

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TEKUSOLV II: D-LIMONENE, I-TETRADECENE CONTAMINATED WITH HAZARDOUS

**MATERIALS WH** 

#### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 41** 

Distance from Property: 0.007 mi. (37 ft.) WNW

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000015214 OWNER TYPE: PRIVATE

NAME: CAPITOL CHEVROLET OWNER NAME: CAPITOL CHEVROLET INC

ADDRESS: 6200 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745-4531 OPERATOR NAME: CAPITOL CHEVROLET INC

CONTACT NAME: GARY HOOPER
CONTACT ADDRESS: PO BOX 1988

**AUSTIN TX 78767-1988** 

CONTACT PHONE: 512-444-8888

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/03/2001

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

GARY HOOPER MANAGER 03/22/2019
GARY HOOPER MANAGER 12/05/2018

**INDUSTRY CLASSIFICATION (NAICS)** 

44111 - NEW CAR DEALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/18/2019

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D005 BARIUM
D006 CADMIUM



Order# 141197 Job# 336212 315 of 937

#### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

D007 CHROMIUM

D008 LEAD

D018 BENZENE

D035 METHYL ETHYL KETONE

D039 TETRACHLOROETHYLENE

**TRICHLORETHYLENE** 

D040

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 42** 

Distance from Property: 0.009 mi. (48 ft.) ESE

Elevation: 625 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03288

UST ID #: 03288

NAME: ONION CREEK TEXACO
ADDRESS: 11031 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 42** 

Distance from Property: 0.009 mi. (48 ft.) ESE

Elevation: 625 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110034639844

NAME: ONION CREEK SELF SERVICE LOCATION ADDRESS: 11031 S IH 35

**AUSTIN, TX 78747-1709** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**ONION CREEK SELF SERVICE** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

#### Notice of Violations (NOV)

**MAP ID# 42** 

Distance from Property: 0.009 mi. (48 ft.) ESE

Elevation: 625 ft. (Higher than TP)

#### SITE INFORMATION

REFERENCE #: **RN102268521**CUSTOMER #: **CN601538002** 

NAME: ONION CREEK SELF SERVICE

ADDRESS: 11031 S IH 35

CITY: AUSTIN
STATE: TX

ZIPCODE: **78747-1709**COUNTY: **TRAVIS**BUSINESS: **RETAIL** 

CONTACT: MALEK AL-SAYYED

**SITE DETAILS** 

VIOLATION ISSUED: 07/24/08
CATEGORY: MODERATE

MEDIA: WASTE STATUS: RESOLVED

ALLEGATION:

30 TAC 115.222 (3) - FAILURE TO ELIMINATE ANY AVOIDABLE GASOLINE LEAKS, AS DETECTED BY SIGHT, SOUND, OR SMELL, EXIST ANYWHERE IN THE LIQUID TRANSFER OR VAPOR BALANCE SYSTEM.

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 07/24/08
CATEGORY: MODERATE

MEDIA: **WASTE** STATUS: **RESOLVED** 

ALLEGATION:

30 TAC 115.222 (3) - FAILURE TO ELIMINATE ANY AVOIDABLE GASOLINE LEAKS, AS DETECTED BY SIGHT, SOUND, OR SMELL, EXIST ANYWHERE IN THE LIQUID TRANSFER OR VAPOR BALANCE SYSTEM.

RESOLUTION DESCRIPTION:

NOT REPORTED

VIOLATION ISSUED: 07/24/08 CATEGORY: MODERATE

MEDIA: **WASTE**STATUS: **RESOLVED** 

ALLEGATION:

30 TAC 115.222 (3) - FAILURE TO ELIMINATE ANY AVOIDABLE GASOLINE LEAKS, AS DETECTED BY SIGHT, SOUND, OR SMELL, EXIST ANYWHERE IN THE LIQUID TRANSFER OR VAPOR BALANCE SYSTEM.

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

**Back to Report Summary** 



**MAP ID# 42** 

Distance from Property: 0.009 mi. (48 ft.) ESE

Elevation: 625 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 62117

NAME: ONION CREEK TEXACO

ADDRESS: 11031 S IH 35

**AUSTIN, TX 78747** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 01/06/1992

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/18/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/18/2019

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603572421

NAME: HINDO INC

CONTACT ADDRESS: 11031 S IH 35

**AUSTIN TX 78747** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/25/2007 CONTACT ROLE: OWNCON

CONTACT NAME: MALEK AL-SAYYED

CONTACT TITLE: PRESIDENT ORGANIZATION: HINDO INC PHONE: (512) 6942223 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603572421

NAME: HINDO INC

CONTACT ADDRESS: 11031 S IH 35

**AUSTIN TX 78747** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 11/25/2007 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: MALEK AL-SAYYED

TITLE: OWNER

ORGANIZATION: ONION CREEK TEXACO

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 6942223 0

GeoSearch www.geo-search.com 888-396-0042

320 of 937 

ORGANIZATION: HINDO INC
PHONE: (512) 6942223 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 318306 SIGNATURE DATE: 03/18/2019

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 301911
SIGNATURE DATE: 03/25/2018

SIGNATURE NAME & TITLE: MALEK SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 284771
SIGNATURE DATE: 03/28/2017

SIGNATURE NAME & TITLE: MALEK SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 268507
SIGNATURE DATE: 04/20/2016

SIGNATURE NAME & TITLE: MALEK SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 250291
SIGNATURE DATE: 02/25/2015

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 234000
SIGNATURE DATE: 03/10/2014

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85349
SIGNATURE DATE: 03/26/2013

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85348
SIGNATURE DATE: 04/19/2012

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER-PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85347
SIGNATURE DATE: 01/02/2012

Order# 141197 Job# 336212 321 of 937

SIGNATURE NAME & TITLE: MALEK AL SAYYED, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85346
SIGNATURE DATE: 02/24/2010

SIGNATURE NAME & TITLE: MALEK AL SAYYED, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85345
SIGNATURE DATE: 03/27/2009

SIGNATURE NAME & TITLE: MALEK AL-SAYYED, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85344
SIGNATURE DATE: 12/14/2007

SIGNATURE NAME & TITLE: MALEK AL-SAYYED, OWNER/PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85343
SIGNATURE DATE: 12/13/2007

SIGNATURE NAME & TITLE: MALKE AL-SAYYED, OWNER/PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85342
SIGNATURE DATE: 08/28/2007

SIGNATURE NAME & TITLE: DOUG STATON, GM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85341
SIGNATURE DATE: 08/31/2006

SIGNATURE NAME & TITLE: DOUG STATON, GENERAL MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85340
SIGNATURE DATE: 07/07/2005

SIGNATURE NAME & TITLE: DOUG STATON, GEN MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85339
SIGNATURE DATE: 07/07/2004

SIGNATURE NAME & TITLE: DOUGLAS STATON, GM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85338
SIGNATURE DATE: 08/11/2003

SIGNATURE NAME & TITLE: DOUGLAS STATON, GEN MGR

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 322 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85337
SIGNATURE DATE: 09/10/2002

SIGNATURE NAME & TITLE: DOUGLAS STATON, SALES MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 85336
SIGNATURE DATE: 04/16/2001

SIGNATURE NAME & TITLE: DOUG STATON, SALES MANAGER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1991 REGISTRATION DATE: 12/31/1991

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93286

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED



Order# 141197 Job# 336212 323 of 937

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1991 REGISTRATION DATE: 12/31/1991

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 11/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93287

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1



INSTALLATION DATE: 11/01/1991 REGISTRATION DATE: 12/31/1991

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 93288

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH),ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 11/01/1991 REGISTRATION DATE: 12/31/1991

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 11/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES



#### **TANK DETAILS**

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 93289

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONTHLY PIPING TIGHTNESS TEST (@ 0.2 GPH), ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Alternative Fueling Stations (ALTFUELS)

**MAP ID# 43** 

Distance from Property: 0.011 mi. (58 ft.) ESE

Elevation: 629 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 123584

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 123584

STATION NAME: COWBOYHDAUSTIN
ADDRESS: 10917 S IH 35 FRONTAGE RD

**AUSTIN, TX 78747** 

INTERSECTION DIRECTIONS: LIVEWIRE1

STATION PHONE: 888-758-4389

STATION CURRENT STATUS: **OPEN: THE STATION IS OPEN.**TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: **ELECTRIC** 

OWNER TYPE: NOT REPORTED

FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: **NOT REPORTED**DATE THE STATION'S DETAILS WERE LAST CONFIRMED: **9/24/2019** 

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-09-24 09:09:21 UTC

**Back to Report Summary** 

327 of 937

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 44** 

Distance from Property: 0.012 mi. (63 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03038

UST ID #: 03038

NAME: 7-ELEVEN #36587
ADDRESS: 6515 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110008161489 REGISTRY ID: 110008161489

NAME: EXXON MOBIL CORPORATION

ADDRESS: 6515 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

### Facility Registry System (FRSTX)

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008161489

NAME: **EXXON MOBIL CORPORATION** LOCATION ADDRESS: **6515 S IH 35** 

**AUSTIN, TX 78744** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: EXXON RAS NO 60095

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110034675812 NAME: 7-ELEVEN STORE 36587 LOCATION ADDRESS: 6515 S IH 35

**AUSTIN, TX 78744-3411** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S: EXXON RS 60095** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

447110 - GASOLINE STATIONS WITH CONVENIENCE STORES.

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 77277 EPA ID: TXD988032181 NAME: EXXON MOBIL CORPORATION

TNRCC ID #: 36563 ADDRESS: **PO BOX 4552** 

NAME: EXXON MOBIL NO 60095 HOUSTON, TX 77210

ADDRESS: 6515 S IH 35 PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: ALDA S POOL PHONE: 713-6569075

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/30/2014

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: **75091** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED ABSORBENT (CONTAINS GASOLINE & OIL)

**Back to Report Summary** 

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: 48877

NAME: 7-ELEVEN STORE 36587

ADDRESS: 6515 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/17/1989

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/14/2018 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/11/2017 SIGNATURE NAME & TITLE: RAYMOND MCNEICE, REG COMP MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 3200 HACKBERRY RD **IRVING TX 75063** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/28/2012 CONTACT ROLE: OWNCON CONTACT NAME: RAY MCNIECE CONTACT TITLE: NOT REPORTED ORGANIZATION: 7-ELEVEN INC PHONE: (972) 8267450 0

FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: PO BOX 711

**DALLAS TX 75221** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/28/2012

CONTACT ROLE: OWNOPRCON

CONTACT NAME: RAYMOND MCNIECE CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: PEGGIE BETZ TITLE: NOT REPORTED

ORGANIZATION: 7-ELEVEN STORE 36587

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (972) 8287805 0

GeoSearch www.geo-search.com 888-396-0042

333 of 937 

ORGANIZATION: 7-ELEVEN INC
PHONE: (847) 6081136 0

FAX: (972) 8286896

EMAIL: RAYMOND.MCNIECE@7-11.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 314486 SIGNATURE DATE: 01/23/2019

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 296333
SIGNATURE DATE: 12/24/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 281014
SIGNATURE DATE: 01/19/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263551
SIGNATURE DATE: 01/19/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 246835
SIGNATURE DATE: 01/15/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230885
SIGNATURE DATE: 01/23/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37136
SIGNATURE DATE: 01/23/2013

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, GAS ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37135
SIGNATURE DATE: 01/09/2012

SIGNATURE NAME & TITLE: CARLTON LABEFF, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37134
SIGNATURE DATE: 04/01/2011

Order# 141197 Job# 336212 334 of 937

SIGNATURE NAME & TITLE: TARONZA L GRAVES, REP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37133
SIGNATURE DATE: 03/15/2010

SIGNATURE NAME & TITLE: TARONZA L GRAVES, OWNERS AUTH AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37132
SIGNATURE DATE: 03/27/2009

SIGNATURE NAME & TITLE: TARONZA L GRAVES, AUTHORIZED AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37131
SIGNATURE DATE: 03/26/2008

SIGNATURE NAME & TITLE: ADRIANNE RUTHERFORD, OWNER AUTH AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37130
SIGNATURE DATE: 04/17/2007

SIGNATURE NAME & TITLE: HEATHER GILMORE, AUTH REP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37129
SIGNATURE DATE: 03/06/2006

SIGNATURE NAME & TITLE: ERIC M MCPHEE, PERMITTING MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37128
SIGNATURE DATE: 03/15/2005

SIGNATURE NAME & TITLE: ERIC M MCPHEE, PERMITTING MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37127
SIGNATURE DATE: 03/12/2004

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, CMS PERMITTING MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37126
SIGNATURE DATE: 03/05/2003

SIGNATURE NAME & TITLE: ERIC M. MCPHEE, PERMIT TEAM LEAD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37125
SIGNATURE DATE: 03/13/2002

SIGNATURE NAME & TITLE: WENDY SALAS, PERMIT TEAM LEAD

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 335 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 37124
SIGNATURE DATE: 11/17/2000

SIGNATURE NAME & TITLE: DAPHYNE JENKINS, PROG MGR

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 3490 APPLICATION RECEIVED DATE: 04/12/2005 SCHEDULE CONSTRUCTION DATE: 07/25/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 04/06/1989

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/02/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 26587

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 



Order# 141197 Job# 336212 336 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 04/06/1989

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/02/1999** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 26588

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: **3A** NUMBER OF COMPARTMENTS: **1**INSTALLATION DATE: **01/01/1989** REGISTRATION DATE: **04/06/1989** 

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/02/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES

GeoSearch www.geo-search.com 888-396-0042

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26589

TANK ID: 3A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/04/1999 REGISTRATION DATE: 10/28/1999

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/04/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED



Order# 141197 Job# 336212 338 of 937

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26590

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/04/1999 REGISTRATION DATE: 10/28/1999

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 02/04/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26591

TANK ID: 2

Order# 141197 Job# 336212 339 of 937

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE

PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/04/1999 REGISTRATION DATE: 10/28/1999

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/04/1999

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 26592

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET

Order# 141197 Job# 336212 340 of 937

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 341 of 937

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 44** 

Distance from Property: 0.011 mi. (58 ft.) NE

Elevation: 678 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD988032181 OWNER TYPE: PRIVATE

NAME: EXXON MOBIL CORPORATION OWNER NAME: EXXON MOBIL CORPORATION

ADDRESS: 6515 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744 OPERATOR NAME: EXXON MOBIL CORPORATION

CONTACT NAME: ALDA S POOL CONTACT ADDRESS: PO BOX 4552

**HOUSTON TX 77210** 

CONTACT PHONE: 713-656-9075

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/29/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

ALDA S POOL UNKNOWN 11/29/2005

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 12/06/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D018 BENZENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 342 of 937

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

NO CORRECTIVE ACTION EVENT(S) REPORTED

### Dry Cleaner Registration Database (DCR)

**MAP ID# 45** 

Distance from Property: 0.012 mi. (63 ft.) ESE

Elevation: 632 ft. (Higher than TP)

**FACILITY INFORMATION** 

LOCATION NUMBER: RN105178545

CUSTOMER #: CN604490060
REGISTRATION ID: DCR14880

REGULATED ENTITY NAME: 360 CLEANERS

NAME: NOT REPORTED

ADDRESS: 11215 S IH 35 STE 126

**AUSTIN, TX 78747** 

COUNTY: TRAVIS

ACCOUNT NUMBER: 24006970

REGION: REGION 11

PRINCIPAL NAME: IMAM786 INC ADDRESS: 8127 MESA DR STE C299

**AUSTIN, TX 78759** 

EMAIL ADDRESS: MESACLEANERS@GMAIL.COM

PHONE NUMBER: 512-3427111

SITE TYPE: DROP STATION REGISTRATION

SITE STATUS: **ACTIVE**ELIGIBLE ANSWER: **YES** 

GROSS RECEIPT: \$150,000 OR LESS

FISCAL YEAR: FY2017
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

344 of 937

# Dry Cleaner Registration Database (DCR)

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2010
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2007
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 45** 

Distance from Property: 0.012 mi. (63 ft.) ESE

Elevation: 632 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110034479473

NAME: **DELUXE CLEANERS** 

LOCATION ADDRESS: 11215 S IH 35 STE 126

**AUSTIN, TX 78747-1864** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: DELUXE CLEANERS

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 46** 

Distance from Property: 0.014 mi. (74 ft.) SSW

Elevation: 673 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0477

UST ID #: C0477

NAME: TEXACO ONE STOP
ADDRESS: 6500 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 46** 

Distance from Property: 0.014 mi. (74 ft.) SSW

Elevation: 673 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 092956

LPST ID: **092956**FACILITY ID: **48333** 

NAME: **TEXACO ONE STOP** ADDRESS: **6500 S IH 35** 

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 092956

NAME: TEXACO ONE STOP

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 5/15/89

REPORTED DATE: 04/06/1989 ENTERED DATE: 05/15/1989 CLOSURE DATE: 03/06/1997

#### **PRP INFORMATION**

NAME: WILLIAM CANNON IH 35 LTD
ADDRESS: ADDRESS NOT REPORTED

HOUSTON TX 77057

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/04/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 115473

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

0.222

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115472

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115471

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/04/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115474

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 46** 

Distance from Property: 0.014 mi. (74 ft.) SSW

Elevation: 673 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 107373

LPST ID: **107373**FACILITY ID: **48333** 

NAME: **TEXACO ONE STOP**ADDRESS: **6500 S IH 35** 

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 107373

NAME: TEXACO ONE STOP

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/18/93

REPORTED DATE: 09/29/1993
ENTERED DATE: 11/18/1993
CLOSURE DATE: 06/23/1994

**PRP INFORMATION** 

NAME: **EDIFICO USA DEVELOPMENT**ADDRESS: **ADDRESS NOT REPORTED** 

**HOUSTON TX 77057** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/04/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 352 of 937

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 115473

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115472

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115471

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

Order# 141197 Job# 336212 354 of 937

INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/04/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115474

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: TEXACO ONE STOP

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: RIRENEAU

TITLE: NOT REPORTED

PHONE: (817) 3378338 0

**MAP ID# 46** 

Distance from Property: 0.014 mi. (74 ft.) SSW

Elevation: 673 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 48333

NAME: TEXACO ONE STOP

ADDRESS: 6500 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS REGION: 11

TYPE: RETAIL

BEGIN DATE: 05/11/1989 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1989 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1989

SIGNATURE NAME & TITLE: SAME, SAME ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601448368

NAME: COMMERCE SAVINGS ASSOCIATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 05/11/1989

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NUMBER OF COMPARTMENTS: 1 TANK ID: 3 INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

356 of 937

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115471

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 141197 Job# 336212 357 of 937

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115472

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): **NOT REPORTED** EMPTY TANK: **NOT EMPTY**STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115473

TANK ID: 1



Order# 141197 Job# 336212 358 of 937

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1989

TANK CAPACITY (GAL): 550 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/04/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 115474

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 550

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED

Order# 141197 Job# 336212 359 of 937

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

FACILITY INFORMATION

REGISTRY ID: 110031234466

NAME: MARTINE SPRINGS-SLAUGHTER CREEK GROUNDWATER PLUME

LOCATION ADDRESS: 10019 SOUTH IH-35

**AUSTIN, TX 78747-1765** 

COUNTY: TRAVIS EPA REGION: 6

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S:
HILL COUNTRY SPRINGS

PROGRAM/S LISTED FOR THIS FACILITY

CERCLIS - COMPREHENSIVE ENVIRONMENTAL RESPONSE, COMPENSATION AND LIABILITY INFORMATION SYSTEM

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110033732129

NAME: HILL COUNTRY SPRINGS

LOCATION ADDRESS: 10019 S I H 35

**AUSTIN, TX 78747-1765** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: HILL COUNTRY SPRINGS

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

312112 - BOTTLED WATER MANUFACTURING.

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 1199531976

FILE NAME: MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME

LOCATION: 10019 SOUTH IH-35, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION

CONTAMINANT: CHLOROFORM, TRICHLOROETHYLENE

ENFORCEMENT STATUS: NOT REPORTED

ACTIVITY STATUS: ACTION COMPLETED: THE REMEDY IS CONSIDERED COMPLETE AND NO FURTHER REGULATORY

**ACTION IS REQUIRED.** 

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 344774864

FILE NAME: MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME

LOCATION: 10019 SOUTH IH-35, AUSTIN

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION

CONTAMINANT: CHLOROFORM, TRICHLOROETHYLENE

ENFORCEMENT STATUS: NOT REPORTED ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 355588453

FILE NAME: MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME

LOCATION: 10019 SOUTH IH-35, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION

CONTAMINANT: CHLOROFORM, TRICHLOROETHYLENE

ENFORCEMENT STATUS: NOT REPORTED ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

FACILITY INFORMATION

FILE NUMBER: 432036810

FILE NAME: MARTINE SPRINGS - SLAUGHTER CREEK GROUND WATER PLUME

LOCATION: 10019 SOUTH IH-35, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION

CONTAMINANT: CHLOROFORM, TRICHLOROETHYLENE

ENFORCEMENT STATUS: NOT REPORTED ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

FACILITY INFORMATION

FILE NUMBER: 476641209
FILE NAME: NOT REPORTED

LOCATION: 10019 SOUTH IH-35, AUSTIN

COUNTY: NOT REPORTED

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: NOT REPORTED

CONTAMINANT: CHLOROFORM, TRICHLOROETHYLENE

ENFORCEMENT STATUS: NOT REPORTED ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 775652658

FILE NAME: MARTINE SPRINGS - SLAUGHTER CREEK GROUNDWATER PLUME

LOCATION: 10019 SOUTH IH-35, AUSTIN

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION
CONTAMINANT: CHLOROFORM, TCE
ENFORCEMENT STATUS: NOT REPORTED
ACTIVITY STATUS: NOT REPORTED

CONTAMINATION CONFIRM DATE: NOT REPORTED

YEAR DELETED: 2010

DATA QUALITY CODE: NOT REPORTED

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

#### SITE INFORMATION

REFERENCE #: RN101179521

CUSTOMER #: CN603036542

NAME: HILL COUNTRY SPRINGS

ADDRESS: NOT REPORTED

CITY: AUSTIN
STATE: TX

ZIPCODE: **78747-1765**COUNTY: **TRAVIS** 

**BUSINESS: WATER BOTTLING AND DISTRIBUTION** 

CONTACT: LONNIE ARDREY

SITE DETAILS

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014
CATEGORY: MODERATE

MEDIA: WATER STATUS: ACTIVE ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER STATUS: ACTIVE ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 



Order# 141197 Job# 336212 369 of 937

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER STATUS: ACTIVE ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

NOT REPORTED

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

NOT REPORTED

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE



Order# 141197 Job# 336212 370 of 937

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014
CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332)

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER STATUS: ACTIVE ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014
CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:



Order# 141197 Job# 336212 371 of 937

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 04/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 06/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

**RESOLUTION DESCRIPTION:** 

NOT REPORTED

VIOLATION ISSUED: 8/18/2014 CATEGORY: MODERATE

MEDIA: WATER STATUS: ACTIVE ALLEGATION:

SWTR SWMOR MAJOR MR VIOLATION 05/2014 - FAILURE TO SUBMIT SURFACE WATER MONTHLY OPERATING REPORT (SWMOR) WITH THE REQUIRED TURBIDITY AND DISINFECTANT RESIDUAL DATA BY THE REQUIRED DEADLINE FOR PLANT (TP13332).

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

VIOLATION ISSUED: 11/16/11

CATEGORY: MINOR
MEDIA: WATER
STATUS: ACTIVE
ALLEGATION:

FAILURE TO HAVE UP TO DATE CHLORINE SECONDARY STANDARDS KIT. THE STANDARDS KIT HAD EXPIRED IN JULY 2011.

RESOLUTION DESCRIPTION:

NOT REPORTED

**Back to Report Summary** 

# Superfund Enterprise Management System Archived Site Inventory (SEMSARCH)

**MAP ID# 47** 

Distance from Property: 0.014 mi. (74 ft.) ESE

Elevation: 602 ft. (Lower than TP)

#### **FACILITY INFORMATION**

EPA ID#: **TXN000606811**SITE ID#: **0606811** 

NAME: MARTINE SPRINGS-SLAUGHTER CREEK GROUNDWATER PLUME

ADDRESS: 10019 SOUTH IH-35
AUSTIN, TX 78747

COUNTY: TRAVIS

FEDERAL FACILITY: NOT A FEDERAL FACILITY

NPL: NOT ON THE NPL

NON NPL STATUS: NFRAP-SITE DOES NOT QUALIFY FOR THE NPL BASED ON EXISTING INFORMATION

SUPERFUND SITE INFORMATION: CLICK HERE

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 48** 

Distance from Property: 0.016 mi. (84 ft.) ESE

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0588

UST ID #: C0588

NAME: KOA KAMPGROUND ADDRESS: 7009 S IH 35 **AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 48** 

Distance from Property: 0.016 mi. (84 ft.) ESE

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: R SARGENT

ID#: 35773 NAME: KOA KAMPGROUND

TITLE: OWNER

NAME: KOA KAMPGROUND ADDRESS: 7003 S IH 35

ORGANIZATION: KOA KAMPGROUND

ALICTINI TV TOT

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

AUSTIN, TX 78744

CITY NOT REPORTED

COUNTY: TRAVIS
REGION: 11

PHONE: **(512) 4446322 0** 

CONTACT INFORMATION

TYPE: UNKNOWN
BEGIN DATE: 09/01/1987
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: **NO**NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: **D A STEWART, OWNER** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600246607 NAME: DON A STEWART INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY



Order# 141197 Job# 336212 376 of 937

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/02/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL: STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 92527

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1973 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/02/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

STEEL

CORROSION PROTECTION:



377 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 92528

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03294

UST ID #: 03294

NAME: MURPHY OIL USA #7211

ADDRESS: 9300 S IH 35

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110035137376

REGISTRY ID: 110035137376

NAME: WAL-MART SUPERCENTER 5317

ADDRESS: 9300 S IH 35 STE B **AUSTIN, TX 78748** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110021017807

NAME: WAL-MART STORES TEXAS LLC
LOCATION ADDRESS: 9300 S IH 35 BLDG B
AUSTIN, TX 78748

COUNTY: **TRAVIS** EPA REGION: **06** 

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NO ALTERNATIVE NAME(S) LISTED FOR THIS FACILITY

PROGRAM/S LISTED FOR THIS FACILITY

\*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

**NO NAICS DATA REPORTED** 

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

FACILITY INFORMATION
REGISTRY ID: 110034494287

NAME: MURPHY USA 7211

LOCATION ADDRESS: 127 SLAUGHTER LN W

**AUSTIN, TX 78748-1721** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: MURPHY USA 7211

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110034893042

NAME: TEXAS ROADHOUSE TEXAS ROADHOUSE AT SLAUGHTER CREEK SIDE PLAZA SHOPPING CENTER

LOCATION ADDRESS: 9300 S IH 35

**AUSTIN, TX 78748-1733** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

TEXAS ROADHOUSE TEXAS ROADHOUSE AT SLAUGHTER CREEK SIDE PLAZA SHOPPING CENTER

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110035129045

NAME: SLAUGHTERWAY RETAIL CREEKSIDE PLAZA SHOPPING CENTER

LOCATION ADDRESS: 9300 S IH 35

**AUSTIN, TX 78748-1733** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

SLAUGHTERWAY RETAIL CREEKSIDE PLAZA SHOPPING CENTER

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110035137376

NAME: WAL-MART SUPERCENTER 5317
LOCATION ADDRESS: 9300 S IH 35 STE B
AUSTIN, TX 78748-1741

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**WAL-MART SUPERCENTER 5317** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

NO SIC DATA REPORTED

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

452910 - WAREHOUSE CLUBS AND SUPERCENTERS.

45291 - WAREHOUSE CLUBS AND SUPERCENTERS

45291 - WAREHOUSE CLUBS AND SUPERCENTERS

**Back to Report Summary** 

385 of 937

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110035163480

NAME: VELOCITY CREDIT SLAUGHTER IH 35 COMMERCIAL PHASE 3

LOCATION ADDRESS: 9300 S IH 35

**AUSTIN, TX 78748-1733** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**VELOCITY CREDIT SLAUGHTER IH 35 COMMERCIAL PHASE 3** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 88775 EPA ID: TXR000062943 NAME: WAL-MART STORES TEXAS LLC

TNRCC ID #: 123666 ADDRESS: 1300 SE 8TH ST

NAME: WAL-MART SUPERCENTER 5317 BENTONVILLE, AR 72712

ADDRESS: 9300 S IH 35 STE B PHONE: 1-479-2042231

AUSTIN, TX 78748
CONTACT: ROSE ARNOLD

PHONE: **479-2778972** 

BUSINESS DESCRIPTION: WAREHOUSE CLUB RETAIL SUPERCENTER

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/27/2017

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 327536

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: EXPLOSIVES

WASTE ID: 231423

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231424

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 387 of 937

#### Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLSDATE OF GENERATION: 1/1/08

WASTE ID: 231425

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231426

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231427

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERSDATE OF GENERATION: 1/1/08

WASTE ID: 231428

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231429

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PROPANE CYLINDERS DATE OF GENERATION: 1/1/08; DUE TO WASTE

MINIMIZATION, INGREDI

WASTE ID: 231430

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231431

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDSDATE OF GENERATION: 1/1/08

WASTE ID: 231432

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LUIGUIDS DATE OF GENERATION: 1/1/08; DUE TO WASTE

MINIMIZATION, INGRED

WASTE ID: 242234

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 388 of 937

#### Industrial and Hazardous Waste Sites (IHW)

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDE. 01/01/2010

WASTE ID: 242235

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUID. 01/01/2010

WASTE ID: 250486

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED WASTE PHARMACEUTICALS

WASTE ID: 250487

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **77256** 

NAME: WAL-MART SUPERCENTER 5317

ADDRESS: 9300 S IH 35

**AUSTIN, TX 78748** 

COUNTY: TRAVIS
REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/09/2005 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/28/2005 SIGNATURE NAME & TITLE: SHEILA DEARING, LICENSING MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: **(479) 2042231 0** FAX: **(479) 2775844** 

EMAIL: TERESA.PRUITT@WAL-MART.COM

**OPERATOR** 

OPERATOR NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC

CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **NOT REPORTED**CONTACT TITLE: **NOT REPORTED** 

CONTACT INFORMATION

NAME: **NOT REPORTED**TITLE: **NOT REPORTED** 

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: **(479) 2042231 0** FAX: **(479) 2775844** 

EMAIL: TERESA.PRUITT@WAL-MART.COM

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 20142

APPLICATION RECEIVED DATE: 10/15/2004

SCHEDULE CONSTRUCTION DATE: 01/10/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/15/2004 REGISTRATION DATE: 03/09/2005

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/15/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

CONCRETE

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178838

TANK ID: 1

COMPARTMENT LETTER: A

SUBSTANCES: OIL WATER SEPARATOR OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 



Order# 141197 Job# 336212 391 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 77299

NAME: MURPHY USA 7211

ADDRESS: 9300 S IH 35 SERVICE RD BLDG J

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/14/2016 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/14/2016

SIGNATURE NAME & TITLE: HARRY LEWIS, SR DIR HSSE

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 200 E PEACH ST

EL DORADO AR 71730

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/28/2005 CONTACT ROLE: OWNCON

CONTACT NAME: BRAD WEINISCHKE

CONTACT TITLE: ENV COORD

ORGANIZATION: MURPHY OIL USA INC

PHONE: (870) 8816854 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 4734 SANFORD ST

**METAIRIE LA 70006** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/28/2005 CONTACT ROLE: OPRCON

CONTACT NAME: RUSSEL S COLVIN CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: BRAD WEINISCHKE TITLE: NOT REPORTED

ORGANIZATION: MURPHY USA 7211

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 2806956 0

GeoSearch www.geo-search.com 888-396-0042

393 of 937

ORGANIZATION: MURPHY OIL USA INC

PHONE: (504) 5612307 0
FAX: (504) 5612332
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 325307 SIGNATURE DATE: 09/03/2019

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 308883
SIGNATURE DATE: 09/06/2018

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291309
SIGNATURE DATE: 09/05/2017

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, LICNESE & PERMITS SP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 276117
SIGNATURE DATE: 09/14/2016

SIGNATURE NAME & TITLE: HARRY LEWIS, SR DIR HSSE

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274243
SIGNATURE DATE: 09/01/2016

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 257369
SIGNATURE DATE: 09/08/2015

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{ANNA\ W\ JONES,\ HSSE\ COORDINATOR}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 239924
SIGNATURE DATE: 08/08/2014

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224069
SIGNATURE DATE: 08/23/2013

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212376
SIGNATURE DATE: 08/14/2012



SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALISLT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212375
SIGNATURE DATE: 08/22/2011

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212374
SIGNATURE DATE: 08/03/2010

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212373
SIGNATURE DATE: 08/12/2009

SIGNATURE NAME & TITLE: ANNA W JONES, SR. ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212372
SIGNATURE DATE: 09/05/2008

SIGNATURE NAME & TITLE: ANNA W JONES, SR. ENV. SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212371
SIGNATURE DATE: 08/13/2007

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212370
SIGNATURE DATE: 08/12/2006

SIGNATURE NAME & TITLE: ANNA W JONES, NOT REPORTED

FILING STATUS: AMENDMENT
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212369
SIGNATURE DATE: 08/11/2006

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212125
SIGNATURE DATE: 08/04/2005

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 212124
SIGNATURE DATE: 03/23/2005

SIGNATURE NAME & TITLE: KEVIN ROUSSEL, MGR FIELD CONST

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 395 of 937

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/03/2005 REGISTRATION DATE: 03/28/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 03/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 178882

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 03/03/2005 REGISTRATION DATE: 03/28/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

Order# 141197 Job# 336212 396 of 937

STATUS: IN USE STATUS BEGIN DATE: 03/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 178883

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 03/03/2005 REGISTRATION DATE: 03/28/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 03/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: YES

TANK DETAILS

MATERIAL:



Order# 141197 Job# 336212 397 of 937

#### **FRP**

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 178884

TANK ID: 2

COMPARTMENT LETTER: B
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

 ${\tt SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE, ALARM\ (SET @<=90\%)\ W3A\ OR\ 3B}$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 398 of 937

#### Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 49** 

Distance from Property: 0.017 mi. (90 ft.) W

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000062943 OWNER TYPE: PRIVATE

NAME: WAL-MART SUPERCENTER 5317 OWNER NAME: WALMART STORES TEXAS LLC

ADDRESS: 9300 S IH 35 STE B OPERATOR TYPE: PRIVATE

AUSTIN, TX 78748-1741 OPERATOR NAME: WALMART STORES TEXAS LLC

CONTACT NAME: TERESA PRUITT
CONTACT ADDRESS: 1300 SE 8TH ST

BENTONVILLE AR 72712-6561

CONTACT PHONE: 479-204-2231

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 12/19/2014

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

**TERESA PRUITT ENVIRONMENTAL CONTACT** 12/19/2014 **TERESA PRUITT ENVIRONMENTAL CONTACT** 12/13/2013 **TERESA PRUITT ENV MGR** 09/27/2012 **TERESA PRUITT FNV MGR** 01/31/2012 **TERESA PRUITT ENVIRONMENTAL CONTACT** 02/03/2011 **TERESA PRUITT ENVIRONMENTAL C** 02/09/2010 SHEILA DEARING LICENSING MANAGER 02/09/2005

**INDUSTRY CLASSIFICATION (NAICS)** 

**45291 - WAREHOUSE CLUBS AND SUPERCENTERS** 

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 01/06/2015

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO** UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

<b>GeoSearch</b>	www.geo-search.com	888-396-0042
------------------	--------------------	--------------

Order# 141197 Job# 336212 399 of 937

### Resource Conservation & Recovery Act - Generator (RCRAGR06)

#### HAZARDOUS WASTE D001 **IGNITABLE WASTE** D002 **CORROSIVE WASTE** D003 **REACTIVE WASTE** D004 **ARSENIC** D005 **BARIUM** D006 **CADMIUM** D007 **CHROMIUM** D008 **LEAD** D009 **MERCURY** D010 **SELENIUM** D011 SILVER D016 2,4-D (2,4-DICHLOROPHENOXYACETIC ACID) D018 D022 **CHLOROFORM** D024 M-CRESOL D026 **CRESOL** D027 1,4-DICHLOROBENZENE D035 **METHYL ETHYL KETONE** D039 **TETRACHLOROETHYLENE** D043 **VINYL CHLORIDE** P001 2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT **CONCENTRATIONS GREATER THAN 0.3%** P001 WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3% P075 **NICOTINE, & SALTS** PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS P075 U002 2-PROPANONE (I) U002 **ACETONE (I)** U022 BENZO[A]PYRENE U034 ACETALDEHYDE, TRICHLORO-U034 **CHLORAL** U035 BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]-U035 **CHLORAMBUCIL** U058 2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,NBIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE U058 **CYCLOPHOSPHAMIDE** U072 **BENZENE, 1,4-DICHLORO-**U072 **P-DICHLOROBENZENE** U080 METHANE, DICHLORO-U080 **METHYLENE CHLORIDE** U122 **FORMALDEHYDE** U129 CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)-U129 LINDANE U132 **HEXACHLOROPHENE** U132 PHENOL, 2,2'-METHYLENEBIS[3,4,6-TRICHLORO-U134 HYDROFLUORIC ACID (C,T) U134 **HYDROGEN FLUORIDE (C,T)**



# Resource Conservation & Recovery Act - Generator (RCRAGR06)

U150 L-P	LIENVI ALANINE A IDIC/2 CHI ODOETHVI \AMINOI	
	HENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]-	
	LPHALAN	
	THANOL (I)	
	THYL ALCOHOL (I)	
	UTANONE (I,T)	
	THYL ETHYL KETONE (MEK) (I,T)	
	PHTHALENE	
U182 1,3,	5-TRIOXANE, 2,4,6-TRIMETHYL-	
U182 PAF	RALDEHYDE	
U188 PHE	ENOL	
U200 RES	SERPINE	
	HIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL IER,(3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-	
U205 SEL	LENIUM SULFIDE	
U205 SEL	LENIUM SULFIDE SES2 (R,T)	
U210 ETH	HENE, TETRACHLORO-	
U240 2,4-	D, SALTS & ESTERS	
U240 ACE	ETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS	
	1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYL-BUTYL)-, & SALTS, WHEN PRESENT AT NCENTRATIONS OF 0.3% OR LESS	
U248 WA	RFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS	
U249 ZIN	C PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS OF 10% OR LESS	
U279		
U409 CAF	RBAMIC ACID, [1,2-PHENYLENE BIS(IMINOCARBONOTHIOL)]BIS-, DIMETHYL ESTER	
U409 THI	OPHANATE-METHYL	
U411 PHE	ENOL, 2-(1-METHYLETHOXY)-, METHYLCARBAMATE	
U411 PRO	OPOXUR	
UNIVERSAL WAS	STE - NO UNIVERSAL WASTE REPORTED -	
CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -		
CORRECTIVE ACTION EVENT		
NO CORRECTIVE ACTION EVENT(S) REPORTED		

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: 02620

UST ID #: 02620

NAME: MAZDA SOUTH
ADDRESS: 4506 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110005076906

REGISTRY ID: 110005076906

NAME: FRIENDLY OLDSMOBILE MAZDA

ADDRESS: 4506 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

### Facility Registry System (FRSTX)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110005076906

NAME: FRIENDLY OLDSMOBILE MAZDA LOCATION ADDRESS: 4506 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: FRIENDLY OLDS MAZDA

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 72965 EPA ID: TXD360678486 NAME: FRIENDLY OLDSMOBILE MAZDA

TNRCC ID #: 27400 ADDRESS: NOT REPORTED

NAME: FRIENDLY OLDSMOBILE MAZDA

ADDRESS: 4506 S IH 35 PHONE: NOT REPORTED

AUSTIN, TX 78745

CONTACT: MARY ANN HOTMANN

PHONE: 512-4623131

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/12/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 53448

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 73885 EPA ID: NOT REPORTED NAME: FRIENDLY OLDS MAZDA

TNRCC ID #: 28294 ADDRESS: PO BOX 17667

NAME: FRIENDLY OLDS MAZDA AUSTIN, TX 78760

ADDRESS: PO BOX 17667 PHONE: 1-512-4622922

**AUSTIN, TX 78760** 

CONTACT: KIM JOHNSON PHONE: 512-4622922

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/13/2018

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 54923

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 54924

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



### Leaking Petroleum Storage Tanks (LPST)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 100559

LPST ID: **100559**FACILITY ID: **51500** 

NAME: FRIENDLY OLDS MAZDA

ADDRESS: 4506 S IH 35

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 100559

NAME: FRIENDLY OLDS MAZDA
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.1 - GW IMPACTED NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/7/91

REPORTED DATE: 10/17/1991 ENTERED DATE: 11/07/1991 CLOSURE DATE: 12/10/1998

#### **PRP INFORMATION**

NAME: MAUND FAMILY LTD PARTNERSHIP
ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78767
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1987 REGISTRATION DATE: 03/01/1990

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 09/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

# TANK DETAILS MATERIAL:

#### COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE),FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

#### **NOT REPORTED**

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 407 of 937

### Leaking Petroleum Storage Tanks (LPST)

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 124419

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 03/01/1990

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/04/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 124420

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

### Leaking Petroleum Storage Tanks (LPST)

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 157430 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 03/01/1990

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 01/01/1991 TANK CAPACITY (GAL): 500 REGULATORY STATUS: EXEMPT

STATUS: OUT OF USE SUBSTANCES: UNKNOWN

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



### Notice of Violations (NOV)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

#### **SITE INFORMATION**

REFERENCE #: RN100676451
CUSTOMER #: CN601237522

NAME: MAZDA SOUTH ADDRESS: 4506 S IH 35

CITY: AUSTIN
STATE: TX

ZIPCODE: 78745-2025
COUNTY: TRAVIS
BUSINESS: RETAIL
CONTACT: TIM HARDISON

**SITE DETAILS** 

VIOLATION ISSUED: 09/16/09 CATEGORY: MODERATE

MEDIA: **WASTE** STATUS: **RESOLVED** 

ALLEGATION:

FAILURE TO CONDUCT RECONCILIATION OF DETAILED INVENTORY CONTROL RECORDS AT LEAST ONCE EACH MONTH, SUFFICIENTLY ACCURATE TO DETECT A RELEASE WHICH EQUALS OR EXCEEDS THE SUM OF 1.0 PERCENT OF THE TOTAL SUBSTANCE FLOWTHROUGH FOR THE MONTH PLUS 130 GALLONS.

RESOLUTION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **51500** 

NAME: ROGER BEASLEY MAZDA SOUTH

ADDRESS: 4506 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/08/2019
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/22/2018

SIGNATURE NAME & TITLE: STEVE TONSI, CFO ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601237522

NAME: ROGER BEASLEY IMPORTS INC

CONTACT ADDRESS: 4506 S IH 35

**AUSTIN TX 78745** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2001

CONTACT ROLE: OWNOPRCON
CONTACT NAME: STEVE TONSI
CONTACT TITLE: CONTROLLER

ORGANIZATION: ROGER BEASLEY IMPORTS INC

PHONE: (512) 9122116 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN601237522

NAME: ROGER BEASLEY IMPORTS INC

CONTACT ADDRESS: 4506 S IH 35

**AUSTIN TX 78745** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/01/2001

CONTACT ROLE: OWNOPRCON
CONTACT NAME: STEVE TONSI
CONTACT TITLE: CONTROLLER

CONTACT INFORMATION

NAME: STEVE TONSI

TITLE: CFO

ORGANIZATION: MAZDA SOUTH

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 9122116 0

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 411 of 937

ORGANIZATION: ROGER BEASLEY IMPORTS INC

PHONE: (512) 9122116 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 322812 SIGNATURE DATE: 06/22/2019

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 306660
SIGNATURE DATE: 06/22/2018

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 322811
SIGNATURE DATE: 06/22/2018

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 288980
SIGNATURE DATE: 05/31/2017

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 272899
SIGNATURE DATE: 06/01/2016

SIGNATURE NAME & TITLE: ANDREW CRAIN, FACIL DIR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 255497
SIGNATURE DATE: 06/30/2015

SIGNATURE NAME & TITLE:  $\mbox{\bf JERRY JORSCHICK},\mbox{\bf DIR OF FAC}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 239455
SIGNATURE DATE: 07/30/2014

SIGNATURE NAME & TITLE: JERRY JORSCHICK, DIR OF FACILTY

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 222617
SIGNATURE DATE: 07/25/2013

SIGNATURE NAME & TITLE: JERRY JORSCHICK, OPS MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132557
SIGNATURE DATE: 07/10/2012



Order# 141197 Job# 336212 412 of 937

SIGNATURE NAME & TITLE: JERRY JORSCHICK, OPS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132556
SIGNATURE DATE: 05/20/2011

SIGNATURE NAME & TITLE: TIM HARDISON, OPERATIONS MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132555
SIGNATURE DATE: 06/22/2010

SIGNATURE NAME & TITLE: TIM HARDISON, OPER MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132554
SIGNATURE DATE: 07/02/2009

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132553
SIGNATURE DATE: 07/31/2008

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132552
SIGNATURE DATE: 08/07/2007

SIGNATURE NAME & TITLE: STEVE TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132551
SIGNATURE DATE: 08/01/2005

SIGNATURE NAME & TITLE: STEVEN TONSI, CFO

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132550
SIGNATURE DATE: 07/26/2004

SIGNATURE NAME & TITLE: JIM BAGAN, MGR PARTNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132549
SIGNATURE DATE: 07/01/2003

SIGNATURE NAME & TITLE: STEVE TONSI, NOT REPORTED

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132548
SIGNATURE DATE: 07/10/2002

SIGNATURE NAME & TITLE: CAROL BUNDY, CONTROLLER

FILING STATUS: RENEWAL

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 132547
SIGNATURE DATE: 05/01/2001

SIGNATURE NAME & TITLE: CAROL BUNDY, CONTROLLER

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 09/01/1987 REGISTRATION DATE: 03/01/1990

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 09/01/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 124419

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, AUTOMATIC TANK GAUGE TEST & INVENTORY

CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),TRIENNIAL TIGHTNESS TEST (FOR SUCTION/GRAVITY PIPING)

PIPE COMPLIANCE FLAG



Order# 141197 Job# 336212 414 of 937

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 03/01/1990

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/04/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 124420

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 157430 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 03/01/1990

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 01/01/1991 TANK CAPACITY (GAL): 500 REGULATORY STATUS: EXEMPT

STATUS: OUT OF USE SUBSTANCES: UNKNOWN

**MATERIAL OF CONSTRUCTION** 



Order# 141197 Job# 336212 415 of 937

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO **CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: YES CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 50** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD360678486 OWNER TYPE: PRIVATE

NAME: FRIENDLY OLDSMOBILE MAZDA OWNER NAME: FRIENDLY OLDSMOBILE MAZDA

ADDRESS: 4506 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: FRIENDLY OLDSMOBILE MAZDA

CONTACT NAME: MARY ANN HOTMANN
CONTACT ADDRESS: PO BOX 1608
AUSTIN TX 78767

CONTACT PHONE: 512-462-3131

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 07/27/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

— CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRICHLORO-1,2-TRI

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

GeoSearch www.geo-search.com 888-396-0042

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 51** 

Distance from Property: 0.017 mi. (90 ft.) ESE

Elevation: 616 ft. (Lower than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110033551323

NAME: 10001 SOUTH IH 35 INVESTMENTS PARKSIDE PAVILION OFFICE CENTER

LOCATION ADDRESS: 10001 S IH 35

**AUSTIN, TX 78747-1722** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

10001 SOUTH IH 35 INVESTMENTS PARKSIDE PAVILION OFFICE CENTER

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 51** 

Distance from Property: 0.017 mi. (90 ft.) ESE

Elevation: 616 ft. (Lower than TP)

FACILITY INFORMATION

REGISTRY ID: 110033904620

NAME: HARVEY CLEARY BUILDERS PARKSIDE PAVILLION

LOCATION ADDRESS: 10001 S IH 35

**AUSTIN, TX 78747-1722** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

HARVEY CLEARY BUILDERS PARKSIDE PAVILLION

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

1542 - GENERAL CONTRACTORS-NONRESIDENTIAL BUILDINGS, OTHER THAN INDUSTRIAL BUILDINGS AND WAREHOUSES

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Hazardous Materials Incident Reporting System (HMIRSR06)

**MAP ID# 52** 

Distance from Property: 0.017 mi. (90 ft.) WNW

Elevation: 652 ft. (Higher than TP)

**INCIDENT INFORMATION** 

REPORT #: E-2012100335

REPORT SUBMISSION SOURCE: NOT REPORTED
REPORT TYPE: A HAZARDOUS MATERIAL INCIDENT

NRC REPORT NUMBER: 1025747

FEDERAL DOT REPORT NUMBER: NOT REPORTED

FEDERAL AGENCY NAME: NOT REPORTED

DATE: 9/27/2012
INCIDENT LOCATION:

9400 SOUTH IH 35 NORTHBOUND LN

AUSTIN, TX TRAVIS

#### **CARRIER INFORMATION**

NAME: COASTAL TRANSPORT CO. INC.

ADDRESS: 1603 ACKERMAN RD

SAN ANTONIO, TX 78219-3518
MODE OF TRANSPORTATION: HIGHWAY

MODE OF TRANSPORTATION: **HIGHWAY** TRANSPORTATION PHASE: **IN TRANSIT** 

#### **COMMODITY DETAILS**

IDENTIFICATION NUMBER: UN1203

COMMODITY SHIPPING NAME: GASOLINE INCLUDES GASOLINE MIXED WITH ETHYL ALCOHOL WITH NOT MORE THAN 10%

**ALCOHOL** 

TRADE NAME: GASOLINE

QUANTITY RELEASED: 2900 LIQUID - GALLON

PACKAGING: CARGO TANK MOTOR VEHICLE (CTMV)
HAZARDOUS CLASS: FLAMMABLE - COMBUSTIBLE LIQUID

.

#### **FAILURE DESCRIPTION**

WHAT FAILED: 137 MANWAY OR DOME COVER

HOW FAILED: 308 - LEAKED
FAILURE CAUSE DESCRIPTION:
531 - ROLLOVER ACCIDENT
DESCRIPTION OF EVENTS:

VEHICLE WAS N-B ON IH35 MAIN LANES. DRIVER CLAIMS HE SWERVED TO RIGHT TO AVOID ANIMAL CROSSING ROADWAY. VEHICLE RAN OFF RIGHT SIDE OF ROADWAY AND ROLLED ONTO RIGHT SIDE. VEHICLE CAME TO REST ON IT'S RIGHT SIDE ON THE GRASSY MEDIAN SEPARATING THE MAINLINES FROM FRONTAGE ROAD. DURING ROLLOVER A COMPARTMENT MANHOLE COVER CAME LOOSE TO SECONDARY CLAMP POSITION. APPROXIMATELY 2900 GALLONS OF GASOLINE FLOWED FROM THE PARTIALLY OPENED MANHOLE COVER. FIRST RESPONDERS CLAMPED THE MANHOLE SHUT PRIOR TO EVACUATION OF THE PRODUCT. THE REMAINING PRODUCT WAS REMOVED FROM THE CARGO TANK. THE VEHICLE WAS RIGHTED AND MOVED AWAY TO STORAGE. ENVIRONMENTAL SPILL PERSONNEL WERE ON SCENE AND BEGAN REMEDIATION WORK IMMEDIATELY. CONTAMINATED SOIL WAS REMOVED AND REPLACED. THE ENVIRONMENTAL CLEAN UP EFFORTS WERE COMPLETED WITHIN 36 HOURS. DURING THE PRODUCT REMOVAL NORTHBOUND TRAFFIC

### Hazardous Materials Incident Reporting System (HMIRSR06)

#### WAS DIVERTED TO TOLL 130.

RECOMMENDATIONS/ACTIONS TAKEN:

THIS COMPANY BEGAN SMITH SYSTEM DRIVER TRAINING FOR ALL CURRENT CMV DRIVERS ON JANUARY 2012. ALL NEW HIRE DRIVERS ARE ATTENDING SMITH SYSTEM DRIVER TRAINING DURING HIS/HER NEW HIRE TRAINING. WE WILL ALSO DISCUSS THE FACTS OF THIS INCIDENT WITH ALL DRIVERS DURING UPCOMING SAFETY MEETINGS. WE ARE ALSO PURCHASING 125 NEW TRACTORS THIS YEAR. THESE UNITS WILL BE EQUIPPED WITH ANTI-ROLLOVER TECHNOLOGY TO ASSIST DRIVERS IN MAINTAINING BETTER CONTROL DURING EVASIVE MANEUVERS TURNS AND CURVES.

#### **INCIDENT DETAILS**

SPILLAGE RESULT IDENTIFIED: NOT REPORTED
FIRE RESULT IDENTIFIED: NOT REPORTED
EXPLOSION RESULT IDENTIFIED: NOT REPORTED
WATER SEWER RESULT IDENTIFIED: NOT REPORTED
GAS DISPERSION RESULT IDENTIFIED: NOT REPORTED

ENVIRONMENTAL DAMAGE RESULT IDENTIFIED: NOT REPORTED

NO RELEASE RESULT IDENTIFIED: NOT REPORTED
OTHER CLEANUP IDENTIFIED: NOT REPORTED
FIRE EMS REPORT IDENTIFIED: NOT REPORTED
FIRE EMS EMS REPORT NUMBER: NOT REPORTED
POLICE REPORT NUMBER: NOT REPORTED
IN HOUSE CLEANUP IDENTIFIED: NOT REPORTED

### Facility Registry System (FRSTX)

**MAP ID# 53** 

Distance from Property: 0.018 mi. (95 ft.) ESE

Elevation: 641 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110035115853

NAME: SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC

LOCATION ADDRESS: 9725 S IH 35

**AUSTIN, TX 78744-7930** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS OFC** 

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

**MAP ID# 53** 

Distance from Property: 0.018 mi. (95 ft.) ESE

Elevation: 641 ft. (Higher than TP)

**FACILITY INFORMATION** 

CONTACT INFORMATION

ID#: 78027 NAME: NOT REPORTED NAME: SOUTH AUSTIN AREA ENGINEERS & SPECIAL CREWS TITLE: NOT REPORTED

**OFC** 

REGION: 11

ADDRESS: 9725 S IH 35 ORGANIZATION: SOUTH AUSTIN AREA ENGINEERS & SPECIAL

**CREWS OFC** 

**AUSTIN, TX 78744** MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 5853358 0

COUNTY: TRAVIS

TYPE: FLEET REFUELING BEGIN DATE: 06/01/2006

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 2

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/13/2006 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 06/01/2006 SIGNATURE NAME & TITLE: ROBERT NORMENT, FAC COORD

**ENFORCEMENT ACTION DATE: NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600803456

NAME: TEXAS DEPARTMENT OF TRANSPORTATION

CONTACT ADDRESS: 150 E RIVERSIDE DR

**AUSTIN TX 78704** 

TYPE: STATE GOVERNMENT BEGIN DATE: 06/01/2006 CONTACT ROLE: OWNCON

CONTACT NAME: JAMES STEVENSON

CONTACT TITLE: MAINTENANCE DEPUTY DIVISION DIRECTOR ORGANIZATION: TEXAS DEPARTMENT OF TRANSPORTATION

PHONE: (512) 4163056 0 FAX: (512) 4162914

EMAIL: DEBA.DUTTA@TXDOT.GOV

**OPERATOR** 

OPERATOR NUMBER: CN600803456

NAME: TEXAS DEPARTMENT OF TRANSPORTATION

CONTACT ADDRESS: 135 SLATON RD

LUBBOCK TX 79404

TYPE: STATE GOVERNMENT BEGIN DATE: 06/01/2006 CONTACT ROLE: OPRCON

CONTACT NAME: SEVERIANO K SISNEROS



424 of 937

CONTACT TITLE: BROWNFIELD AREA ENGINEER

ORGANIZATION: TEXAS DEPARTMENT OF TRANSPORTATION

PHONE: **(806) 6374501 0** FAX: **NOT REPORTED** 

EMAIL: SEVE.SISNEROS@TXDOT.GOV

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 21351

APPLICATION RECEIVED DATE: 12/17/2005

SCHEDULE CONSTRUCTION DATE: 01/16/2006

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 206812 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 06/13/2006

INSTALLATION DATE: 06/01/2006 STATUS BEGIN DATE: 06/01/2006

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **YES** NONE: **NO** 

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 206813 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 2 REGISTRATION DATE: 06/13/2006

INSTALLATION DATE: 06/01/2006 STATUS BEGIN DATE: 06/01/2006

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: YES NONE: NO

STAGE I VAPOR RECOVERY: EXEMPT BY TCEQ RULE

STAGE I INSTALLATION DATE: NOT REPORTED

**Back to Report Summary** 



### Tier I I Chemical Reporting Program Facilities (TIERII)

**MAP ID# 53** 

Distance from Property: 0.018 mi. (95 ft.) ESE

Elevation: 641 ft. (Higher than TP)

SITE INFORMATION

UNIQUE ID: 2TZK4X05KP3G

SITE ID: FATR20122TZK4X05KP3G

NAME: TXDOT-AUSTIN-SPECIAL CREW MAINTENANCE

ADDRESS: 9725 IH 35 SOUTH
AUSTIN, TX 78744

SIGNED DATE: 1/25/2013

VALIDATION REPORT: NOT REPORTED
MAILING ADDRESS: NOT REPORTED

SITE DETAILS

SITE TYPE: REG & ADMIN OF TRANS PROGRAMS

CHEMICAL LOCATION:

**INSIDE BUILDING 12;BRIDGE CREW STORAGE AREA** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

SOUTH EAST CORNER OF YARD

CHEMICAL AMOUNT: 2000 GALLONS

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL IN TRUCK BAY** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

INSIDE BUILDING 12; NORTH WALL OF TRUCK BAY

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: DISTRICT OFFICE

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: DISTRICT OFFICE

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12; BRIDGE CREW STORAGE AREA** 

426 of 937

Order# 141197 Job# 336212

### Tier I I Chemical Reporting Program Facilities (TIERII)

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL IN TRUCK BAY** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

INSIDE BUILDING 12; NORTH WALL OF TRUCK BAY

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

**SOUTH EAST CORNER OF YARD** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**SOUTH EAST CORNER OF YARD** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: DISTRICT OFFICE

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: DISTRICT OFFICE

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12;BRIDGE CREW STORAGE AREA** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

INSIDE BUILDING 12; NORTH WALL IN TRUCK BAY

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL OF TRUCK BAY** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

SOUTH EAST CORNER OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

SOUTH EAST CORNER OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

DISTRICT OFFICE

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: EAST SIDE OF YARD

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12; BRIDGE CREW STORAGE AREA** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL IN TRUCK BAY** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL OF TRUCK BAY** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**SOUTH EAST CORNER OF YARD** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION:

**INSIDE BUILDING 12;BRIDGE CREW STORAGE AREA** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

**SOUTH EAST CORNER OF YARD** 

CHEMICAL AMOUNT: 2000 GALLONS

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL IN TRUCK BAY** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION:

**INSIDE BUILDING 12; NORTH WALL OF TRUCK BAY** 

CHEMICAL AMOUNT: 60000 POUNDS

CHEMICAL LOCATION: **EAST SIDE OF YARD** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL LOCATION: **EAST SIDE OF YARD** 

CHEMICAL AMOUNT: NOT REPORTED

CHEMICAL NAME: SILICA SAND MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: LIQUID DEICER -MAGNESIUM CHLORIDE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES CHEMICAL NAME: PORTLAND CEMENT MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: NOT REPORTED MIXTURE: YES CHEMICAL NAME: SANDBLASTING SAND

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED CHEMICAL NAME: UNLEADED GASOLINE MAXIMUM AMOUNT: NOT REPORTED



Order# 141197 Job# 336212 428 of 937

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: SILICA SAND
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: LIQUID DEICER - MAGNESIUM CHLORIDE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES
CHEMICAL NAME: PORTLAND CEMENT
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: **NOT REPORTED** MIXTURE: **YES**CHEMICAL NAME: **SANDBLASTING SAND**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED
CHEMICAL NAME: UNLEADED GASOLINE
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: SILICA SAND
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: MAGNESIUM CHLORIDE COMPLEX - LIQUID

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES**CHEMICAL NAME: **PORTLAND CEMENT**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: **NOT REPORTED** MIXTURE: **YES**CHEMICAL NAME: **SANDBLASTING SAND**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED
CHEMICAL NAME: UNLEADED GASOLINE



MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: MAGNESIUM CHLORIDE COMPLEX -LIQUID

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES
CHEMICAL NAME: UNLEADED GASOLINE
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: SILICA SAND
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: MAGNESIUM CHLORIDE COMPLEX - LIQUID

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES
CHEMICAL NAME: PORTLAND CEMENT
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: **NOT REPORTED** MIXTURE: **YES**CHEMICAL NAME: **SANDBLASTING SAND**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED
CHEMICAL NAME: UNLEADED GASOLINE
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: MAGNESIUM CHLORIDE COMPLEX -LIQUID

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES
CHEMICAL NAME: UNLEADED GASOLINE
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

Order# 141197 Job# 336212 430 of 937

CHEMICAL NAME: SILICA SAND
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED

CHEMICAL NAME: LIQUID DEICER -MAGNESIUM CHLORIDE

MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES**CHEMICAL NAME: **PORTLAND CEMENT**MAXIMUM AMOUNT: **NOT REPORTED** 

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: NOT REPORTED MIXTURE: YES
CHEMICAL NAME: SANDBLASTING SAND
MAXIMUM AMOUNT: NOT REPORTED

FIRE: NOT REPORTED GAS: NOT REPORTED LIQUID: NOT REPORTED SOLID: YES

PURE: YES MIXTURE: NOT REPORTED
CHEMICAL NAME: UNLEADED GASOLINE
MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: NOT REPORTED MIXTURE: YES

CHEMICAL NAME: DIESEL

MAXIMUM AMOUNT: NOT REPORTED

FIRE: YES GAS: NOT REPORTED LIQUID: YES SOLID: NOT REPORTED

PURE: **NOT REPORTED** MIXTURE: **YES** MIXTURE CHEMICAL: **PORTLAND CEMENT** 

MIXTURE CHEMICAL: QUARTZ MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: CYRSTALLINE SILICA

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: GYPSUM/CALCIUM SULFATE DIHYDRATE

MIXTURE CHEMICAL: PORTLAND CEMENT

MIXTURE CHEMICAL: QUARTZ
MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: CYRSTALLINE SILICA

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES
MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: GYPSUM/CALCIUM SULFATE DIHYDRATE

MIXTURE CHEMICAL: PORTLAND CEMENT

MIXTURE CHEMICAL: QUARTZ MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: CYRSTALLINE SILICA

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES
MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: GYPSUM/CALCIUM SULFATE DIHYDRATE

MIXTURE CHEMICAL: RESPSIRABLE QUARTZ

MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES
MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: PORTLAND CEMENT

MIXTURE CHEMICAL: QUARTZ MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: CYRSTALLINE SILICA

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: GYPSUM/CALCIUM SULFATE DIHYDRATE

MIXTURE CHEMICAL: RESPSIRABLE QUARTZ

MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: PORTLAND CEMENT

MIXTURE CHEMICAL: QUARTZ MIXTURE CHEMICAL: WATER

MIXTURE CHEMICAL: CYRSTALLINE SILICA

MIXTURE CHEMICAL: POTASSIUM CARBOXYLATES MIXTURE CHEMICAL: COMPLEX CARBOHYDRATES

MIXTURE CHEMICAL: GYPSUM/CALCIUM SULFATE DIHYDRATE

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 54** 

UST ID #: C0616

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0616

NAME: NATIONAL TIRE WAREHOUSE

ADDRESS: 4720 S IH 35 AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C
HISTORICAL RECORD?: NO
COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110005072287

REGISTRY ID: 110005072287

NAME: NATIONAL TIRE & BATTERY #8686

ADDRESS: 4720 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

# Facility Registry System (FRSTX)

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110005072287

NAME: NATIONAL TIRE & BATTERY #8686

LOCATION ADDRESS: 4720 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**ONION CREEK VOLKSWAGEN** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

811111 - GENERAL AUTOMOTIVE REPAIR.

## Facility Registry System (FRSTX)

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRY ID: 110034434583

NAME: NTW

LOCATION ADDRESS: 4720 S I H 35

**AUSTIN, TX 78745-2439** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

NTW

PROGRAM/S LISTED FOR THIS FACILITY

TX-TCEQ ACR - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 73493 EPA ID: TXD118926419 NAME: ONION CREEK VOLKSWAGEN

TNRCC ID #: 27906

ADDRESS: PO BOX 1354

NAME: ONION CREEK VOLKSWAGEN

**AUSTIN, TX 78767** 

ADDRESS: 4720 S IH 35

PHONE: 1-512-4418200

**AUSTIN, TX 78745** CONTACT: KENNY BLEWETT

PHONE: 512-4418200

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES

WASTE RECEIVER: NO WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/12/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 54288

WASTE CODE STATUS: INACTIVE

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

437 of 937 

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 110718

LPST ID: **110718**FACILITY ID: **10845** 

NAME: NTW

ADDRESS: 4720 S IH 35

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 110718 NAME: NTW

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 3/29/96

REPORTED DATE: 03/26/1996
ENTERED DATE: 03/29/1996
CLOSURE DATE: 09/17/1996

#### **PRP INFORMATION**

PHONE: NOT REPORTED

NAME: NTW

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78745
CONTACT: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/22/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 438 of 937

#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 37181** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37182

TANK ID: 2

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 439 of 937

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37184

TANK ID: 3

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37183

TANK ID: 4

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL



Order# 141197 Job# 336212 441 of 937

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37193

TANK ID: 5

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37192

TANK ID: 6

Order# 141197 Job# 336212 442 of 937

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37191

TANK ID: 7

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 8 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37190

TANK ID: 8

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 9 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

Order# 141197 Job# 336212 444 of 937

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT
TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37189

TANK ID: 9

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 10 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

Order# 141197 Job# 336212 445 of 937

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37188

TANK ID: 10

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 11 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 37187

TANK ID: 11

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

Order# 141197 Job# 336212 446 of 937

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 12 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

00000000

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 37186

TANK ID: 12

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

Order# 141197 Job# 336212 447 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 13 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37185

TANK ID: 13

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 448 of 937

**MAP ID# 54** 

ID#: 10845

NAME: NTW

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: MIKE LAUGHLIN

**CONTACT INFORMATION** 

TITLE: NOT REPORTED ADDRESS: 4720 S IH 35 ORGANIZATION: NTW

> **AUSTIN, TX 78745** MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: TRAVIS **CITY NOT REPORTED** 

REGION: 11 PHONE: (512) 4481689 0

TYPE: UNKNOWN BEGIN DATE: 07/24/1986 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/17/1986

SIGNATURE NAME & TITLE: K BLEWETT, SVC MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600916605 NAME: NATIONAL TIRE WAREHOUSE

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 03/31/1991

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986 EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 500



449 of 937

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/22/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37181

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 141197 Job# 336212 450 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37182

TANK ID: 2

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37183

TANK ID: 4

Order# 141197 Job# 336212 451 of 937

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37184

TANK ID: 3

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED

Order# 141197 Job# 336212 452 of 937

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 13 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37185

TANK ID: 13

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 12 NUMBER OF COMPARTMENTS: 1

Order# 141197 Job# 336212 453 of 937

INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37186

TANK ID: 12

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 11 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: EXEMPT TANK DESIGN SINGLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STATUS: IN USE

STATUS BEGIN DATE: 01/01/1985

Order# 141197 Job# 336212 454 of 937

#### **STEEL**

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 37187

TANK ID: 11

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 10 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 37188

TANK ID: 10

COMPARTMENT LETTER: A

SUBSTANCES: HYDRAULIC LIFT OIL
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 9 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37189

TANK ID: 9

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 



MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 8 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37190

TANK ID: 8

COMPARTMENT LETTER:  ${f A}$ 

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO

Order# 141197 Job# 336212 457 of 937

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 7 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37191

TANK ID: 7

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 6 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

Order# 141197 Job# 336212 458 of 937

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 37192

TANK ID: 6

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 50 EMPTY TANK: NOT EMPTY

STATUS: IN USE

INTERNAL PROTECTION DATE: NOT REPORTED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

STATUS BEGIN DATE: 01/01/1985

REGULATORY STATUS: EXEMPT

TANK DESIGN DOUBLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 459 of 937

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 37193

TANK ID: 5

COMPARTMENT LETTER: A

SUBSTANCES: **HYDRAULIC LIFT OIL**OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 50

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 54** 

Distance from Property: 0.018 mi. (95 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD118926419 OWNER TYPE: OTHER

NAME: NATIONAL TIRE & BATTERY #8686 OWNER NAME: ONION CREEK VOLKSWAGEN

ADDRESS: 4720 S IH 35 OPERATOR TYPE: OTHER

AUSTIN, TX 78745 OPERATOR NAME: ONION CREEK VOLKSWAGEN

CONTACT NAME: AARON ENGI

CONTACT ADDRESS: 4280 PROFESSIONAL CENTER DR. STE 400

**PALM BEACH GARDENS FL 33410** 

CONTACT PHONE: 561-383-3000

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/08/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

DANIELLE MELNICK MGR. ENV. COMPL. 02/06/2019
DAVID ZOLNOWSKI RISK MANAGER 03/08/2005

INDUSTRY CLASSIFICATION (NAICS)
811111 - GENERAL AUTOMOTIVE REPAIR

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 04/02/2019

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D008 LEAD

D039 TETRACHLOROETHYLENE

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 461 of 937

#### Resource Conservation & Recovery Act - Generator (RCRAGR06)

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 55** 

Distance from Property: 0.02 mi. (106 ft.) ESE

Elevation: 609 ft. (Lower than TP)

PROGRAM ID: **T3130**RN NUMBER: **RN107080186** 

NAME: SOUTH POINT NISSAN PREOWEND

ADDRESS: 6001 S IH 35

**AUSTIN, TX 78744** 

STATUS: **INACTIVE**STATUS DATE: **2/10/14** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 56** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 637 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 0J041

UST ID #: **OJ041** 

NAME: CRUMLEY'S GROCERY ADDRESS: 10730 S IH 35 **AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## Emergency Response Notification System (ERNSTX)

**MAP ID# 56** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 637 ft. (Higher than TP)

GSID#: 563116

NRC REPORT #: 563116

INCIDENT LOCATION: ONION CREEK LIQUOR STORE, NW CORNER OF BUILDING

INCIDENT ADDRESS: 10730 SOUTH INTERSTATE HWY 35

**AUSTIN, TX** 

INCIDENT COUNTY: TRAVIS

#### **INCIDENT INFORMATION**

NRC REPORT #: 563116

DESCRIPTION OF INCIDENT: THE CALLER DISCOVERED A 55 GALLON GREY DRUM OF MATERIAL NEXT TO THE BUILDING.

TYPE OF INCIDENT: STORAGE TANK

CAUSE: **DUMPING** 

DATE/TIME: 4/16/2001 5:15:00 PM

DISCOVERED/OCCURED/PLANNED: DISCOVERED

POTENTIAL FLAG: YES

### REPORT RECEIPT AND SUSPECTED RESPONSIBLE PARTY INFORMATION

NRC REPORT #: 563116

DATE/TIME RECEIVED: 4/16/2001
DATE/TIME COMPLETE: 4/16/2001

CALL TYPE: **INCIDENT** SOURCE: **TELEPHONE** 

RESPONSIBLE COMPANY: NOT REPORTED ADDRESS: ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

RESPONSIBLE COMPANY ORGANIZATION TYPE: UNKNOWN

#### **INCIDENT DETAILS**

NRC REPORT #: 563116
FIRE INVOLVED: NO

**EVACUATION RADIUS: NOT REPORTED** 

ANY INJURIES: NO
ANY EVACUATIONS: NO
ANY FATALITIES: NO
ANY DAMAGES: NO

DAMAGE AMOUNT: NOT REPORTED
MEDIUM DESCRIPTION: LAND
ADDITIONAL MEDIUM INFO: SOIL
BODY OF WATER: NOT REPORTED
TRIBUTARY OF: NOT REPORTED

RELEASE SECURED: YES

ESTIMATED DURATION OF RELEASE: NOT REPORTED

RELEASE RATE: NOT REPORTED

REMEDIAL ACTION: NO CORRECTIVE ACTION TAKEN

STATE AGENCY ON SCENE: NOT REPORTED STATE AGENCY REPORT #: NOT REPORTED

Order# 141197 Job# 336212 465 of 937

## Emergency Response Notification System (ERNSTX)

OTHER AGENCY NOTIFIED: NOT REPORTED WATER SUPPLY CONTAMINATED: UNKNOWN

COMMUNITY IMPACT: NO

ADDITIONAL INFO: THE CALLER REPORTS THAT DRUM WAS NOT AT THE LOCATION FRIDAY NIGHT.

STATE AGENCY NOTIFIED: NOT REPORTED FEDERAL AGENCY NOTIFIED: NOT REPORTED

OFFSHORE: NO

### **INFORMATION SPECIFIC TO EACH TYPE OF INCIDENT**

- NO INFORMATION REPORTED -

#### **MATERIALS INVOLVED**

NRC REPORT #: 563116
CHRIS CODE: NCC
CAS #: NOT REPORTED

MATERIAL RELEASED/AMOUNT: HYDROCARBON FLUIDS / UNKNOWN AMOUNT

IF REACHED WATER: NO

AMOUNT IN WATER: NOT REPORTED

### **OTHER MATERIALS INVOLVED**

- NO OTHER MATERIALS INVOLVED -

### **TRAINS DETAILS**

- NO TRAIN DETAILS REPORTED -

### **TRAIN DERAILED UNITS**

- NO TRAIN DERAILED UNITS REPORTED -

### **VESSEL DETAILS**

- NO VESSEL DETAILS REPORTED -

### **MOBILE DETAILS**

- NO MOBILE DETAILS REPORTED -

## **Groundwater Contamination Cases (GWCC)**

**MAP ID# 56** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 637 ft. (Higher than TP)

**FACILITY INFORMATION** 

FILE NUMBER: 108986

FILE NAME: TEX CON OIL CO

LOCATION: 10730 S IH 35, AUSTIN, TX

COUNTY: TRAVIS

AGENCY: TEXAS COMMISSION ON ENVIRONMENTAL QUALITY

DIVISION: REMEDIATION DIVISION/PETROLEUM STORAGE TANK REIMBURSEMENT PROGRAM

DATE OF CONTAMINATION

CONFIRMATION BY AGENCY: 01/18/95 CONTAMINANT(S): GASOLINE

ENFORCEMENT STATUS: STAFF ACTION: THE AGENCY INITIATES AN ACTION TO ADDRESS A CONTAMINATION INCIDENT.

ACTIVITY STATUS: ACTION COMPLETED: THE REMEDY IS CONSIDERED COMPLETE.

NEW CASE?: NO

**MAP ID# 56** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 637 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 108986

LPST ID: **108986**FACILITY ID: **38365** 

NAME: FORMER CRUMLEYS GROCERY

ADDRESS: 10730 S IH 35

**AUSTIN, TX 78748** 

#### **LEAKING TANK DETAILS**

LPST ID: 108986

NAME: FORMER CRUMLEYS GROCERY FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2.5 - GW IMPACT PUBLIC/DOMESTIC WATER SUPPLY WELL W/IN 0.25MI

CORRECTIVE ACTION STATUS CODE: 6P - FINAL PENDING WELL PLUG

CORRECTIVE ACTION START DATE: 4/8/04

REPORTED DATE: 07/20/1994 ENTERED DATE: 01/18/1995 CLOSURE DATE: 04/08/2004

PRP INFORMATION

NAME: **TEX CON OIL CO** 

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78760
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 468 of 937

#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 84010** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/13/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 84012

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 84011

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION



Order# 141197 Job# 336212 470 of 937

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



**CONTACT INFORMATION** 

ORGANIZATION: D E CRUMLEY GROC

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: **D E CRUMLEY** 

PHONE: (512) 2829198 0

TITLE: OWNER

**MAP ID# 56** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 637 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 38365 NAME: DECRUMLEY GROC

ADDRESS: IH 35

AUSTIN, TX 78744

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 01/08/1987 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/06/1986

SIGNATURE NAME & TITLE: TIM RAMSEY, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602402174
NAME: HAYS CITY CORPORATION

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/08/1987

CONTACT ROLE: NOT REPORTED
CONTACT NAME: NOT REPORTED
CONTACT TITLE: NOT REPORTED
ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 84010

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 141197 Job# 336212 473 of 937

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 84011

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/13/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 84012

TANK ID: 2



Order# 141197 Job# 336212 474 of 937

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0208

UST ID #: C0208

NAME: SOUTHPOINT PONTIAC
ADDRESS: 4610 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110008151034 REGISTRY ID: 110008151034

NAME: SOUTHPOINT PONTIAC JEEP EAGLE

ADDRESS: 4610 S IH 35 **AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** UNIQUE ID: 110008155655

REGISTRY ID: 110008155655

NAME: LONE STAR PORSCHE AUDI

ADDRESS: 4700 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Enforcement and Compliance History Information (ECHOR06)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

UNIQUE ID: 110008170629 REGISTRY ID: 110008170629 NAME: CEN-TEX NISSAN INC ADDRESS: 4610 S IH 35 **AUSTIN, TX 78745** 

COUNTY: TRAVIS

FACILITY LINK: Facility Detail Report

## Facility Registry System (FRSTX)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008151034

NAME: SOUTHPOINT PONTIAC JEEP EAGLE

LOCATION ADDRESS: 4610 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S: SOUTHPOINT PONTIAC** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

44111 - NEW CAR DEALERS

## Facility Registry System (FRSTX)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008155655

NAME: **LONE STAR PORSCHE AUDI**LOCATION ADDRESS: **4700 S IH 35** 

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

**ALTERNATIVE NAME/S:** 

**LONE STAR PORSCHE AUDI** 

PROGRAM/S LISTED FOR THIS FACILITY

RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Facility Registry System (FRSTX)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

REGISTRY ID: 110008170629

NAME: CEN-TEX NISSAN INC

LOCATION ADDRESS: 4610 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS EPA REGION: 06

FEDERAL FACILITY: NOT REPORTED
TRIBAL LAND: NOT REPORTED

ALTERNATIVE NAME/S: CENTEX NISSAN

PROGRAM/S LISTED FOR THIS FACILITY

**RCRAINFO - \*DEFINITION NOT PROVIDED BY REPORTING AGENCY** 

STANDARD INDUSTRIAL CLASSIFICATION/S (SIC)

**NO SIC DATA REPORTED** 

NORTH AMERICAN INDUSTRY CLASSIFICATION/S (NAICS)

NO NAICS DATA REPORTED

## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 68657 EPA ID: TXD981590862 NAME: LONE STAR PORSCHE AUDI

TNRCC ID #: 23594 ADDRESS: 4700 S IH 35

NAME: LONE STAR PORSCHE AUDI AUSTIN, TX 78745

ADDRESS: 4700 S IH 35 PHONE: 1-512-4432828

**AUSTIN, TX 78745** 

CONTACT: KARL ROTH PHONE: 512-4432828

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/08/2005

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 48362

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 48363

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



## Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 75066 EPA ID: TXD121514178 NAME: SOUTHPOINT PONTIAC JEEP EAGLE

TNRCC ID #: 29421

ADDRESS: 4610 S IH 35

NAME: SOUTHPOINT PONTIAC JEEP EAGLE

**AUSTIN, TX 78745** 

ADDRESS: 4610 S IH 35

PHONE: 1-512-4450300

**AUSTIN, TX 78745** 

CONTACT: MITCHELL LEE BYAS

PHONE: 512-4450300

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES

WASTE RECEIVER: NO WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/25/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 140091

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: 140092

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: IMMERSION CLEANER

WASTE ID: 57162

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: YES

484 of 937

## Industrial and Hazardous Waste Sites (IHW)

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: **57163** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**CONTACT INFORMATION** 

ORGANIZATION: SOUTHPOINT PONTIAC

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: JIM RANEY

TITLE: NOT REPORTED

PHONE: (512) 4450300 0

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **4419** 

NAME: SOUTHPOINT PONTIAC

ADDRESS: 4610 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 09/01/1988 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/16/1986

SIGNATURE NAME & TITLE: **G A SPENCER, GEN MGR** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601253800

NAME: SOUTH POINT PONTIAC-CADILLAC INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **09/11/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137031

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: WO1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/19/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/17/1995**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 141197 Job# 336212 487 of 937

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137032

TANK ID: WO1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: WO2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/19/1984 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/17/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 137033

TANK ID: WO2

Order# 141197 Job# 336212 488 of 937

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD121514178 OWNER TYPE: PRIVATE

NAME: SOUTHPOINT PONTIAC JEEP EAGLE OWNER NAME: SOUTHPOINT PONTIAC JEEP EAGLE

ADDRESS: 4610 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: SOUTHPOINT PONTIAC JEEP

**EAGLE** 

CONTACT NAME: MITCHELL LEE BYAS CONTACT ADDRESS: 4610 S IH 35

**AUSTIN TX 78745** 

CONTACT PHONE: 512-445-0300

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/14/2002

CERTIFICATION - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

44111 - NEW CAR DEALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/16/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D002 CORROSIVE WASTE

 D006
 CADMIUM

 D007
 CHROMIUM

 D008
 LEAD

 D018
 BENZENE



D021 CHLOROBENZENE
D027 1,4-DICHLOROBENZENE
D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA
- NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD981590862 OWNER TYPE: PRIVATE

NAME: LONE STAR PORSCHE AUDI OWNER NAME: LONE STAR PORSCHE AUDI

ADDRESS: 4700 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: LONE STAR PORSCHE AUDI

CONTACT NAME: KARL ROTH
CONTACT ADDRESS: 4700 S IH 35

**AUSTIN TX 78745** 

CONTACT PHONE: 512-443-2828

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 07/27/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 02/17/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

<u>EVALUATIONS</u> - NO EVALUATIONS REPORTED - <u>VIOLATIONS</u> - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

GeoSearch www.geo-search.com 888-396-0042

NO CORRECTIVE ACTION EVENT(S) REPORTED

OWNER TYPE: NOT REPORTED

OWNER NAME: CEN-TEX NISSAN INC

OPERATOR TYPE: NOT REPORTED

OPERATOR NAME: CEN-TEX NISSAN INC

**MAP ID# 57** 

Distance from Property: 0.02 mi. (106 ft.) WNW

Elevation: 644 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000022236

NAME: CEN-TEX NISSAN INC

ADDRESS: 4610 S IH 35

**AUSTIN, TX 78745** 

CONTACT NAME: JIMMY A WEBB
CONTACT ADDRESS: 4610 S IH 35

**AUSTIN TX 78745** 

CONTACT PHONE: 512-444-1400

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

42111 - AUTOMOBILE AND OTHER MOTOR VEHICLE WHOLESALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM
D008 LEAD
D018 BENZENE

D027 1,4-DICHLOROBENZENE
D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE



<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 58** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 683 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: A0002

UST ID #: A0002

NAME: DAVE TRANSPORTATION SERVICES

ADDRESS: 8300 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: A

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 58** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 683 ft. (Higher than TP)

PROGRAM ID: T1680
RN NUMBER: RN101496354

NAME: DAVE TRANSPORTATION SERVICES

ADDRESS: 8300 S IH 35

**AUSTIN, TX 78745** 

STATUS: INACTIVE
STATUS DATE: 1/11/01

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**CONTACT INFORMATION** 

ORGANIZATION: DAVE TRANSPORTATION SERVICES

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: MARK KING

TITLE: NOT REPORTED

PHONE: (512) 2800088 0

**MAP ID# 58** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 683 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **59868** 

NAME: DAVE TRANSPORTATION SERVICES

ADDRESS: 8300 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS
REGION: 11

TYPE: OTHER

BEGIN DATE: 09/13/1991

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/13/1991
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 09/13/1991

SIGNATURE NAME & TITLE: FRED LOCKWOOD, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600783930

NAME: BRADSHER

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 09/13/1991

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**ABOVEGROUND STORAGE TANK INFORMATION** 

GeoSearch www.geo-search.com 888-396-0042

AST ID #: 164465 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 09/13/1991

INSTALLATION DATE: 01/01/1991 STATUS BEGIN DATE: 01/01/1991

TANK CAPACITY (GAL): 12000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: NO CONCRETE: YES
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: NOT REPORTED
STAGE I INSTALLATION DATE: NOT REPORTED

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 58** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 683 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD988064614 OWNER TYPE: PRIVATE

NAME: DAVE TRANSPORTATION SERVICES INC OWNER NAME: DAVE TRANSPORTATION SVC INC

ADDRESS: 8300 IH 35 S ACCESS RD OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78745 OPERATOR NAME: NOT REPORTED

CONTACT NAME: BRUCE ABEL

CONTACT ADDRESS: 8300 IH 35 S ACCESS RD

**AUSTIN TX 78745** 

CONTACT PHONE: 512-280-0088

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/13/2013

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 02/13/2013

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

<u>CORRECTIVE ACTION AREA</u> - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

GeoSearch www.geo-search.com 888-396-0042

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 59** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 631 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03394

UST ID #: 03394

NAME: CORNER STORE #1570
ADDRESS: 11206 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: F

HISTORICAL RECORD?: NOT REPORTED

COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 59** 

Distance from Property: 0.024 mi. (127 ft.) WNW

Elevation: 631 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **87533** NAME

NAME: CIRCLE K STORE 2741570

ADDRESS: 11206 S IH 35 FRONTAGE RD

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: **RETAIL** 

BEGIN DATE: 10/14/2015

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2

NUMBER OF ACTIVE ABOVEGROUND TANKS: NOT REPORTED

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/25/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/24/2017 SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COOR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604312421 NAME: BIG DIAMOND LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/27/2015

CONTACT ROLE: OWNOPRCON
CONTACT NAME: KENT HAMEL
CONTACT TITLE: NOT REPORTED
ORGANIZATION: BIG DIAMOND LLC

PHONE: (210) 6922275 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN604312421

NAME: BIG DIAMOND LLC

CONTACT ADDRESS: PO BOX 690350

SAN ANTONIO TX 78269

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/27/2015

CONTACT ROLE: OWNOPRCON
CONTACT NAME: KENT HAMEL
CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: NOT REPORTED

TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: BIG DIAMOND LLC

PHONE: (210) 6922275 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 326700 SIGNATURE DATE: 09/19/2019

SIGNATURE NAME & TITLE: ANNETTE S TOALE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 311028
SIGNATURE DATE: 10/01/2018

SIGNATURE NAME & TITLE: ANNETTE S TOALE, WC ENVIRO MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292500
SIGNATURE DATE: 08/24/2017

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 276047
SIGNATURE DATE: 08/22/2016

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 261604
SIGNATURE DATE: 11/19/2015

SIGNATURE NAME & TITLE: JENNIFER RESNICK, O&E COMP COORD

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 27341

APPLICATION RECEIVED DATE: 03/30/2015

SCHEDULE CONSTRUCTION DATE: 05/18/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

BUILDING NEW LOCATION WITH INSTALLATION OF UST TANKS, DOUBLE WALL PIPING, SUMPS, AND DISPENSERS

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 10/14/2015 REGISTRATION DATE: 11/23/2015

TANK CAPACITY (GAL): 30172 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 10/14/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP



Order# 141197 Job# 336212 503 of 937

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 189370

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 30172

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT.

**INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 10/14/2015 REGISTRATION DATE: 11/23/2015

TANK CAPACITY (GAL): 19805 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/14/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 504 of 937

CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 189371

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7901

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT.

**INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 10/14/2015 REGISTRATION DATE: 11/23/2015

TANK CAPACITY (GAL): 19805 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 10/14/2015

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 189372

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 



Order# 141197 Job# 336212 505 of 937

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 11904

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT.

**INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Alternative Fueling Stations (ALTFUELS)

**MAP ID# 60** 

Distance from Property: 0.024 mi. (127 ft.) SE

Elevation: 586 ft. (Lower than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 96817

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 96817

STATION NAME: BMW SOUTH AUS
ADDRESS: 5501 S IH 35 FRONTAGE RD

**AUSTIN, TX 78744** 

INTERSECTION DIRECTIONS: CPE100STATION1; -

CPE100STATION2; CPE100STATION3; CT4021STATION1; CT4021STATION2; CT4021STATION3; CT4021STATION4; -

STATION PHONE: 888-758-4389

STATION CURRENT STATUS: **OPEN: THE STATION IS OPEN.**TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: **ELECTRIC** 

OWNER TYPE: **NOT REPORTED**FEDERAL AGANCY ID: **NOT REPORTED**FEDERAL AGENCY NAME: **NOT REPORTED** 

DATE THAT THE STATION BEGAN OFFERING THE FUEL: NOT REPORTED

DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 9/24/2019

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-09-24 09:09:21 UTC

**Back to Report Summary** 

### Alternative Fueling Stations (ALTFUELS)

**MAP ID# 61** 

Distance from Property: 0.026 mi. (137 ft.) S

Elevation: 639 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 68637

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 68637

STATION NAME: U-HAUL ADDRESS: 9001 I-35 S

**AUSTIN, TX 78744** 

INTERSECTION DIRECTIONS: SOUTHEAST CORNER OF SLAUGHTER AND I-35

STATION PHONE: 512-280-3232

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: LIQUEFIED PETROLEUM GAS (PROPANE)

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: NOT REPORTED DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 9/10/2018

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-05-14 21:16:45 UTC

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 62** 

UST ID #: 03348

Distance from Property: 0.027 mi. (143 ft.) WNW

Elevation: 619 ft. (Lower than TP)

FACILITY INFORMATION

GEOSEARCH ID: 03348

NAME: SAM'S CLUB GAS STATION #8259

ADDRESS: 9900 S IH 35 SVRD SB

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 62** 

Distance from Property: 0.027 mi. (143 ft.) WNW

Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 96156 EPA ID: **TXR000080384** NAME: **SAMS EAST INC**TNRCC ID #: 131501 ADDRESS: **PO BOX 8041** 

NAME: SAMS CLUB 8259

BENTONVILLE, AR 72712

ADDRESS: 9900 S INTERSTATE 35 # SB PHONE: 1-479-2043517

AUSTIN, TX 78748
CONTACT: ROSE ARNOLD

PHONE: **479-2778972** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 08/14/2017

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 378758

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDS

WASTE ID: 378759

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS

WASTE ID: 378760

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

Order# 141197 Job# 336212 510 of 937

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDS

WASTE ID: 378761

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS

WASTE ID: 378763

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERS, BUTANE, MAPP GAS

WASTE ID: 378764

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDS

WASTE ID: 378765

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDES

WASTE ID: 378766

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS

WASTE ID: 378767

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS

WASTE ID: 378768

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUIDS

WASTE ID: 378769

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED WASTE PHARMACEUTICALS

WASTE ID: 378770

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

**MAP ID# 62** 

Distance from Property: 0.027 mi. (143 ft.) WNW

Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

ID#: 84284

NAME: SAMS CLUB 8259

ADDRESS: 9900 S IH 35 SVRD STE J

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 03/18/2011

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 4 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 09/03/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/20/2019

SIGNATURE NAME & TITLE: DIANE CONLEY, LIC SUPP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600761597

NAME: SAMS EAST INC

CONTACT ADDRESS: 8725 ROSEHILL RD STE 450

**LENEXA KS 66215** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/18/2011

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: SAMS EAST INC

PHONE: (877) 8295505 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600761597

NAME: SAMS EAST INC

CONTACT ADDRESS: 8725 ROSEHILL RD STE 450

**LENEXA KS 66215** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 03/18/2011

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

513 of 937 

ORGANIZATION: SAMS EAST INC

PHONE: (877) 8295505 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 325966 SIGNATURE DATE: 08/20/2019

SIGNATURE NAME & TITLE: DIANE CONLEY, LIC SUPP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 309522
SIGNATURE DATE: 08/06/2018

SIGNATURE NAME & TITLE: DIANE CONLEY, LIC SUPP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291176
SIGNATURE DATE: 08/14/2017

SIGNATURE NAME & TITLE: DIANE CONLEY, LICENSE SUPP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 275054
SIGNATURE DATE: 08/08/2016

SIGNATURE NAME & TITLE: DIANE GRABMILLER, CB&I LIC SUPP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 258480
SIGNATURE DATE: 08/10/2015

SIGNATURE NAME & TITLE: DIANE CONLEY, AGENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 241237
SIGNATURE DATE: 08/08/2014

SIGNATURE NAME & TITLE:  $\,$  DIANE CONLEY, CB & L LIC SUP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 225810
SIGNATURE DATE: 08/16/2013

SIGNATURE NAME & TITLE:  $\mbox{\bf DIANE CONLEY, LIC SUPPORT}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216436
SIGNATURE DATE: 08/06/2012

SIGNATURE NAME & TITLE: LALITHA ASIRVADAM, LICENSING SUPPORT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 216435
SIGNATURE DATE: 09/15/2011



Order# 141197 Job# 336212 514 of 937

SIGNATURE NAME & TITLE: TONYA REESE, LICENSING SUPPORT

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 23502

APPLICATION RECEIVED DATE: 09/01/2011

SCHEDULE CONSTRUCTION DATE: 03/21/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

THIS NOTICE IS TO EXTEND THE TEMP DELIVERY CERT FOR THE REFERENCED SITE. A TEMP DELIVERY CERT WAS ISSUED

BY TCEQ ON 2/23/2011. THIS PROJECT INVOLVES THE INSTA LLATION OF (3) 20K UST'S

NOTIFICATION CONSTRUCTION ID: 23503

APPLICATION RECEIVED DATE: 02/18/2011

SCHEDULE CONSTRUCTION DATE: 03/21/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

INSTALL FUEL TANKS, DISPENSERS AND RELATED EQUIPMENT. REC'D AMENDED FORN ON 8/1 8/11 SHOWING NEW

**INSTALL DATE OF 03/21/11.** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/18/2011 REGISTRATION DATE: 09/16/2011

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 03/18/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 180232

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY TANK GAUGING (FOR EMER. GENERATOR TANKS), SIR (STAT.

**INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 



Order# 141197 Job# 336212 515 of 937

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/18/2011 REGISTRATION DATE: 09/16/2011

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 03/18/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 180233

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY TANK GAUGING (FOR EMER. GENERATOR TANKS), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 141197 Job# 336212 516 of 937

MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 03/18/2011 REGISTRATION DATE: 09/16/2011

EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 20000

STATUS: IN USE STATUS BEGIN DATE: 03/18/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 180234

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY TANK GAUGING (FOR EMER. GENERATOR TANKS), SIR (STAT. **INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 03/18/2011 REGISTRATION DATE: 09/16/2011

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 517 of 937

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 03/18/2011

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 180235

TANK ID: 3

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: MONITORING OF SECONDARY CONTAINMENT BARRIER, INTERSTITIAL

MONITORING WITHIN SECONDARY WALL/JACKET, MONTHLY TANK GAUGING (FOR EMER. GENERATOR TANKS), SIR (STAT.

**INVENTORY RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/21/2011 REGISTRATION DATE: 09/28/2011

TANK CAPACITY (GAL): **750** EMPTY TANK: **NOT EMPTY**STATUS: **IN USE** STATUS BEGIN DATE: **03/21/2011** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO



Order# 141197 Job# 336212 518 of 937

#### **TANK DETAILS**

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 180236

TANK ID: 4

COMPARTMENT LETTER: A

SUBSTANCES: **OIL WATER SEPARATOR** OTHER SUBSTANCES: **NOT REPORTED** 

CAPACITY (GAL): 750

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 62** 

Distance from Property: 0.027 mi. (143 ft.) WNW

Elevation: 619 ft. (Lower than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000080384 OWNER TYPE: PRIVATE

NAME: SAMS CLUB 8259 OWNER NAME: SAMS CLUB 8259

ADDRESS: 9900 SOUTH INTERSTATE HIGHWAY 35 SERVICE ROAD SB OPERATOR TYPE: PRIVATE

AUSTIN, TX 78748 OPERATOR NAME: SAMS CLUB 8259

CONTACT NAME: JUSTIN WILSON CONTACT ADDRESS: PO BOX 8041

**BENTONVILLE AR 72712-2841** 

CONTACT PHONE: 479-204-3517

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/01/2015

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

 JUSTIN WILSON
 SR MGR
 01/01/2015

 JUSTIN WILSON
 SR MGR
 08/03/2011

**INDUSTRY CLASSIFICATION (NAICS)** 

45291 - WAREHOUSE CLUBS AND SUPERCENTERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 01/25/2016

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE
D003 REACTIVE WASTE

D004 ARSENIC

Order# 141197 Job# 336212 520 of 937

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

D005	BARIUM
D006	CADMIUM
D007	CHROMIUM
D008	LEAD
D009	MERCURY
D010	SELENIUM
D011	SILVER
D016	2,4-D (2,4-DICHLOROPHENOXYACETIC ACID)
D018	BENZENE
D022	CHLOROFORM
D024	M-CRESOL
D026	CRESOL
D027	1,4-DICHLOROBENZENE
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE
D043	VINYL CHLORIDE
P001	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYLBUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN $0.3\%$
P001	WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 0.3%
P075	NICOTINE, & SALTS
P075	PYRIDINE, 3-(1-METHYL-2-PYRROLIDINYL)-,(S)-, & SALTS
U002	2-PROPANONE (I)
U002	ACETONE (I)
U034	ACETALDEHYDE, TRICHLORO-
U034	CHLORAL
U035	BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]-
U035	CHLORAMBUCIL
U058	2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,NBIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE
U058	CYCLOPHOSPHAMIDE
U072	BENZENE, 1,4-DICHLORO-
U072	P-DICHLOROBENZENE
U080	METHANE, DICHLORO-
U080	METHYLENE CHLORIDE
U122	FORMALDEHYDE
U129	CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)-
U129	LINDANE
U132	HEXACHLOROPHENE
U132	PHENOL, 2,2'-METHYLENEBIS[3,4,6-TRICHLORO-
U134	HYDROFLUORIC ACID (C,T)
U134	HYDROGEN FLUORIDE (C,T)
U150	L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]-
U150	MELPHALAN
U154	METHANOL (I)
U154	METHYL ALCOHOL (I)
U159	2-BUTANONE (I,T)
U159	METHYL ETHYL KETONE (MEK) (I,T)



# Resource Conservation & Recovery Act - Generator (RCRAGR06)

U165	NAPHTHALENE
U182	1,3,5-TRIOXANE, 2,4,6-TRIMETHYL-
U182	PARALDEHYDE
U188	PHENOL
U200	RESERPINE
U200	YOHIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL ESTER,(3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-
U205	SELENIUM SULFIDE
U205	SELENIUM SULFIDE SES2 (R,T)
U210	ETHENE, TETRACHLORO-
U248	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYL-BUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS
U248	WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS
U249	ZINC PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS OF 10% OR LESS
U279	
U409	CARBAMIC ACID, [1,2-PHENYLENE BIS(IMINOCARBONOTHIOL)]BIS-, DIMETHYL ESTER
U409	THIOPHANATE-METHYL
U411	PHENOL, 2-(1-METHYLETHOXY)-, METHYLCARBAMATE
U411	PROPOXUR
UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -	
CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -	
CORRECTIVE ACTION EVENT	

**Back to Report Summary** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 63** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0435

UST ID #: C0435 NAME: LIPSHY

ADDRESS: 4738 S IH 35 AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 63** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 81580 EPA ID: TX0000062042 NAME: LIPSHY MOTORCARS INC

TNRCC ID #: 36590 ADDRESS: PO BOX 1354

NAME: EASY WHEELS AUSTIN, TX 78767

ADDRESS: 4738 S IH 35 PHONE: NOT REPORTED

**AUSTIN, TX 78745** 

CONTACT: **JOE BAILEY** PHONE: **512-4432828** 

BUSINESS DESCRIPTION: AUTOMOTIVE DEALER REPAIR SHOP 04/22/2004-REGISTRATION INACTIVATED DUE TO

**RETURNMAIL. CW** 

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/22/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: **75260** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: WASTE PETROLEUM NAPHTHA, SPENT SOLVENT

Back to Report Summary

### Leaking Petroleum Storage Tanks (LPST)

**MAP ID# 63** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 635 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 107587

LPST ID: **107587** FACILITY ID: **36926** 

NAME: LIPSHY MOTOR CARS ADDRESS: 4738 S IH 35

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 107587

NAME: LIPSHY MOTOR CARS

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 5/29/96

REPORTED DATE: 12/21/1993 ENTERED DATE: 05/29/1996 CLOSURE DATE: 03/14/1994

#### **PRP INFORMATION**

NAME: BOB HONTS PROPERTIES
ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78734
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/15/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

#### **TANK DETAILS**

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 525 of 937

### Leaking Petroleum Storage Tanks (LPST)

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 145539

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/15/1993** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 145538

TANK ID: 2

COMPARTMENT LETTER: A
SUBSTANCES: NOT REPORTED
OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 526 of 937

## Leaking Petroleum Storage Tanks (LPST)

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**CONTACT INFORMATION** 

ORGANIZATION: LIPSHY MOTOR CARS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: GARY WOODS

PHONE: (210) 8216523 0

TITLE: AUTH REP

**MAP ID# 63** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **36926** 

NAME: LIPSHY MOTOR CARS

ADDRESS: 4738 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1988 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/21/1986

SIGNATURE NAME & TITLE: **GEORGE E COFFEY, PRES.** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601242100

NAME: MCCOMBS B J

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **10/01/1996** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/15/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL: STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 145538

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/15/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

STEEL

CORROSION PROTECTION:

529 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 145539

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: **USED OIL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 63** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TX0000062042 OWNER TYPE: NOT REPORTED

NAME: LIPSHY MOTORCARS INC OWNER NAME: LIPSHY MOTORCARS INC

ADDRESS: 4738 S IH 35 OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78745 OPERATOR NAME: LIPSHY MOTORCARS INC

CONTACT NAME: JOE BAILEY
CONTACT ADDRESS: PO BOX 1354

**AUSTIN TX 78745** 

CONTACT PHONE: 512-443-2828

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 04/22/2004

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)
811111 - GENERAL AUTOMOTIVE REPAIR

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 05/12/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D008 LEAD

D039 TETRACHLOROETHYLENE

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED



Order# 141197 Job# 336212 531 of 937

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

OWNER INFORMATION

**MAP ID# 64** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 600 ft. (Lower than TP)

**FACILITY INFORMATION** 

REGISTRATION#: 74959 EPA ID: TXD987984374 NAME: SOUTH FORK HYUNDAI

TNRCC ID #: 29319 ADDRESS: 9000 TESORO DR STE 122

NAME: SOUTH FORK HYUNDAI SAN ANTONIO, TX 78217

ADDRESS: 5306 S IH 35 PHONE: 1-512-4737400

CONTACT: JUDY COX
PHONE: 512-4737400

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

**AUSTIN, TX 78745** 

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/25/2004

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 



Order# 141197 Job# 336212 533 of 937

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 64** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 600 ft. (Lower than TP)

PROGRAM ID: 74959

RN NUMBER: RN100640556
NAME: SOUTH FORK HYUNDAI

ADDRESS: 5306 S IH 35

**AUSTIN, TX 78745** 

STATUS: **INACTIVE**STATUS DATE: **7/8/14** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: 5306 S IH 35, AUSTIN, TX

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 64** 

Distance from Property: 0.028 mi. (148 ft.) WNW

Elevation: 600 ft. (Lower than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD987984374 OWNER TYPE: PRIVATE

NAME: SOUTH FORK HYUNDAI OWNER NAME: SOUTH FORK HYUNDAI

ADDRESS: 5306 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: SOUTH FORK HYUNDAI

CONTACT NAME: JUDY COX

CONTACT ADDRESS: 9000 TESORO STE 122

SAN ANTONIO TX 78217

CONTACT PHONE: 512-473-7400

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/15/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/16/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

07/25/1991 NRR NON-FINANCIAL RECORD REVIEW

**VIOLATIONS** 

07/25/1991 XXS STATE STATUTE OR REGULATION

**ENFORCEMENTS** 

07/25/1991 120 WRITTEN INFORMAL

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM
D007 CHROMIUM
D008 LEAD



Order# 141197 Job# 336212 535 of 937

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

D018 BENZENE

D022 CHLOROFORM

D039 TETRACHLOROETHYLENE

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

F004 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND

THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 65** 

Distance from Property: 0.034 mi. (180 ft.) WNW

Elevation: 600 ft. (Lower than TP)

FACILITY INFORMATION
GEOSEARCH ID: 02014

UST ID #: 02014

NAME: SOUTH STAR DODGE
ADDRESS: 5210 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C
HISTORICAL RECORD?: NO
COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 65** 

Distance from Property: 0.034 mi. (180 ft.) WNW

Elevation: 600 ft. (Lower than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 72465 EPA ID: TXD981914450 NAME: SOUTH STAR DODGE

TNRCC ID #: 26905 ADDRESS: 5210 S IH 35

NAME: SOUTH STAR DODGE AUSTIN, TX 78745

ADDRESS: **5210 S IH 35** PHONE: **1-210-6958715** 

**AUSTIN, TX 78745** 

CONTACT: **JEFF BOWMAN** 

PHONE: 210-6958715

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1995 AND NO WASTE ACTIVITY WAS REPORTED IN 1995,1996 AND 1997.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/15/2002

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 52532

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: **52533** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 65** 

Distance from Property: 0.034 mi. (180 ft.) WNW

Elevation: 600 ft. (Lower than TP)

PROGRAM ID: 72465 RN NUMBER: RN100582006 NAME: SOUTH STAR DODGE ADDRESS: 5210 S IH 35

**AUSTIN, TX 78745** 

STATUS: INACTIVE STATUS DATE: 8/7/14

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**CONTACT INFORMATION** 

ORGANIZATION: SOUTH STAR DODGE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

NAME: DON BENNER

TITLE: NOT REPORTED

PHONE: (512) 4439333 0

**MAP ID# 65** 

Distance from Property: 0.034 mi. (180 ft.) WNW

Elevation: 600 ft. (Lower than TP)

**FACILITY INFORMATION** 

ID#: 53069

NAME: SOUTH STAR DODGE

ADDRESS: 5210 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 04/11/1990 STATUS: INACTIVE

**EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/30/1990 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/28/1990 SIGNATURE NAME & TITLE: MIKE BRAENDLE, SERVICE MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604216317

NAME: PCS PARTNERS L P DBA SOUTH STAR DODGE CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 11/01/1996

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NUMBER OF COMPARTMENTS: 1 TANK ID: 1 INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 03/30/1990 EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 500

GeoSearch www.geo-search.com 888-396-0042

540 of 937

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/04/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 136077

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1987 REGISTRATION DATE: 03/30/1990

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/04/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:



Order# 141197 Job# 336212 541 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 136078

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: DELIVERY SHUT-OFF VALVE

# PIPING SYSTEMS MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

# Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 65** 

Distance from Property: 0.034 mi. (180 ft.) WNW

Elevation: 600 ft. (Lower than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD981914450 OWNER TYPE: PRIVATE

NAME: SOUTH STAR DODGE OWNER NAME: SOUTH STAR DODGE

ADDRESS: 5210 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: SOUTH STAR DODGE

CONTACT NAME: **JEFF BOWMAN**CONTACT ADDRESS: **5210 S I H 35** 

**AUSTIN TX 78745** 

CONTACT PHONE: 210-695-8715

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/15/2002

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE
CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,
TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN
PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE
SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

### Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F004

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: CRESOLS, CRESYLIC ACID, AND NITROBENZENE; AND THE STILL BOTTOMS FROM THE RECOVERY OF THESE SOLVENTS; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F002, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 66** 

Distance from Property: 0.035 mi. (185 ft.) ESE

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0178

UST ID #: C0178
NAME: HOLT CO

ADDRESS: 9601 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 66** 

Distance from Property: 0.038 mi. (201 ft.) ESE

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

REGISTRATION#: **68602** EPA ID: **TXD026020156** NAME: **HOLT TEXAS LTD**TNRCC ID #: **23541** ADDRESS: **PO BOX 207916** 

NAME: HOLT CAT SAN ANTONIO, TX 78220

ADDRESS: 9601 S IH 35 PHONE: 1-210-4448715

AUSTIN, TX 78744

CONTACT: JENNIFER MCNEW

PHONE: **210-3048557-8557** 

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 01/16/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 397336

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ONE-TIME SHIPMENT. DISCONTINUE USE OF BATTERY ACID FOR FILLING

BATTERIES. THIS

WASTE ID: **397335** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ONE-TIME SHIPMENT. DISCONTINUE USE OF BATTERY ACID FOR FILLING

BATTERIES. THIS WASTE ID: 159302

WASTE CODE STATUS: INACTIVE



Order# 141197 Job# 336212 546 of 937

# Industrial and Hazardous Waste Sites (IHW)

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT FROM ENGINE PARTS DEGREASING AND CLEANING - NON-

HALOGENATED; 1/1/9
WASTE ID: 159303

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: ETHYLENE GLYCOL BASED ANTIFREEZE FROM EARTH MOVING EQUIPMENT

**RADIATORS - FLAMMAB** 

WASTE ID: 159304

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT BATTERY CORES FROM BATTERY REPLACEMENT IN EQUIPMENT.

**CONTAINS LEAD, ACID A** 

WASTE ID: 194638

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASH RACK SLUDGE SLUDGE FROM GRIT TRAP LOCATED IN EQUIPMENT REPAIR

**AREA DATE OFG** 

WASTE ID: 194639

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT THINNERS OR PETROLEUM DISTILLATES USED IN DEGREASING OF PARTS

DATE OF GENE

WASTE ID: 48273

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 48274

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 66** 

Distance from Property: 0.038 mi. (201 ft.) ESE

Elevation: 640 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 095789

LPST ID: **095789**FACILITY ID: **40963** 

NAME: HOLT MACHINERY CO ADDRESS: 9601 S IH 35

**AUSTIN, TX 78744** 

#### **LEAKING TANK DETAILS**

LPST ID: 095789

NAME: HOLT MACHINERY CO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/13/90

REPORTED DATE: 05/02/1990 ENTERED DATE: 06/13/1990 CLOSURE DATE: 05/22/1992

**PRP INFORMATION** 

NAME: HOLT CO OF TEXAS

ADDRESS: ADDRESS NOT REPORTED

**SAN ANTONIO TX 78220** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/09/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 141197 Job# 336212 548 of 937

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 70534

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70533

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 



Order# 141197 Job# 336212 549 of 937

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/13/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70532

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70531

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL



CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70535

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 212697 MULTIPLE COMPARTMENT FLAG: NO TANK ID: HEYARD1 REGISTRATION DATE: 09/17/2009

INSTALLATION DATE: 02/01/2006 STATUS BEGIN DATE: 02/01/2006

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



**MAP ID# 66** 

Distance from Property: 0.038 mi. (201 ft.) ESE

Elevation: 640 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 096361

LPST ID: **096361**FACILITY ID: **40963** 

NAME: HOLT MACHINERY CO ADDRESS: 9601 S IH 35

**AUSTIN, TX 78744** 

#### **LEAKING TANK DETAILS**

LPST ID: 096361

NAME: HOLT MACHINERY CO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 8/7/90

REPORTED DATE: 08/03/1990 ENTERED DATE: 08/07/1990 CLOSURE DATE: 05/22/1992

PRP INFORMATION

NAME: HOLT CO

ADDRESS: ADDRESS NOT REPORTED

**SAN ANTONIO TX 78220** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/09/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 553 of 937

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 70534

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70533

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 554 of 937

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/13/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70532

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70531

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL



Order# 141197 Job# 336212 556 of 937

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70535

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 212697 MULTIPLE COMPARTMENT FLAG: NO TANK ID: HEYARD1 REGISTRATION DATE: 09/17/2009

INSTALLATION DATE: 02/01/2006 STATUS BEGIN DATE: 02/01/2006

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 66** 

Distance from Property: 0.038 mi. (201 ft.) ESE

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 40963

NAME: HOLT CAT AUSTIN ADDRESS: 9601 S IH 35

ADDITION: COLL C III CO

**AUSTIN, TX 78744** 

COUNTY: TRAVIS
REGION: 11

REGION. 11

TYPE: RETAIL

BEGIN DATE: 01/21/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986 SIGNATURE NAME & TITLE: STEVE ATHERTON, EXEC VP FIN

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601186745

NAME: HOLT TEXAS LTD

CONTACT ADDRESS: PO BOX 207916

**SAN ANTONIO TX 78220** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: **02/01/2006**CONTACT ROLE: **OWNCON** 

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: HOLT CAT

PHONE: (210) 6488838 0 FAX: (210) 4448704

EMAIL: ROEL.DE\_LOS\_SANTOS@HOLTCAT.COM

**OPERATOR** 

OPERATOR NUMBER: CN601186745

NAME: HOLT TEXAS LTD

CONTACT ADDRESS: 3302 S WW WHITE RD

SAN ANTONIO TX 78222

TYPE: CORPORATION/COMPANY

BEGIN DATE: 02/01/2006 CONTACT ROLE: OPRCON

CONTACT NAME: NOE CISNEROS

CONTACT TITLE: DIRECTOR OF SAFETY ENVIRONMENAL

CONTACT INFORMATION

NAME: **JOHN GERVING** 

TITLE: SRV MGR

ORGANIZATION: HOLT CAT AUSTIN

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 2925040 0

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 558 of 937

ORGANIZATION: HOLT TEXAS LTD DBA HOLT CAT

PHONE: **(210) 8678047 0** FAX: **NOT REPORTED** 

EMAIL: NOE.CISNEROS@HOLTCAT.COM

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 70531

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 559 of 937

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70532

TANK ID: 3

COMPARTMENT LETTER: A
SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/13/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 141197 Job# 336212 560 of 937

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70533

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/09/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 561 of 937

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 70534

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/13/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 70535

TANK ID: 5

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

Order# 141197 Job# 336212 562 of 937

#### **PIPING SYSTEMS**

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 212697 MULTIPLE COMPARTMENT FLAG: NOT TANK ID: HEYARD1 REGISTRATION DATE: 09/17/2009

INSTALLATION DATE: 02/01/2006 STATUS BEGIN DATE: 02/01/2006

TANK CAPACITY (GAL): 5000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 



### Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 66** 

Distance from Property: 0.038 mi. (201 ft.) ESE

Elevation: 640 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD026020156 OWNER TYPE: PRIVATE

NAME: HOLT CAT

ADDRESS: 9601 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744-7931 OPERATOR NAME: HOLT CAT

CONTACT NAME: **JENNIFER MCNEW**CONTACT ADDRESS: **PO BOX 207916** 

**SAN ANTONIO TX 78220-7916** 

CONTACT PHONE: 210-304-8557 X8557

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/16/2018

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

JENNIFER MCNEW ENVIRONMENTAL SPEC 01/16/2018
JENNIFER MCNEW ENV. COMPL. SPEC. 11/09/2016
JENNIFER MCNEW ENVIRONMENTAL SPEC 09/30/2016
PETER L DONAHOE JR UNKNOWN 11/28/2006
PETER L DONAHOE JR UNKNOWN 11/29/2005

**INDUSTRY CLASSIFICATION (NAICS)** 

42181 - CONSTRUCTION AND MINING (EXCEPT OIL WELL) MACHINERY AND EQUIPMENT WHOLESALERS

81131 - COMMERCIAL AND INDUSTRIAL MACHINERY AND EQUIPMENT (EXCEPT AUTOMOTIVE AND ELECTRONIC) REPAIR AND MAINTENANCE

811310 - COMMERCIAL AND INDUSTRIAL MACHINERY AND EQUIPMENT (EXCEPT AUTOMOTIVE AND ELECTRONIC) REPAIR AND MAINTENANCE

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: VSG LAST UPDATED DATE: 04/30/2019

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -



Order# 141197 Job# 336212 564 of 937

# Resource Conservation & Recovery Act - Generator (RCRAGR06)

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D008 LEAD
D018 BENZENE

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE,TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE,CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

UNKN

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 67** 

Distance from Property: 0.036 mi. (190 ft.) S

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0680

UST ID #: C0680

NAME: PRESTIGE SOUTH CHRYSLER

ADDRESS: 6905 S IH 35 AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: **C**HISTORICAL RECORD?: **NO** 

COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 67** 

Distance from Property: 0.036 mi. (190 ft.) S

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 75334 EPA ID: TXD988020749 NAME: PRESTIGE CHRYSLER PLYMOUTH INC

TNRCC ID #: 29687 ADDRESS: 6905 S IH 35

NAME: MAXWELL CHRYSLER PLYMOUTH DODGE AUSTIN, TX 78744

ADDRESS: 6905 S IH 35 PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: BRIAN WYCHE

PHONE: **512-4451151** 

BUSINESS DESCRIPTION: 11-21-03 INACTIVATED PER CORRESPONDENCE DATED 10-6-2003 SIGNED BY BRIAN WYCHE. --

JM

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/21/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 151060

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 151057

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 140174

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO** 

Order# 141197 Job# 336212 567 of 937

# Industrial and Hazardous Waste Sites (IHW)

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: 140175

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PAINT WASTE

WASTE ID: 140176

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: IMMERSION CLEANER

WASTE ID: 140177

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PAINT BOOTH FILTERS

WASTE ID: 57639

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 57640

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

# Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 67** 

Distance from Property: 0.036 mi. (190 ft.) S

Elevation: 663 ft. (Higher than TP)

PROGRAM ID: **75334**RN NUMBER: **RN104430616** 

NAME: MAXWELL CHRYSLER PLYMOUTH DODGE

ADDRESS: **6905 S IH 35** 

**AUSTIN, TX 78744** 

STATUS: **INACTIVE**STATUS DATE: 10/3/08

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: 6905 S IH 35, AUSTIN, TX

**CONTACT INFORMATION** 

ORGANIZATION: PRESTIGE SOUTH CHRYSLER PLYMOUTH

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: OLIVER COCHRAN

TITLE: NOT REPORTED

PHONE: (512) 9232903 0

**MAP ID# 67** 

Distance from Property: 0.036 mi. (190 ft.) S

Elevation: 663 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: **71778** 

NAME: PRESTIGE SOUTH CHRYSLER PLYMOUTH

ADDRESS: 6905 S IH 35

**AUSTIN, TX 78744** 

COUNTY: TRAVIS REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/03/1999 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/26/1999 SIGNATURE NAME & TITLE: THOMAS H NOLES, EASTERN REG MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600916670 NAME: DAIMLER CHRYSLER

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 08/31/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NUMBER OF COMPARTMENTS: 1 TANK ID: A INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 03/03/1999 EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 500

GeoSearch www.geo-search.com 888-396-0042

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **12/17/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 167364

TANK ID: A

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 67** 

Distance from Property: 0.036 mi. (190 ft.) S

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD988020749 OWNER TYPE: NOT REPORTED

NAME: MAXWELL CHRYSLER PLYMOUTH DODGE INC OWNER NAME: PRESTIGE CHRYSLER PLYMOUTH INC

ADDRESS: 6905 S IH 35 OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78744 OPERATOR NAME: PRESTIGE CHRYSLER PLYMOUTH

INC

CONTACT NAME: BRIAN WYCHE

CONTACT ADDRESS: 6905 S INTERSTATE 35

**AUSTIN TX 78744** 

CONTACT PHONE: 512-445-1151

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 10/06/2003

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

44111 - NEW CAR DEALERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

06/29/2007 FCI FOCUSED COMPLIANCE INSPECTION

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

D006 CADMIUM
D007 CHROMIUM
D008 LEAD

GeoSearch www.geo-search.com 888-396-0042

D018	BENZENE
D021	CHLOROBENZENE
D027	1,4-DICHLOROBENZENE
D035	METHYL ETHYL KETONE
D039	TETRACHLOROETHYLENE
D040	TRICHLORETHYLENE

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

UNIVERSAL WASTE - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

F005

NO CORRECTIVE ACTION EVENT(S) REPORTED

**Back to Report Summary** 

### City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 68** 

Distance from Property: 0.039 mi. (206 ft.) ESE

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03284

UST ID #: 03284

NAME: CIRCLE K 2704673

ADDRESS: 8801

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NOT REPORTED

COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 68** 

Distance from Property: 0.039 mi. (206 ft.) ESE

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 88388 EPA ID: TXR000060087 NAME: HOME DEPOT USA INC

TNRCC ID #: 121882 ADDRESS: 1905 ASTON AVE STE 100
NAME: HOME DEPOT USA HD6563 CARLSBAD, CA 92008

ADDRESS: 8801 S IH 35 PHONE: NOT REPORTED

AUSTIN, TX 78744

CONTACT: ASHLEY CAMPBELL

PHONE: **713-9855472** 

BUSINESS DESCRIPTION: HOME IMPROVEMENT RETAILER

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 05/08/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 240407

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE CORROSIVE FLAMMABLE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 240422

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: COMPRESSED GAS CYLINDERS (ALL SIZES); INACTIVATED FOR UNKNOWN

REASON.

WASTE ID: 345440

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO** 



WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(LARGE), INORGANIC; INACTIVATED FOR

**UNKNOWN REASON.** 

WASTE ID: 345442

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(MEDIUM), INORGANIC; INACTIVATED FOR

UNKNOWN REASON.

WASTE ID: 345444

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(SMALL), INORGANIC; INACTIVATED FOR

**UNKNOWN REASON.** 

WASTE ID: 345441

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(LARGE), ORGANIC; INACTIVATED FOR

UNKNOWN REASON.

WASTE ID: 345443

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(MEDIUM), ORGANIC; INACTIVATED FOR

UNKNOWN REASON.

WASTE ID: 345445

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NON-FLAMMABLE GAS CYLINDERS(SMALL), ORGANIC; INACTIVATED FOR

**UNKNOWN REASON.** 

WASTE ID: 345475

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: OIL FILTERS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 345476

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: OZZY JUICE/MATS/SLUDGE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 345465

WASTE CODE STATUS: INACTIVE



Order# 141197 Job# 336212 576 of 937

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OILY WATER; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 376006

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: KEY SHAVINGS

WASTE ID: 376007

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ROAD FLARES

WASTE ID: 376009

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: INORGANIC OXIDIZER SOLID

WASTE ID: 376010

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: POWER TOOL FUEL CELLS

WASTE ID: 376011

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CHARCOAL

WASTE ID: 376017

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MATCHES

WASTE ID: 376018

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ISOCYANATES CYLINDERS

WASTE ID: 376019

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NITROUS OXIDE CARTRIDGES

WASTE ID: 376020

WASTE CODE STATUS: ACTIVE



WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SUMP WASTE, IGNITABLE

WASTE ID: 348417

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE/CORROSIVE LIQUIDS, ACIDIC

WASTE ID: 348418

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE/CORROSIVE LIQUIDS, ALKALINE

WASTE ID: 348419

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS, U-LISTED

WASTE ID: 348420

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ALKALINE LIQUIDS, ORGANIC

WASTE ID: 348421

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: METAL BEARING CAULKS/SEALANTS (RCRA)

WASTE ID: 348422

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: CLASS 9 LIQUIDS, ORGANIC (RCRA)

WASTE ID: 348423

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: BENZOYL PEROXIDE HARDENERS, <10% BPO

WASTE ID: 348424

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: JET FUEL

WASTE ID: 348425

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 578 of 937

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: SOLDER MATERIALS

WASTE ID: 348426

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: POLYOL CYLINDER

WASTE ID: 348427

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: AMINES, CORROSIVE/NON-FLAMMABLE

WASTE ID: 345432

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: MDI RESIN CYLINDER

WASTE ID: 345433

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ZINC PHOSPHIDE RODENTICIDE

WASTE ID: 345434

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC/FLAMMABLE LIQUIDS LOOSEPACK

WASTE ID: **345435** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE SOLIDS, INORGANIC

WASTE ID: **345436** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: ACETYLENE CYLINDERS

WASTE ID: 345437

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ASBESTOS, FRIABLE AND NON-FRIABLE

WASTE ID: 345438

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 579 of 937

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: ANTIFREEZE

WASTE ID: 345439

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CARBON DIOXIDE(CO2)CYLINDERS

WASTE ID: 345446

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: EMPTY GAS CADDY

WASTE ID: 345447

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: EMPTY DRUM

WASTE ID: 345448

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: HELIUM CYLINDERS

WASTE ID: 345449

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: **ELEMENTAL MERCURY** 

WASTE ID: 345450

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: POLYMERIC MDI LIQUID

WASTE ID: **345451** 

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: MOSQUITO MAGNET CO2 CARTRIDGES

WASTE ID: **345452** 

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NON-PCB LIGHT BALLASTS

WASTE ID: 345453

WASTE CODE STATUS: ACTIVE



WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NON-RCRA FERTILIZER, SOLID

WASTE ID: 345454

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: OILY DEBRIS

WASTE ID: 345456

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: POLYOL RESIN

WASTE ID: 345457

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: POOL TABLETS

WASTE ID: 345458

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: OIL-FILLED RADIATOR HEATER

WASTE ID: 345459

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: REFRIGERANT GAS CYLINDERS, SMALL

WASTE ID: 345460

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE DEBRIS

WASTE ID: 345461

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: SAFETY BOOSTERS

WASTE ID: 345462

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: INSECTICIDE LIQUIDS WITH CARBARYL

WASTE ID: 345463

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 581 of 937

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: WELDING RODS

WASTE ID: 345473

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS, HALOGENATED ORGANICS

WASTE ID: 345474

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: DIESEL FUEL, BULK

WASTE ID: 345477

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PCB LIGHT BALLASTS

WASTE ID: 345455

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER LIQUIDS LOOSEPACK

WASTE ID: 345464

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ZEP ENFORCER

WASTE ID: 345466

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FIRE EXTINGUISHER, SMALL

WASTE ID: 345467

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER SOLIDS LOOSEPACK

WASTE ID: 345468

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: MAPP GAS CYLINDERS

WASTE ID: 345469

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 582 of 937

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: LATEX PAINT CONTAMINATED DEBRIS

WASTE ID: 345470

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NON-REGULATED WASTE PRODUCTS

WASTE ID: 345471

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED OIL, BULK

WASTE ID: 345472

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: SUMP WATER FROM CATCH BASINS

WASTE ID: 247812

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER LIQUID LOOSE PACK; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232987

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: WASTE FLAMMABLE PAINT RELATED MATERIAL; INACTIVATED FOR UNKNOWN

REASON.

WASTE ID: 232988

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: ALKALINE/CORROSIVE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232989

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS ONLY LOOSEPACK; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232990

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS LOOSEPACK - NO FERTILIZERS; INACTIVATED FOR UNKNOWN

REASON.



WASTE ID: 232991

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232992

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: BULK GAS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232993

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: OXIZDIZER WASTE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232994

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER LOOSEPACK; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232995

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: FERTILIZERS W/PESTICIDES; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 232996

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: COMPRESSED GAS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 240408

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: DEBRIS CONTAINING GASOLINE

WASTE ID: 240409

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OZZY JUICE - PARTS WASHER SOLUTION

WASTE ID: 240410

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLID LOOSEPACK

WASTE ID: 240411

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LOOSEPACK

WASTE ID: 240412

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ALKALINE/CORROSIVE LOOSEPACK

WASTE ID: 240413

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ACIDIC/CORROSIVE LOOSEPACK

WASTE ID: 240414

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC (SOLIDS ONLY) LOOSEPACK - NO FERTILIZERS

WASTE ID: 240415

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC (LIQUIDS ONLY) LOOSEPACK

WASTE ID: 240416

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS - ACCUMULATION DRUM

WASTE ID: 240417

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER SOLID LOOSEPACK; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 240418

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OIL BASED PAINTS AND STAINS

WASTE ID: 240419

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FERTILIZERS WITH PESTICIDES (BROKEN BAGS ONLY)

WASTE ID: 240420

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FERTILIZER SWEEPINGS ONLY (NO BAGS)

WASTE ID: 240421

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: BULK GASOLINE

WASTE ID: 240423

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXYGEN COMPRESSED GAS CYLINDERS (SMALL)

WASTE ID: 240424

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: APPARATUSES CONTAINING MERCURY AND DEBRIS

WASTE ID: 240425

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OFF SPEC CATCH BASIN WATER

WASTE ID: 240426

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERS FOR DISPOSAL

WASTE ID: 240427

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: COMPRESSED GAS CYLINDERS (MAPP GAS); INACTIVATED FOR UNKNOWN

REASON.

WASTE ID: 240428

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDE

WASTE ID: 240429

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 586 of 937

GENERATOR'S DESCRIPTION OF WASTE: BLEACH SOLUTIONS (NO SOLIDS) LOOSEPACK

WASTE ID: 240430

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CRUSHED FLUORESCENT LIGHT TUBES

WASTE ID: 240431

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER LIQUID LOOSE PACK; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 245535

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE/TOXIC LOOSE PACK

WASTE ID: 245536

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LEAD CONTAMINATED DEBRIS

WASTE ID: 245537

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OIL WITH GASOLINE

WASTE ID: 245538

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PARTS WASHER MACHINE

WASTE ID: 245539

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: REGULATED LEAD ACID BATTERIES FOR RECYCLING (AUTOMOTIVE)

WASTE ID: 247813

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: REGULATED SMALL SEALED LEAD ACID BATTERIES

WASTE ID: 255483

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 587 of 937

GENERATOR'S DESCRIPTION OF WASTE: ACIDS CONTAINING HYDROFLUORIC ACID

WASTE ID: 255484

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ZINC PHOSPHIDE RODENTICIDE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255485

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: POOL TABLETS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255486

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: EMPTY GAS CADDY; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255487

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: ISOCYANATES CYLINDER; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255488

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OIL BASED PAINT CONTAMINATED DEBRIS

WASTE ID: 255489

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SAFETY BOOSTERS; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255490

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: METHANOL/ETHANOL AND WATER; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255491

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MOTH BALLS

WASTE ID: 255492

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 588 of 937

GENERATOR'S DESCRIPTION OF WASTE: ACIDIC/CORROSIVE /ORGANIC LOOSEPACK

WASTE ID: 255493

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ACETYLENE CYLINDER; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 255494

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: AMINES LIQUID CORROSIVE FLAMMABLE; INACTIVATED FOR UNKNOWN REASON.

WASTE ID: 223254

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS, COMPRESSED GAS - USED/RETURNED/DAMAGED/SPILLED PRODUCT.

**DATE OF FIRSTG** 

WASTE ID: 223255

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE, ACIDIC LIQUID-SULFURIG ACID, HYDROCHLORIC ACID -

**USED/RETURNED/DAMAGE** 

WASTE ID: 223256

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE, BASIC LIQUID - POTASSIUM HYDROXIDE, SODIUM HYDROXIDE -

USED/RETURNED/

WASTE ID: 223257

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLID-CHLORINE (POOL CHEMICALS) -

USED/RETURNED/DAMAGED/SPILLED PRODUC

WASTE ID: 223258

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: PAINT RELATED MATERIAL - FLAMMABLE LIQUIDS -

USED/RETURNED/DAMAGED/SPILLEDPRODUC

WASTE ID: 223259

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES



Order# 141197 Job# 336212 589 of 937

GENERATOR'S DESCRIPTION OF WASTE: **PESTICIDES-SOLIDS - USED/RETURNED/DAMAGED/SPILLED PRODUCT. DATE OF FIRST GENERAT** 

WASTE ID: 223260

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS - PRESTICIDES - USED/RETURNED/DAMAGED/SPILLED PRODUCT.

DATE OF FIR

WASTE ID: 226248

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: GASOLINE-FROM RETURNED OUTDOOR/LAWN EQUIPMENT; INACTIVATED FOR

**UNKNOWN REASON.** 

**Back to Report Summary** 

**MAP ID# 68** 

Distance from Property: 0.039 mi. (206 ft.) ESE

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 76336

NAME: CIRCLE K STORE 2704673

ADDRESS: 8801 S IH 35 STE B

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 06/01/2003

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/12/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/09/2019

SIGNATURE NAME & TITLE: VERONICA RIVERA, ENVIRONMENTAL SPECIALIST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600134456 NAME: CIRCLE K STORES INC CONTACT ADDRESS: PO BOX 52085

PHOENIX AZ 85072

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/2012

CONTACT ROLE: OWNOPRCON CONTACT NAME: VERONICA RIVERA

CONTACT TITLE: ENV SPEC

ORGANIZATION: CIRCLE K STORES INC

PHONE: (602) 7288000 0 FAX: NOT REPORTED

EMAIL: ESS-WESTCOAST@CIRCLEK.COM

**OPERATOR** 

OPERATOR NUMBER: CN600134456 NAME: CIRCLE K STORES INC CONTACT ADDRESS: PO BOX 52085

PHOENIX AZ 85072

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/08/2012

CONTACT ROLE: OWNOPRCON CONTACT NAME: VERONICA RIVERA

CONTACT TITLE: ENV SPEC

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

591 of 937

ORGANIZATION: CIRCLE K STORES INC

PHONE: **(602) 7288000 0** FAX: **NOT REPORTED** 

EMAIL: ESS-WESTCOAST@CIRCLEK.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 326801 SIGNATURE DATE: 09/19/2019

SIGNATURE NAME & TITLE: ANNETTE S TOALE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 311349
SIGNATURE DATE: 10/01/2018

SIGNATURE NAME & TITLE: ANNETTE S TOALE, MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 294017
SIGNATURE DATE: 09/18/2017

SIGNATURE NAME & TITLE: MINDY SZANISZLO, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 277071
SIGNATURE DATE: 09/16/2016

SIGNATURE NAME & TITLE: MINDY SZANISZLO, ENV COMP COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 259353
SIGNATURE DATE: 09/01/2015

SIGNATURE NAME & TITLE: MINDY SZANISZLO, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 241436
SIGNATURE DATE: 08/27/2014

SIGNATURE NAME & TITLE: SREENATH THOTA, ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 226431
SIGNATURE DATE: 08/14/2013

SIGNATURE NAME & TITLE: RUTH BULMER, SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206996
SIGNATURE DATE: 08/08/2012

SIGNATURE NAME & TITLE: RUTH BULMER, SPEC ENV COMPL

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206995
SIGNATURE DATE: 05/25/2012



Order# 141197 Job# 336212 592 of 937

SIGNATURE NAME & TITLE: RUTH BULMER, SPEC ENV COMP

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206994
SIGNATURE DATE: 06/08/2011

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206993
SIGNATURE DATE: 06/16/2010

SIGNATURE NAME & TITLE: FORD SMITH, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206992
SIGNATURE DATE: 06/09/2009

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206991
SIGNATURE DATE: 06/02/2008

SIGNATURE NAME & TITLE: FORD SMITH JR, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206990
SIGNATURE DATE: 05/18/2007

SIGNATURE NAME & TITLE: FORD SMITH JR, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206989
SIGNATURE DATE: 07/01/2006

SIGNATURE NAME & TITLE: FORD SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206988
SIGNATURE DATE: 06/23/2005

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206987
SIGNATURE DATE: 06/24/2004

SIGNATURE NAME & TITLE: ALLEN W SMITH, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 206986
SIGNATURE DATE: 02/12/2004

SIGNATURE NAME & TITLE: FORD F SMITH, NOT REPORTED

FILING STATUS: INITIAL

Order# 141197 Job# 336212 593 of 937

REGISTRATION FLAG: YES

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 20886

APPLICATION RECEIVED DATE: 05/06/2008

SCHEDULE CONSTRUCTION DATE: 06/02/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/2003 REGISTRATION DATE: 02/18/2004

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 183709

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINMEN/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 141197 Job# 336212 594 of 937

PIPE DESIGN DOUBLE WALL: YES

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 06/01/2003 REGISTRATION DATE: 02/18/2004

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 06/01/2003

INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** TANK DESIGN SINGLE WALL: **NO** TANK DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:

STEEL

CORROSION PROTECTION:

PIPE DESIGN SINGLE WALL: NO

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 183710

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 7000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 06/01/2003 REGISTRATION DATE: 02/18/2004

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 06/01/2003

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

GeoSearch www.geo-search.com 888-396-0042

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** MATERIAL:

**STEEL** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, CATHODIC PROTECTION - FACTORY INSTALLATION

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 183711

TANK ID: 2

COMPARTMENT LETTER: B SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),SIR (STAT. INVENTORY **RECONCILIATION) & INVENTORY CONTROL** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

Order# 141197 Job# 336212 596 of 937

**MAP ID# 68** 

Distance from Property: 0.039 mi. (206 ft.) ESE

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000060087 OWNER TYPE: PRIVATE

NAME: HOME DEPOT USA HD6563 OWNER NAME: HOME DEPOT USA INC

ADDRESS: 8801 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744-6713 OPERATOR NAME: HOME DEPOT USA INC

CONTACT NAME: ASHLEY CAMPBELL
CONTACT ADDRESS: 5151 SAN FELIPE ST

**HOUSTON TX 77056-3607** 

CONTACT PHONE: 713-985-5472

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 05/07/2018

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

**ASHLEY CAMPBELL WASTE SPECIALIST** 05/07/2018 **ASHLEY CAMPBELL** WASTE SPECIALIST 01/08/2013 **MELANIE KOSKE WASTE SPECIALIST** 06/28/2011 **MELANIE KOSKE WASTE SPECIALIST** 05/03/2011 **MELANIE KOSKE WASTE SPECIALIT** 08/03/2010 **MELANIE KOSKE UNKNOWN** 06/15/2010 **MELANIE KOSKE WASTE SPECIALIT** 03/30/2010 **MELANIE KOSKE WASTE SPECIALIS** 11/24/2009 **MELANIE KOSKE WASTE SPECIALIS** 04/07/2009 **MELANIE KOSKE WASTE SPECIALIS** 03/11/2008 **MELANIE KOSKE AUTHORIZEDAGENT** 03/01/2008 **WASTE SPECIALIS MELANIE KOSKE** 11/02/2007 **MELANIE KOSKE WASTE SPECIALIS** 10/01/2007 **ROBERT PERKINS TECHNICAL PROJECT SPECIALIST II** 06/18/2005 **ROBERT PERKINS SPECIALIST** 07/12/2004

**INDUSTRY CLASSIFICATION (NAICS)** 

44411 - HOME CENTERS

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 05/17/2018

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO** 



Order# 141197 Job# 336212 597 of 937

USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - NO EVALUATIONS REPORTED -

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS - NO ENFORCEMENTS REPORTED -**

HAZARDOUS WASTE

D001 **IGNITABLE WASTE** D002 **CORROSIVE WASTE REACTIVE WASTE** D003 D004 **ARSENIC** D005 **BARIUM** D006 **CADMIUM** D007 **CHROMIUM** D008 LEAD D009 **MERCURY** D011 **SILVER** D016 2,4-D (2,4-DICHLOROPHENOXYACETIC ACID) D018 **BENZENE** D027 1,4-DICHLOROBENZENE D028 1,2-DICHLOROETHANE D035 METHYL ETHYL KETONE D039 **TETRACHLOROETHYLENE** D040 **TRICHLORETHYLENE** 

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTON FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

FROM THE RECOVERT OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

P122 ZINC PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS GREATER THAN 10% (R,T)

U001 ACETALDEHYDE (I)
U001 ETHANAL (I)
U002 2-PROPANONE (I)
U002 ACETONE (I)

VINYL CHLORIDE

D043

U003 ACETONITRILE (I,T)
U004 ACETOPHENONE
U004 ETHANONE, 1-PHENYLU005 2-ACETYLAMINOFLUORENE

GeoSearch www.geo-search.com 888-396-0042

U005	ACETAMIDE, N-9H-FLUOREN-2-YL
U006	ACETYL CHLORIDE (C,R,T)
U007	2-PROPENAMIDE
U007	ACRYLAMIDE
U008	2-PROPENOIC ACID (I)
U008	ACRYLIC ACID (I)
U009	2-PROPENENITRILE
U009	ACRYLONITRILE
U010	AZIRINO [2',3':3,4]PYRROLO[1,2-A]INDOLE-4,7-DIONE, 6-AMINO-8-[[(AMINOCARBONYL)OXY]METHYL]-1,1A,2,8,8A,8B-HEXAHYDRO-8A-METHOXY-5-METHYL-, [1AS-(1AALPHA, 8BETA, 8AALPHA,8BALPHA)]-
U010	MITOMYCIN C
U011	1H-1,2,4-TRIAZOL-3-AMINE
U011	AMITROLE
U012	ANILINE (I,T)
U012	BENZENAMINE (I,T)
U014	AURAMINE
U014	BENZENAMINE, 4,4'-CARBONIMIDOYLBIS[N,NDIMETHYL-
U015	AZASERINE
U015	L-SERINE, DIAZOACETATE (ESTER)
U016	BENZ[C]ACRIDINE
U017	BENZAL CHLORIDE
U017	BENZENE, (DICHLOROMETHYL)-
U018	BENZ[A]ANTHRACENE
U019	BENZENE (I,T)
U020	BENZENESULFONIC ACID CHLORIDE (C,R)
U020	BENZENESULFONYL CHLORIDE (C,R)
U021	[1,1'-BIPHENYL]-4,4'-DIAMINE
U021	BENZIDINE
U022	BENZO[A]PYRENE
U023	BENZENE, (TRICHLOROMETHYL)-
U023	BENZOTRICHLORIDE (C,R,T)
U024	DICHLOROMETHOXY ETHANE
U024	ETHANE, 1,1'-[METHYLENEBIS(OXY)]BIS[2-CHLORO-
U025	DICHLOROETHYL ETHER
U025	ETHANE, 1,1'-OXYBIS[2-CHLORO-
U026	CHLORNAPHAZIN
U026	NAPHTHALENAMINE, N,N'-BIS(2-CHLOROETHYL)-
U027	DICHLOROISOPROPYL ETHER
U027	PROPANE, 2,2'-OXYBIS[2-CHLORO-
U028	1,2-BENZENEDICARBOXYLIC ACID, BIS(2-ETHYLHEXYL) ESTER
U028	DIETHYLHEXYL PHTHALATE
U029	METHANE, BROMO-
U029	METHYL BROMIDE
U030	4-BROMOPHENYL PHENYL ETHER
U030	BENZENE, 1-BROMO-4-PHENOXY-
U031	1-BUTANOL (I)

U031	N-BUTYL ALCOHOL (I)
U032	CALCIUM CHROMATE
U032	CHROMIC ACID H2CRO4, CALCIUM SALT
U033	CARBON OXYFLUORIDE (R,T)
U033	CARBONIC DIFLUORIDE
U034	ACETALDEHYDE, TRICHLORO-
U034	CHLORAL
U035	BENZENEBUTANOIC ACID, 4-[BIS(2-CHLOROETHYL)AMINO]-
U035	CHLORAMBUCIL
U036	4,7-METHANO-1H-INDENE, 1,2,4,5,6,7,8,8-OCTACHLORO-2,3,3A,4,7,7A-HEXAHYDRO-
U036	CHLORDANE, ALPHA & GAMMA ISOMERS
U037	BENZENE, CHLORO-
U037	CHLOROBENZENE
U038	BENZENEACETIC ACID, 4-CHLORO-ALPHA-(4-CHLOROPHENYL)-ALPHA-HYDROXY-, ETHYL ESTER
U038	CHLOROBENZILATE
U039	P-CHLORO-M-CRESOL
U039	PHENOL, 4-CHLORO-3-METHYL-
U041	EPICHLOROHYDRIN
U041	OXIRANE, (CHLOROMETHYL)-
U042	2-CHLOROETHYL VINYL ETHER
U042	ETHENE, (2-CHLOROETHOXY)-
U043	ETHENE, CHLORO-
U043	VINYL CHLORIDE
U044	CHLOROFORM
U044	METHANE, TRICHLORO-
U045	METHANE, CHLORO- (I,T)
U045	METHYL CHLORIDE (I,T)
U046	CHLOROMETHYL METHYL ETHER
U046	METHANE, CHLOROMETHOXY-
U047	BETA-CHLORONAPHTHALENE
U047	NAPHTHALENE, 2-CHLORO-
U048	O-CHLOROPHENOL
U048	PHENOL, 2-CHLORO-
U049	4-CHLORO-O-TOLUIDINE, HYDROCHLORIDE
U049	BENZENAMINE, 4-CHLORO-2-METHYL-, HYDROCHLORIDE
U050	CHRYSENE
U051	CREOSOTE
U052	CRESOL (CRESYLIC ACID)
U052	PHENOL, METHYL-
U053	2-BUTENAL
U053	CROTONALDEHYDE
U055	BENZENE, (1-METHYLETHYL)- (I)
U055	CUMENE (I)
U056	BENZENE, HEXAHYDRO- (I)
11050	OVOLOUEVANE (I)

U056

CYCLOHEXANE (I)

U057	CYCLOHEXANONE (I)
U058	2H-1,3,2-OXAZAPHOSPHORIN-2-AMINE, N,NBIS(2-CHLOROETHYL)TETRAHYDRO-, 2-OXIDE
U058	CYCLOPHOSPHAMIDE
U059	5,12-NAPHTHACENEDIONE, 8-ACETYL-10-[(3-AMINO-2,3,6-TRIDEOXY)-ALPHA-L-LYXOHEXOPYRANOSYL) OXY]-7,8,9,10-TETRAHYDRO-6,8,11-TRIHYDROXY-1-METHOXY-, (8S-CIS)-
U059	DAUNOMYCIN
U060	BENZENE, 1,1'-(2,2-DICHLOROETHYLIDENE)BIS[4-CHLORO-
U060	DDD
U061	BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-CHLORO-
U061	DDT
U062	CARBAMOTHIOIC ACID, BIS(1-METHYLETHYL)-, S-(2,3-DICHLORO-2-PROPENYL) ESTER
U062	DIALLATE
U063	DIBENZ[A,H]ANTHRACENE
U064	BENZO[RST]PENTAPHENE
U064	DIBENZO[A,I]PYRENE
U066	1,2-DIBROMO-3-CHLOROPROPANE
U066	PROPANE, 1,2-DIBROMO-3-CHLORO-
U067	ETHANE, 1,2-DIBROMO-
U067	ETHYLENE DIBROMIDE
U068	METHANE, DIBROMO-
U068	METHYLENE BROMIDE
U069	1,2-BENZENEDICARBOXYLIC ACID, DIBUTYL ESTER
U069	DIBUTYL PHTHALATE
U070	BENZENE, 1,2-DICHLORO-
U070	O-DICHLOROBENZENE
U071	BENZENE, 1,3-DICHLORO-
U071	M-DICHLOROBENZENE
U072	BENZENE, 1,4-DICHLORO-
U072	P-DICHLOROBENZENE
U073	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DICHLORO-
U073	3,3'-DICHLOROBENZIDINE
U074	1,4-DICHLORO-2-BUTENE (I,T)
U074	2-BUTENE, 1,4-DICHLORO- (I,T)
U075	DICHLORODIFLUOROMETHANE
U075	METHANE, DICHLORODIFLUORO-
U076	ETHANE, 1,1-DICHLORO-
U076	ETHYLIDENE DICHLORIDE
U077	ETHANE, 1,2-DICHLORO-
U077	ETHYLENE DICHLORIDE
U078	1,1-DICHLOROETHYLENE
U078	ETHENE, 1,1-DICHLORO-
U079	1,2-DICHLOROETHYLENE
U079	ETHENE, 1,2-DICHLORO-,(E)-
U080	METHANE, DICHLORO-
U080	METHYLENE CHLORIDE
U081	2,4-DICHLOROPHENOL

U081	PHENOL, 2,4-DICHLORO-
U082	2,6-DICHLOROPHENOL
U082	PHENOL, 2,6-DICHLORO-
U083	PROPANE, 1,2-DICHLORO-
U083	PROPYLENE DICHLORIDE
U084	1,3-DICHLOROPROPENE
U084	1-PROPENE, 1,3-DICHLORO-
U085	1,2:3,4-DIEPOXYBUTANE (I,T)
U085	2,2'-BIOXIRANE
U086	HYDRAZINE, 1,2-DIETHYL-
U086	N,N'-DIETHYLHYDRAZINE
U087	O,O-DIETHYL S-METHYL DITHIOPHOSPHATE
U087	PHOSPHORODITHIOIC ACID, O,O-DIETHYL SMETHYL ESTER
U088	1,2-BENZENEDICARBOXYLIC ACID, DIETHYL ESTER
U088	DIETHYL PHTHALATE
U089	DIETHYLSTILBESTEROL
U089	PHENOL, 4,4'-(1,2-DIETHYL-1,2-ETHENEDIYL)BIS, (E)-
U090	1,3-BENZODIOXOLE, 5-PROPYL-
U090	DIHYDROSAFROLE
U091	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'- DIMETHOXY-
U091	3,3'-DIMETHOXYBENZIDINE
U092	DIMETHYLAMINE (I)
U092	METHANAMINE, N-METHYL- (I)
U093	BENZENAMINE, N,N-DIMETHYL-4-(PHENYLAZO)-
U093	P-DIMETHYLAMINOAZOBENZENE
U094	7,12-DIMETHYLBENZ[A]ANTHRACENE
U094	BENZ[A]ANTHRACENE, 7,12-DIMETHYL-
U095	[1,1'-BIPHENYL]-4,4'-DIAMINE, 3,3'-DIMETHYL-
U095	3,3'-DIMETHYLBENZIDINE
U096	ALPHA,ALPHA-DIMETHYLBENZYLHYDROPEROXIDE (R)
U096	HYDROPEROXIDE, 1-METHYL-1-PHENYLETHYL-(R)
U097	CARBAMIC CHLORIDE, DIMETHYL-
U097	DIMETHYLCARBAMOYL CHLORIDE
U098	1,1-DIMETHYLHYDRAZINE
U098	HYDRAZINE, 1,1-DIMETHYL-
U099	1,2-DIMETHYLHYDRAZINE
U099	HYDRAZINE, 1,2-DIPHENYL-
U101	2,4-DIMETHYLPHENOL
U101	PHENOL, 2,4-DIMETHYL-
U102	1,2-BENZENEDICARBOXYLIC ACID, DIMETHYL ESTER
U102	DIMETHYL PHTHALATE
U103	DIMETHYL SULFATE
U103	SULFURIC ACID, DIMETHYL ESTER
U105	2,4-DINITROTOLUENE
U105	BENZENE, 1-METHYL-2,4-DINITRO-



U106	2,6-DINITROTOLUENE
U106	BENZENE, 2-METHYL-1,3-DINITRO-
U107	1,2-BENZENEDICARBOXYLIC ACID, DIOCTYL ESTER
U107	DI-N-OCTYL PHTHALATE
U108	1,4-DIETHYLENEOXIDE
U108	1,4-DIOXANE
U109	1,2-DIPHENYLHYDRAZINE
U109	HYDRAZINE, 1,2-DIPHENYL-
U110	1-PROPANIMINE, N-PROPYL-(I)
U110	DIPROPYLAMINE (I)
U111	1-PROPANAMINE, N-NITROSO-N-PROPYL-
U111	DI-N-PROPYLNITROSAMINE
U112	ACETIC ACID, ETHYL ESTER (I)
U112	ETHYL ACETATE (I)
U113	2-PROPENOIC ACID, ETHYL ESTER (I)
U113	ETHYL ACRYLATE (I)
U114	CARBAMODITHIOIC ACID, 1,2-ETHANEDIYLBIS-, SALTS & ESTERS
U114	ETHYLENEBISDITHIOCARBAMIC ACID, SALTS & ESTERS
U115	ETHYLENE OXIDE (I,T)
U115	OXIRANE (I,T)
U116	2-IMIDAZOLIDINETHIONE
U116	ETHYLENETHIOUREA
U117	ETHANE, 1,1'-OXYBIS-(I)
U117	ETHYL ETHER (I)
U118	2-PROPENOIC ACID, 2-METHYL-, ETHYL ESTER
U118	ETHYL METHACRYLATE
U119	ETHYL METHANESULFONATE
U119	METHANESULFONIC ACID, ETHYL ESTER
U120	FLUORANTHENE
U121	METHANE, TRICHLOROFLUORO-
U121	TRICHLOROMONOFLUOROMETHANE
U122	FORMALDEHYDE
U123	FORMIC ACID (C,T)
U124	FURAN (I)
U124	FURFURAN (I)
U125	2-FURANCARBOXALDEHYDE (I)
U125	FURFURAL (I)
U126	GLYCIDYLALDEHYDE
U126	OXIRANECARBOXYALDEHYDE
U127	BENZENE, HEXACHLORO-
U127	HEXACHLOROBENZENE
U128	1,3-BUTADIENE, 1,1,2,3,4,4-HEXACHLORO-
U128	HEXACHLOROBUTADIENE
U129	CYCLOHEXANE, 1,2,3,4,5,6-HEXACHLORO-, (1ALPHA, 2ALPHA, 3BETA, 4ALPHA, 5ALPHA, 6BETA)-
U129	LINDANE

Order# 141197 Job# 336212 603 of 937

U130	1,3-CYCLOPENTADIENE, 1,2,3,4,5,5-HEXACHLORO-
U130	HEXACHLOROCYCLOPENTADIENE
U131	ETHANE, HEXACHLORO-
U131	HEXACHLOROETHANE
U132	HEXACHLOROPHENE
U132	PHENOL, 2,2'-METHYLENEBIS[3,4,6-TRICHLORO-
U133	HYDRAZINE (R,T)
U134	HYDROFLUORIC ACID (C,T)
U134	HYDROGEN FLUORIDE (C,T)
U135	HYDROGEN SULFIDE
U135	HYDROGEN SULFIDE H2S
U136	ARSINIC ACID, DIMETHYL-
U136	CACODYLIC ACID
U137	INDENO[1,2,3-CD]PYRENE
U138	METHANE, IODO-
U138	METHYL IODIDE
U140	1-PROPANOL, 2-METHYL- (I,T)
U140	ISOBUTYL ALCOHOL (I,T)
U141	1,3-BENZODIOXOLE, 5-(1-PROPENYL)-
U141	ISOSAFROLE
U142	1,3,4-METHENO-2H-CYCLOBUTA[CD]PENTALEN-2-ONE, 1,1A,3,3A,4,5,5,5A,5B,6-DECACHLOROOCTAHYDRO-
U142	KEPONE
U143	2-BUTENOIC ACID, 2-METHYL-, 7-[[2,3-DIHYDROXY-2-(1-METHOXYETHYL)-3-METHYL-1-OXOBUTOXY]METHYL]-2,3,5,7A-TETRAHYDRO-1HPYRROLIZIN-1-YL ESTER, [1S-[1ALPHA(Z),7(2S*,3R*), 7AALPHA]]-
U143	LASIOCARPINE
U144	ACETIC ACID, LEAD(2+) SALT
U144	LEAD ACETATE
U145	LEAD PHOSPHATE
U145	PHOSPHORIC ACID, LEAD(2+) SALT (2:3)
U146	LEAD SUBACETATE
U146	LEAD, BIS(ACETATO-O)TETRAHYDROXYTRI-
U147	2,5-FURANDIONE
U147	MALEIC ANHYDRIDE
U148	3,6-PYRIDAZINEDIONE, 1,2-DIHYDRO-
U148	MALEIC HYDRAZIDE
U149	MALONONITRILE
U149	PROPANEDINITRILE
U150	L-PHENYLALANINE, 4-[BIS(2-CHLOROETHYL)AMINO]-
U150	MELPHALAN
U151	MERCURY
U152	2-PROPENENITRILE, 2-METHYL- (I,T)
U152	METHACRYLONITRILE (I,T)
U153	METHANETHIOL (I,T)
U153	THIOMETHANOL (I,T)
U154	METHANOL (I)
U154	METHYL ALCOHOL (I)

U155	1,2-ETHANEDIAMINE, N,N-DIMETHYL-N'-2-PYRIDINYL-N'-(2-THIENYLMETHYL)-
U155	METHAPYRILENE
U156	CARBONOCHLORIDIC ACID, METHYL ESTER, (I,T)
U156	METHYL CHLOROCARBONATE (I,T)
U157	3-METHYLCHOLANTHRENE
U157	BENZ[J]ACEANTHRYLENE, 1,2-DIHYDRO-3-METHYL-
U158	4,4'-METHYLENEBIS(2-CHLOROANILINE)
U158	BENZENAMINE, 4,4'-METHYLENEBIS[2-CHLORO-
U159	2-BUTANONE (I,T)
U159	METHYL ETHYL KETONE (MEK) (I,T)
U160	2-BUTANONE, PEROXIDE (R,T)
U160	METHYL ETHYL KETONE PEROXIDE (R,T)
U161	4-METHYL-2-PENTANONE (I)
U161	METHYL ISOBUTYL KETONE (I)
U161	PENTANOL, 4-METHYL-
U162	2-PROPENOIC ACID, 2-METHYL-, METHYL ESTER (I,T)
U162	METHYL METHACRYLATE (I,T)
U163	GUANIDINE, N-METHYL-N'-NITRO-N-NITROSO-
U163	MNNG
U164	4(1H)-PYRIMIDINONE, 2,3-DIHYDRO-6-METHYL-2-THIOXO-
U164	METHYLTHIOURACIL
U165	NAPHTHALENE
U166	1,4-NAPHTHALENEDIONE
U166	1,4-NAPHTHOQUINONE
U167	1-NAPTHALENAMINE
U167	ALPHA-NAPHTHYLAMINE
U168	2-NAPTHALENAMINE
U168	BETA-NAPHTHYLAMINE
U169	BENZENE, NITRO-
U169	NITROBENZENE (I,T)
U170	P-NITROPHENOL (I,T)
U170	PHENOL, 4-NITRO-
U171	2-NITROPROPANE (I,T)
U171	PROPANE, 2-NITRO- (I,T)
U172	1-BUTANAMINE, N-BUTYL-N-NITROSO-
U172	N-NITROSODI-N-BUTYLAMINE
U173	ETHANOL, 2,2'-(NITROSOIMINO)BIS-
U173	N-NITROSODIETHANOLAMINE
U174	ETHANAMINE, N-ETHYL-N-NITROSO-
U174	N-NITROSODIETHYLAMINE
U176	N-NITROSO-N-ETHYLUREA
U176	UREA, N-ETHYL-N-NITROSO-
U177	N-NITROSO-N-METHYLUREA
U177	UREA, N-METHYL-N-NITROSO-
U178	CARBAMIC ACID, METHYLNITROSO-, ETHYL ESTER

U178	N-NITROSO-N-METHYLURETHANE
U179	N-NITROSOPIPERIDINE
U179	PIPERIDINE, 1-NITROSO-
U180	N-NITROSOPYRROLIDINE
U180	PYRROLIDINE, 1-NITROSO-
U181	5-NITRO-O-TOLUIDINE
U181	BENZENAMINE, 2-METHYL-5-NITRO
U182	1,3,5-TRIOXANE, 2,4,6-TRIMETHYL-
U182	PARALDEHYDE
U183	BENZENE, PENTACHLORO-
U183	PENTACHLOROBENZENE
U184	ETHANE, PENTACHLORO-
U184	PENTACHLOROETHANE
U185	BENZENE, PENTACHLORONITRO-
U185	PENTACHLORONITROBENZENE (PCNB)
U186	1,3-PENTADIENE (I)
U186	1-METHYLBUTADIENE (I)
U187	ACETAMIDE, N-(4-ETHOXYPHENYL)-
U187	PHENACETIN
U188	PHENOL
U189	PHOSPHORUS SULFIDE (R)
U189	SULFUR PHOSPHIDE (R)
U190	1,3-ISOBENZOFURANDIONE
U190	PHTHALIC ANHYDRIDE
U191	2-PICOLINE
U191	PYRIDINE, 2-METHYL-
U192	BENZAMIDE, 3,5-DICHLORO-N-(1,1-DIMETHYL-2-PROPYNYL)-
U192	PRONAMIDE
U193	1,2-OXATHIOLANE, 2,2-DIOXIDE
U193	1,3-PROPANE SULTONE
U194	1-PROPANAMINE (I,T)
U194	N-PROPYLAMINE (I,T)
U196	PYRIDINE
U197	2,5-CYCLOHEXADIENE-1,4-DIONE
U197	P-BENZOQUINONE
U200	RESERPINE
U200	YOHIMBAN-16-CARBOXYLIC ACID, 11,17-DIMETHOXY-18-[(3,4,5-TRIMETHOXYBENZOYL)OXY]-, METHYL ESTER,(3BETA, 16BETA, 17ALPHA, 18BETA, 20ALPHA)-
U201	1,3-BENZENEDIOL
U201	RESORCINOL
U202	1,2-BENZISOTHIAZOL-3(2H)-ONE, 1,1-DIOXIDE, & SALTS
U202	SACCHARIN, & SALTS
U203	1,3-BENZODIOXOLE, 5-(2-PROPENYL)-
U203	SAFROLE
U204	SELENIOUS ACID
U204	SELENIUM DIOXIDE



Order# 141197 Job# 336212 606 of 937

U205	SELENIUM SULFIDE
U205	SELENIUM SULFIDE SES2 (R,T)
U206	$\hbox{D-GLUCOSE, 2-DEOXY-2-[[(METHYLNITROSOAMINO)-CARBONYL]AMINO]-}\\$
U206	GLUCOPYRANOSE, 2-DEOXY-2-(3-METHYL-3-NITROSOUREIDO)-,D-
U206	STREPTOZOTOCIN
U207	1,2,4,5-TETRACHLOROBENZENE
U207	BENZENE, 1,2,4,5-TETRACHLORO-
U208	1,1,1,2-TETRACHLOROETHANE
U208	ETHANE, 1,1,1,2-TETRACHLORO-
U209	1,1,2,2-TETRACHLOROETHANE
U209	ETHANE, 1,1,2,2-TETRACHLORO-
U210	ETHENE, TETRACHLORO-
U211	CARBON TETRACHLORIDE
U211	METHANE, TETRACHLORO-
U213	FURAN, TETRAHYDRO-(I)
U213	TETRAHYDROFURAN (I)
U214	ACETIC ACID, THALLIUM(1+) SALT
U214	THALLIUM(I) ACETATE
U215	CARBONIC ACID, DITHALLIUM(1+) SALT
U215	THALLIUM(I) CARBONATE
U216	THALLIUM CHLORIDE TLCL
U216	THALLIUM(I) CHLORIDE
U217	NITRIC ACID, THALLIUM(1+) SALT
U217	THALLIUM(I) NITRATE
U218	ETHANETHIOAMIDE
U218	THIOACETAMIDE
U219	THIOUREA
U220	BENZENE, METHYL-
U220	TOLUENE
U221	BENZENEDIAMINE, AR-METHYL-
U221	TOLUENEDIAMINE
U222	BENZENAMINE, 2-METHYL-, HYDROCHLORIDE
U222	O-TOLUIDINE HYDROCHLORIDE
U223	BENZENE, 1,3-DIISOCYANATOMETHYL- (R,T)
U223	TOLUENE DIISOCYANATE (R,T)
U225	BROMOFORM
U225	METHANE, TRIBROMO-
U226	ETHANE, 1,1,1-TRICHLORO-
U226	METHYL CHLOROFORM
U227	1,1,2-TRICHLOROETHANE
U227	ETHANE, 1,1,2-TRICHLORO-
U228	ETHENE, TRICHLORO-
U228	TRICHLOROETHYLENE
U234	1,3,5-TRINITROBENZENE (R,T)
U234	BENZENE, 1,3,5-TRINITRO-

U235	1-PROPANOL, 2,3-DIBROMO-, PHOSPHATE (3:1)
U235	TRIS(2,3,-DIBROMOPROPYL) PHOSPHATE
U236	$2,7\text{-NAPHTHALENEDISULFONIC ACID,} 3,3\text{-}[(3,3\text{-DIMETHYL}[1,1\text{-BIPHENYL}]-4,4\text{-DIYL})} BIS(AZO)BIS[5\text{-AMINO-4-HYDROXY}]-, TETRASODIUM SALT$
U236	TRYPAN BLUE
U237	2,4-(1H,3H)-PYRIMIDINEDIONE, 5-[BIS(2-CHLOROETHYL)AMINO]-
U237	URACIL MUSTARD
U238	CARBAMIC ACID, ETHYL ESTER
U238	ETHYL CARBAMATE (URETHANE)
U239	BENZENE, DIMETHYL- (I,T)
U239	XYLENE (I)
U240	2,4-D, SALTS & ESTERS
U240	ACETIC ACID, (2,4-DICHLOROPHENOXY)-, SALTS & ESTERS
U243	1-PROPENE, 1,1,2,3,3,3-HEXACHLORO-
U243	HEXACHLOROPROPENE
U244	THIOPEROXYDICARBONIC DIAMIDE [(H2N)C(S)]2S2, TETRAMETHYL-
U244	THIRAM
U246	CYANOGEN BROMIDE (CN)BR
U247	BENZENE, 1,1'-(2,2,2-TRICHLOROETHYLIDENE)BIS[4-METHOXY-
U247	METHOXYCHLOR
U248	2H-1-BENZOPYRAN-2-ONE, 4-HYDROXY-3-(3-OXO-1-PHENYL-BUTYL)-, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS
U248	WARFARIN, & SALTS, WHEN PRESENT AT CONCENTRATIONS OF 0.3% OR LESS
U249	ZINC PHOSPHIDE ZN3P2, WHEN PRESENT AT CONCENTRATIONS OF 10% OR LESS
U271	
U277	
U278	
U279	
U280	
U328	BENZENAMINE, 2-METHYL-
U328	O-TOLUIDINE
U353	BENZENAMINE, 4-METHYL-
U353	P-TOLUIDINE P-TOLUIDINE
U359	ETHANOL, 2-ETHOXY-
U359	ETHYLENE GLYCOL MONOETHYL ETHER
U364	BENDIOCARB PHENOL
U364	1,3,BENZODIOXOL-4-OL,2,2-DIMETHYL-,
U365	H-AZEPINE-1-CARBOTHIOIC ACID, HEXAHYDRO-, S-ETHYL ESTER
U365	MOLINATE
U366	DAZOMET
U366	2H-1,3,5-THIADIAZINE-2-THIONE, TETRAHYDRO-3,5-DIMETHYL-
U367	7-BENZOFURANOL, 2,3-DIHYDRO-2,2-DIMETHYL-
U367	CARBOFURAN PHENOL
U372	CARBAMIC ACID, 1H-BENZIMIDAZOL-2-YL, METHYL ESTER
U372	CARBENDAZIM
U373	CARBAMIC ACID, PHENYL-, 1-METHYLETHYL ESTER



Order# 141197 Job# 336212 608 of 937

U373	PROPHAM
U375	CARBAMIC ACID, BUTYL-, 3-IODO-2-PROPYNYL ESTER
U375	3-IODO-2-PROPYNYL N-BUTYLCARBAMATE
U376	${\tt CARBAMODITHIOIC\ ACID,\ DIMETHYL-,\ TETRAANHYDROSULFIDE\ WITH\ ORTHOTHIOSELENIOUS\ ACID}$
U376	SELENIUM, TETRAKIS(DIMETHYLDITHIOCARBAMATE)
U377	CARBAMODITHIOIC ACID, METHYL-, MONOPOTASSIUM SALT
U377	POTASSIUM N-METHYLDITHIOCARBAMATE
U378	CARBAMODITHIOIC ACID, (HYDROXYMETHYL)METHYL-, MONOPOTASSIUM SALT
U378	POTASSIUM N-HYDROXYMETHYL-N-METHYLDI-THIOCARBAMATE
U379	CARBAMODITHIOIC ACID, DIBUTYL, SODIUM SALT
U379	SODIUM DIBUTYLDITHIOCARBAMATE
U381	CARBAMODITHIOIC ACID, DIETHYL-, SODIUM SALT
U381	SODIUM DIETHYLDITHIOCARBAMATE
U382	CARBAMODITHIOIC ACID, DIMETHYL-, SODIUM SALT
U382	SODIUM DIMETHYLDITHIOCARBAMATE
U383	CARBAMODITHIOIC ACID, DIMETHYL, POTASSIUM SALT
U383	POTASSIUM DIMETHYLDITHIOCARBAMATE
U384	CARBAMODITHIOIC ACID, METHYL-, MONOSODIUM SALT
U384	METAM SODIUM
U385	CARBAMOTHIOIC ACID, DIPROPYL-, S-PROPYL ESTER
U385	VERNOLATE
U386	CARBAMOTHIOIC ACID, CYCLOHEXYETHYL-, S-ETHYL ESTER
U386	CYCLOATE
U387	CARBAMOTHIOIC ACID, DIPROPYL-, S-(PHENYLMETHYL) ESTER
U387	PROSULFOCARB
U389	CARBAMOTHIOIC ACID, BIS(1-METHYLETHYL)-, S-(2,3,3-TRICHLORO-2-PROPENYL) ESTER
U389	TRIALLATE
U390	CARBAMOTHIOIC ACID, DIPROPYL-, S-ETHYL ESTER
U390	EPTC
U391	CARBAMOTHIOIC ACID, BUTYLETHYL-, S-PROPYL ESTER
U391	PEBULATE
U392	BUTYLATE
U392	CARBAMOTHIOIC ACID, BIS(2-METHYPROPYL)-, S-ETHYL ESTER
U393	COPPER, BIS(DIMETHYLCARBAMODITHIOATO-S,SÆ)-
U393	COPPER DIMETHYLDITHIOCARBAMATE
U394	A2213
U394	ETHANIMIDOTHIOIC ACID, 2-(DIMETHYLAMINO)-N-HYDROXY-2-OXO-, METHYL ESTER
U395	DIETHYLENE GLYCOL, DICARBAMATE
U395	ETHANOL, 2,2Æ-OXYBIS-, DICARBAMATE
U396	FERBAM
U396	IRON, TRIS(DIMETHYLCARBAMODITHIATO-S,SÆ)-,
U400	BIS(PENTAMETHYLENE)TRIURAM TETRASULFIDE
U400	PIPERIDINE, 1,1Æ-(TETRATHIODICARBONOTHIOYL)-BIS-
U401	BIS(DIMETHYLTHIOCARBAMOYL) SULFIDE
U401	TETRAMETHYLTHIURAM MONOSULFIDE



U402 TETRABUTYLTHIURAM DISULFIDE

U402 THIOPEROXYDICARBONIC DIAMIDE, TETRABUTYL

U403 DISULFIRAM

U403 THIOPEROXYDICARBONIC DIAMIDE, TETRAETHYL

U404 ETHANAMINE, N,N-DIETHYL-

U404 TRIETHYLAMINE U407 ETHYL ZIRAM

U407 ZINC, BIS(DIETHYLCARBAMODITHIOATO-S,SÆ)-

U409 CARBAMIC ACID, [1,2-PHENYLENE BIS(IMINOCARBONOTHIOL)]BIS-, DIMETHYL ESTER

U409 THIOPHANATE-METHYL

U410 ETHANINIDOTHIOIC ACID, N,NÆ-[THIOBIS[(METHYLIMINO) CARBONYLOXY]]BIS-, DIMETHYL ESTER

U410 THIODICARB

U411 PHENOL, 2-(1-METHYLETHOXY)-, METHYLCARBAMATE

U411 PROPOXUR

**UNIVERSAL WASTE** 

WASTE TYPE: ACCUMULATED GENERATED SOURCE TYPE:

WASTE ON-SITE: WASTE ON-SITE:

BATTERIES NO NO ANNUAL/BIENNIAL REPORT LAMPS NO NO ANNUAL/BIENNIAL REPORT PESTICIDES NO NO ANNUAL/BIENNIAL REPORT MERCURY CONTAINING NO NO ANNUAL/BIENNIAL REPORT

**EQUIPMENT** 

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 39114

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 39114

STATION NAME: CLAY COOLEY NISSAN

ADDRESS: 4914 S IH-35

**AUSTIN, TX 78745** 

INTERSECTION DIRECTIONS: NOT REPORTED

STATION PHONE: 512-444-1400

STATION CURRENT STATUS: **OPEN: THE STATION IS OPEN.** 

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: ELECTRIC

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: 1/15/2011

DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 7/9/2018

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-05-14 21:16:45 UTC

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 48318

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 48318

STATION NAME: CLAY COOLEY NISSAN

ADDRESS: 4914 S IH-35

**AUSTIN, TX 78745** 

INTERSECTION DIRECTIONS: NOT REPORTED

STATION PHONE: 512-444-1400

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: ELECTRIC

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: 1/15/2011
DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 7/9/2018

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-05-14 21:16:45 UTC

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 79015

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 79015

STATION NAME: CLAY COOLEY NISSAN ADDRESS: 4914 S IH 35 FRONTAGE RD

**AUSTIN, TX 78745** 

INTERSECTION DIRECTIONS: NOT REPORTED

STATION PHONE: 512-710-1100

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: NOT REPORTED

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: 9/1/2011

DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 11/2/2016

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2017-02-17 20:09:57 UTC

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 79047

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 79047

STATION NAME: CLAY COOLEY NISSAN ADDRESS: 4914 S IH 35 FRONTAGE RD

**AUSTIN, TX 78745** 

INTERSECTION DIRECTIONS: NOT REPORTED

STATION PHONE: 512-710-1100

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: NOT REPORTED

OWNER TYPE: PRIVATELY OWNED
FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: 9/1/2011

DATE THE STATION'S DETAILS WERE LAST CONFIRMED: 11/2/2016

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2017-02-17 20:09:57 UTC

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 85133 EPA ID: TXR000022236 NAME: CEN-TEX NISSAN INC

TNRCC ID #: 105711 ADDRESS: 4914 S IH 35

NAME: CEN-TEX NISSAN AUSTIN, TX 78745

ADDRESS: 4914 S IH 35 PHONE: 1-512-4441400

**AUSTIN, TX 78745** 

CONTACT: JIMMY A WEBB

PHONE: **512-4441400** 

BUSINESS DESCRIPTION: AUTOMOBILE DEALERSHIP

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/29/2006

**ACTIVITIES** 

ACTIVITY TYPE: **HANDLER STATUS**ACTIVITY DESCRIPTION: **OTHER** 

**WASTE** 

WASTE ID: 160218

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: WASTE SOLVENT FROM PARTS CLEANING OPERATIONS

**Back to Report Summary** 

Order# 141197 Job# 336212 615 of 937

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 69** 

Distance from Property: 0.039 mi. (206 ft.) NNW

Elevation: 627 ft. (Higher than TP)

PROGRAM ID: 85133 RN NUMBER: RN103776217 NAME: CEN-TEX NISSAN ADDRESS: 4914 S IH 35

**AUSTIN, TX 78745** 

STATUS: INACTIVE STATUS DATE: 2/10/14

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION: 4914 S IH 35, AUSTIN, TX

**MAP ID# 70** 

Distance from Property: 0.041 mi. (216 ft.) N

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: ANTIQUE STREET LAMPS INC

REGISTRATION#: 20760 EPA ID: NOT REPORTED

1000000 Do Doy 10000

TNRCC ID #: **7193** 

ADDRESS: PO BOX 43289

AUSTIN, TX 78745

OWNER INFORMATION

NAME: ANTIQUE STREET LAMS CULLEN LANE

PHONE: **1-512-2829780** 

ADDRESS: 9005 CULLEN LN

**AUSTIN, TX 78748** 

CONTACT: ROBERT PEERY

PHONE: 512-2829780

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: CLOSED

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/31/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 271646

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 272206

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 1179

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

Order# 141197 Job# 336212 617 of 937

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 1180

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 1181

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 1182

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 70** 

Distance from Property: 0.041 mi. (216 ft.) N

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 82165 EPA ID: TXD988059861 NAME: STAR CUSTOMS INC
TNRCC ID #: 37330 ADDRESS: 9005B CULLEN LN
NAME: HOLT CUSTOMS AUSTIN, TX 78748

ADDRESS: 9005B CULLEN LN PHONE: 1-512-2802604

AUSTIN, TX 78748

CONTACT: DAVID L MORGAN

PHONE: 512-2802604

BUSINESS DESCRIPTION: CONVERSION & CUSTOMIZING OF NEW VEHICLES INCLUDING CUSTOM PAINT & INTERIORS.

THIS REGISTRATION WAS INACTIVATED BECAUSE THE FACILITY WAS REGISTERED PRIOR TO 1995

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/19/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 83105

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 70** 

Distance from Property: 0.041 mi. (216 ft.) N

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD988059861 OWNER TYPE: NOT REPORTED

NAME: HOLT CUSTOMS INC

ADDRESS: 9005B CULLEN LN

AUSTIN, TX 78748
OPERATOR NAME: HOLT CUSTOMS INC

OPERATOR NAME: HOLT CUSTOMS INC

CONTACT NAME: DAVID L MORGAN
CONTACT ADDRESS: 9005B CULLEN LN
AUSTIN TX 78748

CONTACT PHONE: 512-280-2604

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

CERTIFICATION - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

811121 - AUTOMOTIVE BODY, PAINT, AND INTERIOR REPAIR AND MAINTENANCE

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM
D007 CHROMIUM
D008 LEAD

D035 METHYL ETHYL KETONE

Order# 141197 Job# 336212 620 of 937

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 71** 

Distance from Property: 0.045 mi. (238 ft.) WNW

Elevation: 638 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 79939

NAME: PCW CONSTRUCTION

ADDRESS: 10704 S IH 35

**AUSTIN, TX 78748** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 06/29/2009

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/06/2009 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/02/2009

SIGNATURE NAME & TITLE: JAY TINSLEY, OPS MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603822727 NAME: JOHNSON OIL COMPANY

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2009

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN603506619

NAME: JAIME

CONTACT ADDRESS: OPERATOR ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL BEGIN DATE: 07/01/2009

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: ROLANDO JAIME

TITLE: OWNER

ORGANIZATION: PCW CONSTRUCTION

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 2336161 0

GeoSearch www.geo-search.com 888-396-0042

622 of 937

ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 212404 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: IT1189 REGISTRATION DATE: 07/06/2009

INSTALLATION DATE: 06/29/2009 STATUS BEGIN DATE: 06/29/2009

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO** 

STAGE I VAPOR RECOVERY: **EXEMPT BY TCEQ RULE**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

623 of 937

### Affected Property Assessment Reports (APAR)

**MAP ID# 72** 

Distance from Property: 0.056 mi. (296 ft.) NW

Elevation: 686 ft. (Higher than TP)

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: T1674

NOT REPORTED

REFERENCE NUMBER: RN103099990

FACILITY NAME: AARONS AUTO PARTS AUSTIN

ADDRESS: 8409 S CONGRESS AVE

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGULATED ENTITY NAME: AARONS AUTO PARTS

LOCATION DESCRIPTION: NOT REPORTED

TYPE OF FACILITY: AUTO SVC STN/REPAIR/VEH MAINTE

FACILITY STATUS: COMPLETED WORKLOAD PROGRAM: IHW CORRECTIVE ACTION

PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE **CONTAMINATIONS:** 11/19/04 **NOT REPORTED** 

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 72** 

Distance from Property: 0.056 mi. (296 ft.) NW

Elevation: 686 ft. (Higher than TP)

PROGRAM ID: T1674 RN NUMBER: RN103099990 NAME: AARONS AUTO PARTS ADDRESS: 8409 S CONGRESS AVE **AUSTIN, TX 78745** 

STATUS: INACTIVE STATUS DATE: 12/14/05

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 73** 

Distance from Property: 0.059 mi. (312 ft.) WNW

Elevation: 703 ft. (Higher than TP)

**FACILITY INFORMATION** GEOSEARCH ID: 03395

UST ID #: 03395

NAME: MACLEOD RANCH

ADDRESS: 11922 **AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NOT REPORTED

COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 74** 

Distance from Property: 0.072 mi. (380 ft.) E

Elevation: 622 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0536

UST ID #: C0536

NAME: ADAM'S EXTRACT

ADDRESS: 2217 ONION CREEK PKWY

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**CONTACT INFORMATION** 

ORGANIZATION: ADAMS EXTRACT

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: DICK MEYER

PHONE: (512) 2821100 0

TITLE: MANAGER

**MAP ID# 74** 

Distance from Property: 0.072 mi. (380 ft.) E

Elevation: 622 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **55718** 

NAME: ADAMS EXTRACT

ADDRESS: 2217 ONION CREEK PKWY

**AUSTIN, TX 78747** 

COUNTY: TRAVIS

REGION: 11

TYPE: INDUST/MFG/CHEM PLANT

BEGIN DATE: 09/24/1990 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/30/1990 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/28/1990

SIGNATURE NAME & TITLE: **JOHN G ADAMS, OWNER** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600783492

NAME: ADAMS JOHN G

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION
BEGIN DATE: 09/24/1990

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 06/01/1960 REGISTRATION DATE: 08/30/1990
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/06/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL: STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 128483

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 08/01/1955 REGISTRATION DATE: 08/30/1990

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 01/06/1995 INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

STEEL

CORROSION PROTECTION:



629 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 128484

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 75** 

Distance from Property: 0.072 mi. (380 ft.) NW

Elevation: 646 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 85794 EPA ID: TXR000010009 NAME: CHAMPION TOYOTA
TNRCC ID #: 108033 ADDRESS: 4901 WEIDEMAR LN

NAME: CHAMPION TOYOTA AUSTIN, TX 78745

ADDRESS: 4901 WEIDEMAR LN PHONE: 1-512-7075555

AUSTIN, TX 78745

CONTACT: DON STEWART

PHONE: **512-7075555** 

BUSINESS DESCRIPTION: AUTOMOTIVE PAINT AND BODY REPAIR

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/04/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 171718

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTE PAINT AND PAINT RELATED MATERIAL FROM CLEAN UP OF PAINT GUNS

AND EQUIPMENT

**Back to Report Summary** 

Order# 141197 Job# 336212 631 of 937

**MAP ID# 75** 

Distance from Property: 0.072 mi. (380 ft.) NW

Elevation: 646 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000010009 OWNER TYPE: NOT REPORTED

NAME: CHAMPION TOYOTA

ADDRESS: 4901 WEIDEMAR LANE OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78745 OPERATOR NAME: MCCOMBS ENTERPRISES

CONTACT NAME: DON STEWART

CONTACT ADDRESS: 4901 WEIDEMAR LANE

**AUSTIN TX 78745** 

CONTACT PHONE: 512-707-5555

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/29/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

811121 - AUTOMOTIVE BODY, PAINT, AND INTERIOR REPAIR AND MAINTENANCE

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL
BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;
ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT
NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE
OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS. AND A TOTAL OF TEN PERCENT OR MORE (BY

OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 632 of 937

F005

THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 76** 

Distance from Property: 0.074 mi. (391 ft.) ESE

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000067637 OWNER TYPE: PRIVATE

NAME: TARGET STORE 0683 OWNER NAME: TARGET CORP

ADDRESS: 6405 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744-3412 OPERATOR NAME: TARGET CORP

CONTACT NAME: **JENNIFER R RYMANOWSKI** 

CONTACT ADDRESS: POBOX 111

MINNEAPOLIS MN 55440-0111

CONTACT PHONE: 612-304-4417

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 01/17/2006

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

JENNIFER RYMANOWSKI NATL ENVIRO COMPL MGR 12/29/2005

INDUSTRY CLASSIFICATION (NAICS)

**452112 - DISCOUNT DEPARTMENT STORES** 

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR LAST UPDATED DATE: 01/24/2006

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

**UNIVERSAL WASTE** 

WASTE TYPE: ACCUMULATED GENERATED SOURCE TYPE:

WASTE ON-SITE: WASTE ON-SITE:

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 634 of 937

BATTERIES NO YES NOTIFICATION LAMPS NO YES NOTIFICATION

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 77** 

Distance from Property: 0.08 mi. (422 ft.) NW

Elevation: 655 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0087

UST ID #: C0087

NAME: NIGHTHAWK FROZEN FOODS

ADDRESS: 1120 SHELBY LN

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 77** 

Distance from Property: 0.08 mi. (422 ft.) NW

Elevation: 655 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 74979 EPA ID: TXR000012336 NAME: COLLISION TEAM OF AMERICA LLC

TNRCC ID #: 29338 ADDRESS: 500 E OHIO ST

NAME: B&B BODY AND PAINT INDIANAPOLIS, IN 46204

ADDRESS: 1120 SHELBY LN PHONE: NOT REPORTED

**AUSTIN, TX 78745** 

CONTACT: TED D MCCLINTIC

PHONE: 317-6305030

BUSINESS DESCRIPTION: AUTOMOBILE BODY REPAIR AND PAINTING. NIGHT HAWK FOODS WAS INACTIVATED BECAUSETHERE WERE ONLY 6-DIGIT WASTE CODES ON THE NOR AND NO WASTE ACTIVITY WAS REPORTED I

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/03/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 173933

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT AND PAINT THINNER RELATED WASTE FROM PAINT BEING PURCHASED,

MIXED AND SPRA

WASTE ID: 173934

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT AND PAINT THINNER RELATED WASTE. PAINT IS PURCHASED, MIXED AND

SPRAYED. E

WASTE ID: 57026



Order# 141197 Job# 336212 637 of 937

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 77** 

Distance from Property: 0.08 mi. (422 ft.) NW

Elevation: 655 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: **J E HYDE** 

NAME: NIGHT HAWK FROZEN FOODS

TITLE: VP

ADDRESS: 1120 SHELBY LN

ORGANIZATION: NIGHT HAWK FROZEN FOODS

AUSTIN, TX 78745

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: TRAVIS

CITY NOT REPORTED

REGION: 11

ID#: 14471

PHONE: (512) 4444781 0

CONTACT INFORMATION

TYPE: UNKNOWN
BEGIN DATE: 08/12/1986
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/17/1986

SIGNATURE NAME & TITLE: **J E HYDE, VP**ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600411714

NAME: NIGHT HAWK FROZEN FOODS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/12/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1968 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 639 of 937

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 41258

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1968 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/28/1989** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

Order# 141197 Job# 336212 640 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 41259

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 77** 

Distance from Property: 0.08 mi. (422 ft.) NW

Elevation: 655 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD177592896 OWNER TYPE: PRIVATE

NAME: GARLYN SHELTON MAZDA

ADDRESS: 1120A SHELBY LN

AUSTIN, TX 78745

OWNER NAME: GARLYN O SHELTON

OPERATOR TYPE: NOT REPORTED

OPERATOR NAME: NOT REPORTED

CONTACT NAME: JIM WYLY

CONTACT ADDRESS: 1120A SHELBY LN

**AUSTIN TX 78745** 

CONTACT PHONE: 512-462-2922

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 12/08/1988

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS) - NO NAICS INFORMATION REPORTED -

— CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 04/04/2013

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

F002 THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE. METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE, 1,1,2-TRICHLORO-1,2,2-TRICHLOROETHANE, CHLOROETHANE, CHLOROETHANE

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

GeoSearch www.geo-search.com 888-396-0042

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

**MAP ID# 77** 

Distance from Property: 0.08 mi. (422 ft.) NW

Elevation: 655 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000012336 OWNER TYPE: NOT REPORTED

NAME: **B&B BODY AND PAINT** OWNER NAME: **COLLISION TEAM OF AMERICA LLC** 

ADDRESS: 1120 SHELBY LANE OPERATOR TYPE: NOT REPORTED

AUSTIN, TX 78745 OPERATOR NAME: COLLISION TEAM OF AMERICA LLC

CONTACT NAME: TED D MCCLINTIC
CONTACT ADDRESS: 1120 SHELBY LANE

**AUSTIN TX 78745** 

CONTACT PHONE: 317-630-5030

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 08/17/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

811121 - AUTOMOTIVE BODY, PAINT, AND INTERIOR REPAIR AND MAINTENANCE

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D008 LEAD
D018 BENZENE
D022 CHLOROFORM

D028 1,2-DICHLOROETHANE



Order# 141197 Job# 336212 644 of 937

## Resource Conservation & Recovery Act - Non-Generator (RCRANGR06)

F003 THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

CORRECTIVE ACTION EVENT

NO CORRECTIVE ACTION EVENT(S) REPORTED

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 78** 

Distance from Property: 0.081 mi. (428 ft.) SW

Elevation: 655 ft. (Higher than TP)

PROGRAM ID: T1726 RN NUMBER: RN104615810

NAME: POMPA TRUCKING AUSTIN ADDRESS: 9203 CULLEN LN

**AUSTIN, TX 78748** 

STATUS: INACTIVE STATUS DATE: 6/24/04

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

## Dry Cleaner Registration Database (DCR)

**MAP ID# 79** 

Distance from Property: 0.086 mi. (454 ft.) WNW

Elevation: 669 ft. (Higher than TP)

**FACILITY INFORMATION** 

LOCATION NUMBER: RN100582568

CUSTOMER #: CN605126424
REGISTRATION ID: DCR10197

REGULATED ENTITY NAME: SE-P OPERATING

NAME: SE-P OPERATING

ADDRESS: 919 E SAINT ELMO RD

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

ACCOUNT NUMBER: 24007398 REGION: REGION 11 - AUSTIN

PRINCIPAL NAME: SE-P OPERATING LLC

ADDRESS: 5324 CAMERON RD

**AUSTIN, TX 78723** 

EMAIL ADDRESS: BARB@RICKSCLEANERS.COM

PHONE NUMBER: 512-4532916
SITE TYPE: FACILITY REGISTRATION

SITE STATUS: ACTIVE
ELIGIBLE ANSWER: YES
GROSS RECEIPT: > \$150,000
FISCAL YEAR: FY2019
SOLVENT: PETROLEUM
QUANTITY: 867 GALLONS

FISCAL YEAR: FY2018
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2017
SOLVENT: PETROLEUM
QUANTITY: 616 GALLONS

FISCAL YEAR: FY2016
SOLVENT: PETROLEUM
QUANTITY: 556 GALLONS

FISCAL YEAR: FY2015

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 525 GALLONS

FISCAL YEAR: FY2014

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 411 GALLONS

647 of 937

## Dry Cleaner Registration Database (DCR)

FISCAL YEAR: FY2013

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 366.7 GALLONS

FISCAL YEAR: FY2012

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 540 GALLONS

FISCAL YEAR: FY2011

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 620 GALLONS

FISCAL YEAR: FY2010

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 308 GALLONS

FISCAL YEAR: FY2009

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 308 GALLONS

FISCAL YEAR: FY2008

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 443.9 GALLONS

FISCAL YEAR: FY2007

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 720 GALLONS

FISCAL YEAR: FY2006

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 386 GALLONS

FISCAL YEAR: FY2005

SOLVENT: PERCHLOROETHYLENE (TETRACHLOROETHYLENE)

QUANTITY: 0 GALLONS

FISCAL YEAR: FY2004
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

**Back to Report Summary** 



Order# 141197 Job# 336212 648 of 937

**MAP ID# 79** 

Distance from Property: 0.086 mi. (454 ft.) WNW

Elevation: 669 ft. (Higher than TP)

**FACILITY INFORMATION** 

TNRCC ID #: 109546

OWNER INFORMATION

REGISTRATION#: 86102 EPA ID: TXR000031443 NAME: ESE-T OPERATING LP ADDRESS: 5324 CAMERON RD

NAME: ESE-T OPERATING

**AUSTIN, TX 78723** 

ADDRESS: 919 E SAINT ELMO RD

PHONE: 1-512-4532916

**AUSTIN, TX 78745** 

CONTACT: BARB HUMPHREYS

PHONE: 512-4532916

BUSINESS DESCRIPTION: DRY CLEANERS INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES

WASTE RECEIVER: NO WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 05/23/2013

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 176030

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: WASTE LIQUID TETRACHLOROETHYLENE THAT CAN NO LONGER BE USED.

WASTE ID: 176029

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: FILTERS USED TO FILTER & CLEAN THE TETRACHLOROETHYLENE IN THE DRY

**CLEANING PROCE** 

WASTE ID: 176028

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO



649 of 937

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: TETRACHLOROETHYLENE STILL BOTTOM (SLUDGE). GENERATING PROCESS:

THE CHEMICAL ISD

## Resource Conservation & Recovery Act - Generator (RCRAGR06)

**MAP ID# 79** 

Distance from Property: 0.086 mi. (454 ft.) WNW

Elevation: 669 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000031443 OWNER TYPE: PRIVATE

NAME: ESE-T OPERATING LP OWNER NAME: ESE-T OPERATING LP

ADDRESS: 919 E ST ELMO OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: ESE-T OPERATING LP

CONTACT NAME: BARB HUMPHREYS
CONTACT ADDRESS: 5324 CAMERON RD

**AUSTIN TX 78723** 

CONTACT PHONE: 512-453-2916

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 07/26/2001

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

BARB HUMPHREYS MANAGER 04/26/2007

**INDUSTRY CLASSIFICATION (NAICS)** 

81232 - DRYCLEANING AND LAUNDRY SERVICES (EXCEPT COIN-OPERATED)

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR LAST UPDATED DATE: 05/22/2007

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: **NO**UNIVERSAL WASTE DESTINATION FACILITY: **NO** 

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D039 TETRACHLOROETHYLENE

Order# 141197 Job# 336212 651 of 937

## Resource Conservation & Recovery Act - Generator (RCRAGR06)

F002

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 80** 

Distance from Property: 0.103 mi. (544 ft.) ESE

Elevation: 663 ft. (Higher than TP)

FACILITY INFORMATION
GEOSEARCH ID: 01170

UST ID #: 01170

NAME: CANNON FOOD MART

ADDRESS: 1719 E WILLIAM CANNON DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 80** 

Distance from Property: 0.093 mi. (491 ft.) ESE

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 11313

NAME: CANNON FOOD MART

ADDRESS: 1719 E WILLIAM CANNON DR

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: **RETAIL** 

BEGIN DATE: 08/31/1988

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 02/06/2019
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/05/2019

SIGNATURE NAME & TITLE: LAHZAT KHANJE, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601193709
NAME: CANNON MART INC

CONTACT ADDRESS: 1719 E WILLIAM CANNON DR STE A

**AUSTIN TX 78744** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/11/2000

CONTACT ROLE: OWNOPRCON

CONTACT NAME: LAHZAT ALI KHANJAE

CONTACT TITLE: PRES

ORGANIZATION: CANNON MART INC

PHONE: (512) 4413634 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN601193709

NAME: CANNON MART INC

CONTACT ADDRESS: 1719 E WILLIAM CANNON DR STE A

**AUSTIN TX 78744** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/11/2000

CONTACT ROLE: OWNOPRCON

CONTACT NAME: LAHZAT ALI KHANJAE

CONTACT TITLE: PRES

CONTACT INFORMATION

NAME: LAHZAT ALI KHANJAE

TITLE: PRES

ORGANIZATION: CANNON FOOD MART

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (512) 4413634 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: CANNON MART INC

PHONE: (512) 4413634 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 316061 SIGNATURE DATE: 02/05/2019

SIGNATURE NAME & TITLE: LAHZAT KHANJE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 299404
SIGNATURE DATE: 01/17/2018

SIGNATURE NAME & TITLE: LAHZAT KHANJAE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 283026
SIGNATURE DATE: 02/25/2017

SIGNATURE NAME & TITLE: LAHZAT KHANJAE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 264924
SIGNATURE DATE: 01/18/2016

SIGNATURE NAME & TITLE: LAHZAT KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 248426
SIGNATURE DATE: 01/26/2015

SIGNATURE NAME & TITLE: LAHZAT A KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230968
SIGNATURE DATE: 01/24/2014

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: **RENEWAL**REGISTRATION FLAG: **YES**SELF-CERTIFICATION ID: 134792
SIGNATURE DATE: 02/12/2013

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134791
SIGNATURE DATE: 01/18/2012

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134790
SIGNATURE DATE: 01/08/2011



Order# 141197 Job# 336212 655 of 937

SIGNATURE NAME & TITLE: LAHZAT KHANJAQ, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134789
SIGNATURE DATE: 01/16/2010

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134788
SIGNATURE DATE: 01/31/2009

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134787
SIGNATURE DATE: 01/01/2008

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134786
SIGNATURE DATE: 01/17/2007

SIGNATURE NAME & TITLE: LAHZA ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134785
SIGNATURE DATE: 01/17/2006

SIGNATURE NAME & TITLE: LAHZAI ALI KHANJAE, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134784
SIGNATURE DATE: 02/22/2005

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134783
SIGNATURE DATE: 02/25/2004

SIGNATURE NAME & TITLE: LAHZAT A KHANJAE, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134782
SIGNATURE DATE: 02/05/2003

SIGNATURE NAME & TITLE: KHANJAE L ALI, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134781
SIGNATURE DATE: 01/17/2002

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, VP

FILING STATUS: RENEWAL



REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 134780
SIGNATURE DATE: 01/22/2001

SIGNATURE NAME & TITLE: LAHZAT ALI KHANJAE, PRES

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1980

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 129670

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

 ${\bf SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE}$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES



Order# 141197 Job# 336212 657 of 937

CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1980 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 4000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1980

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 129671

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING),SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 



Order# 141197 Job# 336212 658 of 937

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 81** 

Distance from Property: 0.093 mi. (491 ft.) E

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 02002

UST ID #: 02002

NAME: CORNER STORE NO. 2194

ADDRESS: 1706 E WILLIAM CANNON DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 81** 

Distance from Property: 0.093 mi. (491 ft.) E

Elevation: 663 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 24541

NAME: CIRCLE K STORE 2742194

ADDRESS: 1706 E WILLIAM CANNON DR

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 10/02/1986

STATUS: ACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/25/2017 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/24/2017

SIGNATURE NAME & TITLE: JENNIFER RESNIK, O&E COMP COORDINATOR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN604312868

NAME: SKIPPER BEVERAGE COMPANY LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED

ORGANIZATION: SKIPPER BEVERAGE COMPANY LLC

PHONE: (210) 6922275 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN604312868

NAME: SKIPPER BEVERAGE COMPANY LLC

CONTACT ADDRESS: PO BOX 690350

**SAN ANTONIO TX 78269** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 04/29/2013

CONTACT ROLE: OWNOPRCON CONTACT NAME: KENT HAMEL CONTACT TITLE: NOT REPORTED **CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

660 of 937

ORGANIZATION: SKIPPER BEVERAGE COMPANY LLC

PHONE: (210) 6922275 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 327540 SIGNATURE DATE: 09/25/2019

SIGNATURE NAME & TITLE: ANNETTE S TOALE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 310739
SIGNATURE DATE: 10/01/2018

SIGNATURE NAME & TITLE: ANNETTE S TOALE, WC ENVIRO MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 292367
SIGNATURE DATE: 08/24/2017

SIGNATURE NAME & TITLE: JENNIFER RESNIK, O&E COMP COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 275417
SIGNATURE DATE: 08/23/2016

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 258552
SIGNATURE DATE: 08/26/2015

SIGNATURE NAME & TITLE: JENNIFER RESNIK, COMP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 242407
SIGNATURE DATE: 08/29/2014

SIGNATURE NAME & TITLE: **JENNIFER RESNIK, COMP COORD** 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 226104
SIGNATURE DATE: 09/11/2013

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63483
SIGNATURE DATE: 09/11/2012

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63482
SIGNATURE DATE: 08/24/2011



Order# 141197 Job# 336212 661 of 937

SIGNATURE NAME & TITLE: KENT HAMEL, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63481
SIGNATURE DATE: 08/24/2010

SIGNATURE NAME & TITLE: KENT HAMEL, COMP SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63480
SIGNATURE DATE: 03/23/2010

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63479
SIGNATURE DATE: 08/27/2009

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63478
SIGNATURE DATE: 08/29/2008

SIGNATURE NAME & TITLE: KENT HAMEL, COMP COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63477
SIGNATURE DATE: 08/29/2007

SIGNATURE NAME & TITLE: KENT HAMEL, O & E SPECIALIST

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63476
SIGNATURE DATE: 08/28/2007

SIGNATURE NAME & TITLE: KENT HAMEL, COMPLIANCE COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63475
SIGNATURE DATE: 08/02/2006

SIGNATURE NAME & TITLE: KENT HAMEL, O&E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63474
SIGNATURE DATE: 07/27/2005

SIGNATURE NAME & TITLE: KENT HAMEL, O & E SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63473
SIGNATURE DATE: 08/09/2004

SIGNATURE NAME & TITLE: KENT HAMEL, O&E SPECIALIST

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 662 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63472
SIGNATURE DATE: 08/05/2003

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O & E SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63471
SIGNATURE DATE: 07/24/2002

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O&E SPEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 63470
SIGNATURE DATE: 12/29/2000

SIGNATURE NAME & TITLE: CHRIS TRINKLE, O & E SPEC

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 6116
APPLICATION RECEIVED DATE: 06/17/2011
SCHEDULE CONSTRUCTION DATE: 07/15/2011

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPLACE (4) EXISTING DISPENSERS WITH BLENDING DISPENSERS AND CONVERTING ONE TANK TO DIESEL. NO

CONCRETE WILL BE BROKEN, THIS IS A LIKE FOR LIKE DISPENSER SWAP OUT.

NOTIFICATION CONSTRUCTION ID: 27448

APPLICATION RECEIVED DATE: 04/15/2015

SCHEDULE CONSTRUCTION DATE: 04/27/2015

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPLACE SPILL BUCKET ON DISEL TANK - REQUEST 30 DAY WAIVER

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 08/18/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 



Order# 141197 Job# 336212 663 of 937

**UST COMPARTMENT ID: 61571** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 08/18/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 61572

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET



Order# 141197 Job# 336212 664 of 937

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 08/18/1986

TANK CAPACITY (GAL): 9728 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1985

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

CATHODIC PROTECTION - FIELD INSTALLATION, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 61573

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 9728

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING

(NONCORRODIBLE), ISOLATED IN OPEN AREA/2ND CONTAINMENT

EXTERNAL CONTAINMENT: NOT REPORTED

Order# 141197 Job# 336212 665 of 937

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@  $0.1\ GPH$ )

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: 03093

UST ID #: 03093

NAME: COA SERVICE CENTER #8
ADDRESS: 4411 MEINARDUS DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 81607 EPA ID: TX0000365957 NAME: CITY OF AUSTIN DBA AUSTIN ENERGY

TNRCC ID #: 36629 ADDRESS: 721 BARTON SPRINGS RD

NAME: ST ELMO SERVICE CENTER AUSTIN, TX 78704
ADDRESS: 4411 MEINARDUS DR STE A PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: TODD SHAW PHONE: 512-3226267

BUSINESS DESCRIPTION: THE CITY OF AUSTIN ELECTRIC UTILITY DEPARTMENT PRODUCES AND DISTRIBUTES

**ELECTRICITY FOR THE CITY OF AUSTIN.** 

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/07/2019

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 136819

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MERCURY-CONTAINING EQUIPMENT COMPONENTS; REMOVED DUE TO

**EQUIPMENT DECOMMISSIONING** 

WASTE ID: 136820

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PLANT TRASH FROM FACILITY OR OFFICES; PAPER, CARDBOARD, LININGS,

WRAPPINGS, PACK
WASTE ID: 142655

Order# 141197 Job# 336212 668 of 937

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PCB CAPACITOR, SMALL; < 1.36 KG (3 LB) DIELECTRIC FLUID; GENERATED AFTER

**REMOVIN** 

WASTE ID: 142656

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CAPACITOR, SMALL, NON-PCB; GENERATED FROM THE DECOMMISSIONING OF

**ELECTRICAL EQUI** 

WASTE ID: **75612** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SMALL CAPACITORS WITHOUT PCBS; GENERATED FROM REMOVING ELECTRICAL

**EQUIPMENT FROM** 

WASTE ID: 129737

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ALKALINE BATTERIES, SPENT; GENERATED FROM REPLACEMENT IN SMALL

**ELECTRICAL EQUIPM** 

WASTE ID: 121898

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLUORESCENT LAMPS, SPENT; REPLACED DURING ROUTINE MAINTENANCE

**ACTIVITIES** 

WASTE ID: **75613** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PCB LIGHT BALLASTS; GENERATED FROM REMOVING ELECTRICAL EQUIPMENT

FROM SERVICE; W
WASTE ID: 75614

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHT BALLASTS WITHOUT PCBS; GENERATED FROM REMOVING ELECTRICAL

**EQUIPMENT FROM S** 

WASTE ID: 142657

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: BALLAST, NON-PCB; GENERATED FROM THE DECOMMISSIONING OF ELECTRICAL

Order# 141197 Job# 336212 669 of 937

#### **EQUIPMENT**

WASTE ID: 149322

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NICKEL-CADMIUM BATTERIES, SPENT; 5/96

WASTE ID: 108246

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CABLE, LEAD-COATED; CONTAINS < 50 PPM PCB OIL; USED IN UNDERGROUND

**ELECTRICAL VA** 

WASTE ID: 97156

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT HALOGENATED SOLVENT USED IN DEGREASING & CLEANING ELECTRICAL

#### **EQUIPMENT**

WASTE ID: 108247

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LAMPS, SPENT, MERCURY-CONTAINING; HIGH-PRESSURE SODIUM, MERCURY

VAPOR; REPLACEDD

WASTE ID: **75615** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: MERCURY LAMP BALLASTS; GENERATED FROM REMOVAL OF ELECTRICAL

#### **EQUIPMENT FROM SERVI**

WASTE ID: 108248

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: DETERGENT, CAUSTIC, USED IN CLEANING EQUIPMENT DURING ROUTINE

#### **MAINTENANCE ACTIVI**

WASTE ID: **75616** 

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: METAL SCRAP FROM DECOMMISSIONED POLES AND

#### TRANSMISSION/DISTRIBUTION EQUIPMENT; G

WASTE ID: 283318

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: NO



Order# 141197 Job# 336212 670 of 937

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 283319

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: NO WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

FACILITY INFORMATION

OWNER INFORMATION

REGISTRATION#: 84139 EPA ID: TXR000024232 NAME: CITY OF AUSTIN TNRCC ID #: 102058 ADDRESS: PO BOX 1088

NAME: SERVICE CENTER 8 AUSTIN, TX 78767

ADDRESS: 4411 MEINARDUS DR STE B PHONE: NOT REPORTED

**AUSTIN, TX 78744** 

CONTACT: WILL OCONNOR

PHONE: 512-9273297

BUSINESS DESCRIPTION: AUTOMOTIVE MAINTENANCE SHOP (TRUCKS, TRACTOR, CARS, AERIAL TOWERS).

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/09/2008

**ACTIVITIES** 

ACTIVITY TYPE: USED OIL

ACTIVITY DESCRIPTION: MARKETER OF SPEC. FUEL OIL

**WASTE** 

WASTE ID: 135441

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED MOTOR OIL. USED ANTIFREEZE (ENGINE COOLANT)USED AUTOMOTIVE

BATTERIES. USE

WASTE ID: 155535

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: SOLVENT (SPENT) USED FOR PARTS DEGREASING/ DATE OF INITIAL GENERATION

AUG 1995.

WASTE ID: 155536

WASTE CODE STATUS: INACTIVE

Order# 141197 Job# 336212 672 of 937

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SOLVENT (SPENT)/ USED FOR PARTS DEGREASING/ DATE OF INITIAL

**GENERATION AUG 1995.** 

WASTE ID: 155533

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: AQUEOUS WASTE WITH LOW OTHER TOXIC ORGANICS, FROM BRAKE CLEANING.

**INITIAL GENER** 

WASTE ID: 162805

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WIPES/RAG CONTAMINATED WITH SOLVENT, ANTI-FREEZE. CLEANUP OF

**GENERAL WORKING AR** 

WASTE ID: 155534

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: DATE OF INITIAL GENERATION AUG. 1995. WASTE COMPOUNDS, CLEANING

LIQUIDS.

## No Longer Regulated RCRA Non-CORRACTS TSD Facilities (NLRRCRAT)

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000024232 OWNER TYPE: MUNICIPAL

NAME: CITY OF AUSTIN

ADDRESS: 4411 MEINARDUS DR BLDG B

AUSTIN, TX 78744 OPERATOR NAME: CITY OF AUSTIN

OPERATOR NAME: CITY OF AUSTIN

CONTACT NAME: WILL OCONNOR CONTACT ADDRESS: 6400 BOLM RD

**AUSTIN TX 78721** 

CONTACT PHONE: 512-927-3297

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 09/09/2008

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

 WILL OCONNOR
 OCC HLTH & SFTY
 09/09/2008

 WILL OCONNOR
 OCC HLTH & SFTY
 07/08/2008

 JOANN COWAN
 OCC HLTH & SFTY
 12/20/2007

 PAUL GROSS
 FUEL OPERATIONS
 03/07/2007

INDUSTRY CLASSIFICATION (NAICS)
811111 - GENERAL AUTOMOTIVE REPAIR

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 09/30/2008

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 674 of 937

# No Longer Regulated RCRA Non-CORRACTS TSD Facilities (NLRRCRAT)

D008 LEAD
D018 BENZENE

D027 1,4-DICHLOROBENZENE
D035 METHYL ETHYL KETONE
D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 47046

NAME: SERVICE CENTER 8

ADDRESS: 4411 MEINARDUS DR STE D

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 02/15/1989

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 3 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/15/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/15/2019 SIGNATURE NAME & TITLE: WILLIAM OCONNOR, FLEET PROG MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600135198

NAME: CITY OF AUSTIN

CONTACT ADDRESS: 6400 BOLM RD

**AUSTIN TX 78721** 

TYPE: CITY GOVERNMENT BEGIN DATE: 02/15/1989 CONTACT ROLE: OWNCON CONTACT NAME: JIMMY TUBBS CONTACT TITLE: FUEL OPS COORD ORGANIZATION: CITY OF AUSTIN

PHONE: (512) 9782649 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600135198

NAME: CITY OF AUSTIN

CONTACT ADDRESS: 505 BARTON SPRINGS RD

**AUSTIN TX 78704** 

TYPE: CITY GOVERNMENT BEGIN DATE: 02/15/1989 CONTACT ROLE: OPRCON

CONTACT NAME: SANDRA CREIGHTON CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: FRANK GOMEZ

TITLE: SVC MGR

**ORGANIZATION: SERVICE CENTER 8** 

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 9743075 0

676 of 937

ORGANIZATION: CITY OF AUSTIN

PHONE: NOT REPORTED FAX: NOT REPORTED EMAIL: NOT REPORTED SELF-CERTIFICATION

SELF-CERTIFICATION ID: 320629 SIGNATURE DATE: 05/15/2019

SIGNATURE NAME & TITLE: WILLIAM OCONNOR, FLEET PROG MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 303808
SIGNATURE DATE: 05/10/2018

SIGNATURE NAME & TITLE: WILLIAM O'CONNOR, FLEET PROGRAM MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 286262
SIGNATURE DATE: 04/11/2017

SIGNATURE NAME & TITLE: WILLIAM OCONNOR, FLT PROG MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 270487
SIGNATURE DATE: 05/24/2016

SIGNATURE NAME & TITLE: WILLIAM OCONNOR, FLEET MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 253950
SIGNATURE DATE: 06/01/2015

SIGNATURE NAME & TITLE: WILLIAM OCONNOR, FLEET MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 236396
SIGNATURE DATE: 04/23/2014

SIGNATURE NAME & TITLE: VALERIE SPINELLI, GRANTS COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 218833
SIGNATURE DATE: 04/18/2013

SIGNATURE NAME & TITLE: JIMMY TUBBS, FUEL SPEC SR

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 116
SIGNATURE DATE: 05/07/2012

SIGNATURE NAME & TITLE: JIMMY TUBBS, FUEL SPEC SR

FILING STATUS: RENEWAL REGISTRATION FLAG: YES SELF-CERTIFICATION ID: 115 SIGNATURE DATE: 04/08/2011

SIGNATURE NAME & TITLE: JIMMY TUBBS, FUEL SPEC SENIOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 114
SIGNATURE DATE: 05/10/2010

SIGNATURE NAME & TITLE: WILL O'CONNOR, FLEET PROGRAM MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 113
SIGNATURE DATE: 04/06/2009

SIGNATURE NAME & TITLE: STACEY MONROE, FUEL OPS COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 112
SIGNATURE DATE: 06/05/2008

SIGNATURE NAME & TITLE: WILL OCONNOR, FLT PGM MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 111
SIGNATURE DATE: 05/01/2007

SIGNATURE NAME & TITLE: PAUL GROSS, FUEL OPS MANAGER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 110
SIGNATURE DATE: 05/01/2006

SIGNATURE NAME & TITLE: PAUL GROSS, FUEL OPER COORD

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 109
SIGNATURE DATE: 05/02/2005

SIGNATURE NAME & TITLE: MARC CHILDERS, NOT REPORTED

FILING STATUS: RENEWAL REGISTRATION FLAG: YES SELF-CERTIFICATION ID: 108 SIGNATURE DATE: 05/21/2004

SIGNATURE NAME & TITLE: MARC CHILDERS, FUEL OPER MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 107
SIGNATURE DATE: 04/29/2003

SIGNATURE NAME & TITLE: MARC CHILDERS, FUEL OPERATIONS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 106
SIGNATURE DATE: 04/25/2002

SIGNATURE NAME & TITLE: MARC CHILDERS, NOT REPORTED

FILING STATUS: RENEWAL



REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 105
SIGNATURE DATE: 01/30/2001

SIGNATURE NAME & TITLE: MARC CHILDERS, FUEL OPS MGR

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 94
APPLICATION RECEIVED DATE: 03/29/2012
SCHEDULE CONSTRUCTION DATE: 04/02/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**REPLACE FLEXIBLE E-85 PIPE.** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 02/14/1989

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 324

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 



Order# 141197 Job# 336212 679 of 937

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 02/14/1989

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 325

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG



Order# 141197 Job# 336212 680 of 937

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1989 REGISTRATION DATE: 02/14/1989

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 01/01/1989

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

CATHODIC PROTECTION - FACTORY INSTALLATION, CATHODIC PROTECTION - FIELD INSTALLATION, COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE), FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 326

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP, FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE, FLOW RESTRICTOR VALUE, ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING), SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

Order# 141197 Job# 336212 681 of 937

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TX0000365957 OWNER TYPE: PRIVATE

NAME: ST ELMO SERVICE CENTER OWNER NAME: CITY OF AUSTIN DBA AUSTIN ENERGY

ADDRESS: 4411 MEINARDUS DR STE A OPERATOR TYPE: PRIVATE

AUSTIN, TX 78744-1170 OPERATOR NAME: CITY OF AUSTIN DBA AUSTIN

**ENERGY** 

CONTACT NAME: TODD SHAW

CONTACT ADDRESS: 721 BARTON SPRINGS RD

**AUSTIN TX 78704-1328** 

CONTACT PHONE: 512-322-6267

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 11/29/2005

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

 TODD SHAW
 ENGINEER II
 03/06/2019

 TODD SHAW
 UNKNOWN
 11/29/2005

INDUSTRY CLASSIFICATION (NAICS)
221122 - ELECTRIC POWER DISTRIBUTION

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/12/2019

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: **NO**USED OIL FUEL MARKETER TO BURNER: **NO**USED OIL REFINER: **NO**SPECIFICATION USED OIL MARKETER: **NO** 

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** - **NO EVALUATIONS REPORTED** - **VIOLATIONS** - **NO VIOLATIONS REPORTED** -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D000

D001 IGNITABLE WASTE
D002 CORROSIVE WASTE

GeoSearch www.geo-search.com 888-396-0042

D006 CADMIUM
D008 LEAD
D009 MERCURY

D039 TETRACHLOROETHYLENE

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE

CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-

TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2,

TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT

SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL

BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL;

ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT

NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS

FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON

DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA
- NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

**MAP ID# 82** 

Distance from Property: 0.105 mi. (554 ft.) ESE

Elevation: 659 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXR000024232 OWNER TYPE: MUNICIPAL

NAME: CITY OF AUSTIN

ADDRESS: 4411 MEINARDUS DR BLDG B

AUSTIN, TX 78744 OPERATOR NAME: CITY OF AUSTIN

OPERATOR NAME: CITY OF AUSTIN

CONTACT NAME: WILL OCONNOR
CONTACT ADDRESS: 6400 BOLM RD
AUSTIN TX 78721

CONTACT PHONE: 512-927-3297

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 09/09/2008

**CERTIFICATION** 

CERTIFICATION NAME: CERTIFICATION TITLE: CERTIFICATION SIGNED DATE:

 WILL OCONNOR
 OCC HLTH & SFTY
 09/09/2008

 WILL OCONNOR
 OCC HLTH & SFTY
 07/08/2008

 JOANN COWAN
 OCC HLTH & SFTY
 12/20/2007

 PAUL GROSS
 FUEL OPERATIONS
 03/07/2007

INDUSTRY CLASSIFICATION (NAICS)
811111 - GENERAL AUTOMOTIVE REPAIR

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 09/30/2008

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO USED OIL FUEL BURNER: NO ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

EVALUATIONS - NO EVALUATIONS REPORTED - VIOLATIONS - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

D006 CADMIUM

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 685 of 937

D008 LEAD
D018 BENZENE

D027 1,4-DICHLOROBENZENE
D035 METHYL ETHYL KETONE
D039 TETRACHLOROETHYLENE
D040 TRICHLORETHYLENE

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 83** 

Distance from Property: 0.111 mi. (586 ft.) W

Elevation: 676 ft. (Higher than TP)

FACILITY INFORMATION
GEOSEARCH ID: 03079

UST ID #: 03079

NAME: HOWDY HONDA

ADDRESS: 4110 SANTIAGO ST

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 83** 

Distance from Property: 0.111 mi. (586 ft.) W

Elevation: 676 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 68954 EPA ID: NOT REPORTED NAME: HOWDY HONDA

TNRCC ID #: 23870 ADDRESS: 4110 SANTIAGO ST
NAME: HOWDY HONDA AUSTIN, TX 78745

ADDRESS: 4110 SANTIAGO ST PHONE: 1-512-4434300

AUSTIN, TX 78745

CONTACT: WILLIE SEDGWICK

PHONE: 512-4434300

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/12/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 48822

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 48823

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



**MAP ID# 83** 

Distance from Property: 0.111 mi. (586 ft.) W

Elevation: 676 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 105202

LPST ID: 105202
FACILITY ID: 1284
NAME: HOWDY HONDA

ADDRESS: 4110 SANTIAGO ST

**AUSTIN, TX 78745** 

### **LEAKING TANK DETAILS**

LPST ID: 105202

NAME: HOWDY HONDA

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/3/92

REPORTED DATE: 10/21/1992 ENTERED DATE: 12/03/1992 CLOSURE DATE: 07/13/1995

PRP INFORMATION
NAME: MAUND CHARLES

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78745
CONTACT: NOT REPORTED

PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/19/1998

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL: **STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 4548** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/13/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4549

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 690 of 937

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 190970 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/28/1999

INSTALLATION DATE: 01/01/1999 STATUS BEGIN DATE: 01/01/1999

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **YES** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**CONTACT INFORMATION** 

ORGANIZATION: HOWDY HONDA

**MAP ID# 83** 

Distance from Property: 0.111 mi. (586 ft.) W

Elevation: 676 ft. (Higher than TP)

**FACILITY INFORMATION** 

ADDRESS: 4110 SANTIAGO ST

ID#: 1284 NAME: CLIFF COLLIER

NAME: **HOWDY HONDA**TITLE: **NOT REPORTED** 

AUSTIN, TX 78745 MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: TRAVIS CITY NOT REPORTED

REGION: 11 PHONE: (512) 4434300 0

TYPE: FLEET REFUELING
BEGIN DATE: 06/03/1986
STATUS: ACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **1** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/10/1986

SIGNATURE NAME & TITLE: J BISSONNET, SVC MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600308340

NAME: HOWDY HONDA

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

CITY NOT REPORTED

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/03/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/19/1998** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4548

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 500 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/13/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:



Order# 141197 Job# 336212 693 of 937

### FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4549

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 500

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 190970 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/28/1999

INSTALLATION DATE: 01/01/1999 STATUS BEGIN DATE: 01/01/1999

TANK CAPACITY (GAL): 2000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **YES** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



Order# 141197 Job# 336212 694 of 937

## Voluntary Cleanup Program Sites (VCP)

**MAP ID# 83** 

Distance from Property: 0.111 mi. (586 ft.) W

Elevation: 676 ft. (Higher than TP)

### **FACILITY INFORMATION**

PROGRAM ID#: 0586

NAME: JOHN ROBERTS BMW/LEXUS OF AUST

ADDRESS: 4110 SANTIAGO ST

**AUSTIN TX 78745** 

ADDRESS DESCRIPTION: 4110 SANTIAGO STREET AKA JOHN ROBERTS BMW LEXUS OF AUSTIN

ASSOCIATED VCP ID(s): 586

PCA NUMBER: 38496

PROJECT NUMBER: 314960

LEGAL ID: 1000497

REGULATED ENTITY REFERENCE NUMBER (RN): RN100598556

CURRENT FACILITY TYPE: **AUTO DEALERSHIP**FORMER FACILITY TYPE: **NOT REPORTED** 

PROJECT MANAGER: PWEHNER
PROJECT PHASE: COMPLETED

ADMINISTRATIVE STATUS: INACTIVE
CASHIER RECEIVED DATE: 08/04/1997
APPLICATION RECEIVED DATE: 08/04/1997
APPLICATION ACCEPTANCE DATE: 09/04/1997

VCP APPLICATION ACCEPTED: YES

AGREEMENT ACCEPTANCE DATE: NOT REPORTED
REGION NOTIFIED OF APPLICATION: 08/04/1997
TCEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: PAHS; TPH

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE: NOT REPORTED

LPST NO: **NOT REPORTED**IOP ID: **NOT REPORTED** 

EPA CERCLIS #: NOT REPORTED

EPA RCRIS #: NOT REPORTED

FILE MEDIA: MICROFILM FILE LOCATION: CR

SITE SIZE: 2

Order# 141197 Job# 336212 695 of 937

## Voluntary Cleanup Program Sites (VCP)

TYPE OF REMEDY: EXCAVATION/REMOVAL TO OFFSITE LANDFILL

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 06/05/1998

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: RRR

APPLICABLE STANDARDS: 2

APPLICABLE TRRP TIER: NOT REPORTED

### **AFFILIATED CUSTOMER(S)**

CN NUMBER: **CN600308340** RN NUMBER: **RN100598556** 

CUSTOMER NAME: HOWDY HONDA

ROLE CD: BILLCONT

CONTACT NAME: COLLIER, CLIFF
CONTACT TITLE: NOT REPORTED
ORGANIZATION NAME: HOWDY HONDA
MAILING ADDRESS: 4110 SANTIAGO ST

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78745** 

CONTACT PHONE: (512) 443-4300

**Back to Report Summary** 

Order# 141197 Job# 336212 696 of 937

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 84** 

Distance from Property: 0.112 mi. (591 ft.) WNW

Elevation: 665 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0170

UST ID #: C0170 NAME: CARMAX

ADDRESS: 4400 S IH 35 AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: A

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 84** 

Distance from Property: 0.112 mi. (591 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 68643 EPA ID: TXD982289449 NAME: HENDRIX GMC TRUCKS INC

TNRCC ID #: 23581

ADDRESS: PO BOX 19363 **AUSTIN, TX 78760** 

NAME: HENDRIX GMC TRUCKS

CONTACT: BRUCE GLASCOCK

ADDRESS: 4400 S IH 35

PHONE: 1-512-4446635

**AUSTIN, TX 78745** 

PHONE: 512-4446635

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES

WASTE RECEIVER: NO WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/08/2005

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 153354

WASTE CODE STATUS: INACTIVE

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: PARTS DEGREASER/WASTE NAPHTHA/USED TO CLEAN AUTOMOTIVE PARTS.

WASTE ID: 48333

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 48334

WASTE CODE STATUS: INACTIVE WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: NO

698 of 937

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 84** 

Distance from Property: 0.112 mi. (591 ft.) WNW

Elevation: 665 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 109366

LPST ID: 109366 FACILITY ID: 1280

NAME: HENDRIX GMC TRUCKS INC

ADDRESS: 4400 S IH 35

**AUSTIN, TX 78745** 

### **LEAKING TANK DETAILS**

LPST ID: 109366

NAME: **HENDRIX GMC TRUCKS INC**FACILITY LOCATION: **NOT REPORTED** 

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 2/22/96

REPORTED DATE: 01/11/1996 ENTERED DATE: 02/22/1996 CLOSURE DATE: 01/31/1996

### **PRP INFORMATION**

NAME: **HENDRIX GMC TRUCKS INC**ADDRESS: **ADDRESS NOT REPORTED** 

AUSTIN TX 78721
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1600 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/11/1990

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 141197 Job# 336212 700 of 937

### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 4543** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1600

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 250 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/22/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL: **NOT REPORTED** 

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4544

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 250

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 208137 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/02/2007

INSTALLATION DATE: 01/01/2007 STATUS BEGIN DATE: 01/01/2007

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO
CONTAINMENT LINER: NO NONE: NO
STAGE I VAPOR RECOVERY: TWO POINT SYSTEM

STAGE I INSTALLATION DATE: 01/16/2007

**CONTACT INFORMATION** 

ORGANIZATION: CARMAX 7190

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: ALI WOODWORTH

TITLE: NOT REPORTED

PHONE: (804) 7470422 0

**MAP ID# 84** 

Distance from Property: 0.112 mi. (591 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 1280

NAME: CARMAX 7190

ADDRESS: 4400 S IH 35

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 06/03/1986

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/12/1986

SIGNATURE NAME & TITLE: W C HENDRIX, PRES ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600366355

NAME: CARMAX AUTO SUPERSTORES INC

CONTACT ADDRESS: 12800 TUCKAHOE CREEK PKWY

**RICHMOND VA 23238** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/2006

CONTACT ROLE: OWNOPRCON CONTACT NAME: JOHANNA GRISCIK

CONTACT TITLE: ENV MGR

ORGANIZATION: CARMAX AUTO SUPERSTORES INC

PHONE: (804) 7470422 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600366355

NAME: CARMAX AUTO SUPERSTORES INC

CONTACT ADDRESS: 12800 TUCKAHOE CREEK PKWY

**RICHMOND VA 23238** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 08/31/2006

CONTACT ROLE: OWNOPRCON CONTACT NAME: JOHANNA GRISCIK

CONTACT TITLE: ENV MGR

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: CARMAX AUTO SUPERSTORES INC

PHONE: (804) 7470422 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 302

APPLICATION RECEIVED DATE: 09/26/2006

SCHEDULE CONSTRUCTION DATE: 10/26/2006

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1600 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/11/1990** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4543

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1600

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

Order# 141197 Job# 336212 704 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 250 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/22/1994** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 4544

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: USED OIL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 250

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

AST ID #: 208137 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 1 REGISTRATION DATE: 04/02/2007

INSTALLATION DATE: 01/01/2007 STATUS BEGIN DATE: 01/01/2007

TANK CAPACITY (GAL): 4000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: GASOLINE



Order# 141197 Job# 336212 705 of 937

### **MATERIAL OF CONSTRUCTION**

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **TWO POINT SYSTEM** 

STAGE I INSTALLATION DATE: 01/16/2007

**MAP ID# 84** 

Distance from Property: 0.112 mi. (591 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD982289449 OWNER TYPE: PRIVATE

NAME: HENDRIX GMC TRUCKS INC OWNER NAME: HENDRIX GMC TRUCKS INC

ADDRESS: 4400 S IH 35 OPERATOR TYPE: PRIVATE

AUSTIN, TX 78745 OPERATOR NAME: HENDRIX GMC TRUCKS INC

CONTACT NAME: BRUCE GLASCOCK
CONTACT ADDRESS: PO BOX 19363
AUSTIN TX 78760

CONTACT PHONE: 512-444-6635

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

<u>CERTIFICATION</u> - NO CERTIFICATION REPORTED -

INDUSTRY CLASSIFICATION (NAICS)

336211 - MOTOR VEHICLE BODY MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 02/17/2005

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

02/08/1989 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

**VIOLATIONS** - NO VIOLATIONS REPORTED -

**ENFORCEMENTS** - NO ENFORCEMENTS REPORTED -

HAZARDOUS WASTE

D001 IGNITABLE WASTE

F001 THE FOLLOWING SPENT HALOGENATED SOLVENTS USED IN DEGREASING:

TETRACHLOROETHYLENE, TRICHLORETHYLENE, METHYLENE CHLORIDE, 1,1,1-TRICHLOROETHANE, CARBON TETRACHLORIDE ANDCHLORINATED FLUOROCARBONS; ALL SPENT SOLVENT MIXTURES/BLENDS USED IN DEGREASING CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F002, F004, AND F005; AND STILL

BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 707 of 937

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 85** 

Distance from Property: 0.117 mi. (618 ft.) WNW

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0379

UST ID #: C0379

NAME: C J C HOLDINGS
ADDRESS: 7211 CIRCLE S RD

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 85** 

Distance from Property: 0.117 mi. (618 ft.) WNW

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 32601 EPA ID: TXD026028357

NAME: COMMEMORATIVE BRANDS INC

TNRCC ID #: 10138

ADDRESS: PO BOX 149056

NAME: COMMEMORATIVE BRANDS

AUSTIN, TX 78714

ADDRESS: 7211 CIRCLE S RD

CONTACT: JANICE DOLDER

PHONE: 1-512-4402320

**AUSTIN, TX 78745** 

PHONE: **512-4402320** 

512-4402320

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES

WASTE RECEIVER: NO

WASTE TRANSPORTER: NO

TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): YES

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: INDUSTRIAL THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/26/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 404096

WASTE CODE STATUS: **ACTIVE** 

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: 85-90% ISOPROPYL ALCOHOL. REMAINING 15% CONSTITUENTS - ETHYLENE

**GLYCOL, HYDROXYL** 

WASTE ID: 379301

WASTE CODE STATUS: ACTIVE

WASTE IS RADIOACTIVE: **NO** 

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE SPENT RHODIUM PLATING SOLUTION SENT FOR PRECIOUS METAL

**RECOVERY** 

WASTE ID: 361665

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 710 of 937

WASTE IS RADIOACTIVE: **NO** 

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: USED EMERGENCY EXIT SIGNS CONTAINING LOW LEVEL TRITIUM

WASTE ID: 127149

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SOLID CYANIDE SALTS AND BOTTOM SLUDGES HAVING BEEN GENERATED IN

PLATING PROCESS/

WASTE ID: 145242

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CAUSTIC AND/OR METAL SALTS HAVING BEEN GENERATED AS A RESIDUE OR

**DISCARDEDPRODUC** 

WASTE ID: 145243

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT CYANIDE PLATING LIQUID GENERATED FROM PLATING PROCESSES/ 1994.

WASTE ID: 145244

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: METHYLENE CHLORIDE WITH ADHESIVE GENERATED IN CLEANING/1994

WASTE ID: 145245

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CERAMIC INVESTMENT MATERIAL GENERATED IN MOLDING PROCESSES/1994.

WASTE ID: 145246

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTEWATER WITH INVESTMENT MATERIAL GENERATED IN MOLDING

PROCESSES/ 1994.

WASTE ID: 145249

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: WASTEWATER GENERATED FROM GOLD-PLATING PROCESSES/ 1994.

WASTE ID: 145253

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



GENERATOR'S DESCRIPTION OF WASTE: NEAUTRALIZED WASTEWATER FROM GOLD RECOVERY-CYANIDE

WASTE ID: 145254

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PLANT WASTEWATER THAT CAN CONTAIN METALS AND/OR INVESTMENT

MATERIAL/ 1994. WASTE ID: 145256

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MISCELLANEOUS LABPACKS OF DISCARDED OR EXPIRED LAB CHEMICALS OR

**OBSOLETE PRODUCT** 

WASTE ID: 145257

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED OIL GENERATED IN MACHINE MAINTENANCE/1994.

WASTE ID: 145258

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SCRAP METAL (STAINLESS STEEL, ALUMINUM, IRON, COPPER) GENERATED IN

**MANUFACTURIN** 

WASTE ID: 145259

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PLANT OFFICE/PRODUCTION REFUSE/1994.

WASTE ID: 188661

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT ANTIFREEZE GENERATED FROM PLATING PROCESSES/ 2001

WASTE ID: 189843

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OVEN BURNERS WITH BUILDUP OF CORROSIVE SOLID SODIUM HYDROXIDE/2001

WASTE ID: 190132

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: RCRA EMPTY CONTAINERS-(TRIPLE RINSED)

WASTE ID: 145260

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SUPPLEMENTAL PLANT PRODUCTION REFUSE THAT MAY CONTAIN SMALL

**AMOUNTS OF SANDBLAST** 

WASTE ID: 190872

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: PPE, PAPER TOWELS AND MISCELLANEOUS CLEANING MATERIALS

**CONTAMINATED WITH CYANIDE** 

WASTE ID: 191808

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT WITH MOTOR OIL AND PLASTIC SHAVINGS

WASTE ID: 191809

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT LUBRICANT WITH WAX (MOOSEMILK)

WASTE ID: 191810

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SOCKS, RAGS, TOWELS AND OTHER DEBRIS USED TO SOAK UP OIL AND/OR WIPE

SURFACES ANDE

WASTE ID: 194012

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OVEN BURNERS WITH BUILDUP OF CORROSIVE SOLID SODIUM HYDROXIDE

WASTE ID: 197542

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SOIL CONTAMINATED WITH RESIDUAL SODIUM HYDROXIDE/SODIUM PHOSPHATE

ANDEXTHOYLATED

WASTE ID: 201387

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: **SPENT WASH FROM CLEANING PROCESS OF RING TOPS.** 

WASTE ID: 221614

WASTE CODE STATUS: ACTIVE



Order# 141197 Job# 336212 713 of 937

WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT OXIGUARD DIP FROM RING CLEANING PROCESS CONTAINING >120 PPM

OF CHROME.

WASTE ID: 216886

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: USED FLOURESCENT LIGHT TUBES FROM A MAJOR CONSTRUCTION

RENNOVATION.

WASTE ID: 236852

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT SYNERGY LUBRICANT (96% WATER) CONTAINING LESS THAN 5.0 MG/L

LEAD. USED ASA

WASTE ID: 236853

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: SPENT SNYGERY 15 LUBRICANT FILTERS CONTAINING LESS THAN 5.0 MG/L OF

LEAD

WASTE ID: 92479

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CYANDIDE DIATING SALTS FROM CLASS RINGS GOLD PLATING.

WASTE ID: 204231

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: METAL PARTS, REFRACTORY, AND CONSTRUCTION DEBRIS FROM

**DECOMMISSIONING OF TRASH I** 

WASTE ID: 123851

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ETHYL ALCOHOL AND ETHYL POLYSILICATE, OUTDATED MATERIAL; 1995

WASTE ID: 209148

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: MIXED LAB PACKS OF NON-HAZARDOUS CHEMICALS AND MATERIALS

WASTE ID: 211363

WASTE CODE STATUS: ACTIVE



WASTE IS RADIOACTIVE: NO

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: CYANIDE CONTAMINATED CONSTRUCTION DEBRIS AFTER DECOMMISSIONING

PLATING ROOM.

WASTE ID: 244228

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: EQUIPMENT, PIPING, TANKS, AND OTHER DEBRIS ASSOCIATED WITH

**DECOMISSIONED SALT BA** 

WASTE ID: 259865

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 272759

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 271348

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 273358

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 286133

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26350

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26351

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

### Industrial and Hazardous Waste Sites (IHW)

WASTE ID: 26352

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26353

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26354

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26355

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26356

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 26357

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 85** 

Distance from Property: 0.117 mi. (618 ft.) WNW

Elevation: 660 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 105722

LPST ID: 105722
FACILITY ID: 6726
NAME: C J C HOLDINGS

ADDRESS: 7211 CIRCLE S RD

**AUSTIN, TX 78745** 

#### **LEAKING TANK DETAILS**

LPST ID: 105722

NAME: C J C HOLDINGS

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/23/95

REPORTED DATE: 01/07/1993 ENTERED DATE: 01/23/1995 CLOSURE DATE: 02/12/1993

PRP INFORMATION

NAME: C J C HOLDINGS

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78714
CONTACT: NOT REPORTED

PHONE: NOT REPORTED

#### UNDERGROUND STORAGE TANK

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 02/12/1993

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 23598

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**CONTACT INFORMATION** 

ORGANIZATION: CJC HOLDINGS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (512) 4402320 0

**MAP ID# 85** 

Distance from Property: 0.116 mi. (612 ft.) WNW

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 6726

NAME: CJC HOLDINGS

ADDRESS: 7211 CIRCLE S RD

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: **UNKNOWN**BEGIN DATE: **06/09/1986** 

STATUS: **INACTIVE**EXEMPT STATUS: **NO** 

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/09/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/07/1986 SIGNATURE NAME & TITLE: JOHN PERSON, GENERAL SER MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600409973

NAME: ARTCARVED CLASS RINGS INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/09/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1975 REGISTRATION DATE: 05/09/1986

TANK CAPACITY (GAL): NOT REPORTED EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **02/12/1993** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 23598

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: UNKNOWN

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 0

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 85** 

Distance from Property: 0.117 mi. (618 ft.) WNW

Elevation: 660 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD026028357 OWNER TYPE: PRIVATE

NAME: COMMEMORATIVE BRANDS OWNER NAME: COMMEMORATIVE BRANDS INC

ADDRESS: 7211 CIRCLE S RD OPERATOR TYPE: PRIVATE

> OPERATOR NAME: COMMEMORATIVE BRANDS INC **AUSTIN, TX 78745-6603**

> > CERTIFICATION SIGNED DATE:

01/25/1998

CONTACT NAME: JANICE DOLDER CONTACT ADDRESS: PO BOX 149056

**AUSTIN TX 78714-9056** 

CONTACT PHONE: 512-440-2320 NON-NOTIFIER: NOT A NON-NOTIFIER DATE RECEIVED BY AGENCY: 11/29/2005

**CERTIFICATION** 

**CERTIFICATION NAME:** 

**JANICE DOLDER SAFETY MANAGER** 10/25/2019

JANICE DOLDER SAFETY MANAGER 09/26/2018 **SAFETY MANAGER** JANICE DOLDER 01/26/2016 **JANICE DOLDER SAFETY MANAGER** 03/18/2014 JANICE DOLDER **UNKNOWN** 05/04/2010 **AUTHORIZED COMPANY AGENT JANICE DOLDER** 03/01/2010 JANICE DOLDER **UNKNOWN** 02/09/2010 JANICE DOLDER UNKNOWN 09/01/2009 **JANICE DOLDER UNKNOWN** 07/01/2008 **JANICE DOLDER UNKNOWN** 04/29/2008 **AUTHORIZEDAGENT** 

**CERTIFICATION TITLE:** 

**JANICE DOLDER** 03/01/2008 **JANICE DOLDER UNKNOWN** 07/31/2007 **JANICE DOLDER UNKNOWN** 08/25/2006 **UNKNOWN** JANICE DOLDER 06/28/2006 **JANICE DOLDER** UNKNOWN 05/04/2006 JANICE DOLDER **AUTHORIZEDAGENT** 03/01/2006 **JANICE DOLDER UNKNOWN** 11/29/2005 JANICE DOLDER UNKNOWN 06/02/2005 **JANICE DOLDER UNKNOWN** 02/16/2005 **JANICE DOLDER AUTHORIZEDAGENT** 03/01/2004 JANICE DOLDER **AUTHORIZEDAGENT** 03/01/2002 **JANICE DOLDER AUTHORIZED COMP** 01/25/2000

**INDUSTRY CLASSIFICATION (NAICS)** 

**JANICE DOLDER** 

332211 - CUTLERY AND FLATWARE (EXCEPT PRECIOUS) MANUFACTURING

**AUTHORIZED AGNT** 

33991 - JEWELRY AND SILVERWARE MANUFACTURING

339911 - JEWELRY (EXCEPT COSTUME) MANUFACTURING

CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: SMALL QUANTITY GENERATOR

LAST UPDATED DATE: 10/31/2019

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO



Order# 141197 Job# 336212 721 of 937

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO

USED OIL FUEL MARKETER TO BURNER: NO

USED OIL REFINER: NO

SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

#### **EVALUATIONS**

04/15/2010 NRR NON-FINANCIAL RECORD REVIEW

01/21/2010 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

08/23/2006 NRR NON-FINANCIAL RECORD REVIEW

04/26/2006 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
11/20/1997 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
01/29/1992 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

#### **VIOLATIONS**

01/21/2010 262.A GENERATORS - GENERAL

01/21/2010 262.C GENERATORS - PRE-TRANSPORT

01/21/2010 265.B TSD IS-GENERAL FACILITY STANDARDS 01/21/2010 265.C TSD IS-PREPAREDNESS AND PREVENTION

01/21/2010 265.D TSD IS-CONTINGENCY PLAN AND EMERGENCY PROCEDURES

01/21/2010 279.C USED OIL - GENERATORS

01/21/2010 XXS STATE STATUTE OR REGULATION
08/23/2006 262.C GENERATORS - PRE-TRANSPORT
08/23/2006 265.B TSD IS-GENERAL FACILITY STANDARDS
08/23/2006 270.A PERMITS - GENERAL INFORMATION
04/26/2006 262.C GENERATORS - PRE-TRANSPORT

04/26/2006 265.I TSD IS-CONTAINER USE AND MANAGEMENT

04/26/2006 265.J TSD IS-TANK SYSTEM STANDARDS

04/26/2006 279.C USED OIL - GENERATORS

04/26/2006 XXS STATE STATUTE OR REGULATION

11/20/1997 268.A LDR - GENERAL

01/29/1992 262.A GENERATORS - GENERAL

01/29/1992 XXS STATE STATUTE OR REGULATION

#### **ENFORCEMENTS**

02/18/2010 120 WRITTEN INFORMAL 05/10/2006 120 WRITTEN INFORMAL 11/20/1997 110 VERBAL INFORMAL 03/06/1992 120 WRITTEN INFORMAL



Order# 141197 Job# 336212 722 of 937

#### HAZARDOUS WASTE

D001 **IGNITABLE WASTE** D002 **CORROSIVE WASTE** D003 **REACTIVE WASTE** D004 **ARSENIC** D005 **BARIUM** D006 **CADMIUM** D007 **CHROMIUM** D008 LEAD

D008 LEAD
D009 MERCURY
D010 SELENIUM

D011 SILVER

THE FOLLOWING SPENT HALOGENATED SOLVENTS: TETRACHLOROETHYLENE, METHYLENE CHLORIDE, TRICHLOROETHYLENE, 1,1,1-TRICHLOROETHANE, CHLOROBENZENE, 1,1,2-TRICHLORO-1,2,2-TRIFLUOROETHANE, ORTHO-DICHLOROBENZENE, TRICHLOROFLUOROMETHANE, AND 1,1,2, TRICHLOROETHANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE HALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001,F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

THE FOLLOWING SPENT NON-HALOGENATED SOLVENTS: XYLENE, ACETONE, ETHYL ACETATE, ETHYL BENZENE, ETHYL ETHER, METHYL ISOBUTYL KETONE, N-BUTYL ALCOHOL, CYCLOHEXANONE, AND METHANOL; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONLY THE ABOVE SPENT NONHALOGENATED SOLVENTS; AND ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS, AND A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THOSE SOLVENTS LISTED IN F001, F002, F004, AND F005; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F005 THE FOLLOWING SPENT NONHALOGENATED SOLVENTS: TOLUENE, METHYL ETHYL KETONE, CARBON DISULFIDE, ISOBUTANOL, PYRIDINE, BENZENE, 2-ETHOXYETHANOL, AND 2-NITROPROPANE; ALL SPENT SOLVENT MIXTURES/BLENDS CONTAINING, BEFORE USE, A TOTAL OF TEN PERCENT OR MORE (BY VOLUME) OF ONE OR MORE OF THE ABOVE NONHALOGENATED SOLVENTS OR THOSE SOLVENTS LISTED IN F001, F002, OR F004; AND STILL BOTTOMS FROM THE RECOVERY OF THESE SPENT SOLVENTS AND SPENT SOLVENT MIXTURES.

F006 WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

F007 SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.

F008 PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

F009 SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH CYANIDES ARE USED IN THE PROCESS.

P030 CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED

P098 POTASSIUM CYANIDE

P098 POTASSIUM CYANIDE K(CN)

P106 SODIUM CYANIDE

P106 SODIUM CYANIDE NA(CN)

#### **UNIVERSAL WASTE**

WASTE TYPE: ACCUMULATED GENERATED SOURCE TYPE:

WASTE ON-SITE: WASTE ON-SITE:

BATTERIES NO NO ANNUAL/BIENNIAL REPORT
BATTERIES UNKNOWN UNKNOWN ANNUAL/BIENNIAL REPORT
LAMPS NO NO ANNUAL/BIENNIAL REPORT



Order# 141197 Job# 336212 723 of 937

LAMPS	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
PESTICIDES	NO	NO	ANNUAL/BIENNIAL REPORT
PESTICIDES	UNKNOWN	UNKNOWN	ANNUAL/BIENNIAL REPORT
MERCURY CONTAINING EQUIPMENT	NO	NO	ANNUAL/BIENNIAL REPORT

MERCURY CONTAINING UNKNOWN UNKNOWN ANNUAL/BIENNIAL REPORT

**EQUIPMENT** 

CORRECTIVE ACTION AREA - NO CORRECTIVE ACTION AREA INFORMATION REPORTED -

**CORRECTIVE ACTION EVENT** 

NO CORRECTIVE ACTION EVENT(S) REPORTED

CONTACT INFORMATION

ORGANIZATION: L&T WAGGONER TRUCKING

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: BILL LIERMAN

PHONE: (512) 4734895 0

TITLE: VP

**MAP ID# 86** 

Distance from Property: 0.134 mi. (708 ft.) E

Elevation: 649 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 58587
NAME: L&T WAGGONER TRUCKING

NAME. LAI WAGGONER IRUCKIN

ADDRESS: 1825 OAK HILL LN
AUSTIN, TX 78744

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING
BEGIN DATE: 06/17/1991
STATUS: INACTIVE
EXEMPT STATUS: NO

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS:  $oldsymbol{0}$  NUMBER OF ACTIVE ABOVEGROUND TANKS:  $oldsymbol{0}$ 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 06/14/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/10/1991

SIGNATURE NAME & TITLE: WILLIAM P LIERMAN, VP ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600777585
NAME: COLLECTING BANK N A

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: **ORGANIZATION**BEGIN DATE: **06/17/1991** 

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/14/1991
TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 725 of 937

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **03/15/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 143543

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 06/14/1991

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 03/15/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 143544

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0360

UST ID #: C0360

NAME: SHOPPERS MART #16
ADDRESS: 4036 S IH 35
AUSTIN, TX

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

FACILITY INFORMATION OWNER INFORMATION

REGISTRATION#: 75644 EPA ID: TXD987993789 NAME: STAR ENTERPRISE GENERAL PARTNERSHIP

TNRCC ID #: 29991 ADDRESS: NOT REPORTED

NAME: STAR ENTERPRISES

ADDRESS: 4036 S IH 35 PHONE: NOT REPORTED

AUSTIN, TX 78704

CONTACT: DAVID GUMBLEY

PHONE: **214-6500200** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 03/26/2007

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 58169

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 141197 Job# 336212 729 of 937

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 091948

LPST ID: **091948**FACILITY ID: **34925** 

NAME: SHOPPERS MART 16 ADDRESS: 4036 S IH 35

**AUSTIN, TX 78704** 

#### **LEAKING TANK DETAILS**

LPST ID: 091948

NAME: SHOPPERS MART 16

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2A - GROUNDWATER OTHER THAN 1B SITE CHARACTERIZATION INCOMPLETE

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/20/88

REPORTED DATE: 06/10/1988
ENTERED DATE: 06/20/1988
CLOSURE DATE: 08/01/1991

PRP INFORMATION
NAME: TMR COMPANY

ADDRESS: ADDRESS NOT REPORTED

IRVING TX 75015
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 123183

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123184

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123186

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

Order# 141197 Job# 336212 732 of 937

INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

0.\_\_\_

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123185

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 105181

LPST ID: **105181**FACILITY ID: **34925** 

NAME: SHOPPERS MART 16 ADDRESS: 4036 S IH 35

**AUSTIN, TX 78704** 

#### **LEAKING TANK DETAILS**

LPST ID: 105181

NAME: SHOPPERS MART 16

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/9/92

REPORTED DATE: 10/27/1992 ENTERED DATE: 12/09/1992 CLOSURE DATE: 01/06/1997

**PRP INFORMATION** 

NAME: STAR ENTERPRISES INC

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78762

CONTACT: NOT REPORTED PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 123183

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123184

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123186

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1

Order# 141197 Job# 336212 736 of 937

INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123185

TANK ID: 4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: SHOPPERS MART 16

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: NOT REPORTED

TITLE: NOT REPORTED

PHONE: (512) 3852020 0

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 34925 NAME: SHOPPERS MART 16

ADDRESS: 4036 S IH 35

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 12/10/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/30/1986

SIGNATURE NAME & TITLE: FORD SMTIH, OWNER ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600124051
NAME: MOTIVA ENTERPRISES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 12/10/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123183

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 11/17/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

Order# 141197 Job# 336212 739 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123184

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/17/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123185

TANK ID: 4

Order# 141197 Job# 336212 740 of 937

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1981 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **11/17/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 123186

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED



Order# 141197 Job# 336212 741 of 937

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 87** 

ID#: 36927

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

CONTACT INFORMATION NAME: NOT REPORTED

NAME: TEXAS ALTERNATOR STARTER SERVICE

TITLE: SHOP MGR

ADDRESS: 1230 E BEN WHITE BLVD

ORGANIZATION: NOT REPORTED

**AUSTIN, TX 78742** 

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: NOT REPORTED

**CITY NOT REPORTED** 

REGION: 11

PHONE: NOT REPORTED

TYPE: NOT REPORTED

BEGIN DATE: NOT REPORTED STATUS: NOT REPORTED

**EXEMPT STATUS: NOT REPORTED** RECORDS OFF-SITE: NOT REPORTED

NUMBER OF ACTIVE UNDERGROUND TANKS: 1

NUMBER OF ACTIVE ABOVEGROUND TANKS: NOT REPORTED

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/86 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/22/86 SIGNATURE NAME & TITLE: SIGNATURE NAME NOT REPORTED, MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

NO OWNER INFORMATION REPORTED

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NUMBER OF COMPARTMENTS: NOT REPORTED TANK ID: 1

INSTALLATION DATE: 01011972 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 **EMPTY TANK: NOT EMPTY** 

STATUS: PERM. FILLED IN PLACE STATUS BEGIN DATE: NOT REPORTED INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: NOT REPORTED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**NOT REPORTED** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 



Order# 141197 Job# 336212 743 of 937

CORROSION PROTECTION COMPLIANCE FLAG: NOT REPORTED

CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: NOT REPORTED

TANK ID: 1

COMPARTMENT LETTER: A
SUBSTANCES: UNKNOWN
OTHER SUBSTANCES: EMPTY
CAPACITY (GAL): 0000000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NOT REPORTED

CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

CONTACT INFORMATION

ORGANIZATION: TEXAS ALTERNATOR STARTER SERVICE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: HAROLD FARREL

PHONE: (512) 3854545 0

TITLE: MGR

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 41169

NAME: TEXAS ALTERNATOR STARTER SERVICE

ADDRESS: 1230 E BEN WHITE BLVD

**AUSTIN, TX 78742** 

COUNTY: TRAVIS

REGION: 11

TYPE: UNKNOWN BEGIN DATE: 01/22/1987

STATUS: INACTIVE **EXEMPT STATUS: NO** 

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/24/1986

SIGNATURE NAME & TITLE: STEVE PFERTNER, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602880387 NAME: THE MCADAMS GROUP LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: ORGANIZATION BEGIN DATE: 01/22/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1972 REGISTRATION DATE: 05/08/1986

EMPTY TANK: NOT EMPTY TANK CAPACITY (GAL): 1000

GeoSearch www.geo-search.com 888-396-0042

745 of 937

STATUS: **PERM FILLED IN PLACE** STATUS BEGIN DATE: **11/30/1979** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 85149

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: EMPTY

OTHER SUBSTANCES: NOT REPORTED CAPACITY (GAL): NOT REPORTED

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**CONTACT INFORMATION** 

ORGANIZATION: OLD FUELING FACILITY

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: BETTY FERGUSON

PHONE: (512) 4432996 0

TITLE: OWNER

**MAP ID# 87** 

Distance from Property: 0.139 mi. (734 ft.) NNE

Elevation: 667 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **65826** 

NAME: OLD FUELING FACILITY

ADDRESS: 1240 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING
BEGIN DATE: 01/01/1988
STATUS: INACTIVE

EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 07/12/1994 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 07/11/1994 SIGNATURE NAME & TITLE: MICHELLE NAUMAN, GEOLOGIST

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600778179

NAME: FERGUSON

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: INDIVIDUAL
BEGIN DATE: 01/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 07/12/1994
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/30/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**FRP** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 162778

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 07/12/1994

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **06/30/1994**INTERNAL PROTECTION DATE: **NOT REPORTED** REGULATORY STATUS: **FULLY REGULATED** 

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO
PIPE DESIGN SINGLE WALL: NO
PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:



Order# 141197 Job# 336212 748 of 937

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 162779

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: **NO**CORROSION PROTECTION VARIANCE: **NO VARIANCE** 

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1988 REGISTRATION DATE: 07/12/1994

TANK CAPACITY (GAL): 3000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 06/30/1994

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 162780

TANK ID: 3

Order# 141197 Job# 336212 749 of 937

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 3000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 88** 

Distance from Property: 0.139 mi. (734 ft.) WNW

Elevation: 672 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: 03314

UST ID #: 03314

NAME: PENSKE TRUCK LEASING
ADDRESS: 8800 S CONGRESS AVE

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 88** 

Distance from Property: 0.139 mi. (734 ft.) WNW

Elevation: 672 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: 79443

NAME: PENSKE TRUCK LEASING AUSTIN CONGRESS

ADDRESS: 8800 S CONGRESS AVE

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 05/23/2008

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 08/26/2019 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 08/26/2019 SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR OF ENV

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601573330

NAME: PENSKE TRUCK LEASING CO LP CONTACT ADDRESS: PO BOX 7635

**READING PA 19603** 

TYPE: PARTNERSHIP BEGIN DATE: 06/15/2008 CONTACT ROLE: OWNCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

ORGANIZATION: PENSKE TRUCK LEASING CO LP

PHONE: (214) 8728481 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601573330 NAME: PENSKE TRUCK LEASING CO LP CONTACT ADDRESS: PO BOX 7635

**READING PA 19603** 

TYPE: PARTNERSHIP BEGIN DATE: 06/15/2008 CONTACT ROLE: OPRCON

CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

#### **CONTACT INFORMATION**

NAME: BRIAN YAZEMBOSKI

TITLE: MGR ENVIR SV

ORGANIZATION: PENSKE TRUCK LEASING AUSTIN CONGRESS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (610) 6038450 0

GeoSearch www.geo-search.com 888-396-0042

752 of 937

ORGANIZATION: PENSKE TRUCK LEASING CO LP

PHONE: **(610) 7756298 0** FAX: **(620) 7756442** 

EMAIL: WWW.PENSKETRUCKLEASING.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 324858 SIGNATURE DATE: 08/26/2019

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR OF ENV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 306398
SIGNATURE DATE: 06/28/2018

SIGNATURE NAME & TITLE: MICHAEL CONSTANZA, DIR OF ENV SERV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 289490
SIGNATURE DATE: 07/05/2017

SIGNATURE NAME & TITLE: MICHAEL CONSTANZA, DIRECTOR OF ENVIRO SERVICES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 272776
SIGNATURE DATE: 06/24/2016

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR OF ENVIRONMENTAL SERVICES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 256581
SIGNATURE DATE: 06/24/2015

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR ENV SRV

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 240657
SIGNATURE DATE: 07/02/2014

SIGNATURE NAME & TITLE: MICHAEL CONSTANZA, DIR EHS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 222965
SIGNATURE DATE: 06/20/2013

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR EHS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217995
SIGNATURE DATE: 06/25/2012

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, DIR ENV SVCS

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217994
SIGNATURE DATE: 06/22/2011



Order# 141197 Job# 336212 753 of 937

SIGNATURE NAME & TITLE: ANDREW E CULLEN, VP ENERGY & TELECOM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217993
SIGNATURE DATE: 06/23/2010

SIGNATURE NAME & TITLE: ANDREW E CULLEN, VP ENERGY & TELECOM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217992
SIGNATURE DATE: 06/26/2009

SIGNATURE NAME & TITLE: ANDREW E CULLEN, VP, ENERGY & TELECOM

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 217991
SIGNATURE DATE: 08/01/2008

SIGNATURE NAME & TITLE: MICHAEL COSTANZA, MGR ENV SVR

FILING STATUS: **RENEWAL** REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NOTIFICATION CONSTRUCTION ID: 21387

APPLICATION RECEIVED DATE: 03/27/2008

SCHEDULE CONSTRUCTION DATE: 04/07/2008

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

#### **NOT REPORTED**

NOTIFICATION CONSTRUCTION ID: 34484

APPLICATION RECEIVED DATE: 04/03/2019

SCHEDULE CONSTRUCTION DATE: 04/01/2019

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION: DIESEL LINE FAILED LINE TEST SO REPIPING DIESEL LINE

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/23/2008 REGISTRATION DATE: 08/26/2008

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 05/23/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

# TANK DETAILS MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 754 of 937

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 183762

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

 ${\tt SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE, ALARM\ (SET @<=90\%)\ W3A\ OR\ 3B}$ 

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 05/23/2008 REGISTRATION DATE: 08/26/2008

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 05/23/2008

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 183763

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

Order# 141197 Job# 336212 755 of 937

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE), NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 89** 

Distance from Property: 0.145 mi. (766 ft.) WNW

Elevation: 686 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 00639

UST ID #: 00639

NAME: SHOP N CARRY FOOD #1
ADDRESS: 8422 S CONGRESS AVE

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**Back to Report Summary** 

**MAP ID# 89** 

Distance from Property: 0.145 mi. (766 ft.) WNW

Elevation: 686 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 092335

LPST ID: **092335**FACILITY ID: **10996** 

NAME: SHOP N CARRY FOOD STORE
ADDRESS: 8514 S CONGRESS AVE
AUSTIN, TX 78745

#### **LEAKING TANK DETAILS**

LPST ID: 092335

NAME: SHOP N CARRY FOOD STORE FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 2A - GROUNDWATER OTHER THAN 1B SITE CHARACTERIZATION INCOMPLETE

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/8/88

REPORTED DATE: 10/28/1988 ENTERED DATE: 12/08/1988 CLOSURE DATE: 10/28/1991

PRP INFORMATION
NAME: SHEIHREEN INC

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78745
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

UNDERGROUND STORAGE TANK

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2019

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 17405** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17405

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

Order# 141197 Job# 336212 759 of 937

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17404

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 141197 Job# 336212 760 of 937

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/11/2019** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

Order# 141197 Job# 336212 761 of 937

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 141197 Job# 336212 762 of 937

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17403

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 89** 

Distance from Property: 0.145 mi. (766 ft.) WNW

Elevation: 686 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 111287

LPST ID: **111287**FACILITY ID: **10996** 

NAME: SHOP N CARRY FOOD STORE
ADDRESS: 8514 S CONGRESS AVE
AUSTIN, TX 78745

**LEAKING TANK DETAILS** 

LPST ID: 111287

NAME: SHOP N CARRY FOOD STORE FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 7/10/96

REPORTED DATE: 06/20/1996 ENTERED DATE: 07/10/1996 CLOSURE DATE: 03/31/1997

**PRP INFORMATION** 

NAME: JIWAMI, RAMZAN A

ADDRESS: ADDRESS NOT REPORTED

**AUSTIN TX 78745** 

CONTACT: **NOT REPORTED** PHONE: **NOT REPORTED** 

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2019

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 764 of 937

#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 17405** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/07/1

STATUS: IN USE STATUS BEGIN DATE: 12/07/1996
INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17405

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

Order# 141197 Job# 336212 765 of 937

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17404

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 141197 Job# 336212 766 of 937

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2019

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

Order# 141197 Job# 336212 767 of 937

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/07/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 141197 Job# 336212 768 of 937

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17403

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 89** 

Distance from Property: 0.143 mi. (755 ft.) WNW

Elevation: 686 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 120751

LPST ID: **120751**FACILITY ID: **10996** 

NAME: SHOP N CARRY FOODS
ADDRESS: 8422 S CONGRESS AVE
AUSTIN, TX 78745

**LEAKING TANK DETAILS** 

LPST ID: 120751

NAME: SHOP N CARRY FOODS
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 1 - RELEASE DETERMINATION

CORRECTIVE ACTION START DATE: NOT REPORTED

REPORTED DATE: 04/27/2019
ENTERED DATE: 07/11/2019
CLOSURE DATE: 12/31/3000

**PRP INFORMATION** 

NAME: SHOP N CARRY FOODS

ADDRESS: ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2019

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



#### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 17405** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17405

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

Order# 141197 Job# 336212 771 of 937

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17404

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 141197 Job# 336212 772 of 937

NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/11/2019** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 **EMPTY TANK: NOT EMPTY** STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** MATERIAL:

**FRP** 

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2A NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 **EMPTY TANK: NOT EMPTY** 

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



Order# 141197 Job# 336212 774 of 937

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17403

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

**MAP ID# 89** 

Distance from Property: 0.145 mi. (766 ft.) WNW

Elevation: 686 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **10996** 

NAME: SHOP N CARRY FOODS
ADDRESS: 8422 S CONGRESS AVE

ALIOTINI TV 70745

AUSTIN, TX 78745

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 07/25/1986 STATUS: INACTIVE EXEMPT STATUS: NO RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/13/2019
SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/06/2019

SIGNATURE NAME & TITLE: MOHAMMAD USMAN, PRES

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN602493322 NAME: USMAN TRADING INC

CONTACT ADDRESS: 4509 E MARTIN LUTHER KING JR BLVD

**AUSTIN TX 78721** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2012

CONTACT ROLE: **OWNOPRCON**CONTACT NAME: **NAVEED M USMAN** 

CONTACT TITLE: PRESIDENT

ORGANIZATION: USMAN TRADING INC

PHONE: (512) 2802539 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN602493322
NAME: USMAN TRADING INC

CONTACT ADDRESS: 4509 E MARTIN LUTHER KING JR BLVD

**AUSTIN TX 78721** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/2012

CONTACT ROLE: OWNOPRCON
CONTACT NAME: NAVEED M USMAN

CONTACT TITLE: PRESIDENT

CONTACT INFORMATION

NAME: NAVEED USMAN

TITLE: MGR

ORGANIZATION: SHOP N CARRY FOODS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (512) 2802539 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: USMAN TRADING INC

PHONE: (512) 2802539 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 272708 SIGNATURE DATE: 07/20/2016

SIGNATURE NAME & TITLE: NAVEED USMAN, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 253912
SIGNATURE DATE: 05/29/2015

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 240802
SIGNATURE DATE: 08/29/2014

SIGNATURE NAME & TITLE: NAVEED USMAN, PRE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 221659
SIGNATURE DATE: 06/24/2013

SIGNATURE NAME & TITLE: NAUEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19008
SIGNATURE DATE: 05/27/2012

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19007
SIGNATURE DATE: 07/07/2011

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19006
SIGNATURE DATE: 06/29/2010

SIGNATURE NAME & TITLE:  ${f MUHAMMAD\ N\ USMAN\ ,\ PRES\ }$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19005
SIGNATURE DATE: 06/10/2009

SIGNATURE NAME & TITLE: MUHAMMAD NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19004
SIGNATURE DATE: 07/01/2008

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19003
SIGNATURE DATE: 06/12/2007

SIGNATURE NAME & TITLE: MUHAMMAD NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19002
SIGNATURE DATE: 06/25/2006

SIGNATURE NAME & TITLE: NAVEED USMAN, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19001
SIGNATURE DATE: 05/19/2005

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 19000
SIGNATURE DATE: 06/18/2004

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 18999
SIGNATURE DATE: 09/23/2003

SIGNATURE NAME & TITLE: NAVEED USMAN, PRES

FILING STATUS: INITIAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 18998
SIGNATURE DATE: 07/15/2003

SIGNATURE NAME & TITLE: KARIM M ALI, PRES/SEC

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 18997
SIGNATURE DATE: 07/10/2002

SIGNATURE NAME & TITLE: KARIM M ALI, PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 18996
SIGNATURE DATE: 01/10/2001

SIGNATURE NAME & TITLE: KARIM M ALI, PRES/SEC

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 34347
APPLICATION RECEIVED DATE: 03/13/2019
SCHEDULE CONSTRUCTION DATE: 04/15/2019



Order# 141197 Job# 336212 778 of 937

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REMOVAL OF 2-8K DW FRP UST'S, DISPENSERS, AND LINES.

**UNDERGROUND STORAGE TANK** 

TANK ID: 2A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 17403

TANK ID: 2A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/07/1996** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO

GeoSearch www.geo-search.com 888-396-0042

PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17404

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

NOT REPORTED

PIPING RELEASE DETECTION:

**AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **04/11/2019** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS
MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 



Order# 141197 Job# 336212 780 of 937

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17405

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 02/11/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17405



Order# 141197 Job# 336212 781 of 937

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 04/11/2019

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP, FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: NOT REPORTED

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

Order# 141197 Job# 336212 782 of 937

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/07/1996 REGISTRATION DATE: 03/17/1997

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/07/1996

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

**TANK DETAILS** 

MATERIAL:

FRP

CORROSION PROTECTION:

EXTERNAL DIELECTRIC COATING/LAMINATE/TAPE/WRAP,FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 17406

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: VAPOR MONITORING, GROUNDWATER MONITORING, MONITORING OF SECONDARY CONTAINMENT BARRIER, AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET, WEEKLY MANUAL TANK GAUGING (TANKS <= 1000 GAL)

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE

GeoSearch www.geo-search.com 888-396-0042

Order# 141197 Job# 336212 783 of 937

#### **PIPING SYSTEMS**

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

## City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

FACILITY INFORMATION
GEOSEARCH ID: C0595

UST ID #: C0595

NAME: **COMMERCIAL METALS**ADDRESS: **710 INDUSTRIAL BLVD** 

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**Back to Report Summary** 

### Industrial and Hazardous Waste Sites (IHW)

**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

**FACILITY INFORMATION** 

**OWNER INFORMATION** 

PHONE: NOT REPORTED

REGISTRATION#: 66013 EPA ID: TXD026025635 NAME: COMMERCIAL METALS COMPANY

TNRCC ID #: 21320 ADDRESS: NOT REPORTED

NAME: COMMERCIAL METALS AUSTIN
ADDRESS: 710 INDUSTRIAL BLVD

**AUSTIN, TX 78745** 

CONTACT: ENVIRONMENTAL MANAGER

PHONE: 512-4422384

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: NOT A HW GENERATOR

GENERATOR TYPE: NOT REPORTED

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/03/2009

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 300788

WASTE CODE STATUS: NOT REPORTED

WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 141197 Job# 336212 786 of 937

### Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

PROGRAM ID: **66013**RN NUMBER: **RN100636281** 

NAME: COMMERCIALS METALS AUSTIN
ADDRESS: 710 INDUSTRIAL BLVD
AUSTIN, TX 78745

STATUS: INACTIVE
STATUS DATE: 5/2/01

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

710 INDUSTRIAL BLVD, AUSTIN, TX

**Back to Report Summary** 

**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

#### **FACILITY INFORMATION**

GEOSEARCH ID: 109572

LPST ID: **109572**FACILITY ID: **12220** 

NAME: COMMERCIALS METALS AUSTIN INC

ADDRESS: 710 INDUSTRIAL BLVD
AUSTIN, TX 78745

#### **LEAKING TANK DETAILS**

LPST ID: 109572

NAME: COMMERCIALS METALS AUSTIN INC FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/22/95

REPORTED DATE: 06/06/1995
ENTERED DATE: 06/22/1995
CLOSURE DATE: 08/17/1995

#### **PRP INFORMATION**

NAME: COMMERCIAL METALS INC
ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78760
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: CMA1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

### **TANK DETAILS**

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 48913

TANK ID: CMA1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA2 NUMBER OF COMPARTMENTS: 1 INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 07/31/1986

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS UST COMPARTMENT ID: 48917** 

TANK ID: CMA2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

789 of 937 

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/26/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48916

TANK ID: CMA3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO
CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA4 NUMBER OF COMPARTMENTS: 1

INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48915

TANK ID: CMA4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL



Order# 141197 Job# 336212 791 of 937

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48914

TANK ID: CMA5

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 173195 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: CMA5 REGISTRATION DATE: 05/08/1986

INSTALLATION DATE: 12/01/1995 STATUS BEGIN DATE: 12/01/1995

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **NO**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 12220

NAME: COMMERCIALS METALS AUSTIN

ADDRESS: 710 INDUSTRIAL BLVD

**AUSTIN, TX 78745** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING BEGIN DATE: 09/01/1988

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/28/1986

SIGNATURE NAME & TITLE: JAMES E BROWDER, MGR ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600312011

NAME: COMMERCIAL METALS COMPANY

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600312011 NAME: COMMERCIAL METALS COMPANY

CONTACT ADDRESS: PO BOX 911

**SEGUIN TX 78156** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1988 CONTACT ROLE: OPRCON

CONTACT NAME: JOE ALVARADO

CONTACT TITLE: PRESIDENT AND CHIEF EXECUTIVE OFFICER

**CONTACT INFORMATION** 

NAME: MIMI RHEA

TITLE: PLANT MGR

ORGANIZATION: COMMERCIALS METALS-AUSTIN MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4422384 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: COMMERCIAL METALS COMPANY

PHONE: **(830) 3728331 0** FAX: **(830) 3728502** 

EMAIL: STEVEN.BREDESEN@CMC.COM

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: CMA1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **05/26/1995** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 48913

TANK ID: CMA1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 794 of 937

TANK ID: CMA5 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS
MATERIAL:
STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48914

TANK ID: CMA5

COMPARTMENT LETTER: A
SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA4 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 



MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48915

TANK ID: CMA4

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 05/26/1995

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 796 of 937

#### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 48916

TANK ID: CMA3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: CMA2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **07/31/1986** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 48917

TANK ID: CMA2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

Order# 141197 Job# 336212 797 of 937

#### **PIPING SYSTEMS**

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

AST ID #: 173195 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: CMA5 REGISTRATION DATE: 05/08/1986

INSTALLATION DATE: 12/01/1995 STATUS BEGIN DATE: 12/01/1995

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: **NO CONTAINMENT** 

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 



**MAP ID# 90** 

Distance from Property: 0.164 mi. (866 ft.) W

Elevation: 676 ft. (Higher than TP)

**SITE INFORMATION** 

COMPANY ID: 20052

COMPANY NAME: COMMERCIAL METALS INC.

SITE NAME: NOT REPORTED
ADDRESS: 710 INDUSTRIAL BLVD

CITY: AUSTIN
STATE: TX
ZIPCODE: 78745
SITE DETAILS

CONTACT NAME: PHILIP BUSH
CONTACT TITLE: ASSISTANT MGR.
CONTACT PHONE: 512-442-2384

CONTACT EMAIL: PHILIP.BUSH@CMCSG.COM

MATERIAL ACCEPTED: AIR CONDITIONING COILS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: APPLIANCES BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: AUTOMOBILES BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: LEAD

CATEGORY: METALS

SUB-CATEGORY: BATTERIES (B309)

COLLECTOR: YES

BROKER: NOT REPORTED

NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: AEROSOL BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: CANS (B308) MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: ALUMINUM BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: CANS (B308) MANUFACTOR: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

COLLECTOR: YES COMPOSTER: NOT REPORTED

MATERIAL ACCEPTED: BI-METAL BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: CANS (B308) MANUFACTOR: NOT REPORTED COMPOSTER: NOT REPORTED COLLECTOR: YES

\_\_\_\_\_

MATERIAL ACCEPTED: STEEL BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: CANS (B308) MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

MATERIAL ACCEPTED: CATALYTIC CONVERTORS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: NOT REPORTED

SUB-CATEGORY: NOT REPORTED MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

\_\_\_\_\_

MATERIAL ACCEPTED: ELECTRIC MOTORS BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED MANUFACTOR: NOT REPORTED COMPOSTER: NOT REPORTED COLLECTOR: YES

-----

MATERIAL ACCEPTED: CIRCUIT BOARDS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: NOT REPORTED

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED COMPOSTER: NOT REPORTED

COLLECTOR: YES

\_\_\_\_\_

BROKER: NOT REPORTED MATERIAL ACCEPTED: OTHER COMPUTER PERIPHERALS

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED COMPOSTER: NOT REPORTED

COLLECTOR: YES

MATERIAL ACCEPTED: PRINTERS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED COMPOSTER: NOT REPORTED

COLLECTOR: YES

MATERIAL ACCEPTED: TELEPHONE EQUIPMENT BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

Order# 141197 Job# 336212 800 of 937

-----

MATERIAL ACCEPTED: RADIATORS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: SCRAP MACHINERY BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: **ALUMINUM** BROKER: **NOT REPORTED** 

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: BRASS BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: BRONZE BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: CADMIUM BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: CHROMIUM BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: COPPER BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: IRON BROKER: NOT REPORTED



Order# 141197 Job# 336212 801 of 937

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: LEAD BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: MAGNESIUM BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: MOLYBDENUM BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: **NICKEL** BROKER: **NOT REPORTED** 

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: STAINLESS STEEL BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: STEEL BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: TIN BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: TITANIUM BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

Order# 141197 Job# 336212 802 of 937

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: TUNGSTEN BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: ZINC BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: SHIPS/BARGES BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: STEEL DRUMS BROKER: NOT REPORTED

CATEGORY: **METALS** PROCESSOR: **YES** 

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: TRUCK BODIES & TRAILERS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

MANUFACTOR: NOT REPORTED

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: UNDERGROUND STORAGE TANKS BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: **NOT REPORTED**COLLECTOR: **YES**MANUFACTOR: **NOT REPORTED**COMPOSTER: **NOT REPORTED** 

-----

MATERIAL ACCEPTED: ALUMINUM BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: WIRE MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: COPPER BROKER: NOT REPORTED

CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: WIRE MANUFACTOR: NOT REPORTED

Order# 141197 Job# 336212 803 of 937

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

BROKER: NOT REPORTED MATERIAL ACCEPTED: STEEL

CATEGORY: **METALS** PROCESSOR: YES

SUB-CATEGORY: WIRE MANUFACTOR: NOT REPORTED COLLECTOR: YES COMPOSTER: NOT REPORTED

## Alternative Fueling Stations (ALTFUELS)

**MAP ID# 91** 

Distance from Property: 0.166 mi. (876 ft.) ESE

Elevation: 688 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 96900

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 96900

STATION NAME: WEINSTEIN

ADDRESS: 8003 S IH 35 FRONTAGE RD

**AUSTIN, TX 78744** 

INTERSECTION DIRECTIONS: 3 FIVE; -

STATION PHONE: 888-758-4389

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: ELECTRIC

OWNER TYPE: NOT REPORTED

FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: **NOT REPORTED**DATE THE STATION'S DETAILS WERE LAST CONFIRMED: **9/24/2019** 

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-09-24 09:09:21 UTC

**Back to Report Summary** 

Order# 141197 Job# 336212 805 of 937

## Dry Cleaner Registration Database (DCR)

**MAP ID# 92** 

Distance from Property: 0.167 mi. (882 ft.) WSW

Elevation: 648 ft. (Higher than TP)

**FACILITY INFORMATION** 

LOCATION NUMBER: RN105548309

CUSTOMER #: CN600264543
REGISTRATION ID: DCR15069

REGULATED ENTITY NAME: FOUR SONS QUALITY CLEANERS 51

NAME: NOT REPORTED

ADDRESS: 9500 S INTERSTATE 35 STE 650

**AUSTIN, TX 78748-1752** 

COUNTY: TRAVIS

ACCOUNT NUMBER: 24000524

REGION: REGION 11

PRINCIPAL NAME: JACK BROWN CLEANERS INC

ADDRESS: NOT REPORTED

NOT REPORTED, NOT REPORTED NOT REPORTED

EMAIL ADDRESS: NOT REPORTED

PHONE NUMBER: 0-0

SITE TYPE: DROP STATION REGISTRATION

SITE STATUS: **ACTIVE**ELIGIBLE ANSWER: **YES** 

GROSS RECEIPT: \$150,000 OR LESS

FISCAL YEAR: FY2016
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2015
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2014
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2013
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2012
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

FISCAL YEAR: FY2011
SOLVENT: NOT REPORTED
QUANTITY: NOT REPORTED

# Dry Cleaner Registration Database (DCR)

FISCAL YEAR: FY2010 SOLVENT: NOT REPORTED QUANTITY: NOT REPORTED

FISCAL YEAR: FY2009 SOLVENT: NOT REPORTED QUANTITY: NOT REPORTED

FISCAL YEAR: FY2008 SOLVENT: NOT REPORTED QUANTITY: NOT REPORTED

**MAP ID# 92** 

Distance from Property: 0.167 mi. (882 ft.) WSW

Elevation: 648 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 90839 EPA ID: TXR000080009 NAME: TARGET CORPORATION

TNRCC ID #: 129807 ADDRESS: **PO BOX 111** 

NAME: TARGET STORE T2288 MINNEAPOLIS, MN 55440

ADDRESS: 9500 S IH 35 STE G PHONE: 1-800-5872228

AUSTIN, TX 78748

CONTACT: STEVEN MUSSER PHONE: 800-5872228

BUSINESS DESCRIPTION: NOT REPORTED
INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 07/27/2018

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 359149

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: BATTERIES, LEAD ACID

WASTE ID: 359150

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PAINT AND/OR PAINT RELATED MATERIAL

WASTE ID: 329671

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GeoSearch www.geo-search.com 888-396-0042

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLS

WASTE ID: 329670

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDS

WASTE ID: 329669

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDS

WASTE ID: 329668

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: ACID (CORROSIVE) LIQUIDS

WASTE ID: 329667

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: ACID (CORROSIVE) SOLIDS

WASTE ID: 329666

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: BASIC (CORROSIVE) LIQUIDS

WASTE ID: 329665

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: BASIC (CORROSIVE) SOLIDS

WASTE ID: 329664

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER SOLIDS

WASTE ID: 329663

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZER LIQUIDS

WASTE ID: 329662

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDS

WASTE ID: 329661

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDS

WASTE ID: 329660

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PROPANE & LIGHTERS

WASTE ID: 329659

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MEDICINE SOLIDS

WASTE ID: 329658

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: MEDICINE LIQUIDS

WASTE ID: 329657

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED PHARMACEUTICALS

WASTE ID: 329656

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: INJECTABLE PHARMACEUTICALS

WASTE ID: 329655

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: DEA-TOXIC

WASTE ID: 329654

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: DEA-FLAMMABLE

WASTE ID: 329653

WASTE CODE STATUS: ACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: MERCURY CONTAINING WASTE

WASTE ID: 329652

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PRODUCTS CONTAINING DISULFOTON

WASTE ID: 329651

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: PHOTO-PROCESSING WASTEWATER

**MAP ID# 93** 

Distance from Property: 0.189 mi. (998 ft.) WNW

Elevation: 635 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: NOT REPORTED

ID#: **89791** 

NAME: NOT REPORTED

NAME: CAPITOL CHEVROLET PARTS BUILDING

TITLE: NOT REPORTED

CONTACT INFORMATION

ADDRESS: 700 N BLUFF DR

ORGANIZATION: NOT REPORTED

AUSTIN, TX 78745

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: TRAVIS

CITY NOT REPORTED

REGION: 11

PHONE: NOT REPORTED

TYPE: NOT REPORTED

BEGIN DATE: NOT REPORTED

STATUS: **PENDING** 

EXEMPT STATUS: NOT REPORTED

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **NOT REPORTED** NUMBER OF ACTIVE ABOVEGROUND TANKS: **NOT REPORTED** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: **NOT REPORTED**SIGNATURE DATE ON EARLIEST REGISTRATION FORM: **NOT REPORTED** 

SIGNATURE NAME & TITLE: SIGNATURE NAME NOT REPORTED, SIGNATURE TITLE NOT REPORTED

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600246029
NAME: CAPITOL CHEVROLET INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/01/1800

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 32729

APPLICATION RECEIVED DATE: 03/13/2018

SCHEDULE CONSTRUCTION DATE: 05/01/2018

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

FURNISH & INSTALL FUEL SYSTEM WITH (1) 10,000 GALLON DBL WALL UL-2085 AST.

GeoSearch www.geo-search.com 888-396-0042

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 94** 

Distance from Property: 0.193 mi. (1,019 ft.) WNW

Elevation: 691 ft. (Higher than TP)

FACILITY INFORMATION

GEOSEARCH ID: C0321

UST ID #: C0321

NAME: WATTINGER CO., INC.

ADDRESS: 114 RALPH ABLANEDO DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 95** 

Distance from Property: 0.196 mi. (1,035 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 32713 EPA ID: NOT REPORTED

NAME: AUSTIN CIRCUITS INC

TNRCC ID #: 10245

ADDRESS: NOT REPORTED

NAME: AUSTIN CIRCUITS INC. ADDRESS: 900 SHELBY LN

PHONE: NOT REPORTED

AUSTIN, TX 78745

CONTACT: STEVE RADTKE

PHONE: 512-4436222

BUSINESS DESCRIPTION: NOT REPORTED INDUSTRIAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

MUNICIPAL WASTE PERMIT #: NOT REPORTED

STATUS: MERGED

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 06/04/2010

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 26720

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 

Order# 141197 Job# 336212 815 of 937

**MAP ID# 95** 

Distance from Property: 0.196 mi. (1,035 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 68794 EPA ID: TXD000007930 NAME: JOHN COLE CHEMICAL CORPORATION

TNRCC ID #: 23721 ADDRESS: PO BOX 17545
NAME: JOSCO PRODUCTS AUSTIN, TX 78760

ADDRESS: 900 SHELBY LN PHONE: 1-512-4431037

**AUSTIN, TX 78745** 

CONTACT: JOHN S COLE PHONE: 512-4431037

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED

WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/12/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 48542

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 165391

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



**MAP ID# 95** 

Distance from Property: 0.196 mi. (1,035 ft.) WNW

Elevation: 665 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

NAME: M & M MACHINE WORKS

REGISTRATION#: 73860 EPA ID: NOT REPORTED

ADDRESS: 900 SHELBY LN STE 6

NAME: M&M MACHINE WORKS

**AUSTIN, TX 78745** 

ADDRESS: 900 SHELBY LN STE 6

PHONE: 1-512-4427456

**AUSTIN, TX 78745** 

CONTACT: HENRY MCCULLOCH

PHONE: 512-4427456

TNRCC ID #: 28269

BUSINESS DESCRIPTION: NOT REPORTED

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 05/28/2004

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 139837

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: SPENT SOLVENT

WASTE ID: **54893** 

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**MAP ID# 95** 

Distance from Property: 0.196 mi. (1,035 ft.) WNW

Elevation: 665 ft. (Higher than TP)

SITE INFORMATION

COMPANY ID: 20364

COMPANY NAME: JOSCO PRODUCTS

SITE NAME: NOT REPORTED
ADDRESS: 900 SHELBT LN

CITY: AUSTIN
STATE: TX
ZIPCODE: 78745
SITE DETAILS

CONTACT NAME: COLLEEN OGNO

CONTACT TITLE: OPERATIONS MANAGER

CONTACT PHONE: 512-443-1037

CONTACT EMAIL: COGNO@JOSCOPRODUCTS.COM

MATERIAL ACCEPTED: CLOTHING (FOR REUSE) BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: NOT REPORTED

SUB-CATEGORY: NOT REPORTED

COLLECTOR: YES

COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: OTHER BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: YES

SUB-CATEGORY: GARMENT SCRAPS MANUFACTOR: YES

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: NATURAL FIBERS-COTTON BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: NOT REPORTED

SUB-CATEGORY: MATERIAL MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: NON-WOVENS BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: NOT REPORTED

SUB-CATEGORY: MATERIAL MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: WOVENS

CATEGORY: TEXTILES & LEATHER

SUB-CATEGORY: MATERIAL

BROKER: YES

PROCESSOR: YES

MANUFACTOR: YES

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: RAGS BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED MANUFACTOR: YES

Order# 141197 Job# 336212 818 of 937

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: SHEETING MATERIAL BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED MANUFACTOR: YES

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: THREAD AND YARN WASTE BROKER: YES

CATEGORY: TEXTILES & LEATHER PROCESSOR: YES

SUB-CATEGORY: NOT REPORTED MANUFACTOR: YES

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: **WIPING RAGS** BROKER: **YES** 

CATEGORY: **TEXTILES & LEATHER** PROCESSOR: **NOT REPORTED** 

SUB-CATEGORY: NOT REPORTED MANUFACTOR: YES

COLLECTOR: YES COMPOSTER: NOT REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 96** 

Distance from Property: 0.2 mi. (1,056 ft.) ESE

Elevation: 670 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03212

UST ID #: 03212

NAME: 7-ELEVEN STORE #35792

ADDRESS: 1901 E WILLIAM CANNON DR

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 96** 

Distance from Property: 0.2 mi. (1,056 ft.) ESE

Elevation: 670 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: **69489** 

NAME: **7-ELEVEN 35792** 

ADDRESS: 1901 E WILLIAM CANNON DR

**AUSTIN, TX 78744** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: YES

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 04/16/1997 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 04/14/1997 SIGNATURE NAME & TITLE: CHUCK NADEAU, VP/PETRO-TECH

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: 3200 HACKBERRY RD IRVING TX 75063

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/04/2012
CONTACT ROLE: OWNCON
CONTACT NAME: RAY MCNIECE
CONTACT TITLE: NOT REPORTED
ORGANIZATION: 7-ELEVEN INC

PHONE: (972) 8267450 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED

**OPERATOR** 

OPERATOR NUMBER: CN600240329

NAME: 7-ELEVEN INC

CONTACT ADDRESS: PO BOX 711

DALLAS TX 75221

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/04/2012

CONTACT ROLE: OWNOPRCON

CONTACT NAME: RAYMOND MCNIECE CONTACT TITLE: NOT REPORTED

CONTACT INFORMATION

NAME: PEGGIE BETZ
TITLE: ENV COMP SPEC

ORGANIZATION: 7-ELEVEN 35792

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

CITY NOT REPORTED

PHONE: (972) 8287805 0

GeoSearch www.geo-search.com 888-396-0042

ORGANIZATION: 7-ELEVEN INC
PHONE: (847) 6081136 0

FAX: **(972) 8286896** 

EMAIL: RAYMOND.MCNIECE@7-11.COM

**SELF-CERTIFICATION** 

SELF-CERTIFICATION ID: 314180 SIGNATURE DATE: 01/23/2019

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR.

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 296522
SIGNATURE DATE: 12/28/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENV. MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 280902
SIGNATURE DATE: 01/19/2017

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MANAGE

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 263873
SIGNATURE DATE: 01/19/2016

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 247240
SIGNATURE DATE: 01/19/2015

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 230228
SIGNATURE DATE: 01/13/2014

SIGNATURE NAME & TITLE: RAYMOND MCNIECE, ENVIRONMENTAL MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173364
SIGNATURE DATE: 01/04/2013

SIGNATURE NAME & TITLE: SCOTT T JOHNSON, GAS MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173363
SIGNATURE DATE: 06/08/2012

SIGNATURE NAME & TITLE: SCOTT JOHNSON, GAS & ENV COMP MGR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173362
SIGNATURE DATE: 07/29/2011



Order# 141197 Job# 336212 822 of 937

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173361
SIGNATURE DATE: 07/27/2010

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173360
SIGNATURE DATE: 07/21/2009

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173359
SIGNATURE DATE: 07/01/2008

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173358
SIGNATURE DATE: 07/31/2007

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173357
SIGNATURE DATE: 07/21/2006

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173356
SIGNATURE DATE: 07/19/2005

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173355
SIGNATURE DATE: 08/04/2004

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173354
SIGNATURE DATE: 08/25/2003

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VICE PRESIDENT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173353
SIGNATURE DATE: 08/28/2002

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VICE PRESIDENT

FILING STATUS: RENEWAL

Order# 141197 Job# 336212 823 of 937

REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 173352
SIGNATURE DATE: 01/17/2001

SIGNATURE NAME & TITLE: GREGG STRASBURGER, VP

FILING STATUS: **INITIAL**REGISTRATION FLAG: **YES** 

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 19652
APPLICATION RECEIVED DATE: 05/21/2012
SCHEDULE CONSTRUCTION DATE: 05/23/2012

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

REPAIR/REPLACE ALL CONTAINMENT SUMP ENTRY BOOTS AND TEST BOOTS.

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/07/1997 REGISTRATION DATE: 04/16/1997

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/07/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS
MATERIAL:
COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 173872

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 15000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:



Order# 141197 Job# 336212 824 of 937

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 04/07/1997 REGISTRATION DATE: 04/16/1997

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/07/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 173873

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 04/07/1997 REGISTRATION DATE: 04/16/1997

GeoSearch www.geo-search.com 888-396-0042

TANK CAPACITY (GAL): 15000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 04/07/1997

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **YES**PIPE DESIGN SINGLE WALL: **YES** 

TANK DETAILS

MATERIAL:

COMPOSITE

CORROSION PROTECTION:

**COMPOSITE TANK (STEEL W/FRP EXTERNAL LAMINATE)** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 173874

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **DIESEL** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 5000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP,FLOW RESTRICTOR VALUE

**PIPING SYSTEMS** 

MATERIAL: NONMETALLIC FLEXIBLE PIPING

CORROSION PROTECTION: NONMETALLIC FLEXIBLE PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH), AUTO. LINE LEAK DETECTOR (3.0 GPH

FOR PRESSURE PIPING)
PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**Back to Report Summary** 

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 97** 

Distance from Property: 0.202 mi. (1,067 ft.) WNW

Elevation: 671 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: C0084

UST ID #: C0084

NAME: CENTEX MATERIALS INC ADDRESS: 817 E ST ELMO RD

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: C

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

**MAP ID# 97** 

Distance from Property: 0.202 mi. (1,067 ft.) WNW

Elevation: 671 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 66591 EPA ID: TXD981899248 NAME: CENTEX MATERIALS INC

TNRCC ID #: 21859 ADDRESS: **PO BOX 2252** 

NAME: CENTEX MATERIALS AUSTIN, TX 78768

ADDRESS: 810 E SAINT ELMO RD PHONE: 1-512-4767033

**AUSTIN, TX 78745** 

CONTACT: LEWIS H KUTSCHKE

PHONE: **512-4767033** 

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 02/08/2005

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 46812

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: NO

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 46813

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 46814

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO** 



Order# 141197 Job# 336212 828 of 937

WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 46815

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 46816

WASTE CODE STATUS: **INACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **YES** 

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**CONTACT INFORMATION** 

ORGANIZATION: CENTEX MATERIALS

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: ROBERT MICHAEL

TITLE: NOT REPORTED

PHONE: (512) 3274414 0

**MAP ID# 97** 

Distance from Property: 0.202 mi. (1,067 ft.) WNW

Elevation: 671 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: 57261

NAME: CENTEX MATERIALS

ADDRESS: FAREWELL

**AUSTIN, TX 78768** 

COUNTY: TRAVIS

REGION: 11

TYPE: OTHER

BEGIN DATE: 01/10/1991 STATUS: INACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/09/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/31/1990 SIGNATURE NAME & TITLE: ROBERT MICHAEL, GNE MGR AGG DIVISION

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600397434 NAME: CENTEX MATERIALS LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/10/1991

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: NOT REPORTED FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**ABOVEGROUND STORAGE TANK INFORMATION** 

GeoSearch www.geo-search.com 888-396-0042

830 of 937

AST ID #: 162855 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 5 REGISTRATION DATE: 01/09/1991

INSTALLATION DATE: 01/01/1986 STATUS BEGIN DATE: 08/31/1991

TANK CAPACITY (GAL): 15000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: NO CONCRETE: NO CONTAINMENT LINER: NO NONE: NO STAGE I VAPOR RECOVERY: NOT REPORTED STAGE I INSTALLATION DATE: NOT REPORTED

AST ID #: 162856 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: 6 REGISTRATION DATE: 01/09/1991

INSTALLATION DATE: 01/01/1986 STATUS BEGIN DATE: 08/31/1991

TANK CAPACITY (GAL): 3000 REGULATORY STATUS: FULLY REGULATED

STATUS: OUT OF USE SUBSTANCES: GASOLINE

**MATERIAL OF CONSTRUCTION** 

STEEL: YES CORRUGATED METAL: NO FIBERGLASS: NO CONCRETE: NO

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO**CONCRETE: **NO**CONTAINMENT LINER: **NO**NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 

**MAP ID# 97** 

Distance from Property: 0.202 mi. (1,067 ft.) WNW

Elevation: 671 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: **57263** 

NAME: CENTEX MATERIALS SOUTH ADDRESS: 817 E SAINT ELMO RD

**AUSTIN, TX 78745** 

COUNTY: TRAVIS REGION: 11

TYPE: INDUST/MFG/CHEM PLANT

BEGIN DATE: 01/10/1991 STATUS: ACTIVE **EXEMPT STATUS: NO** 

RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 0 NUMBER OF ACTIVE ABOVEGROUND TANKS: 1

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 01/09/1991 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 12/26/1990 SIGNATURE NAME & TITLE: DONALD B OGDEN, SR PLANT MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN600397434 NAME: CENTEX MATERIALS LLC

CONTACT ADDRESS: 3801 S CAPITAL OF TEXAS HWY STE 250

**AUSTIN TX 78704** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/10/1991 CONTACT ROLE: OWNCON CONTACT NAME: PHILIP BOWDEN

CONTACT TITLE: NOT REPORTED

ORGANIZATION: CENTEX MATERIALS LLC

PHONE: (512) 4603003 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN600397434 NAME: CENTEX MATERIALS LLC

CONTACT ADDRESS: 3801 S CAPITAL OF TEXAS HWY STE 250

**AUSTIN TX 78704** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 01/10/1991 CONTACT ROLE: OPRCON

CONTACT NAME: PHILIP BOWDEN CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: RON FINN

TITLE: NOT REPORTED

ORGANIZATION: CENTEX MATERIALS LLC SOUTH MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 4169628 0

GeoSearch www.geo-search.com 888-396-0042

832 of 937

ORGANIZATION: CENTEX MATERIALS LLC

PHONE: (512) 4603003 0
FAX: NOT REPORTED
EMAIL: NOT REPORTED
SELF-CERTIFICATION

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

ABOVEGROUND STORAGE TANK INFORMATION

AST ID #: 162858 MULTIPLE COMPARTMENT FLAG: NO

TANK ID: A REGISTRATION DATE: 01/09/1991

INSTALLATION DATE: 01/01/1971 STATUS BEGIN DATE: 01/01/1971

TANK CAPACITY (GAL): 15000 REGULATORY STATUS: FULLY REGULATED

STATUS: IN USE SUBSTANCES: DIESEL

**MATERIAL OF CONSTRUCTION** 

STEEL: **YES** CORRUGATED METAL: **NO** FIBERGLASS: **NO** CONCRETE: **NO** 

ALUMINIUM: NO CONTAINMENT

EARTHEN DIKE: **NO** CONCRETE: **YES**CONTAINMENT LINER: **NO** NONE: **NO**STAGE I VAPOR RECOVERY: **NOT REPORTED**STAGE I INSTALLATION DATE: **NOT REPORTED** 

**Back to Report Summary** 



# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 03297

UST ID #: 03297

NAME: MURPHY OIL USA #7209
ADDRESS: 710 E BEN WHITE BLVD

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: P

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

# City of Austin Underground Storage Tanks (AUSTINUST)

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

FACILITY INFORMATION
GEOSEARCH ID: N0139

UST ID #: N0139 NAME: SWBELL

ADDRESS: 3909 PAYLOAD PASS

**AUSTIN, TX** 

APPROXIMATE LOCATION OF TANK: NOT REPORTED

TANK TYPE: NOT REPORTED

STATUS OF UST BY CITY COUNCIL: NOT REPORTED CITY COUNCIL APPROVAL DATE: NOT REPORTED

ORDINANCE MANDATING UST TO BE IN RIGHT OF WAY OR NOT: NOT REPORTED

PERMIT STATUS: N

HISTORICAL RECORD?: NO COMMENT: NOT REPORTED

HYPER LINK TO COUNCIL MINUTES: NOT REPORTED

OWNER INFORMATION

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

FACILITY INFORMATION

REGISTRATION#: 73960 EPA ID: TXD987985256 NAME: AGUIRRE PAINT & BODY INC

TNRCC ID #: 28360 ADDRESS: NOT REPORTED

NAME: AGUIRRE PAINT & BODY

ADDRESS: 3909 PAYLOAD PASS PHONE: NOT REPORTED

**AUSTIN, TX 78704** 

CONTACT: ANTHONY AGUIRRE

PHONE: 512-4407757

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THERE WERE ONLY 6-DIGIT WASTE CODES

ONTHE NOR AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED
MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 04/24/2003

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** 

WASTE ID: 55029

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

WASTE ID: 55030

WASTE CODE STATUS: INACTIVE
WASTE IS RADIOACTIVE: NO
WASTE IS TREATED OFF SITE: YES

GENERATOR'S DESCRIPTION OF WASTE: NOT REPORTED

**Back to Report Summary** 



**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 89168 EPA ID: TXR000062836 NAME: WAL-MART STORES TEXAS LP

TNRCC ID #: 128475 ADDRESS: **PO BOX 8041** 

NAME: WALMART SUPERCENTER 1253 BENTONVILLE, AR 72712

ADDRESS: 710 E BEN WHITE BLVD PHONE: 1-479-2043517

AUSTIN, TX 78704
CONTACT: ROSE ARNOLD

PHONE: **479-2778972** 

BUSINESS DESCRIPTION: WAREHOUSE CLUBS AND SUPERCENTERS

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: ACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS REQUIRED TO SUBMIT AN ANNUAL WASTE REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 10/27/2017

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

ACTIVITY DESCRIPTION: NOT REPORTED

**WASTE** 

WASTE ID: 358180

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED WASTE-NICOTINE

WASTE ID: 246857

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE SOLIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246858

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

Order# 141197 Job# 336212 837 of 937

GENERATOR'S DESCRIPTION OF WASTE: AEROSOLSDATE OF GENERATION: 1/1/2010

WASTE ID: 246859

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: CORROSIVE LIQUIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246860

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE LIQUIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246861

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: LIGHTERSDATE OF GENERATION: 1/1/2010

WASTE ID: 246862

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING SOLIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246863

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: ORGANIC PEROXIDEDATE OF GENERATION: 1/1/2010

WASTE ID: 246864

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC SOLIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246865

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: TOXIC LIQUIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 246866

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: OXIDIZING LIQUIDSDATE OF GENERATION: 1/1/2010

WASTE ID: 250755

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 



Order# 141197 Job# 336212 838 of 937

GENERATOR'S DESCRIPTION OF WASTE: P-LISTED WASTE PHARMACEUTICALS

WASTE ID: 250756

WASTE CODE STATUS: **ACTIVE**WASTE IS RADIOACTIVE: **NO**WASTE IS TREATED OFF SITE: **NO** 

GENERATOR'S DESCRIPTION OF WASTE: FLAMMABLE WASTE PHARMACEUTICALS

**CONTACT INFORMATION** 

PHONE: (512) 8702985 0

ORGANIZATION: SOUTHWESTERN BELL TELEPHONE

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

NAME: J RANKIN

TITLE: SUPV

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

#### **FACILITY INFORMATION**

ID#: 20858

NAME: SOUTHWESTERN BELL TELEPHONE

ADDRESS: 3909 PAYLOAD PASS

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGION: 11

TYPE: FLEET REFUELING
BEGIN DATE: 09/11/1986
STATUS: INACTIVE

EXEMPT STATUS: **NO**RECORDS OFF-SITE: **NO** 

NUMBER OF ACTIVE UNDERGROUND TANKS: **0** NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

APPLICATION INFORMATION:

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 03/19/1986

SIGNATURE NAME & TITLE: **G BEAN, ASST SUPV** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN601235641

NAME: BEVERAGE CRUISE SALES LLC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/11/1986

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: XY1915D NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

GeoSearch www.geo-search.com 888-396-0042

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 116317

TANK ID: XY1915D

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: XY1915Y NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

NOT REPORTED

CORROSION PROTECTION:



Order# 141197 Job# 336212 841 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 116318

TANK ID: XY1915Y

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

NAME: J RANKIN

ID#: 35793

TITLE: MGR.

NAME: SOUTHWESTERN BELL ADDRESS: 3909 PAYLOAD PASS

ORGANIZATION: SOUTHWESTERN BELL

AUSTIN, TX 78704

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

COUNTY: TRAVIS

CITY NOT REPORTED

REGION: 11

PHONE: (512) 8702985 0

**CONTACT INFORMATION** 

TYPE: FLEET REFUELING
BEGIN DATE: 09/01/1987
STATUS: INACTIVE
EXEMPT STATUS: NO
RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: **0**NUMBER OF ACTIVE ABOVEGROUND TANKS: **0** 

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/08/1986 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/05/1986

SIGNATURE NAME & TITLE: **D A STEWART, OWNER** ENFORCEMENT ACTION DATE: **NOT REPORTED** 

**OWNER** 

OWNER NUMBER: CN600246607 NAME: DON A STEWART INC

CONTACT ADDRESS: OWNER ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 09/01/1987

CONTACT ROLE: NOT REPORTED CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED ORGANIZATION: NOT REPORTED

PHONE: **NOT REPORTED**FAX: **NOT REPORTED**EMAIL: **NOT REPORTED** 

**OPERATOR** 

NO OPERATOR INFORMATION REPORTED

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

**UNDERGROUND STORAGE TANK** 

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986
TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY



STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **08/31/1987** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**TANK DESIGN DOUBLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 92584

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1976 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 08/31/1987

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS MATERIAL:

STEEL

CORROSION PROTECTION:



Order# 141197 Job# 336212 844 of 937

#### **NOT REPORTED**

**EXTERNAL CONTAINMENT:** 

#### **NOT REPORTED**

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

# COMPARTMENT DETAILS UST COMPARTMENT ID: 92585

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

# PIPING SYSTEMS MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

#### **NOT REPORTED**

PIPING RELEASE DETECTION:

#### **NOT REPORTED**

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 77251

NAME: WAL-MART SUPERCENTER 1253

ADDRESS: 710 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 08/31/1987

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 1 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 03/09/2005 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 02/28/2005 SIGNATURE NAME & TITLE: SHEILA DEARING, LICENSING MGR

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN603246240

NAME: WAL-MART STORES TEXAS LLC CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: (479) 2042231 0 FAX: (479) 2775844

EMAIL: TERESA.PRUITT@WAL-MART.COM

**OPERATOR** 

OPERATOR NUMBER: CN603246240 NAME: WAL-MART STORES TEXAS LLC CONTACT ADDRESS: 1300 SE 8TH ST

**BENTONVILLE AR 72712** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 06/29/2007

CONTACT ROLE: OWNOPRCON CONTACT NAME: NOT REPORTED CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: NOT REPORTED

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

846 of 937

ORGANIZATION: WALMART STORES TEXAS LLC

PHONE: **(479) 2042231 0** FAX: **(479) 2775844** 

EMAIL: TERESA.PRUITT@WAL-MART.COM

**SELF-CERTIFICATION** 

-NO SELF-CERTIFICATION INFORMATION REPORTED-

**CONSTRUCTION NOTIFICATION** 

NOTIFICATION CONSTRUCTION ID: 20140

APPLICATION RECEIVED DATE: 10/15/2004

SCHEDULE CONSTRUCTION DATE: 01/10/2005

GENERAL DESCRIPTION OF PROPOSED CONSTRUCTION:

**NOT REPORTED** 

**UNDERGROUND STORAGE TANK** 

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 12/15/2004 REGISTRATION DATE: 03/09/2005

TANK CAPACITY (GAL): 1000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/15/2004

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: WASTEWATER TREATMENT

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:
CONCRETE

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

NOT REPORTED

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 178835

TANK ID: 1

COMPARTMENT LETTER: A

SUBSTANCES: OIL WATER SEPARATOR OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

**NOT REPORTED** 



Order# 141197 Job# 336212 847 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 98** 

Distance from Property: 0.208 mi. (1,098 ft.) NNW

Elevation: 658 ft. (Higher than TP)

**FACILITY INFORMATION** 

ID#: 77388

NAME: MURPHY USA 7209

ADDRESS: 710 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGION: 11

TYPE: RETAIL

BEGIN DATE: 05/10/2005

STATUS: ACTIVE **EXEMPT STATUS: NO** RECORDS OFF-SITE: NO

NUMBER OF ACTIVE UNDERGROUND TANKS: 2 NUMBER OF ACTIVE ABOVEGROUND TANKS: 0

**APPLICATION INFORMATION:** 

RECEIVED DATE ON EARLIEST REGISTRATION FORM: 05/19/2005 SIGNATURE DATE ON EARLIEST REGISTRATION FORM: 05/10/2005 SIGNATURE NAME & TITLE: KEVIN ROUSSEL, MGR FIELD CONSTRUCTI

ENFORCEMENT ACTION DATE: NOT REPORTED

**OWNER** 

OWNER NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 200 E PEACH ST

EL DORADO AR 71730

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/10/2005 CONTACT ROLE: OWNCON

CONTACT NAME: BRAD WEINISCHKE

CONTACT TITLE: ENV COORD

ORGANIZATION: MURPHY OIL USA INC

PHONE: (870) 8816854 0 FAX: NOT REPORTED **EMAIL: NOT REPORTED** 

**OPERATOR** 

OPERATOR NUMBER: CN601187875 NAME: MURPHY OIL USA INC

CONTACT ADDRESS: 4734 SANFORD ST

**METAIRIE LA 70006** 

TYPE: CORPORATION/COMPANY

BEGIN DATE: 05/10/2005 CONTACT ROLE: OPRCON

CONTACT NAME: RUSSEL S COLVIN CONTACT TITLE: NOT REPORTED

**CONTACT INFORMATION** 

NAME: NOT REPORTED TITLE: NOT REPORTED

ORGANIZATION: MURPHY USA 7209

MAIL ADDRESS: MAILING ADDRESS NOT REPORTED

**CITY NOT REPORTED** 

PHONE: (512) 8045338 0

GeoSearch www.geo-search.com 888-396-0042

849 of 937

ORGANIZATION: MURPHY OIL USA INC

PHONE: (504) 5612307 0
FAX: (504) 5612332
EMAIL: NOT REPORTED
SELF-CERTIFICATION

SELF-CERTIFICATION ID: 325047 SIGNATURE DATE: 09/03/2019

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 309116
SIGNATURE DATE: 09/06/2018

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, OWNER

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 291312
SIGNATURE DATE: 09/05/2017

SIGNATURE NAME & TITLE: KRYSTAL TERRELL, LICNESE & PERMITS SP

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 274246
SIGNATURE DATE: 09/01/2016

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 257538
SIGNATURE DATE: 09/08/2015

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 240016
SIGNATURE DATE: 08/08/2014

 ${\tt SIGNATURE\ NAME\ \&\ TITLE:\ } \textbf{ANNA\ W\ JONES,\ HSSE\ COORDINATOR}$ 

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 224014
SIGNATURE DATE: 08/23/2013

SIGNATURE NAME & TITLE: ANNA W JONES, HSSE COORDINATOR

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213605
SIGNATURE DATE: 08/14/2012

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALISLT

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213604
SIGNATURE DATE: 08/22/2011



SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213603
SIGNATURE DATE: 08/03/2010

SIGNATURE NAME & TITLE: ANNA W JONES, SR ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213602
SIGNATURE DATE: 08/12/2009

SIGNATURE NAME & TITLE: ANNA W JONES, SR. ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213601
SIGNATURE DATE: 08/23/2008

SIGNATURE NAME & TITLE: ANNA W JONES, SR. ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213600
SIGNATURE DATE: 08/13/2007

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213365
SIGNATURE DATE: 08/11/2006

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213364
SIGNATURE DATE: 08/04/2005

SIGNATURE NAME & TITLE: ANNA W JONES, ENV SPECIALIST

FILING STATUS: RENEWAL
REGISTRATION FLAG: YES
SELF-CERTIFICATION ID: 213363
SIGNATURE DATE: 05/10/2005

SIGNATURE NAME & TITLE: KEVIN ROUSSEL, MGR FIELD CONSTRUCTI

FILING STATUS: **INITIAL** REGISTRATION FLAG: **YES** 

#### **CONSTRUCTION NOTIFICATION**

NO CONSTRUCTION NOTIFICATION DATA REPORTED FOR THIS FACILITY

#### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 02/03/2005 REGISTRATION DATE: 05/19/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES



Order# 141197 Job# 336212 851 of 937

PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 179207

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 20000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINED AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINED BUCKET/SUMP, FACTORY - BUILT

 ${\tt SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE, ALARM\ (SET @<=90\%)\ W3A\ OR\ 3B}$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED.

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/03/2005 REGISTRATION DATE: 05/19/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)



Order# 141197 Job# 336212 852 of 937

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 179208

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 12000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 02/03/2005 REGISTRATION DATE: 05/19/2005

TANK CAPACITY (GAL): 20000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 02/03/2005

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

FRP

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 179209

GeoSearch www.geo-search.com 888-396-0042

TANK ID: 2

COMPARTMENT LETTER: **B** SUBSTANCES: **GASOLINE** 

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: INTERSTITIAL MONITORING WITHIN SECONDARY WALL/JACKET

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

 ${\tt SPILL\ CONTAINER/BUCKET/SUMP, DELIVERY\ SHUT-OFF\ VALVE, FLOW\ RESTRICTOR\ VALUE, ALARM\ (SET @ <= 90\%)\ W3A\ OR\ 3B}$ 

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

PIPING RELEASE DETECTION:

ANNUAL PIPING TIGHTNESS TEST / ANNUAL ELECTRONIC MONITORING (@ 0.1 GPH),AUTO. LINE LEAK DETECTOR (3.0 GPH FOR PRESSURE PIPING)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**ABOVEGROUND STORAGE TANK INFORMATION** 

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### Alternative Fueling Stations (ALTFUELS)

**MAP ID# 99** 

Distance from Property: 0.218 mi. (1,151 ft.) ESE

Elevation: 654 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 81476

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 81476

STATION NAME: CONCORD STATION ADDRESS: 7331 BLUFF SPRINGS RD

**AUSTIN, TX 78744** 

INTERSECTION DIRECTIONS: BLUFF SPRINGS 6

**BLUFF SPRINGS 7** 

STATION PHONE: 888-758-4389

STATION CURRENT STATUS: **OPEN: THE STATION IS OPEN.**TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: **ELECTRIC** 

OWNER TYPE: NOT REPORTED

FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: **NOT REPORTED**DATE THE STATION'S DETAILS WERE LAST CONFIRMED: **9/24/2019** 

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-09-24 09:09:21 UTC

**MAP ID# 100** 

Distance from Property: 0.231 mi. (1,220 ft.) WNW

Elevation: 669 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 66344 EPA ID: TXD102730868 NAME: R&T PAINT & BODY SHOP INC

TNRCC ID #: 21623 ADDRESS: 711 E SAINT ELMO RD

NAME: R & T PAINT & BODY SHOP AUSTIN, TX 78745

ADDRESS: 711 E SAINT ELMO RD PHONE: NOT REPORTED

**AUSTIN, TX 78745** 

CONTACT: ROBERT MARRERO

PHONE: NOT REPORTED

BUSINESS DESCRIPTION: 1-11-2002 CHANGED MAILING ADDRESS INCORRECT TO INACTIVE SC

INDUSTRIAL WASTE PERMIT #: NOT REPORTED

MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED
WASTE GENERATOR: YES
WASTE RECEIVER: NO
WASTE TRANSPORTER: NO
TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 11/29/2005

**ACTIVITIES** 

ACTIVITY TYPE: UNKNOWN

ACTIVITY DESCRIPTION: NOT REPORTED

WASTE NO RECORDS

**Back to Report Summary** 

### Closed & Abandoned Landfill Inventory (CALF)

**MAP ID# 101** 

Distance from Property: 0.231 mi. (1,220 ft.) ESE

Elevation: 651 ft. (Higher than TP)

**SITE INFORMATION** 

SITE NUMBER: 890
SITE NAME: MCGUIRE

LOCATION:

E OF IH 35 AND W OF FRIEDRICH LN, S OF E ST. ELMO. (4500 BLK OF FRIEDRICH)

COUNTY: TRAVIS
COMMENTS:

**UNDULATING RIDGES SPACED 50 TO 80 FT APART** 

INSPECTION:

???

OWNER NAME: NOT REPORTED

DATE OPEN: 1954

DATE CLOSE: 1961

SIZE (ACRES): 13.00

SIZE (CUBIC YARDS): 0.00

PARTIES: AUSTIN

**LANDFILL CONTENTS** 

HOUSEHOLD: YES CONSTRUCTION DEMOLITION: NR

INDUSTRIAL: NR TIRES: NR

AGRICULTURE: NR BRUSH: NR

OTHER: NR LEGAL: YES

UNAUTHORIZED: NR HAZARD UNLIKELY: NR HAZARD PROBABLY: NR HAZARD CERTAINLY: NR DEPTH CD: B MINIMUM THICKNESS: B

MAXIMUM DEPTH: 10.00 USE: UK

OTHER DESCRIPTION: NOT REPORTED

REVIEWER: NOT REPORTED

**MAP ID# 102** 

Distance from Property: 0.242 mi. (1,278 ft.) WNW

Elevation: 671 ft. (Higher than TP)

**FACILITY INFORMATION** 

OWNER INFORMATION

REGISTRATION#: 66359 EPA ID: TXD981058241 NAME: CARRIAGE BODY SHOP INC

TNRCC ID #: 21638

ADDRESS: 707 INDUSTRIAL BLVD

NAME: CARRIAGE BODY SHOP

**AUSTIN, TX 78745** 

ADDRESS: 707 INDUSTRIAL BLVD

PHONE: 1-512-4482824

**AUSTIN, TX 78745** 

CONTACT: LARRY BASSETT

PHONE: 512-4482824

BUSINESS DESCRIPTION: THIS REGISTRATION WAS INACTIVATED BECAUSE THIS FACILITY WAS REGISTERED PRIOR

TO1994 AND NO WASTE ACTIVITY WAS REPORTED IN 1994, 1995 AND 1996.

INDUSTRIAL WASTE PERMIT #: NOT REPORTED MUNICIPAL WASTE PERMIT #: NOT REPORTED

SIC CODE: NOT REPORTED WASTE GENERATOR: YES WASTE RECEIVER: NO WASTE TRANSPORTER: NO TRANSFER FACILITY: NO

MAQUILADORA (MEXICAN FACILITY): NO

STATUS: INACTIVE

AMOUNT OF WASTE GENERATED: CONDITIONALLY EXEMPT SMALL QUANTITY GENERATOR

GENERATOR TYPE: NON-INDUSTRIAL AND/OR MUNICIPAL

THIS FACILITY IS A NOTIFIER

THIS FACILITY IS NOT A STEERS REPORTER - (STATE OF TEXAS ENVIRONMENTAL ELECTRONIC REPORTING SYSTEM)

THIS FACILITY IS NOT REQUIRED TO SUBMIT AN ANNUAL WASTE SUMMARY REPORT

THIS FACILITY IS NOT INVOLVED IN RECYCLING ACTIVITIES

LAST UPDATE TO TRACS (TCEQ REGULATORY ACTIVITIES AND COMPLIANCE SYSTEM): 09/10/2003

**ACTIVITIES** 

**ACTIVITY TYPE: UNKNOWN** 

**ACTIVITY DESCRIPTION: NOT REPORTED** 

**WASTE** NO RECORDS

**Back to Report Summary** 

858 of 937

### Municipal Solid Waste Landfill Sites (MSWLF)

**MAP ID# 103** 

Distance from Property: 0.243 mi. (1,283 ft.) ESE

Elevation: 657 ft. (Higher than TP)

**FACILITY INFORMATION** 

PERMIT#: 67008

NAME: STERLING ACURA OF AUSTIN PARKING LOT EXPANSION

ADDRESS: 4720 FREIDRICH LANE

**AUSTIN, TX 78744** 

COUNTY: TRAVIS
FACILITY DETAILS

FACILITY TYPE #: SUBT

PHYSICAL FACILITY STATUS: NOT CONSTRUCTED

LEGAL STATUS: ISSUED

REFERENCE NUMBER(RN): RN109941971

REGION: REGION 11 - AUSTIN

FACILITY TYPE #: SUBT

PHYSICAL FACILITY STATUS: NOT CONSTRUCTED

LEGAL STATUS: PENDING

REFERENCE NUMBER(RN): RN109941971

REGION: REGION 11 - AUSTIN

## Alternative Fueling Stations (ALTFUELS)

**MAP ID# 104** 

Distance from Property: 0.247 mi. (1,304 ft.) WNW

Elevation: 675 ft. (Higher than TP)

**FACILITY INFORMATION** 

GEOSEARCH ID: 68824

UNIQUE IDENTIFIER FOR THIS SPECIFIC STATION: 68824

STATION NAME: PRESIDIUM

ADDRESS: 409 E WILLIAM CANNON DR

**AUSTIN, TX 78745** 

INTERSECTION DIRECTIONS: VIOLET; ON RIGHT SIDE OF ENTRY

STATION PHONE: 888-758-4389

STATION CURRENT STATUS: OPEN: THE STATION IS OPEN.

TYPE OF ALTERNATIVE FUEL THE STATION PROVIDES: ELECTRIC

OWNER TYPE: NOT REPORTED

FEDERAL AGANCY ID: NOT REPORTED
FEDERAL AGENCY NAME: NOT REPORTED

DATE THAT THE STATION BEGAN OFFERING THE FUEL: **NOT REPORTED**DATE THE STATION'S DETAILS WERE LAST CONFIRMED: **9/24/2019** 

TIME THE STATION'S DETAILS WERE LAST UPDATED (ISO 8601 FORMAT).: 2019-09-24 09:09:21 UTC

## Recycling Facilities (WMRF)

**MAP ID# 105** 

Distance from Property: 0.272 mi. (1,436 ft.) ESE

Elevation: 657 ft. (Higher than TP)

**SITE INFORMATION** 

COMPANY ID: 31145

COMPANY NAME: AXCESS TECHNOLOGIES LLP SITE NAME: AXCESS TECHNOLOGIES LLP

ADDRESS: 4801 FREIDRICH LANE

CITY: AUSTIN
STATE: TX
ZIPCODE: 78744
SITE DETAILS

CONTACT NAME: RANDY WEISS
CONTACT TITLE: GEN MGR
CONTACT PHONE: 512-441-1100

CONTACT EMAIL: AXCESS@AXCESSTECH.NET

MATERIAL ACCEPTED: **CIRCUIT BOARDS**CATEGORY: **METALS**BROKER: **YES**PROCESSOR: **YES** 

SUB-CATEGORY: **ELECTRONIC EQUIPMENT & SCRAP** MANUFACTOR: **NOT REPORTED**COLLECTOR: **YES**COMPOSTER: **NOT REPORTED** 

-----

MATERIAL ACCEPTED: **COMPUTERS**CATEGORY: **METALS**BROKER: **YES**PROCESSOR: **YES** 

SUB-CATEGORY: **ELECTRONIC EQUIPMENT & SCRAP** MANUFACTOR: **NOT REPORTED**COLLECTOR: **YES** COMPOSTER: **NOT REPORTED** 

-----

MATERIAL ACCEPTED: **COMPUTER MONITORS**BROKER: **YES** 

CATEGORY: METALS PROCESSOR: NOT REPORTED

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED

COLLECTOR: YES COMPOSTER: NOT REPORTED

-----

MATERIAL ACCEPTED: OTHER COMPUTER PERIPHERALS BROKER: YES CATEGORY: METALS PROCESSOR: YES

SUB-CATEGORY: **ELECTRONIC EQUIPMENT & SCRAP** MANUFACTOR: **NOT REPORTED** COLLECTOR: **YES** COMPOSTER: **NOT REPORTED** 

-----

MATERIAL ACCEPTED: **PRINTERS**CATEGORY: **METALS**BROKER: **YES**PROCESSOR: **YES** 

SUB-CATEGORY: **ELECTRONIC EQUIPMENT & SCRAP** MANUFACTOR: **NOT REPORTED**COLLECTOR: **YES** COMPOSTER: **NOT REPORTED** 

-----

MATERIAL ACCEPTED: **TELEPHONE EQUIPMENT**CATEGORY: **METALS**BROKER: **YES**PROCESSOR: **YES** 

SUB-CATEGORY: ELECTRONIC EQUIPMENT & SCRAP MANUFACTOR: NOT REPORTED

GeoSearch www.geo-search.com 888-396-0042

# Recycling Facilities (WMRF)

COLLECTOR: YES COMPOSTER: NOT REPORTED

**MAP ID# 106** 

Distance from Property: 0.307 mi. (1,621 ft.) NW

Elevation: 673 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 105147

LPST ID: **105147**FACILITY ID: **14327** 

NAME: CHISHOLM CORNER STORE 7
ADDRESS: 600 E BEN WHITE BLVD
AUSTIN, TX 78704

### **LEAKING TANK DETAILS**

LPST ID: 105147

NAME: CHISHOLM CORNER STORE 7
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/21/93

REPORTED DATE: 10/19/1992 ENTERED DATE: 01/21/1993 CLOSURE DATE: 05/12/1994

### **PRP INFORMATION**

NAME: E-Z SERVE PETROLEUM MARKETING COMPANY

ADDRESS: ADDRESS NOT REPORTED

**HOUSTON TX 77292** 

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 8000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/19/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 141197 Job# 336212 863 of 937

### **COMPARTMENT DETAILS**

**UST COMPARTMENT ID: 3059** 

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 10/19/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

0.\_\_\_

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 3058

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 864 of 937

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1970 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 6000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **10/19/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 3060

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 6000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**



NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



## Affected Property Assessment Reports (APAR)

**MAP ID# 107** 

Distance from Property: 0.31 mi. (1,637 ft.) WNW

Elevation: 657 ft. (Higher than TP)

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: 2074

DAVIS, DARIN

REFERENCE NUMBER: RN102479920 FACILITY NAME: MULDOON INTERESTS

ADDRESS: 6210 CROW LN
AUSTIN, TX 78745

COUNTY: TRAVIS

REGULATED ENTITY NAME: MULDOON INTERESTS LOCATION DESCRIPTION: 6210 - 6216 CROW LN

TYPE OF FACILITY: AUTO SVC STN/REPAIR/VEH MAINTE

FACILITY STATUS: COMPLETED
PROGRAM: VOLUNTARY CLEANUP
PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE CONTAMINATIONS: 08/31/07 NOT REPORTED

08/31/07 METALS 08/31/07 TPH

**MAP ID# 107** 

Distance from Property: 0.31 mi. (1,637 ft.) WNW

Elevation: 657 ft. (Higher than TP)

### **FACILITY INFORMATION**

PROGRAM ID#: 2074

NAME: MULDOON INTERESTS
ADDRESS: 6210 CROW LN

**AUSTIN TX 78745** 

ADDRESS DESCRIPTION: 6210 - 6216 CROW LN

ASSOCIATED VCP ID(s): 2074

PCA NUMBER: 34270

PROJECT NUMBER: 342700

LEGAL ID: 12126609

REGULATED ENTITY REFERENCE NUMBER (RN): RN102479920 CURRENT FACILITY TYPE: AUTO SVC STN/REPAIR/VEH MAINTE

FORMER FACILITY TYPE: NOT REPORTED

PROJECT MANAGER: SLAWLESS

PROJECT PHASE: COMPLETED

ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 06/14/2007

APPLICATION RECEIVED DATE: 06/14/2007

APPLICATION ACCEPTANCE DATE: 07/25/2007

VCP APPLICATION ACCEPTED: NOT REPORTED

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 06/14/2007

TCEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: TPH; METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

 ${\tt ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE:} \ \ \textbf{NOT} \ \textbf{REPORTED}$ 

LPST NO: **NOT REPORTED**IOP ID: **NOT REPORTED** 

EPA CERCLIS #: NOT REPORTED
EPA RCRIS #: NOT REPORTED

FILE MEDIA: PAPER
FILE LOCATION: D/200-12

SITE SIZE: 6

Order# 141197 Job# 336212 868 of 937

TYPE OF REMEDY: NOT REPORTED

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 01/28/2008

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: TRRP

APPLICABLE STANDARDS: A
APPLICABLE TRRP TIER: 1

### **AFFILIATED CUSTOMER(S)**

CN NUMBER: **CN603210881** RN NUMBER: **RN102479920** 

CUSTOMER NAME: MULDOON INTERESTS LLC

ROLE CD: APPLCONT

CONTACT NAME: DAVIS, DARIN

CONTACT TITLE: **PROFESSIONAL MANAGER**ORGANIZATION NAME: **MULDOON INTERESTS LLC** 

MAILING ADDRESS: PO BOX 685316

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78768** 

CONTACT PHONE: (512) 637-6377

-----

CN NUMBER: **CN603210881** RN NUMBER: **RN102479920** 

CUSTOMER NAME: MULDOON INTERESTS LLC

ROLE CD: BILLCONT

CONTACT NAME: DAVIS, DARIN
CONTACT TITLE: NOT REPORTED

ORGANIZATION NAME: MULDOON INTERESTS LLC

MAILING ADDRESS: PO BOX 685316

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78768** 

CONTACT PHONE: (512) 637-6377



Order# 141197 Job# 336212 869 of 937

**MAP ID# 108** 

Distance from Property: 0.343 mi. (1,811 ft.) ESE

Elevation: 595 ft. (Lower than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 104683

LPST ID: **104683**FACILITY ID: **60567** 

NAME: ONION CREEK CLUB

ADDRESS: 2510 ONION CREEK PKWY

**AUSTIN, TX 78747** 

### **LEAKING TANK DETAILS**

LPST ID: 104683

NAME: ONION CREEK CLUB

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 10/28/92

REPORTED DATE: 09/04/1992 ENTERED DATE: 10/28/1992 CLOSURE DATE: 09/24/1992

**PRP INFORMATION** 

NAME: ONION CREEK CLUB

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78747
CONTACT: NOT REPORTED

PHONE: NOT REPORTED

### UNDERGROUND STORAGE TANK

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 08/31/1987 REGISTRATION DATE: 10/15/1991

TANK CAPACITY (GAL): 1000 EMPTY TANK: EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 09/04/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 141197 Job# 336212 871 of 937

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 139451

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 1000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

MATERIAL: NOT REPORTED

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 109** 

Distance from Property: 0.36 mi. (1,901 ft.) ESE

Elevation: 636 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 100905

LPST ID: **100905**FACILITY ID: **7131** 

NAME: METRO MARTS 2 FORMER 7 ELEVEN

ADDRESS: 2008 TERI RD

**AUSTIN, TX 78744** 

### **LEAKING TANK DETAILS**

LPST ID: 100905

NAME: **METRO MARTS 2 FORMER 7 ELEVEN** FACILITY LOCATION: **NOT REPORTED** 

PRIORITY CODE: 4A - SOIL CONTAMINATION ONLY REQUIRES FULL SITE ASSESSMENT RAP

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 12/4/91

REPORTED DATE: 11/18/1991 ENTERED DATE: 12/04/1991 CLOSURE DATE: 04/22/1992

PRP INFORMATION
NAME: **METRO FUEL** 

ADDRESS: ADDRESS NOT REPORTED

**ROUND ROCK TX 78664** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 12/01/1991 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES
PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

**TANK DETAILS** 

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 129654

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 8000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, SIR (STAT. INVENTORY RECONCILIATION) &

**INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1 NUMBER OF COMPARTMENTS: 2 INSTALLATION DATE: 12/01/1991 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 12000 EMPTY TANK: NOT EMPTY

STATUS: IN USE STATUS BEGIN DATE: 12/01/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: YES PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: YES

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 129655

TANK ID: 1

COMPARTMENT LETTER: B
SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 4000

COMPARTMENT RELEASE DETECTION: GROUNDWATER MONITORING, SIR (STAT. INVENTORY RECONCILIATION) &

Order# 141197 Job# 336212 874 of 937

### **INVENTORY CONTROL**

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT

SPILL CONTAINER/BUCKET/SUMP, DELIVERY SHUT-OFF VALVE

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 1A NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO

PIPE DESIGN SINGLE WALL: NO

PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 129651

TANK ID: 1A

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

Order# 141197 Job# 336212 875 of 937

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/31/1991** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

**NOT REPORTED** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 129652

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1979 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY
STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/31/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

Order# 141197 Job# 336212 876 of 937

### **TANK DETAILS**

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**NOT REPORTED** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 129653

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 110** 

Distance from Property: 0.378 mi. (1,996 ft.) WNW

Elevation: 673 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 100669

LPST ID: 100669 FACILITY ID: 803

NAME: WENCO DISTRIBUTING
ADDRESS: 600 INDUSTRIAL BLVD
AUSTIN, TX 78745

### **LEAKING TANK DETAILS**

LPST ID: 100669

NAME: WENCO DISTRIBUTING

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 5 - MINOR SOIL CONTAMINATION - DOES NOT REQUIRE A RAP CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 11/15/91

REPORTED DATE: 10/22/1991 ENTERED DATE: 11/15/1991 CLOSURE DATE: 01/30/1992

### **PRP INFORMATION**

NAME: WENCO DISTRIBUTING

ADDRESS: ADDRESS NOT REPORTED

AUSTIN TX 78767
CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1985 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/03/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

### **TANK DETAILS**

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

NOT REPORTED

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 878 of 937

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 129245

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: DIESEL

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 01/01/1971 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 2000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 10/03/1991

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: NO TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: NO PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS

MATERIAL:

STEEL

CORROSION PROTECTION:

NOT REPORTED

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 129244

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 2000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 



Order# 141197 Job# 336212 879 of 937

MATERIAL: STEEL

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

## Affected Property Assessment Reports (APAR)

**MAP ID# 111** 

Distance from Property: 0.391 mi. (2,064 ft.) NW

Elevation: 668 ft. (Higher than TP)

### **FACILITY INFORMATION**

**CONTACTS** 

PROGRAM ID: 2025 ANDREANI, NIC

REFERENCE NUMBER: RN104722301
FACILITY NAME: BEN WHITE LOTS 1,2,3,4,5

ADDRESS: 500 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

COUNTY: TRAVIS

REGULATED ENTITY NAME: BEN WHITE TRACTS 1 AND 2

LOCATION DESCRIPTION: 500 E BEN WHITE, 3700 AND 3900 PAYLOAD PASS

TYPE OF FACILITY: RETAIL
FACILITY STATUS: COMPLETED
PROGRAM: VOLUNTARY CLEANUP
PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

### **CATEGORY OF CONTAMINATION**

DATE CONTAMINATIONS: 06/25/10 NOT REPORTED

06/25/10 CHLORINATED SOLVENTS

06/25/10 METALS

06/30/08 NOT REPORTED

06/30/08 CHLORINATED SOLVENTS

06/30/08 METALS

## Innocent Owner / Operator Database (IOP)

MAP ID# 111

Distance from Property: 0.391 mi. (2,064 ft.) NW

Elevation: 668 ft. (Higher than TP)

### **FACILITY INFORMATION**

ID#: 0580

DATE IOP RECIEVED: 10/17/2006
CERTIFICATE ISSUED: 5/17/2010
NAME: KMS RETAIL PAYLOAD PASS
ADDRESS: 500 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

CONTAMINANTS: VOCS, METALS

MEDIA AFFECTED: SOILS/GROUNDWATER

PHASE: COMPLETED

PROPERTY USE: COMMERCIAL PROPERTY

ACRES: **30-DEC-1899** RN NUMBER: **RN104722301** 

PROGRAM ID:

CURRENT FACILITY TYPE: PROPERTY COMMERCIAL

SITE ADDRESS DESCRIPTION: 500 E BEN WHITE, 3700 AND 3900 PAYLOAD PASS

NEAR CITY NAME: AUSTIN

ADMINISTRATIVE STATUS: INACTIVE
APPLICATION RECEIVED DATE: 10/17/2006

IOC DATE: 04/27/2010; 05/17/2010

TCEQ REGION NAME: REGION 11 - AUSTIN

GROUNDWATER COCS IN CERTIFICATE: NOT REPORTED SEDIMENT COCS IN CERTIFICATE: NOT REPORTED SOIL COCS IN CERTIFICATE: NOT REPORTED

OTHER CONTACTS (CONSULTANT/ATTORNEY)

ORGANIZATION: W&M ENVIRONMENTAL GROUP, INC.

NIC ANDREANI, PE DIVISION MANAGER 12708 RIATA VISTA CIRCLE, SUITE A128

**AUSTIN TX 78727** 

PHONE: 512-493-9691 FAX: 512-493-9693

APPLICANT INFORMATION

ORGANIZATION: KMS RETAIL BEN WHITE LP

NIC ANDREANI, PE, PARTNER

ADDRESS: 8350 NORTH CENTRAL EXPRESSWAY, STE 1275

**DALLAS, TX, 75206** 

INTEREST IN SITE: OWNER

PHONE: (214) 363-3900 FAX: 214-691-2626

**MAP ID# 111** 

Distance from Property: 0.382 mi. (2,017 ft.) NW

Elevation: 668 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 107201

LPST ID: 107201

FACILITY ID: NOT REPORTED

NAME: FORMER TRUCK CITY DEALERSHIP

ADDRESS: 502 E BEN WHITE BLVD

**AUSTIN, TX 78704** 

### **LEAKING TANK DETAILS**

LPST ID: 107201

NAME: FORMER TRUCK CITY DEALERSHIP FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.2 - NO GW IMPACT NO APPARENT THREATS OR IMPACTS TO RECEPTORS

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 5/29/96

REPORTED DATE: 08/04/1993 ENTERED DATE: 05/29/1996 CLOSURE DATE: 10/06/1993

### **PRP INFORMATION**

NAME: TEXAS DEPARTMENT OF TRANSPORTATION

ADDRESS: ADDRESS NOT REPORTED

**AUSTIN TX** 

CONTACT: NOT REPORTED PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

NO UNDERGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 111** 

Distance from Property: 0.391 mi. (2,064 ft.) NW

Elevation: 668 ft. (Higher than TP)

### **FACILITY INFORMATION**

PROGRAM ID#: 2025

NAME: **BEN WHITE LOTS 1,2,3,4,5**ADDRESS: **500 E BEN WHITE BLVD** 

**AUSTIN TX 78704** 

ADDRESS DESCRIPTION: 500 E BEN WHITE, 3700 AND 3900 PAYLOAD PASS

ASSOCIATED VCP ID(s): 2025

PCA NUMBER: 34221

PROJECT NUMBER: 342210

LEGAL ID: 12035810

REGULATED ENTITY REFERENCE NUMBER (RN): RN104722301

CURRENT FACILITY TYPE: RETAIL

FORMER FACILITY TYPE: NOT REPORTED

PROJECT MANAGER: MRIGGLE

PROJECT PHASE: COMPLETED

ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 02/02/2007

APPLICATION RECEIVED DATE: 02/05/2007

APPLICATION ACCEPTANCE DATE: 02/06/2007

VCP APPLICATION ACCEPTED: NOT REPORTED

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 02/05/2007

TCEQ REGION NAME: REGION 11 - AUSTIN

TOEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: 73960

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: CHLORINATED SOLVENTS; METALS

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: CHLORINATED SOLVENTS; METALS

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE: NOT REPORTED

LPST NO: NOT REPORTED

IOP ID: 580

EPA CERCLIS #: NOT REPORTED

EPA RCRIS #: NOT REPORTED

FILE MEDIA: MICROFILM; PAPER

FILE LOCATION: D/200-12; CR

SITE SIZE: 12.306

Order# 141197 Job# 336212 884 of 937

TYPE OF REMEDY: NOT REPORTED

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 11/16/2007; 07/30/2010

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: TRRP

APPLICABLE STANDARDS: **B** APPLICABLE TRRP TIER: **2** 

### **AFFILIATED CUSTOMER(S)**

CN NUMBER: **CN602890451**RN NUMBER: **RN104722301** 

CUSTOMER NAME: KMS RETAIL-BEN WHITE LP

ROLE CD: APPLCONT

CONTACT NAME: FOOSE, BILL CONTACT TITLE: PARTNER

ORGANIZATION NAME: KMS RETAIL BEN WHITE LP
MAILING ADDRESS: 8350 N CENTRAL EXPY STE 1275

MAILING CITY NAME: DALLAS

MAILING STATE: TX
MAILING ZIPCODE: 75206

CONTACT PHONE: (214) 363-3900

**Back to Report Summary** 

Order# 141197 Job# 336212 885 of 937

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

MAP ID# 112

Distance from Property: 0.396 mi. (2,091 ft.) ESE

Elevation: 657 ft. (Higher than TP)

PROGRAM ID: **20619**RN NUMBER: **RN100596691** 

NAME: AMBION

ADDRESS: 2130 WOODWARD ST STE 200

**AUSTIN, TX 78744** 

STATUS: INACTIVE
STATUS DATE: 4/1/19

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

2130 WOODWARD ST, STE 200, AUSTIN, TX

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

MAP ID# 113

Distance from Property: 0.41 mi. (2,165 ft.) ESE

Elevation: 642 ft. (Higher than TP)

PROGRAM ID: **66261**RN NUMBER: **RN100645506** 

NAME: MODERN METAL FINISHING AUSTIN ADDRESS: 7432 BLUFF SPRINGS RD

**AUSTIN, TX 78744** 

STATUS: **INACTIVE**STATUS DATE: **2/3/06** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

7432 BLUFF SPRINGS RD, AUSTIN, TX

## Industrial and Hazardous Waste Corrective Action Sites (IHWCA)

**MAP ID# 114** 

Distance from Property: 0.437 mi. (2,307 ft.) WNW

Elevation: 656 ft. (Higher than TP)

PROGRAM ID: 66010 RN NUMBER: RN100694405 NAME: CEN-TEX PLATING

ADDRESS: 509 E SAINT ELMO RD **AUSTIN, TX 78745** 

STATUS: INACTIVE STATUS DATE: 6/27/17

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 115** 

Distance from Property: 0.442 mi. (2,334 ft.) WNW

Elevation: 664 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 105550

LPST ID: **105550**FACILITY ID: **44924** 

NAME: AUSTIN FOUR CORNERS OLD STOP N GO

ADDRESS: 111 W WILLIAM CANNON DR

**AUSTIN, TX 78745** 

### **LEAKING TANK DETAILS**

LPST ID: 105550

NAME: AUSTIN FOUR CORNERS OLD STOP N GO

FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 6 - MINOR SOIL CONTAMINATION - NO REMEDIAL ACTION REQUIRED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 1/11/93

REPORTED DATE: 12/14/1992 ENTERED DATE: 01/11/1993 CLOSURE DATE: 03/23/1993

### **PRP INFORMATION**

NAME: CALTEX CONSOLIDATED CORP
ADDRESS: ADDRESS NOT REPORTED
SAN DIEGO CA 92123

CONTACT: NOT REPORTED
PHONE: NOT REPORTED

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1987 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/10/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

### **TANK DETAILS**

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE



Order# 141197 Job# 336212 889 of 937

**COMPARTMENT DETAILS** 

UST COMPARTMENT ID: 59972

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1987 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/10/1992

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 59974

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

**PIPING SYSTEMS** 

Order# 141197 Job# 336212 890 of 937

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 03/01/1987 REGISTRATION DATE: 06/11/1987

TANK CAPACITY (GAL): 10000 EMPTY TANK: EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/10/1992** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: **NO**PIPE DESIGN SINGLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO**PIPE DESIGN DOUBLE WALL: **NO** 

TANK DETAILS

MATERIAL:

**FRP** 

CORROSION PROTECTION:

FRP TANK OR PIPING (NONCORRODIBLE)

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 59973

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: NOT REPORTED

SPILL CONTAINMENT AND OVERFILL PREVENTION: NOT REPORTED

PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: NOT REPORTED EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: NOT REPORTED

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: NO CORROSION PROTECTION VARIANCE: NO VARIANCE

### ABOVEGROUND STORAGE TANK INFORMATION



NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY



**MAP ID# 116** 

Distance from Property: 0.461 mi. (2,434 ft.) WNW

Elevation: 664 ft. (Higher than TP)

### **FACILITY INFORMATION**

GEOSEARCH ID: 117722

LPST ID: **117722**FACILITY ID: **7124** 

NAME: FORMER 7 ELEVEN STORE 20079 ADDRESS: 6702 S CONGRESS AVE

**AUSTIN, TX 78745** 

### **LEAKING TANK DETAILS**

LPST ID: 117722

NAME: FORMER 7 ELEVEN STORE 20079
FACILITY LOCATION: NOT REPORTED

PRIORITY CODE: 4.0 - ASSESSMENT INCOMPLETE NO APPARENT RECEPTORS IMPACTED

CORRECTIVE ACTION STATUS CODE: 6A - FINAL CONCURRENCE ISSUED

CORRECTIVE ACTION START DATE: 6/5/08

REPORTED DATE: 11/16/2007 ENTERED DATE: 06/05/2008 CLOSURE DATE: 06/13/2008

**PRP INFORMATION** 

NAME: 7 ELEVEN INCSHAW ENV

ADDRESS: ADDRESS NOT REPORTED

**IRVING TX 75063** 

CONTACT: **NOT REPORTED** PHONE: **NOT REPORTED** 

### **UNDERGROUND STORAGE TANK**

TANK ID: 1 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: REMOVED FROM GROUND STATUS BEGIN DATE: 12/19/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

Order# 141197 Job# 336212 893 of 937

### **COMPARTMENT DETAILS**

UST COMPARTMENT ID: 25916

TANK ID: 1

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

**RECONCILIATION) & INVENTORY CONTROL** 

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B

**PIPING SYSTEMS** 

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 2 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: 12/19/2007

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

**TANK DETAILS** 

MATERIAL:

STEEL

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

**EXTERNAL CONTAINMENT:** 

**NOT REPORTED** 

TANK COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS
UST COMPARTMENT ID: 25917

TANK ID: 2

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY

### **RECONCILIATION) & INVENTORY CONTROL**

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

**NOT REPORTED** 

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

TANK ID: 3 NUMBER OF COMPARTMENTS: 1
INSTALLATION DATE: 04/01/1978 REGISTRATION DATE: 05/08/1986

TANK CAPACITY (GAL): 10000 EMPTY TANK: NOT EMPTY

STATUS: **REMOVED FROM GROUND** STATUS BEGIN DATE: **12/19/2007** 

INTERNAL PROTECTION DATE: NOT REPORTED REGULATORY STATUS: FULLY REGULATED

TANK DESIGN SINGLE WALL: YES TANK DESIGN DOUBLE WALL: NO PIPE DESIGN SINGLE WALL: YES PIPE DESIGN DOUBLE WALL: NO

TANK DETAILS
MATERIAL:

**STEEL** 

CORROSION PROTECTION:

**CATHODIC PROTECTION - FIELD INSTALLATION** 

EXTERNAL CONTAINMENT:

**NOT REPORTED** 

**TANK COMPLIANCE FLAG** 

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

COMPARTMENT DETAILS

UST COMPARTMENT ID: 25918

TANK ID: 3

COMPARTMENT LETTER: A SUBSTANCES: GASOLINE

OTHER SUBSTANCES: NOT REPORTED

CAPACITY (GAL): 10000

COMPARTMENT RELEASE DETECTION: AUTOMATIC TANK GAUGE TEST & INVENTORY CONTROL, SIR (STAT. INVENTORY RECONCILIATION) & INVENTORY CONTROL

SPILL CONTAINMENT AND OVERFILL PREVENTION: TIGHT-FILL FITTING CONTAINER/BUCKET/SUMP,FACTORY - BUILT SPILL CONTAINER/BUCKET/SUMP,DELIVERY SHUT-OFF VALVE,FLOW RESTRICTOR VALUE,ALARM (SET@<=90%) W3A OR 3B PIPING SYSTEMS

MATERIAL: FRP

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

EXTERNAL CONTAINMENT: NOT REPORTED

**CONNECTORS & VALVES:** 

Order# 141197 Job# 336212 895 of 937

# Leaking Petroleum Storage Tanks (LPST)

#### **NOT REPORTED**

CORROSION PROTECTION: FRP TANK OR PIPING (NONCORRODIBLE)

PIPE COMPLIANCE FLAG

CORROSION PROTECTION COMPLIANCE FLAG: YES CORROSION PROTECTION VARIANCE: NO VARIANCE

#### **ABOVEGROUND STORAGE TANK INFORMATION**

NO ABOVEGROUND STORAGE TANK DATA REPORTED FOR THIS FACILITY

**MAP ID# 117** 

Distance from Property: 0.469 mi. (2,476 ft.) NW

Elevation: 653 ft. (Higher than TP)

PROGRAM ID: **31593**RN NUMBER: **RN100686591** 

NAME: CAPITOL METAL FINISHING AUSTIN

ADDRESS: 3909 WAREHOUSE ROW

**AUSTIN, TX 78704** 

STATUS: **INACTIVE**STATUS DATE: **12/8/98** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

3909 WAREHOUSE ROW, AUSTIN, TX

# Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

**MAP ID# 117** 

Distance from Property: 0.469 mi. (2,476 ft.) NW

Elevation: 653 ft. (Higher than TP)

**FACILITY INFORMATION** 

EPA ID#: TXD048452064 OWNER TYPE: PRIVATE

NAME: CAPITOL METAL FINISHING INC OWNER NAME: CAPITOL METAL FINISHING INC

ADDRESS: 3909 WAREHOUSE ROW OPERATOR TYPE: PRIVATE

AUSTIN, TX 78704 OPERATOR NAME: CAPITOL METAL FINISHING INC

CONTACT NAME: FRANK WETHINGTON
CONTACT ADDRESS: 3909 WAREHOUSE ROW

**AUSTIN TX 78704** 

CONTACT PHONE: 512-444-6516

NON-NOTIFIER: NOT A NON-NOTIFIER

DATE RECEIVED BY AGENCY: 02/14/2001

**CERTIFICATION** - NO CERTIFICATION REPORTED -

**INDUSTRY CLASSIFICATION (NAICS)** 

332813 - ELECTROPLATING, PLATING, POLISHING, ANODIZING, AND COLORING

333298 - ALL OTHER INDUSTRIAL MACHINERY MANUFACTURING

- CURRENT ACTIVITY INFORMATION

GENERATOR STATUS: NON-GENERATOR LAST UPDATED DATE: 03/25/2004

SUBJECT TO CORRECTIVE ACTION UNIVERSE: NO

TDSFs POTENTIALLY SUBJECT TO CORRECTIVE ACTION UNDER 3004 (u)/(v) UNIVERSE: NO

TDSFs ONLY SUBJECT TO CORRECTIVE ACTION UNDER DISCRETIONARY AUTHORITIES UNIVERSE: NO

NON TSDFs WHERE RCRA CORRECTIVE ACTION HAS BEEN IMPOSED UNIVERSE: NO

CORRECTIVE ACTION WORKLOAD UNIVERSE: NO

IMPORTER: NO UNDERGROUND INJECTION: NO

MIXED WASTE GENERATOR: NO UNIVERSAL WASTE DESTINATION FACILITY: NO

RECYCLER: NO TRANSFER FACILITY: NO
TRANSPORTER: NO USED OIL FUEL BURNER: NO
ONSITE BURNER EXEMPTION: NO USED OIL PROCESSOR: NO

FURNACE EXEMPTION: NO USED OIL FUEL MARKETER TO BURNER: NO USED OIL REFINER: NO SPECIFICATION USED OIL MARKETER: NO

USED OIL TRANSFER FACILITY: NO USED OIL TRANSPORTER: NO

COMPLIANCE, MONITORING AND ENFORCEMENT INFORMATION

**EVALUATIONS** 

02/15/1996 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE 07/19/1994 CEI COMPLIANCE EVALUATION INSPECTION ON-SITE

04/05/1993 FCI FOCUSED COMPLIANCE INSPECTION 08/02/1991 FCI FOCUSED COMPLIANCE INSPECTION 11/28/1990 NRR NON-FINANCIAL RECORD REVIEW 04/26/1990 NRR NON-FINANCIAL RECORD REVIEW FCI FOCUSED COMPLIANCE INSPECTION 01/24/1990 FCI FOCUSED COMPLIANCE INSPECTION 12/27/1989 11/27/1989 NRR NON-FINANCIAL RECORD REVIEW 09/28/1989 FCI FOCUSED COMPLIANCE INSPECTION

GeoSearch www.geo-search.com 888-396-0042

## Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

09/01/1989	CSE COMPLIANCE SCHEDULE EVALUATION
06/01/1989	NRR NON-FINANCIAL RECORD REVIEW
05/16/1989	CSE COMPLIANCE SCHEDULE EVALUATION
04/12/1989	FCI FOCUSED COMPLIANCE INSPECTION
02/16/1989	CSE COMPLIANCE SCHEDULE EVALUATION
02/05/1988	CDI CASE DEVELOPMENT INSPECTION
10/26/1987	FCI FOCUSED COMPLIANCE INSPECTION
07/10/1987	NRR NON-FINANCIAL RECORD REVIEW
04/28/1987	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
09/09/1986	FCI FOCUSED COMPLIANCE INSPECTION
01/14/1986	CEI COMPLIANCE EVALUATION INSPECTION ON-SITE
<u>VIOLATIONS</u>	
09/01/1989	262.A GENERATORS - GENERAL
05/16/1989	262.A GENERATORS - GENERAL

05/16/1989 FEA FORMAL ENFORCEMENT AGREEMENT OR ORDER

02/16/1989 262.A GENERATORS - GENERAL 02/16/1989 **262.B GENERATORS - MANIFEST** 

02/16/1989 FEA FORMAL ENFORCEMENT AGREEMENT OR ORDER

04/28/1987 262.A GENERATORS - GENERAL

04/28/1987 XXS STATE STATUTE OR REGULATION

01/14/1986 262.A GENERATORS - GENERAL

**ENFORCEMENTS** 

05/16/1990 510 INITIAL CIVIL JUDICIAL ACTION FOR COMPLIANCE AND/OR MONETARY PENALTY

01/11/1990 410 REFERRAL TO ATTORNEY GENERAL

06/16/1989 110 VERBAL INFORMAL

03/09/1988 310 FINAL 3008(A) COMPLIANCE ORDER

01/20/1988 210 INITIAL 3008(A) COMPLIANCE

01/21/1986 120 WRITTEN INFORMAL

HAZARDOUS WASTE

D002 **CORROSIVE WASTE** 

D007 **CHROMIUM** 

F006 WASTEWATER TREATMENT SLUDGES FROM ELECTROPLATING OPERATIONS EXCEPT FROM THE FOLLOWING PROCESSES: (1) SULFURIC ACID ANODIZING OF ALUMINUM; (2) TIN PLATING ON CARBON STEEL; (3) ZINC PLATING (SEGREGATED BASIS) ON CARBON STEEL; (4) ALUMINUM OR ZINC-ALUMINUM PLATING ON CARBON STEEL; (5) CLEANING/STRIPPING ASSOCIATED WITH TIN, ZINC, AND ALUMINUM PLATING ON CARBON STEEL; AND (6) CHEMICAL ETCHING AND MILLING OF ALUMINUM.

F007 SPENT CYANIDE PLATING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS.

F008 PLATING BATH RESIDUES FROM THE BOTTOM OF PLATING BATHS FROM ELECTROPLATING OPERATIONS IN

WHICH CYANIDES ARE USED IN THE PROCESS.

F009 SPENT STRIPPING AND CLEANING BATH SOLUTIONS FROM ELECTROPLATING OPERATIONS IN WHICH

CYANIDES ARE USED IN THE PROCESS.

F019 WASTEWATER TREATMENT SLUDGES FROM THE CHEMICAL CONVERSION COATING OF ALUMINUM EXCEPT

FROM ZIRCONIUM PHOSPHATING IN ALUMINUM CAN WASHING WHEN SUCH PHOSPHATING IS AN EXCLUSIVE

**CONVERSION COATING PROCESS.** 

**COPPER CYANIDE** P029

**COPPER CYANIDE CU(CN)** P029



899 of 937 Order# 141197 Job# 336212

# Resource Conservation & Recovery Act - Corrective Action Facilities (RCRAC)

P030 CYANIDES (SOLUBLE CYANIDE SALTS), NOT OTHERWISE SPECIFIED

P098 POTASSIUM CYANIDE

P098 POTASSIUM CYANIDE K(CN)

P106 SODIUM CYANIDE

P106 SODIUM CYANIDE NA(CN)

P121 ZINC CYANIDE

P121 ZINC CYANIDE ZN(CN)2

<u>UNIVERSAL WASTE</u> - NO UNIVERSAL WASTE REPORTED -

**CORRECTIVE ACTION AREA (RELEASE)** 

AREA NAME: AIR: GROUNDWATER: SOIL: SURFACE WASTE:

ENTIRE FACILITY ---- ---- ----

CORRECTIVE ACTION EVENT
CA EVENT CODE: CA075LO

EVENT DESCRIPTION: CA PRIORITIZATION-LOW CA PRIORITY

EVENT SEQUENCE NUMBER: 2
EVENT RESPONSIBLE AGENCY: EPA
ACTUAL DATE OF EVENT: 09/11/1998

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED NEW SCHEDULE DATE OF EVENT: NOT REPORTED

-----

CA EVENT CODE: CA075LO

EVENT DESCRIPTION: CA PRIORITIZATION-LOW CA PRIORITY

EVENT SEQUENCE NUMBER: 1

EVENT RESPONSIBLE AGENCY: EPA

ACTUAL DATE OF EVENT: 09/26/1994

ORIGINAL SCHEDULE DATE OF EVENT: NOT REPORTED NEW SCHEDULE DATE OF EVENT: NOT REPORTED

# Superfund Enterprise Management System Archived Site Inventory (SEMSARCH)

MAP ID# 117

Distance from Property: 0.469 mi. (2,476 ft.) NW

Elevation: 653 ft. (Higher than TP)

#### **FACILITY INFORMATION**

EPA ID#: **TXD048452064**SITE ID#: **0604124** 

NAME: **CAPITOL METAL FINISHING, INC.** ADDRESS: **3909 A WAREHOUSE ROW** 

**AUSTIN, TX 78767** 

COUNTY: TRAVIS

FEDERAL FACILITY: NOT A FEDERAL FACILITY

NPL: NOT ON THE NPL

NON NPL STATUS: NFRAP-SITE DOES NOT QUALIFY FOR THE NPL BASED ON EXISTING INFORMATION

SUPERFUND SITE INFORMATION: CLICK HERE

Below information was gathered from the prior NFRAP update completed in 10/2013 update:

**ACTION** START DATE **COMPLETION DATE** RESPONSIBILITY PA - PRELIMINARY ASSESSMENT 10/1/1991 10/1/1991 **EPA FUND DS - DISCOVERY** NOT REPORTED 4/1/1990 **EPA FUND** SI - SITE INSPECTION **NOT REPORTED** 10/9/1997 **EPA FUND VS - ARCHIVE SITE NOT REPORTED** 8/17/2000 **EPA IN-HOUSE** 

#### **ACTION DESCRIPTIONS**

- PA (PRELIMINARY ASSESSMENT) COLLECTION OF DIVERSE EXISTING INFORMATION ABOUT THE SOURCE AND NATURE OF THE SITE HAZARD. IT IS EPA POLICY TO COMPLETE THE PRELIMINARY ASSESSMENT WITHIN ONE YEAR OF SITE DISCOVERY.
- DS (DISCOVERY) THE PROCESS BY WHICH A POTENTIAL HAZARDOUS WASTE SITE IS BROUGHT TO THE ATTENTION OF THE EPA. THE PROCESS CAN OCCUR THROUGH THE USE OF SEVERAL MECHANISMS SUCH AS A PHONE CALL OR REFERRAL BY ANOTHER GOVERNMENT AGENCY.
- SI (SITE INSPECTION) THE PROCESS OF COLLECTING SITE DATA AND SAMPLES TO CHARACTERIZE THE SEVERITY OF THE HAZARD FOR THE HAZARD RANKING SCORE AND/OR ENFORCEMENT SUPPORT.
- VS (ARCHIVE SITE) THE DECISION IS MADE THAT NO FURTHER ACTIVITY IS PLANNED AT THE SITE.

## Affected Property Assessment Reports (APAR)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

#### **FACILITY INFORMATION**

**CONTACTS**SIWARD, JANE

PROGRAM ID: 1505

REFERENCE NUMBER: RN102845377
FACILITY NAME: AFCU 2000 WOODWARD

ADDRESS: 2000 WOODWARD ST
AUSTIN, TX 78741

COUNTY: TRAVIS

REGULATED ENTITY NAME: AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY LOCATION DESCRIPTION: SEC OF INTERSECTION OF WOODWARD ST AND PARKER LN

TYPE OF FACILITY: PROPERTY VACANT

FACILITY STATUS: COMPLETED
PROGRAM: VOLUNTARY CLEANUP
PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

#### **CATEGORY OF CONTAMINATION**

DATE CONTAMINATIONS:

12/17/02 NOT REPORTED

12/17/02 HERBICIDES

12/17/02 PESTICIDES

08/05/02 NOT REPORTED

08/05/02 HERBICIDES

08/05/02 PESTICIDES

## Affected Property Assessment Reports (APAR)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: G0066

SWARD, JANE

REFERENCE NUMBER: RN102845377
FACILITY NAME: VACANT PROPERTY
ADDRESS: 2000 WOODWARD ST

**AUSTIN, TX 78741** 

COUNTY: TRAVIS

REGULATED ENTITY NAME: AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY LOCATION DESCRIPTION: SEC OF INTERSECTION OF WOODWARD ST AND PARKER LN

TYPE OF FACILITY: VACANT PROPERTY

FACILITY STATUS: COMPLETED

PROGRAM: BROWNFIELDS SITE ASSESSMT

PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

**CATEGORY OF CONTAMINATION** 

DATE CONTAMINATIONS:

09/10/03 LEAD

## Affected Property Assessment Reports (APAR)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

**FACILITY INFORMATION** 

**CONTACTS** 

PROGRAM ID: G66

NOT REPORTED

REFERENCE NUMBER: RN102845377
FACILITY NAME: VACANT PROPERTY
ADDRESS: 2000 WOODWARD ST

**AUSTIN, TX 78741** 

COUNTY: TRAVIS

REGULATED ENTITY NAME: AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY LOCATION DESCRIPTION: SEC OF INTERSECTION OF WOODWARD ST AND PARKER LN

TYPE OF FACILITY: PROPERTY VACANT

FACILITY STATUS: COMPLETED

PROGRAM: BROWNFIELDS SITE ASSESSMT

PROGRAM STATUS: INACTIVE

**REMEDIATIONS** 

NO REMEDIATION REPORTED

#### **CATEGORY OF CONTAMINATION**

DATE CONTAMINATIONS:

09/10/03 METALS 09/10/03 PESTICIDES

09/10/03 LEAD

### Brownfields Management System (BF)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

SITE INFORMATION

ID#: 10958

NAME: AFCU 2000 WOODWARD STREET LOT 2

ADDRESS: 2000 WOODWARD STREET

AUSTIN, TX 78741

TYPE FUNDING: HAZARDOUS

PREDOMINANT PAST USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED

FUTURE USE (ACREAGE):

GREENSPACE: RESIDENTIAL: COMMERCIAL: INDUSTRIAL: NOT REPORTED NOT REPORTED NOT REPORTED NOT REPORTED

PROPERTY HIGHLIGHT:

**NOT REPORTED** 

PROPERTY SIZE (Acres): 4.58

CURRENT OWNER: AUSTIN FEDERAL CREDIT UNION

PROPERTY DESCRIPTION/ FORMER USE:

VACANT

CONTAMINANT(S): PAHS, OTHER

CONTAMINANT(S) CLEANED UP: NOT REPORTED

MEDIA(S) AFFECTED: **NOT REPORTED**MEDIA(S) CLEANED UP: **NOT REPORTED** 

TYPE OF BROWNFIELD GRANT: TBA

ENVIRONMENTAL ASSESSMENT ACTIVITY: PHASE I ENVIRONMENTAL ASSESSMENT

ASSESSMENT START DATE: 12/11/2003 00:00:00
ASSESSMENT COMPLETION DATE: 12/11/2003 00:00:00

CLEANUP REQUIRED: NOT REPORTED

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NOT REPORTED

INSTITUTIONAL CONTROL IN PLACE: UNKNOWN

INSTITUTIONAL CONTROL IN PLACE DATE: **NOT REPORTED**PROPRIETARY CONTROL INDICATOR: **NOT REPORTED**GOVERNMENTAL CONTROL INDICATOR: **NOT REPORTED** 

OWNERSHIP ENTITY: NOT REPORTED

#GRANT RECIPIENT NAME: R6 BROWNFIELDS TBA (PREVIOUSLY SUPERFUND TBA)

GRANT ID: 10000006

CLEANUP START DATE: NOT REPORTED

CLEANUP COMPLETION DATE: NOT REPORTED

STATE & TRIBAL NO FURTHER ACTION DATE: NOT REPORTED

ASSESSMENT AMOUNT: 30865.00
ASSESSMENT FUNDING ENTITY:
CLEANUP ACRES: NOT REPORTED

Order# 141197 Job# 336212 905 of 937

### Brownfields Management System (BF)

CLEANUP AMOUNT: NOT REPORTED

CLEANUP FUNDING ENTITY: NOT REPORTED
REDEVELOPMENT START DATE: NOT REPORTED
REDEVELOPMENT ACRES: NOT REPORTED
REDEVELOPMENT AMOUNT: NOT REPORTED

REDEVELOPMENT FUNDING ENTITY: NOT REPORTED
REDEVELOPMENT COMPLETION DATE: NOT REPORTED

TYPE OF BROWNFIELD GRANT: TBA

ENVIRONMENTAL ASSESSMENT ACTIVITY: PHASE I ENVIRONMENTAL ASSESSMENT

ASSESSMENT START DATE: 12/11/2003 00:00:00
ASSESSMENT COMPLETION DATE: 12/11/2003 00:00:00

CLEANUP REQUIRED: NOT REPORTED

STATE & TRIBAL ENROLLMENT ID: NOT REPORTED
STATE & TRIBAL ENROLLMENT DATE: NOT REPORTED

PROPERTY ENROLLED IN A STATE & TRIBAL PROGRAM?: NOT REPORTED

ARE INSTITUTIONAL CONTROLS REQUIRED?: NOT REPORTED

INSTITUTIONAL CONTROL IN PLACE: UNKNOWN

INSTITUTIONAL CONTROL IN PLACE DATE: NOT REPORTED PROPRIETARY CONTROL INDICATOR: NOT REPORTED GOVERNMENTAL CONTROL INDICATOR: NOT REPORTED

OWNERSHIP ENTITY: NOT REPORTED

#GRANT RECIPIENT NAME: R6 BROWNFIELDS TBA (PREVIOUSLY SUPERFUND TBA)

GRANT ID: 1000006

CLEANUP START DATE: NOT REPORTED

CLEANUP COMPLETION DATE: NOT REPORTED

STATE & TRIBAL NO FURTHER ACTION DATE: NOT REPORTED

ASSESSMENT AMOUNT: 3429.00
ASSESSMENT FUNDING ENTITY:
CLEANUP ACRES: NOT REPORTED
CLEANUP AMOUNT: NOT REPORTED

CLEANUP FUNDING ENTITY: NOT REPORTED
REDEVELOPMENT START DATE: NOT REPORTED
REDEVELOPMENT ACRES: NOT REPORTED
REDEVELOPMENT AMOUNT: NOT REPORTED

REDEVELOPMENT FUNDING ENTITY: NOT REPORTED
REDEVELOPMENT COMPLETION DATE: NOT REPORTED

**Back to Report Summary** 

Order# 141197 Job# 336212 906 of 937

# Brownfields Site Assessments (BSA)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

#### **SITE INFORMATION**

ID#: G066

NAME: AUSTIN FEDERAL CREDIT UNION WOODWARD PROPERTY

ADDRESS: 2000 WOODWARD ST

**AUSTIN TX 78741** 

ACRES: 4.58

FACILITY TYPE: VACANT PROPERTY APPLICATION DATE: 01/21/2003

CERTIFICATE OF COMPLETION DATE: NOT REPORTED TYPE OF CERTIFICATE ISSUED: NOT REPORTED

PHASE: COMPLETED

CONTAMINANT/S: METALS, PESTICIDES

MEDIA AFFECTED: SOILS
REMEDY: NOT REPORTED
APPLICANT INFORMATION

ORGANIZATION: AUSTIN FEDERAL CREDIT UNION

JANE, SWARD, PRESIDENT

ADDRESS: 1615 WOODWARD STREET, ROOM 104

**AUSTIN, TX 78772-0001** 

PHONE: **512-444-6419** FAX: **512-444-6474** 

## Voluntary Cleanup Program Sites (VCP)

**MAP ID# 118** 

Distance from Property: 0.479 mi. (2,529 ft.) ENE

Elevation: 645 ft. (Higher than TP)

#### **FACILITY INFORMATION**

PROGRAM ID#: 1505

NAME: AFCU 2000 WOODWARD
ADDRESS: 2000 WOODWARD ST

**AUSTIN TX 78741** 

ADDRESS DESCRIPTION: SEC OF INTERSECTION OF WOODWARD ST AND PARKER LN

ASSOCIATED VCP ID(s): 1505

PCA NUMBER: 33705

PROJECT NUMBER: 337050

LEGAL ID: 10144787

REGULATED ENTITY REFERENCE NUMBER (RN): RN102845377

CURRENT FACILITY TYPE: **PROPERTY VACANT**FORMER FACILITY TYPE: **NOT REPORTED** 

PROJECT MANAGER: RGOLDSMI
PROJECT PHASE: COMPLETED

ADMINISTRATIVE STATUS: INACTIVE

CASHIER RECEIVED DATE: 08/02/2002

APPLICATION RECEIVED DATE: 08/02/2002

APPLICATION ACCEPTANCE DATE: 08/12/2002

VCP APPLICATION ACCEPTED: NOT REPORTED

AGREEMENT ACCEPTANCE DATE: NOT REPORTED

REGION NOTIFIED OF APPLICATION: 08/05/2002
TCEQ REGION NAME: REGION 11 - AUSTIN

SWR NUMBER: NOT REPORTED

AIR CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

GROUNDWATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SEDIMENT CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

SOILS CHEMICAL OF CONCERN CLASSIFICATION: **PESTICIDES**; **HERBICIDES** 

SURFACE WATER CHEMICAL OF CONCERN CLASSIFICATION: NOT REPORTED

ABOVE\_RES\_CRITICAL\_PCL: NOT REPORTED

 ${\tt ABOVE\_RES\_CRITICAL\_PCL\_OFFSITE:} \ \ \textbf{NOT REPORTED}$ 

LPST NO: **NOT REPORTED**IOP ID: **NOT REPORTED** 

EPA CERCLIS #: NOT REPORTED
EPA RCRIS #: NOT REPORTED

FILE MEDIA: PAPER
FILE LOCATION: D/211
SITE SIZE: 6.56

Order# 141197 Job# 336212 908 of 937

## Voluntary Cleanup Program Sites (VCP)

TYPE OF REMEDY: NOT REPORTED

AIR REMEDIATION METHOD: NOT REPORTED

GROUNDWATER REMEDIATION METHOD: NOT REPORTED

SOIL REMEDIATION METHOD: NOT REPORTED

SURFACE WATER REMEDIATION METHOD: NOT REPORTED

AIR INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

GROUNDWATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SEDIMENT INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SOIL INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

SURFACE WATER INSTITUTIONAL/ENGINEERING CONTROLS: NOT REPORTED

CERTIFICATE OF COMPLETION DATE: 09/14/2005; 03/26/2003

CONDITIONAL CERTIFICATE OF COMPLETION DATE: NOT REPORTED

APPLICABLE PROGRAM RULES: TRRP

APPLICABLE STANDARDS: A
APPLICABLE TRRP TIER: 1

#### **AFFILIATED CUSTOMER(S)**

CN NUMBER: **CN601465560**RN NUMBER: **RN102845377** 

CUSTOMER NAME: AUSTIN AREA FEDERAL CREDIT UNION

ROLE CD: BILLCONT

CONTACT NAME: SIWARD, JANE
CONTACT TITLE: NOT REPORTED

ORGANIZATION NAME: AUSTIN FEDERAL CREDIT UNION

MAILING ADDRESS: 1900 WOODWARD ST

MAILING CITY NAME: AUSTIN

MAILING STATE: **TX**MAILING ZIPCODE: **78741** 

CONTACT PHONE: (512) 444-6419

**Back to Report Summary** 

Order# 141197 Job# 336212 909 of 937

**MAP ID# 119** 

Distance from Property: 0.516 mi. (2,724 ft.) ESE

Elevation: 645 ft. (Higher than TP)

PROGRAM ID: 20722 RN NUMBER: RN100658285

NAME: CRYSTAL SEMICONDUCTOR ADDRESS: 4210 S INDUSTRIAL DR **AUSTIN, TX 78744** 

STATUS: ACTIVE STATUS DATE: 8/21/18

PHASE: ONGOING WORKLOAD LOCATION DESCRIPTION:

4210 S INDUSTRIAL DR, AUSTIN, TX

**MAP ID# 120** 

Distance from Property: 0.563 mi. (2,973 ft.) ESE

Elevation: 638 ft. (Higher than TP)

PROGRAM ID: 95386
RN NUMBER: RN106791023
NAME: ARTHROCARE

ADDRESS: 2301 E SAINT ELMO RD STE 110

**AUSTIN, TX 78744** 

STATUS: INACTIVE
STATUS DATE: 5/3/19

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 121** 

Distance from Property: 0.592 mi. (3,126 ft.) E

Elevation: 657 ft. (Higher than TP)

PROGRAM ID: 84908 RN NUMBER: RN100683838

NAME: AIR PRODUCTS AND CHEMICALS AUSTIN

ADDRESS: 2307 BUSINESS CENTER DR

**AUSTIN, TX 78744** 

STATUS: INACTIVE STATUS DATE: 2/10/05

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 122** 

Distance from Property: 0.687 mi. (3,627 ft.) ESE

Elevation: 652 ft. (Higher than TP)

PROGRAM ID: 84092
RN NUMBER: RN100843630
NAME: BOC EDWARDS KACHINA

ADDRESS: 4117 COMMERCIAL CENTER DR BLDG 5

**AUSTIN, TX 78744** 

STATUS: **INACTIVE**STATUS DATE: 4/5/12

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

4117 COMMERCIAL CTR DR, BLDG 5, AUSTIN, TX

MAP ID# 123

Distance from Property: 0.744 mi. (3,928 ft.) WNW

Elevation: 640 ft. (Higher than TP)

PROGRAM ID: **T2087**RN NUMBER: **RN104921812** 

NAME: PROPOSED CVS PHARMACY
ADDRESS: 5526 S CONGRESS AVE
AUSTIN, TX 78745

STATUS: **INACTIVE**STATUS DATE: **9/6/06** 

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**INCLUDES ADJACENT SITE: 120 STASSNEY, AUSTIN TX** 

**MAP ID# 124** 

Distance from Property: 0.795 mi. (4,198 ft.) ESE

Elevation: 653 ft. (Higher than TP)

PROGRAM ID: 76613 RN NUMBER: RN100561836 NAME: AUSTIN SCIENTIFIC ADDRESS: 4114 TODD LN

**AUSTIN, TX 78744** 

STATUS: INACTIVE STATUS DATE: 10/27/00

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 125** 

Distance from Property: 0.798 mi. (4,213 ft.) NNW

Elevation: 672 ft. (Higher than TP)

PROGRAM ID: **38485**RN NUMBER: **RN100615277** 

NAME: MAJESTIC PRODUCTS AUSTIN

ADDRESS: 118 E ALPINE RD
AUSTIN, TX 78704

STATUS: INACTIVE
STATUS DATE: 8/20/98

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

**MAP ID# 126** 

Distance from Property: 0.822 mi. (4,340 ft.) WNW

Elevation: 704 ft. (Higher than TP)

PROGRAM ID: T2228 RN NUMBER: RN105377170

NAME: UNDEVELOPED PROPERTY - 8401 S FIRST ST - AUSTIN TX

ADDRESS: 8401 S 1ST ST **AUSTIN, TX 78748** 

STATUS: INACTIVE STATUS DATE: 3/12/08

PHASE: COMPLETED WORKLOAD

LOCATION DESCRIPTION:

**NOT REPORTED** 

# **Unlocated Sites Summary**

This list contains sites that could not be mapped due to limited or incomplete address information.

Database Name	Site ID#	Site Name	Address	City/State/Zip/County
ERNSTX	15010	SITE SPECIFIC	M.P. 243 ON I-35 NORTHBOUND	AUSTIN

AIRSAFS Aerometric Information Retrieval System / Air Facility Subsystem

VERSION DATE: 10/20/14

The United States Environmental Protection Agency (EPA) modified the Aerometric Information Retrieval System (AIRS) to a database that exclusively tracks the compliance of stationary sources of air pollution with EPA regulations: the Air Facility Subsystem (AFS). Since this change in 2001, the management of the AIRS/AFS database was assigned to EPA's Office of Enforcement and Compliance Assurance.

BRS Biennial Reporting System

VERSION DATE: 12/31/15

The United States Environmental Protection Agency (EPA), in cooperation with the States, biennially collects information regarding the generation, management, and final disposition of hazardous wastes regulated under the Resource Conservation and Recovery Act of 1976 (RCRA), as amended. The Biennial Report captures detailed data on the generation of hazardous waste from large quantity generators and data on waste management practices from treatment, storage and disposal facilities. Currently, the EPA states that data collected between 1991 and 1997 was originally a part of the defunct Biennial Reporting System and is now incorporated into the RCRAInfo data system.

CDL Clandestine Drug Laboratory Locations

VERSION DATE: 05/06/19

The U.S. Department of Justice ("the Department") provides this information as a public service. It contains addresses of some locations where law enforcement agencies reported they found chemicals or other items that indicated the presence of either clandestine drug laboratories or dumpsites. In most cases, the source of the entries is not the Department, and the Department has not verified the entry and does not guarantee its accuracy. Members of the public must verify the accuracy of all entries by, for example, contacting local law enforcement and local health departments. The Department does not establish, implement, enforce, or certify compliance with clean-up or remediation standards for contaminated sites; the public should contact a state or local health department or environmental protection agency for that information.

**DOCKETS** EPA Docket Data

VERSION DATE: 12/22/05

The United States Environmental Protection Agency Docket data lists Civil Case Defendants, filing dates as far back as 1971, laws broken including section, violations that occurred, pollutants involved, penalties assessed and superfund awards by facility and location. Please refer to ICIS database as source of current data.

EC Federal Engineering Institutional Control Sites

VERSION DATE: 12/19/19

This database includes site locations where Engineering and/or Institutional Controls have been identified as part



Order# 141197 Job# 336212 919 of 937

of a selected remedy for the site as defined by United States Environmental Protection Agency official remedy decision documents. The data displays remedy component information for Superfund decision documents issued in fiscal years 1982-2017, and it includes final and deleted NPL sites as well as sites with a Superfund Alternative Approach (SAA) agreement in place. The only sites included that are not on the NPL, proposed for NPL, or removed from proposed NPL, are those with an SAA Agreement in place. A site listing does not indicate that the institutional and engineering controls are currently in place nor will be in place once the remedy is complete; it only indicates that the decision to include either of them in the remedy is documented as of the completed date of the document. Institutional controls are actions, such as legal controls, that help minimize the potential for human exposure to contamination by ensuring appropriate land or resource use. Engineering controls include caps, barriers, or other device engineering to prevent access, exposure, or continued migration of contamination.

ECHOR06 Enforcement and Compliance History Information

VERSION DATE: 10/27/19

The U.S. Environmental Protection Agency's Enforcement and Compliance History Online (ECHO) database, provides compliance and enforcement information for facilities nationwide. This database includes facilities regulated as Clean Air Act stationary sources, Clean Water Act direct dischargers, Resource Conservation and Recovery Act hazardous waste handlers, Safe Drinking Water Act public water systems along with other data, such as Toxics Release Inventory releases.

**ERNSTX** Emergency Response Notification System

VERSION DATE: 10/06/19

This National Response Center database contains data on reported releases of oil, chemical, radiological, biological, and/or etiological discharges into the environment anywhere in the United States and its territories. The data comes from spill reports made to the U.S. Environmental Protection Agency, U.S. Coast Guard, the National Response Center and/or the U.S. Department of Transportation.

FRSTX Facility Registry System

VERSION DATE: 10/09/19

The United States Environmental Protection Agency's Office of Environmental Information (OEI) developed the Facility Registry System (FRS) as the centrally managed database that identifies facilities, sites or places subject to environmental regulations or of environmental interest. The Facility Registry System replaced the Facility Index System or FINDS database.

HMIRSR06 Hazardous Materials Incident Reporting System

VERSION DATE: 11/20/19

The HMIRS database contains unintentional hazardous materials release information reported to the U.S. Department of Transportation located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.



ICIS Integrated Compliance Information System (formerly DOCKETS)

VERSION DATE: 09/21/19

ICIS is a case activity tracking and management system for civil, judicial, and administrative federal Environmental Protection Agency enforcement cases. ICIS contains information on federal administrative and federal judicial cases under the following environmental statutes: the Clean Air Act, the Clean Water Act, the Resource Conservation and Recovery Act, the Emergency Planning and Community Right-to-Know Act - Section 313, the Toxic Substances Control Act, the Federal Insecticide, Fungicide, and Rodenticide Act, the Comprehensive Environmental Response, Compensation, and Liability Act, the Safe Drinking Water Act, and the Marine Protection, Research, and Sanctuaries Act.

**ICISNPDES** 

Integrated Compliance Information System National Pollutant Discharge Elimination System

VERSION DATE: 07/09/17

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. This database is provided by the U.S. Environmental Protection Agency.

**LUCIS** Land Use Control Information System

VERSION DATE: 09/01/06

The LUCIS database is maintained by the U.S. Department of the Navy and contains information for former Base Realignment and Closure (BRAC) properties across the United States.

MLTS Material Licensing Tracking System

VERSION DATE: 06/29/17

MLTS is a list of approximately 8,100 sites which have or use radioactive materials subject to the United States Nuclear Regulatory Commission (NRC) licensing requirements. Disclaimer: Due to agency regulations and policies, this database contains applicant/licensee location information which may or may not be related to the physical location per MLTS site.

NPDESR06 National Pollutant Discharge Elimination System

VERSION DATE: 04/01/07

Authorized by the Clean Water Act, the National Pollutant Discharge Elimination System (NPDES) permit program controls water pollution by regulating point sources that discharge pollutants into waters of the United States. The NPDES database was collected from the U.S. Environmental Protection Agency (EPA) from December 2002 through April 2007. Refer to the PCS and/or ICIS-NPDES database as source of current data. This database includes permitted facilities located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

PADS PCB Activity Database System

VERSION DATE: 09/14/18

PADS Identifies generators, transporters, commercial storers and/or brokers and disposers of Polychlorinated Biphenyls (PCB) who are required to notify the U.S. Environmental Protection Agency of such activities.

PCSR06 Permit Compliance System

VERSION DATE: 08/01/12

The Permit Compliance System is used in tracking enforcement status and permit compliance of facilities controlled by the National Pollutant Discharge Elimination System (NPDES) under the Clean Water Act and is maintained by the United States Environmental Protection Agency's Office of Compliance. PCS is designed to support the NPDES program at the state, regional, and national levels. This database includes permitted facilities located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas. PCS has been modernized, and no longer exists. National Pollutant Discharge Elimination System (ICIS-NPDES) data can now be found in Integrated Compliance Information System (ICIS).

RCRASC RCRA Sites with Controls

**VERSION DATE: 11/22/19** 

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with institutional controls in place.

SEMSLIENS SEMS Lien on Property

VERSION DATE: 08/13/18

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs. This is a listing of SEMS sites with a lien on the property.

SFLIENS CERCLIS Liens

**VERSION DATE: 06/08/12** 

A Federal CERCLA ("Superfund") lien can exist by operation of law at any site or property at which United States



Order# 141197 Job# 336212 922 of 937

Environmental Protection Agency has spent Superfund monies. These monies are spent to investigate and address releases and threatened releases of contamination. CERCLIS provides information as to the identity of these sites and properties. This database contains those CERCLIS sites where the Lien on Property action is complete. Please refer to the SEMSLIENS database as source of current data.

SSTS Section Seven Tracking System

VERSION DATE: 02/01/17

The United States Environmental Protection Agency tracks information on pesticide establishments through the Section Seven Tracking System (SSTS). SSTS records the registration of new establishments and records pesticide production at each establishment. The Federal Insecticide, Fungicide and Rodenticide Act (FIFRA) requires that production of pesticides or devices be conducted in a registered pesticide-producing or device-producing establishment. ("Production" includes formulation, packaging, repackaging, and relabeling.)

TRI Toxics Release Inventory

VERSION DATE: 12/31/17

The Toxics Release Inventory, provided by the United States Environmental Protection Agency, includes data on toxic chemical releases and waste management activities from certain industries as well as federal and tribal facilities. This inventory contains information about the types and amounts of toxic chemicals that are released each year to the air, water, and land as well as information on the quantities of toxic chemicals sent to other facilities for further waste management.

TSCA Toxic Substance Control Act Inventory

VERSION DATE: 12/31/12

The Toxic Substances Control Act (TSCA) was enacted in 1976 to ensure that chemicals manufactured, imported, processed, or distributed in commerce, or used or disposed of in the United States do not pose any unreasonable risks to human health or the environment. TSCA section 8(b) provides the United States Environmental Protection Agency authority to "compile, keep current, and publish a list of each chemical substance that is manufactured or processed in the United States." This TSCA Chemical Substance Inventory contains non-confidential information on the production amount of toxic chemicals from each manufacturer and importer site.

RCRAGR06 Resource Conservation & Recovery Act - Generator

VERSION DATE: 12/30/19

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities currently generating hazardous waste. EPA region 6 includes the following states: Arkansas,

Louisiana, New Mexico, Oklahoma, and Texas.

RCRANGR06 Resource Conservation & Recovery Act - Non-Generator

VERSION DATE: 12/30/19

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities classified as non-generators. Non-Generators do not presently generate hazardous waste. EPA Region 6 includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ALTFUELS Alternative Fueling Stations

VERSION DATE: 09/24/19

Nationwide list of alternative fueling stations made available by the U.S. Department of Energy's Office of Energy Efficiency & Renewable Energy. Includes Bio-diesel stations, Ethanol (E85) stations, Liquefied Petroleum Gas (Propane) stations, Ethanol (E85) stations, Natural Gas stations, Hydrogen stations, and Electric Vehicle Supply Equipment (EVSE).

FEMAUST FEMA Owned Storage Tanks

VERSION DATE: 12/01/16

This is a listing of FEMA owned underground and aboveground storage tank sites. For security reasons, address information is not released to the public according to the U.S. Department of Homeland Security.

**HISTPST** Historical Gas Stations

VERSION DATE: NR

This historic directory of service stations is provided by the Cities Service Company. The directory includes Cities Service filling stations that were located throughout the United States in 1930.

ICISCLEANERS Integrated Compliance Information System Drycleaners

**VERSION DATE: 09/21/19** 

This is a listing of drycleaner facilities from the Integrated Compliance Information System (ICIS). The U.S. Environmental Protection Agency (EPA) tracks facilities that possess NAIC and SIC codes that classify businesses as drycleaner establishments. The following Primary SIC Codes are included in this data: 7211, 7212, 7213, 7215, 7216, 7217, 7218, and/or 7219; the following Primary NAICS Codes are included in this data: 812320, 812331, and/or 812332.

MRDS Mineral Resource Data System

VERSION DATE: 03/15/16

MRDS (Mineral Resource Data System) is a collection of reports describing metallic and nonmetallic mineral resources throughout the world. Included are deposit name, location, commodity, deposit description, geologic characteristics, production, reserves, resources, and references. This database contains the records previously provided in the Mineral Resource Data System (MRDS) of USGS and the Mineral Availability System/Mineral Industry Locator System (MAS/MILS) originated in the U.S. Bureau of Mines, which is now part of USGS.

MSHA Mine Safety and Health Administration Master Index File

VERSION DATE: 09/20/19

The Mine dataset lists all Coal and Metal/Non-Metal mines under MSHA's jurisdiction since 1/1/1970. It includes such information as the current status of each mine (Active, Abandoned, NonProducing, etc.), the current owner and operating company, commodity codes and physical attributes of the mine. Mine ID is the unique key for this data. This information is provided by the United States Department of Labor - Mine Safety and Health Administration (MSHA).

BF Brownfields Management System

VERSION DATE: 10/15/19

Brownfields are real property, the expansion, redevelopment, or reuse of which may be complicated by the presence or potential presence of a hazardous substance, pollutant, or contaminant. Cleaning up and reinvesting in these properties takes development pressures off of undeveloped, open land, and both improves and protects the environment. The United States Environmental Protection Agency maintains this database to track activities in the various brown field grant programs including grantee assessment, site cleanup and site redevelopment. This database included tribal brownfield sites.

**DNPL** Delisted National Priorities List

**VERSION DATE: 10/18/19** 

This database includes sites from the United States Environmental Protection Agency's Final National Priorities List (NPL) where remedies have proven to be satisfactory or sites where the original analyses were inaccurate, and the site is no longer appropriate for inclusion on the NPL, and final publication in the Federal Register has occurred.

NLRRCRAT No Longer Regulated RCRA Non-CORRACTS TSD Facilities

VERSION DATE: 12/30/19

This database includes RCRA Non-Corrective Action TSD facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements. This listing includes facilities that formerly treated, stored or disposed of hazardous waste.

ODI Open Dump Inventory

VERSION DATE: 06/01/85

The open dump inventory was published by the United States Environmental Protection Agency. An "open dump" is defined as a facility or site where solid waste is disposed of which is not a sanitary landfill which meets the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944) and which is not a facility for disposal of hazardous waste. This inventory has not been updated since June 1985.

RCRAT Resource Conservation & Recovery Act - Non-CORRACTS Treatment, Storage & Disposal Facilities

VERSION DATE: 12/30/19

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities recognized as hazardous waste treatment, storage, and disposal sites (TSD).

SEMS Superfund Enterprise Management System

VERSION DATE: 10/21/19

The U.S. Environmental Protection Agency's (EPA) Office of Solid Waste and Emergency Response, Office of Superfund Remediation and Technology Innovation (OSRTI), has implemented The Superfund Enterprise Management System (SEMS), formerly known as CERCLIS (Comprehensive Environmental Response, Compensation and Liability Information System) to track and report on clean-up and enforcement activities taking place at Superfund sites. SEMS represents a joint development and ongoing collaboration between Superfund's Remedial, Removal, Federal Facilities, Enforcement and Emergency Response programs.

SEMSARCH Superfund Enterprise Management System Archived Site Inventory

VERSION DATE: 10/22/19

The U.S. Environmental Protection Agency's (EPA) Superfund Enterprise Management System Archived Site Inventory (List 8R Archived) replaced the CERCLIS NFRAP reporting system in 2015. This listing reflects sites at which the EPA has determined that assessment has been completed and no further remedial action is planned under the Superfund program.

SMCRA Surface Mining Control and Reclamation Act Sites

VERSION DATE: 11/26/19

An inventory of land and water impacted by past mining (primarily coal mining) is maintained by the Office of Surface Mining Reclamation and Enforcement (OSMRE) to provide information needed to implement the Surface Mining Control and Reclamation Act of 1977 (SMCRA). The inventory contains information on the location, type,



and extent of AML impacts, as well as, information on the cost associated with the reclamation of those problems. The inventory is based upon field surveys by State, Tribal, and OSMRE program officials. It is dynamic to the extent that it is modified as new problems are identified and existing problems are reclaimed.

USUMTRCA Uranium Mill Tailings Radiation Control Act Sites

VERSION DATE: 03/04/17

The Legacy Management Office of the Department of Energy (DOE) manages radioactive and chemical waste, environmental contamination, and hazardous material at over 100 sites across the U.S. The L.M. Office manages this database of sites registered under the Uranium Mill Tailings Control Act (UMTRCA).

**DOD** Department of Defense Sites

VERSION DATE: 12/01/14

This information originates from the National Atlas of the United States Federal Lands data, which includes lands owned or administered by the Federal government. Army DOD, Army Corps of Engineers DOD, Air Force DOD, Navy DOD and Marine DOD areas of 640 acres or more are included.

FUDS Formerly Used Defense Sites

VERSION DATE: 06/01/15

The Formerly Used Defense Sites (FUDS) inventory includes properties previously owned by or leased to the United States and under Secretary of Defense Jurisdiction, as well as Munitions Response Areas (MRAs). The remediation of these properties is the responsibility of the Department of Defense. This data is provided by the U.S. Army Corps of Engineers (USACE), the boundaries/polygon data are based on preliminary findings and not all properties currently have polygon data available. DISCLAIMER: This data represents the results of data collection/processing for a specific USACE activity and is in no way to be considered comprehensive or to be used in any legal or official capacity as presented on this site. While the USACE has made a reasonable effort to insure the accuracy of the maps and associated data, it should be explicitly noted that USACE makes no warranty, representation or guaranty, either expressed or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. For additional information on Formerly Used Defense Sites please contact the USACE Public Affairs Office at (202) 528-4285.

**FUSRAP** Formerly Utilized Sites Remedial Action Program

VERSION DATE: 03/04/17

The U.S. Department of Energy (DOE) established the Formerly Utilized Sites Remedial Action Program (FUSRAP) in 1974 to remediate sites where radioactive contamination remained from the Manhattan Project and early U.S. Atomic Energy Commission (AEC) operations. The DOE Office of Legacy Management (LM) established long-term surveillance and maintenance (LTS&M) requirements for remediated FUSRAP sites. DOE evaluates the final site conditions of a remediated site on the basis of risk for different future uses. DOE then confirms that LTS&M requirements will maintain protectiveness.

NLRRCRAC No Longer Regulated RCRA Corrective Action Facilities

VERSION DATE: 12/30/19

This database includes RCRA Corrective Action facilities that are no longer regulated by the United States Environmental Protection Agency or do not meet other RCRA reporting requirements.

NMS Former Military Nike Missile Sites

VERSION DATE: 12/01/84

This information was taken from report DRXTH-AS-IA-83A016 (Historical Overview of the Nike Missile System, 12/1984) which was performed by Environmental Science and Engineering, Inc. for the U.S. Army Toxic and Hazardous Materials Agency Assessment Division. The Nike system was deployed between 1954 and the mid-1970's. Among the substances used or stored on Nike sites were liquid missile fuel (JP-4); starter fluids (UDKH, aniline, and furfuryl alcohol); oxidizer (IRFNA); hydrocarbons (motor oil, hydraulic fluid, diesel fuel, gasoline, heating oil); solvents (carbon tetrachloride, trichloroethylene, trichloroethane, stoddard solvent); and battery electrolyte. The quantities of material a disposed of and procedures for disposal are not documented in published reports. Virtually all information concerning the potential for contamination at Nike sites is confined to personnel who were assigned to Nike sites. During deactivation most hardware was shipped to depot-level supply points. There were reportedly instances where excess materials were disposed of on or near the site itself at closure. There was reportedly no routine site decontamination.

NPL National Priorities List

VERSION DATE: 10/18/19

This database includes United States Environmental Protection Agency (EPA) National Priorities List sites that fall under the EPA's Superfund program, established to fund the cleanup of the most serious uncontrolled or abandoned hazardous waste sites identified for possible long-term remedial action.

PNPL Proposed National Priorities List

VERSION DATE: 10/18/19

This database contains sites proposed to be included on the National Priorities List (NPL) in the Federal Register. The United States Environmental Protection Agency investigates these sites to determine if they may present long-term threats to public health or the environment.

RCRAC Resource Conservation & Recovery Act - Corrective Action Facilities

VERSION DATE: 12/30/19

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems



928 of 937

that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities with corrective action activity.

RCRASUBC Resource Conservation & Recovery Act - Subject to Corrective Action Facilities

VERSION DATE: 12/30/19

The Resource Conservation and Recovery Act (RCRA) gives the U.S. Environmental Protection Agency (EPA) the authority to control hazardous waste from the "cradle-to-grave." This includes the generation, transportation, treatment, storage, and disposal of hazardous waste. RCRA also set forth a framework for the management of non-hazardous solid wastes. The 1986 amendments to RCRA enabled EPA to address environmental problems that could result from underground tanks storing petroleum and other hazardous substances. This listing refers to facilities subject to corrective actions.

RODS Record of Decision System

VERSION DATE: 10/18/19

These decision documents maintained by the United States Environmental Protection Agency describe the chosen remedy for NPL (Superfund) site remediation. They also include site history, site description, site characteristics, community participation, enforcement activities, past and present activities, contaminated media, the contaminants present, and scope and role of response action.

### Environmental Records Definitions - STATE (TX)

**GWCC** Groundwater Contamination Cases

VERSION DATE: 12/31/18

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ). The annual report describes the status of groundwater monitoring activities conducted or required by each agency at regulated facilities or associated with regulated activities. The report provides a general overview of groundwater monitoring by participating members on a program by program basis. Groundwater contamination is broadly defined in the report as any detrimental alteration of the naturally occurring quality of groundwater.

HISTGWCC Historic Groundwater Contamination Cases

VERSION DATE: 12/31/17

This is a Joint Groundwater Monitoring and Contamination Report provided by the Texas Commission on Environmental Quality (TCEQ) that includes historic groundwater contamination cases reported since 1994. These cases have been closed by a program area or agency, such as the TCEQ, the Railroad Commission of Texas, and/or the Texas Alliance of Groundwater Districts. According to the TCEQ report, although enforcement actions may be closed on these cases, the Activity Status Code descriptions allow that groundwater contamination may still be present at the site and may therefore be of interest to regulatory agencies and the general public.

LANDAPP Land Application Permits

VERSION DATE: 06/03/19

Texas Land Application Permits are a requirement from the Texas Commission on Environmental Quality for any domestic facility that disposes of treated effluent by land application such as surface irrigation, evaporation, drainfields or subsurface land application.

LIENS TCEQ Liens

VERSION DATE: 06/06/18

Liens filed upon State and/or Federal Superfund Sites by the Texas Commission on Environmental Quality.

MSD Municipal Setting Designations

VERSION DATE: 01/16/19

The Texas Commission on Environmental Quality (TCEQ) defines an MSD as an official state designation given to property within a municipality or its extraterritorial jurisdiction that certifies that designated groundwater at the property is not used as potable water, and is prohibited from future use as potable water because that groundwater is contaminated in excess of the applicable potable-water protective concentration level. The prohibition must be in the form of a city ordinance, or a restrictive covenant that is enforceable by the city and filed in the property records. The MSD property can be a single property, multi-property, or a portion of property.

## Environmental Records Definitions - STATE (TX)

TCEQ Disclaimer: This data is for informational purposes and may not have been prepared for or be suitable for legal, engineering, or surveying purposes. It does not represent an on-the-ground survey and represents only the approximate relative location of property boundaries.

NOV Notice of Violations

VERSION DATE: 02/24/16

This database containing Notice of Violations (NOV) is maintained by the Texas Commission on Environmental Quality. An NOV is a written notification that documents and communicates violations observed during an inspection to the business or individual inspected.

SIEC01 State Institutional/Engineering Control Sites

**VERSION DATE: 08/20/19** 

The Texas Risk Reduction Program (TRRP) requires the placement of institutional controls (e.g., deed notices or restrictive covenants) on affected property in different circumstances as part of completing a response action. In its simplest form, an institutional control (IC) is a legal document that is recorded in the county deed records. In certain circumstances, local zoning or ordinances can serve as an IC. This listing may also include locations where Engineering Controls are in effect, such as a cap, barrier, or other engineering device to prevent access, exposure, or continued migration of contamination. The sites included on this list are regulated by various programs of the Texas Commission on Environmental Quality (TCEQ).

SPILLS Spills Listing

VERSION DATE: 09/19/19

This Texas Commission on Environmental Quality database includes releases of hazardous or potentially hazardous materials into the environment.

TIERII Tier I I Chemical Reporting Program Facilities

VERSION DATE: 12/31/12

The Texas Tier II Chemical Reporting Program in the Department of State Health Services (DSHS) is the state repository for EPCRA-required Emergency Planning Letters (EPLs), which are one-time notifications to the state from facilities that have certain extremely hazardous chemicals in specified amounts. The Program is also the state repository for EPCRA/state-required hazardous chemical inventory reports called Texas Tier Two Reports. This data contains those facility reports for the 2005 through the 2012 calendar years. Please contact the Texas Commission on Environmental Quality Tier II Chemical Reporting Division as the current source for this data, due to confidentiality and safety reasons details such as the location and capacity of on-site hazardous chemicals is only available to local emergency planning agencies, fire departments, and/or owners.

DCR Dry Cleaner Registration Database

VERSION DATE: 10/01/19

Order# 141197 Job# 336212 931 of 937

The database includes dry cleaning drop stations and facilities registered with the Texas Commission on Environmental Quality.

IHW Industrial and Hazardous Waste Sites

VERSION DATE: 05/02/19

Owner and facility information is included in this database of permitted and non-permitted industrial and hazardous waste sites. Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

PIHW Permitted Industrial Hazardous Waste Sites

VERSION DATE: 05/02/19

Owner and facility information is included in this database of all permitted industrial and hazardous waste sites. Industrial waste is waste that results from or is incidental to operations of industry, manufacturing, mining, or agriculture. Hazardous waste is defined as any solid waste listed as hazardous or possesses one or more hazardous characteristics as defined in federal waste regulations. Permitted IHW facilities are regulated under 30 Texas Administrative Code Chapter 335 in addition to federal regulations. The IHW database is maintained by the Texas Commission on Environmental Quality.

**PST** Petroleum Storage Tanks

VERSION DATE: 10/01/19

The Petroleum Storage Tank database is administered by the Texas Commission on Environmental Quality (TCEQ). Both Underground storage tanks (USTs) and Aboveground storage tanks (ASTs) are included in this report. Petroleum Storage Tank registration has been a requirement with the TCEQ since 1986.

APAR Affected Property Assessment Reports

VERSION DATE: 04/05/19

As regulated by the Texas Commission on Environmental Quality, an Affected Property Assessment Report is required when a person is addressing a release of chemical of concern (COC) under 30 TAC Chapter 350, the Texas Risk Reduction Program (TRRP). The purpose of the APAR is to document all relevant affected property information to identify all release sources and COCs, determine the extent of all COCs, identify all transport/exposure pathways, and to determine if any response actions are necessary. The Texas Administrative Code Title 30 §350.4(a)(1) defines affected property as the entire area (i.e. on-site and off-site; including all environmental media) which contains releases of chemicals of concern at concentrations equal to or greater than the assessment level applicable for residential land use and groundwater classification.

**BSA** Brownfields Site Assessments

VERSION DATE: 08/01/19

The Brownfields Site Assessments database is maintained by the Texas Commission on Environmental Quality (TCEQ). The TCEQ, in close partnership with the U.S. Environmental Protection Agency (EPA) and other federal, state, and local redevelopment agencies, and stakeholders, is facilitating cleanup, transferability, and revitalization of brownfields through the development of regulatory, tax, and technical assistance tools.

CALF Closed & Abandoned Landfill Inventory

VERSION DATE: 11/01/05

The Texas Commission on Environmental Quality, under a contract with Texas State University, and in cooperation with the 24 regional Council of Governments (COGs) in the State, has located over 4,000 closed and abandoned municipal solid waste landfills throughout Texas. This listing contains "unauthorized sites". Unauthorized sites have no permit and are considered abandoned. The information available for each site varies in detail and this historical information is not updated. Please refer to the specific regional COG for the most current information.

DCRPS Dry Cleaner Remediation Program Sites

VERSION DATE: 09/01/19

This list of DCRP sites is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the Dry Cleaner Remediation Program (DCRP) establishes a prioritization list of dry cleaner sites and administers the Dry Cleaning Remediation fund to assist with remediation of contamination caused by dry cleaning solvents.

IOP Innocent Owner / Operator Database

VERSION DATE: 08/20/19

Texas Innocent Owner / Operator (IOP), created by House Bill 2776 of the 75th Legislature, provides a certificate to an innocent owner or operator if their property is contaminated as a result of a release or migration of contaminants from a source or sources not located on the property, and they did not cause or contribute to the source or sources of contamination. The IOP database is maintained by the Texas Commission on Environmental Quality.

**LPST** Leaking Petroleum Storage Tanks

VERSION DATE: 12/13/19

The Leaking Petroleum Storage Tank listing is derived from the Petroleum Storage Tank (PST) database and is maintained by the Texas Commission on Environmental Quality. This listing includes aboveground and underground storage tank facilities with reported leaks.



Order# 141197 Job# 336212 933 of 937

MSWLF Municipal Solid Waste Landfill Sites

VERSION DATE: 09/06/19

The municipal solid waste landfill database is provided by the Texas Commission on Environmental Quality. This database includes active landfills and inactive landfills, where solid waste is treated or stored.

RRCVCP Railroad Commission VCP and Brownfield Sites

VERSION DATE: 04/18/19

According to the Railroad Commission of Texas, their Voluntary Cleanup Program (RRC-VCP) provides an incentive to remediate Oil & Gas related pollution by participants as long as they did not cause or contribute to the contamination. Applicants to the program receive a release of liability to the state in exchange for a successful cleanup.

**RWS** Radioactive Waste Sites

VERSION DATE: 07/11/06

This Texas Commission on Environmental Quality database contains all sites in the State of Texas that have been designated as Radioactive Waste sites.

STCV Salt Caverns for Petroleum Storage

VERSION DATE: 09/01/06

The salt caverns for petroleum storage database is provided by the Railroad Commission of Texas.

VCP Voluntary Cleanup Program Sites

VERSION DATE: 08/20/19

The Texas Voluntary Cleanup Program (VCP) provides administrative, technical, and legal incentives to encourage the cleanup of contaminated sites in Texas. Since all non-responsible parties, including future lenders and landowners, receive protection from liability to the state of Texas for cleanup of sites under the VCP, most of the constraints for completing real estate transactions at those sites are eliminated. As a result, many unused or underused properties may be restored to economically productive or community beneficial uses. The VCP database is maintained by the Texas Commission on Environmental Quality.

WMRF Recycling Facilities

VERSION DATE: 11/01/12

This listing of recycling facilities is provided by the Texas Commission on Environmental Quality's Recycle Texas Online service. The company information provided in this database is self-reported. Since recyclers post their own information, a facility or company appearing on the list does not imply that it is in compliance with TCEQ

regulations or other applicable laws. This database is no longer maintained and includes the last compilation of the program participants before the Recycle Texas Online program was closed.

IHWCA Industrial and Hazardous Waste Corrective Action Sites

VERSION DATE: 07/09/19

This database is provided by the Texas Commission on Environmental Quality (TCEQ). According to the TCEQ, the mission of the industrial and hazardous waste corrective action program is to oversee the cleanup of sites contaminated from industrial and municipal hazardous and industrial nonhazardous wastes. The goals of this program are to: Ensure that sites are assessed and remediated to levels that protect human health and the environment; Verify that waste management units or facilities are taken out of service and closed properly; and to Facilitate revitalization of contaminated properties.

SF State Superfund Sites

VERSION DATE: 01/16/19

The state Superfund program mission is to remediate abandoned or inactive sites within the state that pose an unacceptable risk to public health and safety or the environment, but which do not qualify for action under the federal Superfund program (NPL - National Priority Listing). As required by the Texas Solid Waste Disposal Act, Texas Health and Safety Code, Chapter 361, the Texas Commission on Environmental Quality identifies and evaluates these facilities for inclusion on the state Superfund registry. This listing includes any recent developments and the anticipated action for these sites as documented in the annual state Superfund registry publication of the Texas Register as well as the Superfund Webpage on the TCEQ website.

#### **Environmental Records Definitions - LOCAL**

**EAP** Edwards Aquifer Permits

VERSION DATE: 07/21/06

This database, maintained by the Texas Commission on Environmental Quality, contains Edward Aquifer permits.

AUSTINHISTUST City of Austin Historical Underground Storage Tanks

VERSION DATE: 09/09/19

This is an inventory of historical underground gas storage tanks. An Underground Storage Tank (UST) can pose a very serious threat to human health, the environment, and property if not properly operated and maintained. The UST Leak Prevention Program focuses on all facilities with underground storage tanks storing hazardous materials found within the UST Program jurisdiction. Please credit the City of Austin Planning and Development Review with use of this data.

AUSTINUST City of Austin Underground Storage Tanks

VERSION DATE: 09/09/19

This is an inventory of active underground gas storage tanks. An Underground Storage Tank (UST) can pose a very serious threat to human health, the environment, and property if not properly operated and maintained. The UST Leak Prevention Program focuses on all facilities with underground storage tanks storing hazardous materials found within the UST Program jurisdiction. Please credit the City of Austin Planning and Development Review with use of this data.

COAHOSPITALS City of Austin Hospitals

VERSION DATE: 07/07/08

The City of Austin (COA) GIS Division maintains this database of public and private hospitals located in the City of Austin. This data has been produced by the COA for the purpose of aiding regional planning and locating jurisdictional boundaries. No warranty is made by the COA regarding its accuracy or completeness.

#### **Environmental Records Definitions - TRIBAL**

USTR06 Underground Storage Tanks On Tribal Lands

VERSION DATE: 10/01/19

This database, provided by the United States Environmental Protection Agency (EPA), contains underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

LUSTR06 Leaking Underground Storage Tanks On Tribal Lands

VERSION DATE: 10/01/19

This database, provided by the United States Environmental Protection Agency (EPA), contains leaking underground storage tanks on Tribal lands located in EPA Region 6. This region includes the following states: Arkansas, Louisiana, New Mexico, Oklahoma, and Texas.

ODINDIAN Open Dump Inventory on Tribal Lands

VERSION DATE: 11/08/06

This Indian Health Service database contains information about facilities and sites on tribal lands where solid waste is disposed of, which are not sanitary landfills or hazardous waste disposal facilities, and which meet the criteria promulgated under section 4004 of the Solid Waste Disposal Act (42 U.S.C. 6944).

INDIANRES Indian Reservations

VERSION DATE: 01/01/00

The Department of Interior and Bureau of Indian Affairs maintains this database that includes American Indian Reservations, off-reservation trust lands, public domain allotments, Alaska Native Regional Corporations and Recognized State Reservations.

## Attachment D Representative Photographs



1. Facing south GeoSearch # 9, Century South Shopping Center, 801 East William Cannon Drive, Austin, TX 78745



2. Facing south GeoSearch # 10, Sams Club formerly Galvon Industries and Janssen Tract, 9808 South IH 35, Austin, TX 78748





3. Facing north GeoSearch # 32, Jack Brown Cleaners 28, 11001 South IH 35, Austin, TX 78747



4. Facing north GeoSearch # 45, Wisp Lash Lounge formerly Deluxe Cleaners, 11215 South IH 35, Suite 126, Austin, TX 78747

#### **Representative Site Photographs**





5. Facing east GeoSearch # 47, Hill Country Springs, Inc. formerly Martine Springs-Slaughter GW Plume, 10019 South IH 35, Austin, TX 78747



6. Facing south GeoSearch # 79, Ron's Cleaners formerly ESE-T Operating LP and SE-P Operating, 919 East Saint Elmo, Austin, TX 78745

#### **Representative Site Photographs**





7. Facing east GeoSearch # 83, abandoned building/lot, formerly John Roberts BMW/Lexus of Austin,
4110 Santiago Street in Austin, TX 78745



8. Facing west GeoSearch # 92, Strip Shopping Center, 9500 South H 35 Suite 650, Austin, TX 78748

#### **Representative Site Photographs**





9. Facing north GeoSearch # 101, COA, St. Elmo Service Center formerly McGuire, East of IH 35 and West of Freidrich Lane, South of East Saint Elmo (4500 Block of Friedrich), Austin, TX



10. Facing northwest GeoSearch # 107, Retreat at North Bluff formerly Onion Creek Club, 6210 Crow Lane, Austin, TX 78745





11. Facing west GeoSearch # 111; Chickfila, Starbucks, and Wells Fargo formerly Ben White Lots 1-5 and KMS Retail Payload Pass, and empty field; 500 East Ben White Boulevard, Austin, TX 78704



12. Facing east GeoSearch # 117, Kwik Ice formerly Capitol Metal Finishing, Inc., 3909 A Warehouse Row, Austin, TX 78767





13. Facing north GeoSearch # 118, AFCU, 2000 Woodward Street, Austin, TX 78741



14. Facing south with no GeoSearch reference, Fast Break 4 and 6, 14500 and 14444 South IH 35 in Buda, TX.



## Attachment E Hazardous Database Comparison

Low impacts to project not anticipated

investigation needed

Med	potential impacts, additional into or in
100-1	Immediate authorization

	1									
Map ID #	Site Name	Currently on Site	Address	Distance from Proposed ROW (Miles)	Within ROW	Adjacent to ROW	Listing	Site is LPST within 0.25 mile of ROW	Rationale	Site Photo #
1	KMART 7511	Burlington	6715 S IH 35 in Austin, TX 78744	0 mile	Х		PST		1000 gallon UST, used oil. Removed from ground.	-
	Lowes of SE Austin 689	same	5510 South IH 35 in Austin, TX 78745	0 mile	X		RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
2	Fiesta Mart 64	same	5510 South IH 35 in Austin. TX 78745	0 mile	х		PST		15000 gallon UST, gasoline. In service.	_
	i lesta ivial t 04	same	3310 30dti1 ii1 33 iii Adstiii, 1x 78743	Offilie	^		F31		10000 gallon UST, gasoline. In service.	
	Lowes of SE Austin 689	same	5510 South IH 35 in Austin, TX 78745	0 mile	Х		PST		1500 gallon AST, diesel. In service	-
3	George Coffey Lincoln-Mercury	AutoNation Toyota South Aus	4800 South IH 35 in Austin, TX 78747	0 mile	Х		PST		4000 gallon UST, gasoline. Removed from ground.	-
3	Red McCombs Toyota	AutoNation Toyota South Aus	4800 South IH 35 in Austin, TX 78747	0 mile	Х		PST		4000 gallon AST, gasoline. In use.	-
5	Sams Club 8259	KIPP Austin Public Schools-Soi	5107 South IH 35 in Austin, TX 78744	0 mile	Х		LPST	Х	No groundwater impact. Concurrence issued.	-
6	Maxwell Ford	same	5000 South IH 35 in Austin, TX 78745	0 mile	Х		PST		(3)20000 gallon UST. Removed from ground.	-
9	Century South Shopping Center	same	801 East William Cannon Drive in Austin, TX 78745	0 mile	Х		VCP		Site contaminated with TPH, metals, and chlorinated solvents. Agreed remediation completed in 1999.	1
10	Galvon Industries	Sams Club	9808 South IH 35 in Austin, TX 78748	0 mile	Х		IHWCA		Workload is complete.	2
10	Janssen Tract	Sams Club	9808 South IH 35 in Austin, TX 78748	0 mile	X		VCP		Site contaminated with metals. Agreed remediation complete.	2
	Janissen mace								Historical report of ammonium sulfide dumped in 1996. Contaminant is	
13	-	unknown	Oak Hill Community in Austin, TX	0 mile	Х		ERNSTX		not expected to still be present.	-
14		same	I-35 NB @ Slaughter Creek in Austin, TX 78705	0 mile	Х		ERNSTX		Historical propane release on road. Spill has disappated.	-
26	John Roberts BMW of Austin	construction	4108 South IH 35 in Austin, TX 78745	0.014 mile WNW	Х		PST		275 gallon UST, used oil. Removed from ground.	-
	Lexus of Austin	construction	4107 Santiago Street in Austin, TX 78745	0.008 mile WNW	Х		PST		560 gallon UST, used oil. Removed from ground.	-
	Wattinger Facility	between Walgreens and Valer	114 West Slaughter Lane in Austin, TX 78748	0.008 mile N		Х	PST		2000 gallon UST, gasoline. Removed from ground.	-
27	Fast Mart 8166	Valero	110 West Slaughter Lane in Austin, TX 78748	0.008 mile N		x	PST		15104 gal UST, gasoline. In service. 11873 gal UST, gasoline. In service. 5929 gallon UST, diesel. In service.	-
31	Range at Austin	same	8301 South IH 35 in Austin, TX 78744	0.003 mile ESE		х	RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
32	Jack Brown Cleaners 28	same	11001 South IH 35 in Austin, TX 78747	0.003 mile NNE		Х	DCR		Jack Brown's cleaners currently at this site.	3
33	Onion Creek Food Mart	same	2107 Boca Raton Drive in Austin, TX 78747	0.003 mile ESE		X	PST		(3) 10000 gallon UST, gasoline. In service.	-
34	-	Red Roof Inn	4701 South IH 35 in Austin, TX	0.004 mile ESE		Х	ERNSTX		Historical report of radiography camera stolen at this location. Item no long at the site.	-
	7 51 20060	Malana	120 West Slaughter Lane in Austin, TX 78748	0.005 mile W		V	LPST	V		+
36	7 Eleven 39068 7 Eleven 39068	Walgreens		0.005 mile W		X	PST	Х	No groundwater impact. Concurrence issued.	-
	7 Eleven 39068	Walgreens	120 West Slaughter Lane in Austin, TX 78748	0.005 mile w		X	PSI		20000 gallon UST, gasoline. Removed from ground.	+
37	Stassney Food Mart	same	5717 South IH 35 Building D in Austin, TX 78744	0.005 mile SE		х	PST		26000 gallon UST, (14000 gallons gasoline; 6000 gallons gasoline; 6000 gallons diesel). In service.	-
	Shoppers Mart 23	North Bluff Grocery Store	800 East William Cannon Drive in Austin, TX 788745	0.008 mile NW		Х	LPST	Х	No groundwater impact. Concurrence issued.	-
38	Town Food Mart	North Bluff Grocery Store	800 East William Cannon Drive in Austin, TX 788745	0.008 mile NW		x	PST		6000 gallon UST, diesel. In service. 10000 gallon UST, gasoline. In service. 6000 gallon UST, gasoline. In service. 10000 gallon UST, gasoline. In service.	-
	Texaco Service 11	Shell	1601 East Saint Elmo Road in Austin, TX 78744	0.007 mile ESE		Х	LPST	Х	No groundwater impact. Concurrence issued.	-
40	Circle K Store 2704677	same	1601 East Saint Elmo Road in Austin, TX 78744	0.007 mile ESE		х	PST		10000 gallon UST, gasoline. Removed from ground. 10000 gallon UST, gasoline. Removed from ground. 8000 gallon UST, diesel. Removed from ground. 12000 gallon UST, gasoline. In service. 10000 gallon UST, gasoline. In service. 10000 gallon UST, gasoline. In service. 10000 gallon UST, diesel. In service.	-
42	Onion Creek Texaco	same	11031 South IH 35 in Austin, TX 78747	0.009 mile ESE		х	PST		10000 gallon UST, diesel. In service. 12000 gallon UST, gasoline. In service. 10000 gallon UST, gasoline. In service. 10000 gallon UST, gasoline. In service.	-
44	7-Eleven Store 36587	same	6515 South IH 35 in Austin, TX 78744	0.011 mile NE		х	PST		10000 gallon UST, gasoline. Removed from ground. 12000 gallon UST, gasoline. Removed from ground. 10000 gallon UST, gasoline. Removed from ground. 12000 gallon UST, gasoline. In service. 12000 gallon UST, gasoline. In service. 12000 gallon UST, gasoline. In service.	-
45	Deluxe Cleaners	Wisp Lash Lounge	11215 South IH 35 Suite 126 in Austin, TX 78747	0.012 mile ESE		Х	DCR		Cleaners still at this site.	4
46	Texaco One Stop (2 sites)	Exxon	6500 South IH 35 in Austin, TX 78745	0.014 mile SSW		х	LPST	х	No groundwater impact. Concurrence issued. Soil contamination only required full site assessment RAP. Concurrence	-
46	Texaco One Stop	Exxon	6500 South IH 35 in Austin, TX 78745	0.014 mile SSW		х	PST		issued. UST, gasoline. Removed from ground. 550 gallon UST, used oil. Removed from ground.	-
47	Martine Springs-Slaughter GW Plume	Hill Country Springs, Inc.	10019 South IH 35 in Austin, TX 78747	0.014 mile ESE		Х	Archived NPL (CERCLIS/SEMS		Site does not quality for NPL based on existing information.	5
48	KOA Kampground	Austin Love Star RV Resort	7009 South IH 35 in Austin, TX 78744	0.016 mile ESE		х	PST		1000 gallon UST, gasoline. Removed from ground. 1000 gallon UST, gasoline. Removed from ground.	-
	Wal-Mart Supercenter 5217	same	9300 South IH 35 Suite B in Austin, TX 78748	0.017 mile W		х	RCRAGR06		Site is a Conditionally-Exempt Small Quantity Generator with no current violations.	-

Low impacts to project not anticipated

Med potential impacts, additional info or investigation needed

IVICU	potential impacts, add
High	impacts anticipated

nigii	impacts anticipated			1				1		
Map ID#	Site Name	Currently on Site	Address	Distance from Proposed ROW (Miles)	Within ROW	Adjacent to ROW	Listing	Site is LPST within 0.25 mile of ROW	Rationale	Site Photo #
	Wal-Mart Supercenter 5317	same	9300 South IH 35 in Austin, TX 78748	0.017 mile W		Х	PST		1000 gallon UST, OWS. In service.	-
49	Murphy USA 7211	same	9300 South IH 35, Service Building Road J in Austin, T			х	PST		20000 gallon UST, gasoline. In service, 20000 gallon UST, (12000 gallons gasoline; 8000 gallons diesel). In service.	-
50	Friendly Olds Mazda	Roger Beasley Mazda South	4506 South IH 35 in Austin, TX 78745	0.017 mile WNW		Х	LPST	X	Groundwater impacted. Concurrence issued.	
50	Roger Beasley Mazda South	same	4506 South IH 35 in Austin, TX 78745	0.017 mile WNW		х	PST		2000 gallon UST, gasoline. In service. 5000 gallon UST, used oil. Removed from ground. 500 gallon AST, unknown. Out of use.	-
53	South Austin Area Engineers & Speci	a empty field	3725 South IH 35 in Austin, TX 78744	0.018 mile ESE		х	PST		2000 gallon AST, gasoline. In service. 2000 gallon AST, diesel. In service.	-
	NTB #8686	same	4720 South IH 35 in Austin, TX 78745	0.018 mile WNW		X	RCRAGR06		Site is a Conditionally-Exempt Small Quantity Generator with no current	-
54	NTW	NTB	4720 South IH 35 in Austin, TX 78745	0.018 mile WNW		Х	LPST		No groundwater impact. Concurrence issued.	-
	NTW	NTB	4720 South IH 35 in Austin, TX 78745	0.018 mile WNW		Х	PST		500 gallon UST, used oil. Removed from ground. (13) 50 gallon UST, hydraulic lift oil. In service	-
55	South Point Nissan Preowned	South Austin Nissan Pre-Owne	e6001 South IH 35 in Austin, TX 78744	0.02 mile ESE		X	IHWCA		Workload is complete.	-
56	Onion Creek Liquor Store, NW	Planet K	10730 S IH 35 in Austin, TX	0.02 mile WNW		х	ERNSTX		Historical report of drum discovered near building. No remediation required.	-
56	Former Crumley's Grocery	Planet K	10730 South IH 35 in Austin, TX 78748	0.02 mile WNW		х	LPST	X	Groundwater impacted at public/domestic water well within 0.25 miles or leak. Site is pending final well plug, and consurrence has not been issued.	
56	D E Crumley Groc	Planet K	IH 35 in Austin, TX 78744	0.02 mile WNW		Х	PST		6000 gallon UST, gasoline. Removed from ground. (2) 2000 gallon UST, gasoline. Removed from ground.	-
57	Southpoint Pontiac	South Point Hyundai	4610 South IH 35 in Austin, TX 78745	0.02 mile WNW		Х	PST		4000 gallon UST, gasoline. Removed from ground. (2) 500 gallon UST, used oil. Removed from ground.	-
58	Dave Transportation Services	Sunbelt Rentals	8300 South IH 35 in Austin, TX 78745	0.024 mile WNW		Х	IHWCA		Workload is complete.	-
30	Dave Transportation Services	Sunbelt Rentals	8300 South IH 35 in Austin, TX 78745	0.024 mile WNW		Х	PST		12000 gallon AST, diesel. In service.	-
59	Circle K Store 2741570	same	11206 South IH 35 Frontage Road in Austin, TX 78748			х	PST		30172 gallon UST, gasoline. In service. 19805 gallon UST, (7901 gallons gasoline; 11904 gallons diesel). In service.	-
	Sams Club 8259	same	9900 South IH 35 Service Road SB in Austin, TX 78748	0.027 mile WNW		Х	RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
62	Sams Club 8259	same	9900 South IH 35 Service Road SB in Austin, TX 78748	0.027 mile WNW		х	PST		(2) 20000 gallon UST, gasoline. In service. 20000 gallon UST, (12000 gallons gasoline; 8000 gallons diesel). In service. 750 gallon UST, OWS. In service.	-
	Lipshy Motor Cars	Audi South Austin	4738 South IH 35 in Austin, TX 78745	0.028 mile WNW		Х	LPST		No groundwater impact. Concurrence issued.	-
63	Lipshy Motor Cars	Audi South Austin	4738 South IH 35 in Austin, TX 78745	0.028 mile WNW		х	PST		500 gallon UST, unknown. Removed from ground. 500 gallon UST, used oil. Removed from ground	-
64	South Fork Hyundai	Kia of South Austin	5306 South IH 35 in Austin, TX 78745	0.028 mile WNW		Х	IHWCA		Workload is complete.	-
	South Star Dodge		5210 South IH 35 in Austin, TX 78745	0.036 mile S		Х	IHWCA		Workload is complete.	-
65	South Star Dodge		5210 South IH 35 in Austin, TX 78745	0.036 mile S		х	PST		500 gallon UST, used oil. Removed from ground. 2000 gallon UST, gasoline. Removed from ground.	-
66	Holt Cat	same	9601 South IH 35 in Austin, TX 78744	0.038 mile ESE		Х	RCRAGR06		Site is a Very Small Quantity Generator with no current violations.	<del>1</del>
66	Holt Machinery Co. (2 sites)	same	9601 South IH 35 in Austin, TX 78744	0.038 mile ESE		х	LPST		Soil contamination only required full site assessment RAP. Concurrence issued.	-
66	Holt CAT Austin	same	9601 South IH 35 in Austin, TX 78744	0.038 mile ESE		Х	PST		(5) 1000 gallon UST, unknown. Removed from ground. 5000 gallon AST, diesel. In service.	-
	Maxwell Chrysler Plymouth Dodge	Capitol Chevrolet Service Depart	a 6905 South IH 35 in Austin, TX 78744	0.039 mile ESE		Х	IHWCA		Workload is complete.	-
67	Prestige South Chrystler Plymouth		6905 South IH 35 in Austin, TX 78744	0.039 mile ESE		X	PST		500 gallon UST, used oil. Perm fill in place.	-
	Home Depot USA HD6563	same	8801 South IH 35 in Austin, TX 78744	0.039 mile ESE		Х	RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
68	Circle K Store 2704673	same	8801 South IH 35 Suite B In Austin, TX 78744	0.039 mile ESE		х	PST		20000 gallon UST, gasoline. In service. 12000 gallon UST,(7000 gallons gasoline; 5000 gallons diesel). In service.	-
69	Cen-Tex Nissan	South Austin Nissan	4914 South IH 35 in Austin, TX 78745	0.039 mile NNW		Х	IHWCA		Workload is complete.	
71	PCW Construction	Spillar Custom Homes	10704 South IH 35 in Austin, TX 78748	0.045 mile WNW		Х	PST		2000 gallon AST, diesel. In service.	-
72	Aaron's Auto Parts	empty lot	8409 South Congress Avenue in Austin, TX 78745	0.056 mile NW			IHWCA		Workload is complete.	-
74	Adams Extract	residential	2217 Onion Creek Parkway in Austin, TX 78747	0.072 mile E			PST		(2) 1000 UST, gasoline. Removed from ground.	-
76	Target Store 0683	Wayside Schools	6405 South IH 35 in Austin, TX 78744	0.074 mile ESE			RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
77	Night Hawk Frozen Foods	Roger Beasley Mazda South	1120 Shelby Lane in Austin, TX 78745	0.08 mile NW			PST		1000 gallon UST, diesel. Removed from ground. 1000 gallon UST, gasoline. Removed from ground.	-
78	Pompa Trucking Austin	WalMart parking	9203 Cullen Lane in Austin, TX 78748	0.081 mile SW			IHWCA		Workload is complete.	
79	ESE-T Operating LP	Ron's Cleaners	919 East St. Elmo in Austin, TX 78745	0.086 mile WNW			RCRAGR06		Site is a Small Quantity Generator with no current violations.	-
79	SE-P Operating	Ron's Cleaners	919 East Saint Elmo Road in Austin, TX 78745	0.086 mile WNW			DCR		Currently Ron's Cleaners.	6

Low impacts to project not anticipated

Med potential impacts, additional info or investigation needed

High	impacts anticipated									
Map ID #	Site Name	Currently on Site	Address	Distance from Proposed ROW (Miles)	Within ROW	Adjacent to ROW	Listing	Site is LPST within 0.25 mile of ROW		Site Photo#
80	Cannon Food Mart	same	1719 East William Cannon Drive in Austin, TX 78744	0.093 mile ESE			PST		8000 gallon UST, gasoline. In service. 4000 gallon UST, gasoline. In service.	-
81	Cricle K Store 2742194	same	1706 East William Cannon Drive in Austin, TX 78744	0.093 mile E			PST		(2) 9728 gallon UST, gasoline. In service. 9728 gallon UST, diesel. In service.	-
	City of Austin	same	4411 Meinardus Drive Building B in Austin, TX 78744	0.105 mile ESE			RCRA non-CORACTS TSD		Site is currently inactive.	-
82	Service Center 8	same	4411 Meinardus Drive Suite D in Austin, TX 78744	0.105 mile ESE			PST		6000 gallon UST, gasoline. In service. 12000 gallon UST, gasoline. In service. 12000 gallon UST, diesel. In service.	-
	Howdy Honda	abandoned building/lot	4110 Santiago Street in Austin, TX 78745	0.111 mile W			LPST	х	Minor soil contamination required no remediation. Concurrence issued	-
83	Howdy Honda	abandoned building/lot	4110 Santiago Street in Austin, TX 78745	0.111 mile W			PST		3000 gallon UST, gasoline. Removed from ground. 500 gallon UST, used oil. Removed from ground. 2000 gallon AST, gaoline. In service.	-
83		abandoned building/lot	4110 Santiago Street in Austin, TX 78745	0.111 mile W			VCP	-	Agreed remediation complete.	7
	Hendrix GMC Trucks Inc.	CarMax	4400 South IH 35 in Austin, TX 78745	0.112 mile WNW			LPST	Х	No groundwater impact. Concurrence issued.	-
84	Carmax 7190	same	4400 South IH 35 in Austin, TX 78745	0.112 mile WNW			PST		1600 gallon UST, gasoline. Removed from ground. 250 gallon UST, used oil. Removed from ground. 4000 gallon AST, gasoline. In service.	-
	Commemorative Brands	same	7211 Circle S Road in Austin, TX 78745	0.117 mile WNW			RCRAGR06		Site is a Small Quantity Generator with no current violations.	+
85	CJC Holdings	Commemorative Brands	7211 Circle South Road In Austin, TX 78745	0.117 mile WNW			LPST	х	Minor soil contamination required no remediation. Concurrence issued.	-
	CJC Holdings	Commemorative Brands	7211 Circle South Road In Austin, TX 78745	0.117 mile WNW			PST		UST, unknown. Removed from ground.  1000 gallon UST, gasoline. Removed from ground.	+
86	L&T Waggoner Trucking	Pacific Custom Paint and Body	1825 Oak Hill Lane in Austin, TX 78744	0.134 mile E			PST		3000 gallon UST, diesel. Removed from ground.	-
87	Shoppers Mart 16 (2 sites)	under highway	4036 South IH 35 in Austin, TX 78704	0.139 mile NNE			LPST	х	Minor soil contamination required no remediation. Concurrence issued.  Groundwater (other than 1b) site characterization incomplete.	-
	Shoppers Mart 16	under highway	4036 South IH 35 in Austin, TX 78704	0.139 mile NNE			PST		(3) 10000 gallon UST, gasoline. Removed from ground. 10000 gallon UST, diesel. Removed from ground.	-
87	Texas Alternator Starter Service (2 site	under highway	1230 East Ben White Boulevard in Austin, TX 78742	0.139 mile NNE			PST		1000 gallon UST, unknown. Perm filled in place.	-
87	Old Fueling Facility	under highway	1240 East Ben White Boulevard in Austin, TX 78742	0.139 mile NNE			PST		6000 gallon UST, diesel. Perm filled in place. 1000 gallon UST, diesel. Removed from ground. 3000 gallon UST, gasoline. Removed from ground.	-
88	Penske Truck Leasing Austin Congress	same	8800 South Congress Avenue in Austin, TX 78745	0.139 mile WNW			PST		20000 gallon UST, diesel. In service. 12000 gallon UST, gasoline. In service.	-
89	Shop N Carry Foods (3 sites)	same	8514 South Congress Avenue in Austin, TX 78748	0.145 mile WNW			LPST	х	Groundwater (other than 1b) site characterization incomplete.  Concurrence issued.  Assessment incomplete, no receptors impacted, release determination.	-
89	Shop N Carry Foods	same	8514 South Congress Avenue in Austin, TX 78748	0.145 mile WNW			PST		(2) 8000 gallon UST, gasoline. Removed from ground.     (2) 8000 gallon UST, unknown. Removed from ground.     (2) 8000 gallon UST, gasoline. In service.	-
	Commercial Metals Austin	same	710 Industrial Boulevard in Austin, TX 78745	0.164 mile W			IHWCA		Workload is complete.	-
	Commercial Metals Austin Inc	same	710 Industrial Boulevard in Austin, TX 78745	0.164 mile W			LPST	X	No groundwater impact. Concurrence issued. (2) 1000 gallon UST, gasoline. Removed from ground.	-
90	Commercial Metals Austin Inc	same	710 Industrial Boulevard in Austin, TX 78745	0.164 mile W			PST		(2) 1000 gallon UST, disel. Removed from ground. 2000 gallon UST, disel. Removed from ground. 2000 gallon UST, disel. Removed from ground. 2000 gallon UST, diesel. Removed from ground. 3000 gallon AST, diesel. In service.	-
92	name not reported	strip shopping center	9500 South IH 35 Suite 650 in Austin, TX 78748	0.167 mile WSW			DCR		No longer a cleaners at the aite.	8
93	Capitol Chevrolet Parts Building	same	700 North Bluff Drive in Austin, TX 78745	0.189 mile WNW			PST		Proposed fuel system install with 10000 gallon AST.	
96	7-Eleven Store 35792	same	1901 East William Cannon Drive in Austin, TX 78744	0.2 mile ESE			PST		15000 gallon UST, gasoline. In service. 15000 gallon UST, (1000 gallon gasoline; 5000 diesel). In service.	-
97	Centex Materials Centex Materials South	same same	Farewell in Austin, TX 78768 817 East Saint Elmo Road in Austin, TX 78745	0.202 mile WNW 0.202 mile WNW			PST PST		3000 gallon AST, gasoline. Out of use.	
	Southwestern Bell (2 sites)	WalMart parking	3909 Payload Pass in Austin, TX 78704	0.202 mile WNW 0.208 mile NNW			PST PST		15000 gallon AST, diesel. In service. (2) 6000 gallon UST, gasoline. Removed from ground.	-
	Wal-Mart Supercenter 1253	same	710 East Ben White Boulevard in Austin, TX 78704	0.208 mile NNW			PST		1000 gallon UST, OWS. In service.	-
98	Murphy USA 7209	same	710 East Ben White Boulevard in Austin, TX 78704	0.208 mile NNW			PST		20000 gallon UST, gasoline. In service. 20000 gallon UST, (12000 gallons diesel; 8000 gallons gasoline). In service.	-
101	McGuire	COA, St. Elmo Service Center	East of IH 35 and West of Freidrich Lane, South of East Saint Elmo (4500 Block of Friedrich) in TX	0.231 mile ESE			CALF		According to COA,"current conditions associated with this site may pose current or future material concern to human health or the environment additional actions may be warrented at this site."	9
106	Chisholm Corner Store 7	combo strip center	600 East Ben White Boulevard in Austin, TX 78704	0.307 mile NW			LPST		Minor soil contamination not requiring remediation. Concurrence issued.	-
107	Muldoon Interests	Retreat at North Bluff	6210 Crow Lane in Austin, TX 78745	0.31 mile WNW			VCP		Site contaminated with metals and TPH. Agreed remediation complete.	10
108	Onion Creek Club	same	2510 Onion Creek Parkway in Austin, TX 78747	0.343 mile ESE			LPST		Minor soil contamination not requiring remediation. Concurrence issued.	-


Low impacts to project not anticipated

Med potential impacts, additional info or investigation needed

Hink	impacts a	nticina	tod.

Map ID#	Site Name	Currently on Site	Address	Distance from Proposed ROW (Miles)	Within ROW	Adjacent to ROW	Listing	Site is LPST within 0.25 mile of ROW	Rationale	Site Photo#
109	Metro Marts 2 Former 7 Eleven	same	2008 Teri Road in Austin, TX 78744	0.369 mile ESE			LPST		Soil contamination only requiring full site assessment RAP. Concurrence issued.	-
110	Wenco Distributing	Baling Supply	600 Industrial Boulevard in Austin, TX 78745	0.378 mile WNW			LPST		Minor soil contamination not requiring remediation. Concurrence issued.	-
111	Former Truck City Dealership	empty field	502 East Ben White Boulevard in Austin, TX 78704	0.382 mile NW			LPST		No groundwater impacts. Concurrence issued.	-
111	Ben White Lots 1, 2, 3, 4, 5	Chickfila, Starbucks, Wells Far	500 East Ben White Boulevard in Austin, TX 78704	0.391 mile NW			VCP		Site contaminated with VOC sand metals in soils and groundwater. Agreed remediation complete.	11
111	•		500 East Ben White Boulevard in Austin, TX 78704	0.382 mile NW			IOP		Site contaminated with VOC sand metals in soils and groundwater. Agreed remediation complete.	11
112			2130 Woodward Street Suite 200 in Austin, TX 78744	0.396 mile ESE			IHWCA		Workload is complete.	-
	Modern Metal Finishing	abandoned lot	7432 Bluff Springs Drive in Austin, TX 78744	0.41 mile ESE			IHWCA		Workload is complete.	-
114	Cen-Tex Plating	same	509 East Saint Elmo Road in Austin, TX 78745	0.437 mile WNW			IHWCA	,	Workload is complete.	-
115	Austin Four Corners Old Stop N Go	same	111 West William Cannon Drive in Austin, TX 78745	0.442 mile WNW			LPST	I	Minor soil contamination not requiring remediation. Concurrence issued.	-
116	Former 7 Eleven Store 20079	Speedy Cash	6702 South Congress Avenue in Austin, TX 78745	0.461 mile WNW			LPST	,	Assessment incomplete, no receptors impacted, release determination.	-
		Kwik Ice	3909 A Warehosue Row in Austin, TX 78767	0.469 mile NW			Archived NPL (CERCLIS/SEMS)		Site archived in 2000. No further action.	12
117	· ·	Kwik Ice	3909 A Warehosue Row in Austin, TX 78704	0.469 mile NW			RCRA CORRACTS		According to TCEQ, this site is inactive.	-
	Capitol Metal Finishing Austin	Kwik Ice	3909 Warehouse Row in Austin, TX 78767	0.469 mile NW			IHWCA		Workload is complete.	-
118	AFCU	same	2000 Woodward Street Lot 2 in Austin, TX 78741	0.479 mile ENE			BF		Site contaminated with PHAS contaminants, metals, and pesticides in soils. Sataus is complete.	13
110	AFCU 2000 Woodward	same	2000 Woodward Street in Austin, TX 78741	0.479 mile ENE			VCP		Site contaminated with herbicides, pesticides, and lead. Agreed remediation is complete.	13
119	Crystal Semiconductor	Fox Robotics	4210 South Industrial Drive in Austin, TX 78744	0.516 mile ESE			IHWCA	1	Workload is complete.	-
120	Arthrocare	office space	2301 East Saint Elmo Road Suite 110 in Austin, TX 787	0.563 mile ESE			IHWCA	,	Workload is complete.	-
121	Air Products and Chemicals Austin	Austin Lighthouse	2307 Business Center Drive in Austin, TX 78744	0.678 mile ESE			IHWCA	,	Workload is complete.	-
			4117 Commercial Center Drive Building 5 in Austin, TX				IHWCA		Workload is complete.	-
			5526 South Congress Avenue in Austin, TX 78745	0.744 mile WNW			IHWCA		Workload is complete.	-
124			4114 Todd Lane in Austin, TX 78744	0.795 mile ESE			IHWCA		Workload is complete.	-
		Dura Medic	118 East Alpine Road in Austin, TX 78704	0.798 mile NNW			IHWCA		Workload is complete.	-
126	Undeveloped Property - 8401 S First S		8401 South 1st Street in Austin, TX 78748	0.822 mile WNW			IHWCA	1	Workload is complete.	-
		unknown	MP 243 on IH 35 NB in Austin, TX	unknown		unknown	ERNSTX			-
NA	name not reported	Fast Break 4	14500 South IH 35 in Buda, TX	unknown			PST		(4) 10000 gallon UST, gasoline. In service.	14
NA	name not reported	Fast Break 6	14444 South IH 35 in Buda, TX	unknown			PST		(3) 8000 gallon UST, gasoline. Removed from ground. 4000 gallon UST, diesel. Removed from ground. (2) 1000 gallon UST, diesel. In service. 20000 gallon UST, diesel. In service.	14

### Attachment F Additional Data Excerpts

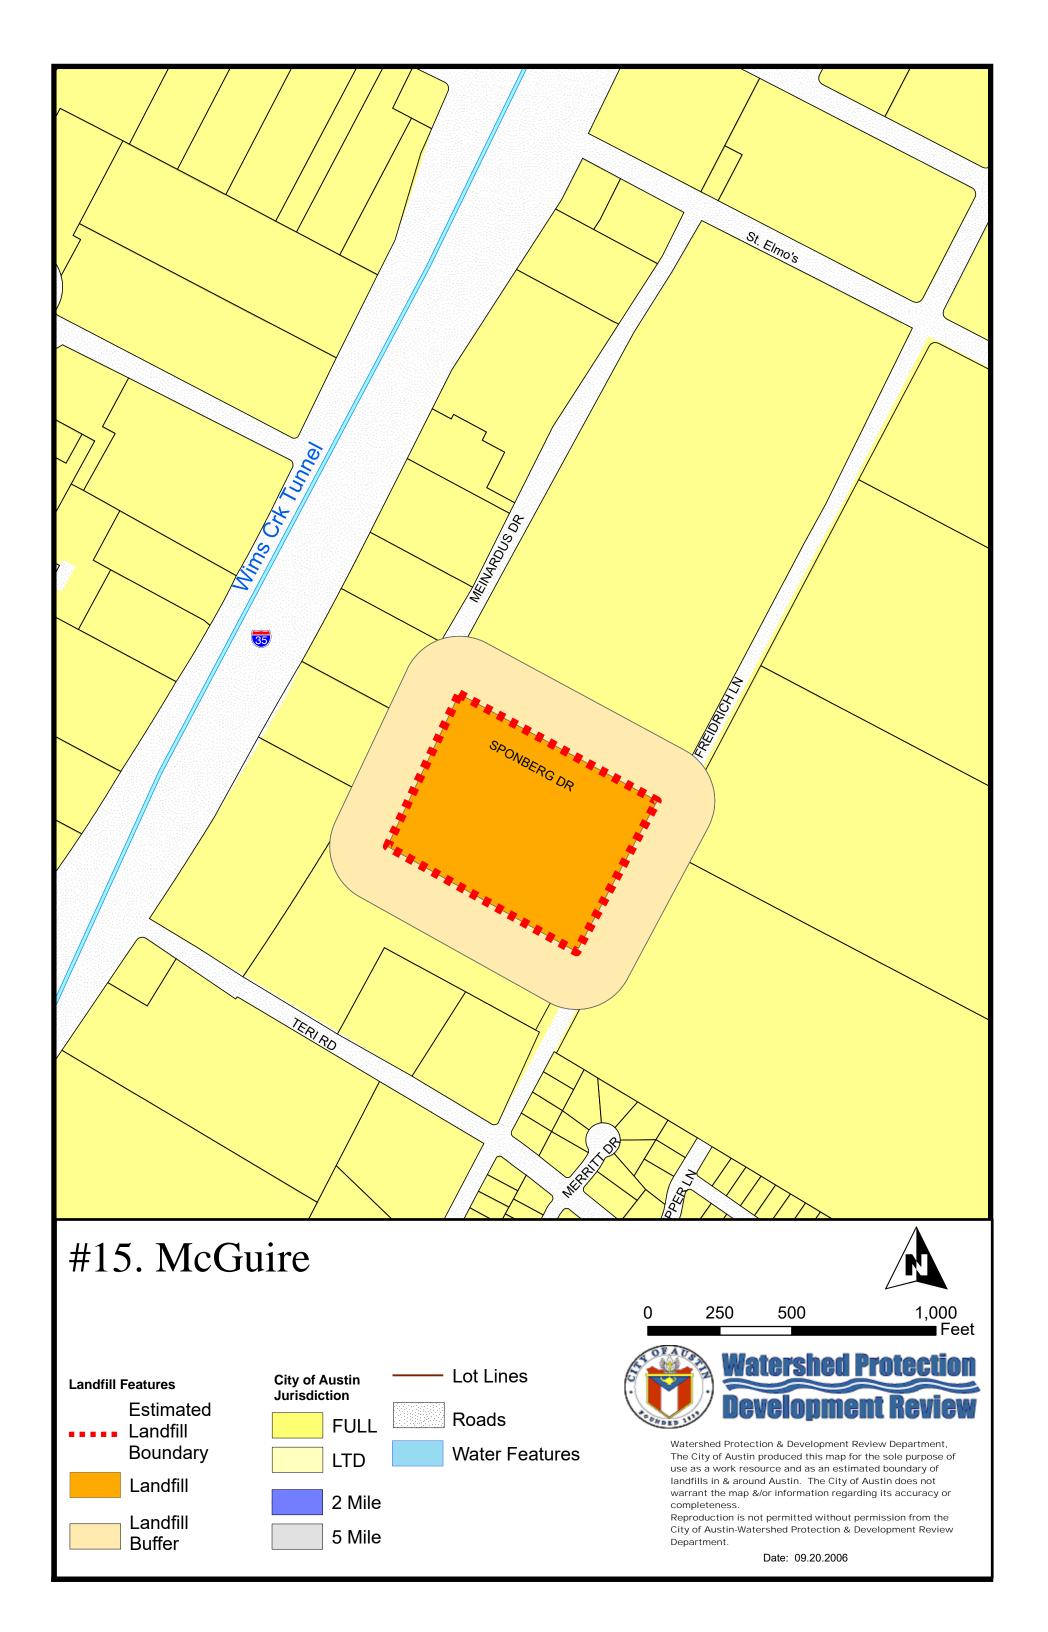

#### 3.14 #15 ,MCGUIRE

Location: The McGuire landfill is owned by the University of Texas, and is located in south

Austin, at 4500 Freidrich Lane.

Extent: The URM report estimated the size of the landfill to be approximately 13 acres.

Several investigations have been performed at this property and adjacent properties to delineate the extent of the landfill. The investigations indicated that the depth of trash extends from approximately 5 to 20 feet below ground surface and covers an area of approximately 7 acres. In 1988 clean fill was placed to level the site. Today, the site appears to be roughly graded, although there is

still some evidence of ridges.

Prior Use: The location map for this landfill in the 1984 URM report shows the area of the

landfill and surrounding properties as undeveloped. Today commercial developments are located adjacent to the north, east, and west, of the site. In addition, immediately south of the site is an apartment complex and a church. A water quality pond was constructed on COA property immediately north of the

site at Freidrich Lane and the easement for Sponberg.

Groundwater: Shallow groundwater is reported at depths of 3 to 17 feet below the ground

surface.

Remediation: Unavailable

Current Conditions: Current conditions associated with this site may pose a current or future material concern to human health or the environment, based on the following factors:

- proximity of structures adjacent to the landfill,
- presence of surface water bodies within the boundary of the landfill,
- unrestricted public access.

Additional actions may be warranted at this site.

Reference: Information in this fact sheet comes from the following:

- 1. Geomatrix Consultants. November 2004. 2004 Supplemental Assessment to Landfills in the Vicinity of Austin, TX. Prepared for City of Austin Public Works Department.
- 2. Underground Resource Management, Inc. November 1984. *Landfills in the Vicinity of Austin, TX.* Prepared for the City of Austin.

Query Home

**Customer Search** 

**RE Search** 

**ID Search** 

**Registration Detail** 

**TCEQ Home** 

#### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 24128

For: FAST BREAK 6 (RN102409646)

14444 S IH 35, BUDA

Registration Status: ACTIVE

Held by: STRIVE VENTURES LLC (CN604711218) View 'Issued To' History

**OWNER OPERATOR** Since 11/25/2014 View Compliance History

Mailing Address: 8870 BUSINESS PARK DR STE 100 AUSTIN, TX 78759 -7519

#### **Financial Assurance**

2,000,000 Insurance Or Risk Retention, expires 10/21/2019 MID-CONTINENT INS CO, Agent

#### **Self-Certification Status by Compartment**

**Current:** 1A 2A 3A (through last day of 08/2020) View Complete Self-Certification History

#### **Registered Tanks and Their Associated Systems**

#### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information
1	20000	02/01/1995	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
2	10000	02/01/1995	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
3	10000	02/01/1995	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery
Α	8000	01/01/1982	Removed from Ground (02/28/1995)	A:Gasoline	Tank Details Compartment

#### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related
1	1:Double Wall ( FRP)	FRP (Noncorrodible)	A: 2: Ext Groundwater Monitoring A: 4: Auto Tank Gauge & Inv Cntrl A: 5: Interstitial Monitoring	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Delivery Shutoff Valve 4: Alarm	Joe Wigginton (CRP000000)	W G GRANGER	Tank Tested	Tank Si Compa Piping Vapor F

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Relatec
2	1:Double Wall ( FRP )	FRP (Noncorrodible)	A: 2: Ext Groundwater	A: 1: Tight Fill Fitting	Joe Wigginton (CRP000000)	W G GRANGER	Tank Tested	Tank Sı Compa ▼

#### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Information
1	A	20000	Diesel		1 : Ext Groundwater Monitoring 2 : Auto Tank Gauge & Inv Cntrl 3 : Interstitial Monitoring	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve 4 : Alarm	Tank Summary Tank Details Piping Vapor Recovery
2	А	10000	Diesel		1 : Ext Groundwater Monitoring 2 : Auto Tank Gauge & Inv Cntrl 3 : Interstitial Monitoring	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Delivery Shutoff Valve 4 : Alarm	Tank Summary Tank Details Piping Vapor Recovery
3	А	10000	Diesel		1 : Ext Groundwater	1 : Tight Fill Fitting 2 : Fac Built Spill	Tank Summary Tank Details

#### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Double Wall 1: Fac Built Nonmetal Jacket	1: Shear Impact Valves 2: Flex Connectors	1: Ext Dielectric Coat/Wrap/Tape 2: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovei
2	Pressurized	FRP	Double Wall 1: Fac Built Nonmetal Jacket	1: Shear Impact Valves 2: Flex Connectors	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recovei
3	Pressurized	FRP	Double Wall 1: Fac Built Nonmetal	1: Shear Impact Valves 2: Flex Connectors	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak	Tank Summar Tank Details Compartment Vapor Recove

#### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	<b>Date Installed</b>	Type of Stage 2	Date Installed	Related Information
1	Two Point System				Tank Summary Tank Details Compartment Piping
2	Two Point System				Tank Summary Tank Details Compartment Piping
3	Two Point System				Tank Summary Tank Details Compartment Piping
Α	Not Reported				Tank Summary Tank Details Compartment Piping
В	Not Reported				Tank Summarv

Query Home Customer Search RE Search ID Search Registration Detail TCEQ Home

#### **Central Registry**

The Customer Name displayed may be different than the Customer Name associated to the Additional IDs related to the customer. This name may be different due to ownership changes, legal name changes, or other administrative changes.

Detail of: Petroleum Storage Tank Registration 49543

For: FAST BREAK 4 (RN102408804)

14500 S INTERSTATE 35, BUDA

Registration Status: ACTIVE

Held by: STRIVE VENTURES LLC (CN604711218) View 'Issued To' History

**OWNER OPERATOR** Since 10/01/2014 View Compliance History

Mailing Address: 8870 BUSINESS PARK DR STE 100 AUSTIN, TX 78759 -7519

#### **Financial Assurance**

1,000,000 Insurance Or Risk Retention, expires 10/21/2019 MID-CONTINENT INS CO, Agent

#### **Self-Certification Status by Compartment**

Current: 1A 2A 3A 4A (through last day of 08/2020)

View Complete Self-Certification History

#### **Registered Tanks and Their Associated Systems**

#### **Table 1. Underground Storage Tank Summary**

Tank	Capacity (Gallon)	Date Installed	Status	<b>Substance Stored</b>	Related Information	
1	10000	01/01/1989	In Use	A:Diesel	Tank Details Compartment Piping Vapor Recovery	
2	10000	01/01/1989	In Use	A:Gasoline	Tank Details Compartment Piping Vapor Recovery	
3	10000	01/01/1989	In Use	A:Gasoline	Tank Details Compartment	

#### **Table 2. Tank Details**

Tank	Design & Materials	Corrosion Protection	Release Detection	Spill Containment and Overfill Prevention	Installation Contractor	Installer	Test Result	Related Informa	tior
1	1:Double Wall ( FRP)	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve 4: Alarm				Tank Summary Compartment Piping Vapor Recovery	
2	1:Double Wall ( FRP)	FRP (Noncorrodible)	A: 4: Auto Tank Gauge & Inv Cntrl	A: 1: Tight Fill Fitting 2: Fac Built Spill Cont/Bckt/Sump 3: Flow Restrictor Valve 4: Alarm				Tank Summary Compartment Piping Vapor Recovery	

#### **Table 3. Compartment Details**

Tank	Compartment	Capacity (gallons)	Principal Substance	Other Substance	Release Detection	Spill Containment and Overfill Prevention	Related Informatio
1	A	10000	Diesel		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve 4 : Alarm	Tank Summary Tank Details Piping Vapor Recovery
2	A	10000	Gasoline		1 : Auto Tank Gauge & Inv Cntrl	1 : Tight Fill Fitting 2 : Fac Built Spill Cont/Bckt/Sump 3 : Flow Restrictor Valve	Tank Summary Tank Details Piping Vapor Recovery

#### **Table 4. Piping Systems**

Tank	Type of Piping	Piping Material	Design and External Containment	Connectors and valves	Corrosion Protection	Release Detection	Related Infor
1	Pressurized	FRP	Double Wall 1: Fac Built Nonmetal Jacket	1: Shear Impact Valves 2: Flex Connectors	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recover
2	Pressurized	FRP	Double Wall 1: Fac Built Nonmetal Jacket	1: Shear Impact Valves 2: Flex Connectors	1: FRP (Noncorrodible)	A:Ann Pipe Tightness/Electr Mon A:Auto Line Leak Detector	Tank Summar Tank Details Compartment Vapor Recover

#### **Table 5. Vapor Recovery Systems**

Tank	Type of Stage 1	Date Installed	Type of Stage 2	Date Installed	Related Information
1	Two Point System	01/01/1989			Tank Summary Tank Details Compartment Piping
2	Two Point System	01/01/1989			Tank Summary Tank Details Compartment Piping
3	Two Point System	01/01/1989			Tank Summary Tank Details Compartment Piping
4	Two Point System	01/01/1989			Tank Summary

Site Help | Disclaimer | Web Policies | Accessibility | Our Compact with Texans | TCEQ Homeland Security | Contact Us | Central Registry | Search Hints | Report Data Errors
Statewide Links: Texas.gov | Texas Homeland Security | TRAIL Statewide Archive | Texas Veterans Portal

© 2002 - 2020 Texas Commission on Environmental Quality





## Hazardous Materials Initial Site Assessment (ISA) Update Memo I-35 Capital Express South from US 290W/SH 71 to SH 45SE Travis County, Texas

CSJ: 0016-01-113; 0015-13-007

June 2021

The environmental review, consultation, and other actions required by applicable Federal environmental laws for this project are being, or have been, carried-out by TxDOT pursuant to 23 U.S.C. 327 and a Memorandum of Understanding dated December 9 2019, and executed by FHWA and TxDOT.

#### **Table of Contents**

List of Acron	nyms	ii
1.	Project Overview	1
2.	Introduction	1
3.	Land Use Changes	1
4.	Conclusion	1
Appendices:	: :	

- A Hazardous Materials Location Map
- B Site Visit Photographs

#### **List of Acronyms**

I-35 Interstate Highway 35
ISA Initial Site Assessment

SH State Highway

TxDOT Texas Department of Transportation

#### 1. Project Overview

The Texas Department of Transportation is proposing improvements to I-35 from US 290 West/State Highway (SH) 71 (SH 71) to SH 45 southeast (SE) in Travis County, with a transition area extending to Main Street in Buda, Hays County. A detailed project description and location map is available in ECOS under PROJECT.

#### 2. Introduction

This document serves as an update to the existing Hazardous Materials Initial Site Assessment (ISA) approved in November 2020. The previously approved ISA used aerial imagery from 2018. Updated aerial imagery is now available, and the updated Google Earth April 2020 and March 2021 aerial imagery was used to compare the changes in land use to the 2018 imagery. Additionally, a limited records review and site visit was conducted on June 7, 2021, to document current conditions.


#### 3. Land Use Changes

A limited records review of building permits within the project corridor showed that a new fuel station was recently permitted in conjunction with the HEB located at 8700 South IH 35. Also, the existing Nissan dealership located at 6100 South IH 35 was newly permitted by Porsche to include a maintenance shop. An updated Hazardous Materials Location Map is located in **Appendix A**. Review of the updated aerial imagery and June 7, 2021, site visit confirmed that the land use within the study area remained unchanged, and that neither of the newly permitted sites have yet been constructed. Photographs from the site visit can be found in **Appendix B** 


#### 4. Conclusion

The study area conditions appear consistent with what was observed in the November 2020 ISA. No indications of new hazardous material issues were observed during the field visit. Aerial imagery comparisons between the 2020 ISA aerial and Google Earth April 2020 and March 2021 imagery did not identify any new issues or concerns.


# Appendix A Project Location Map Hazardous Materials Site Location Map

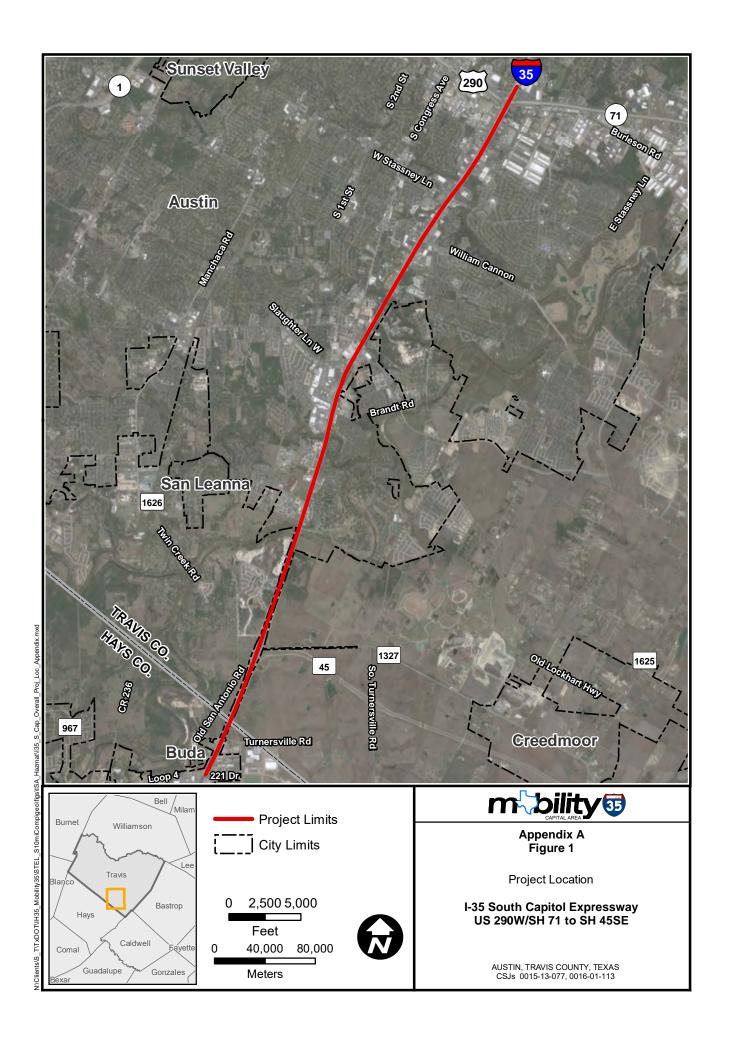




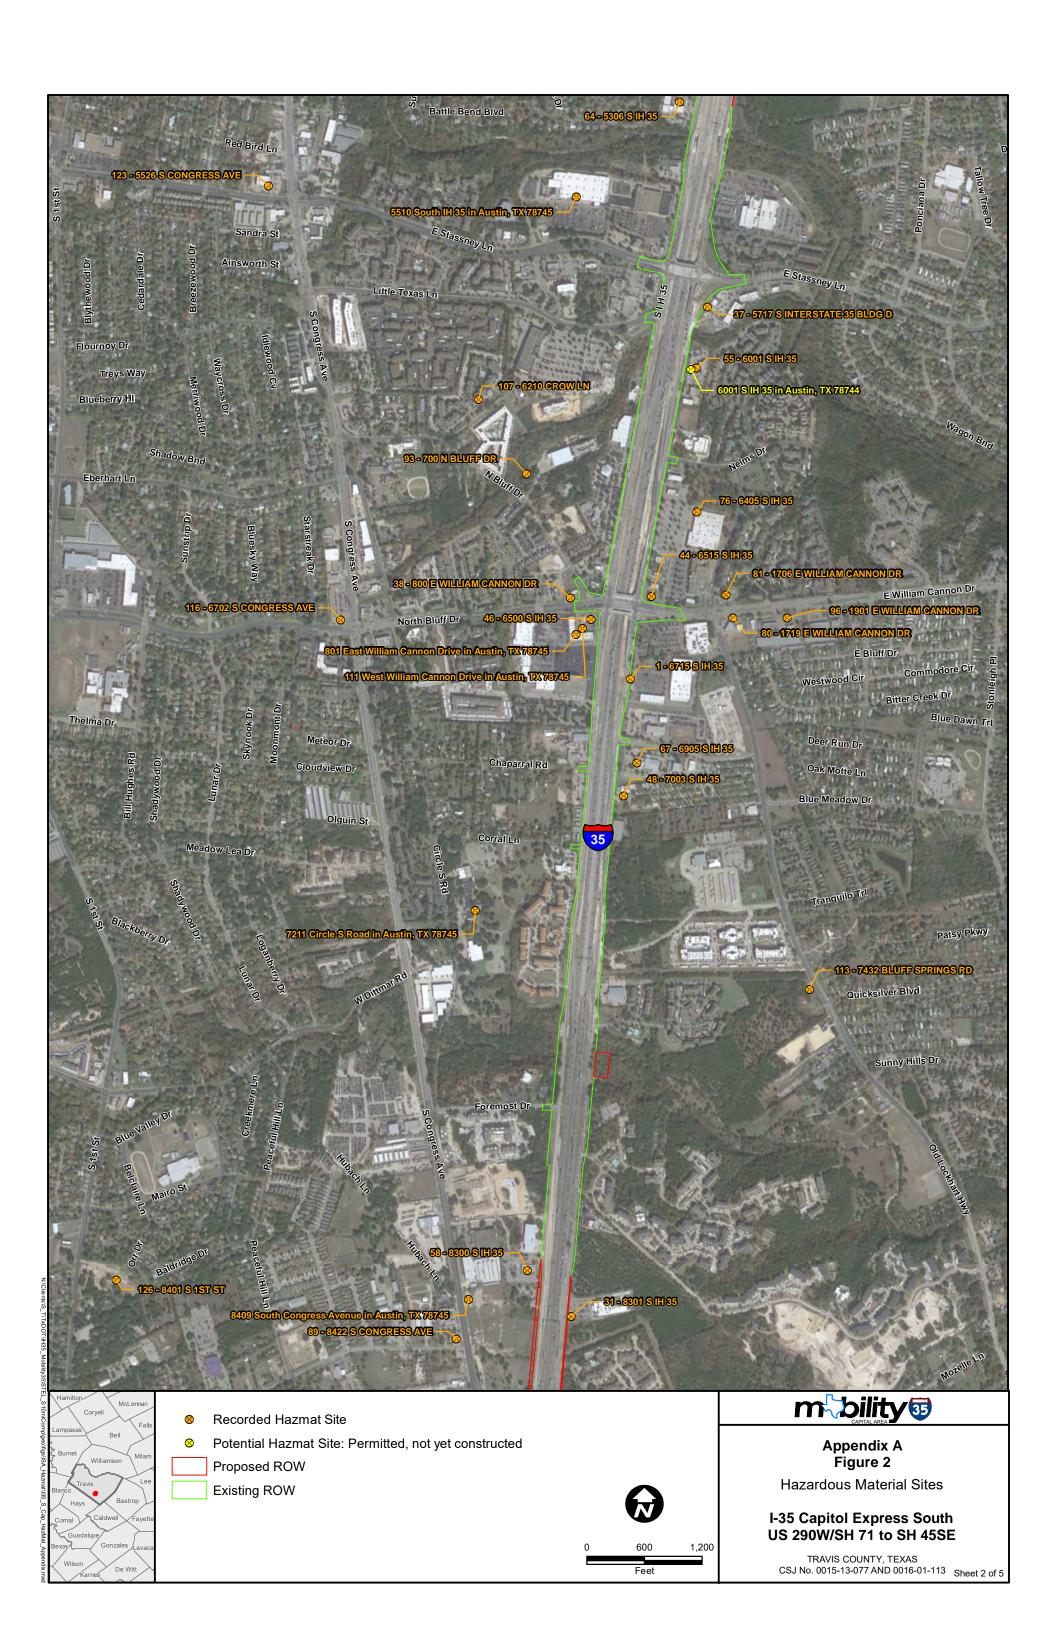



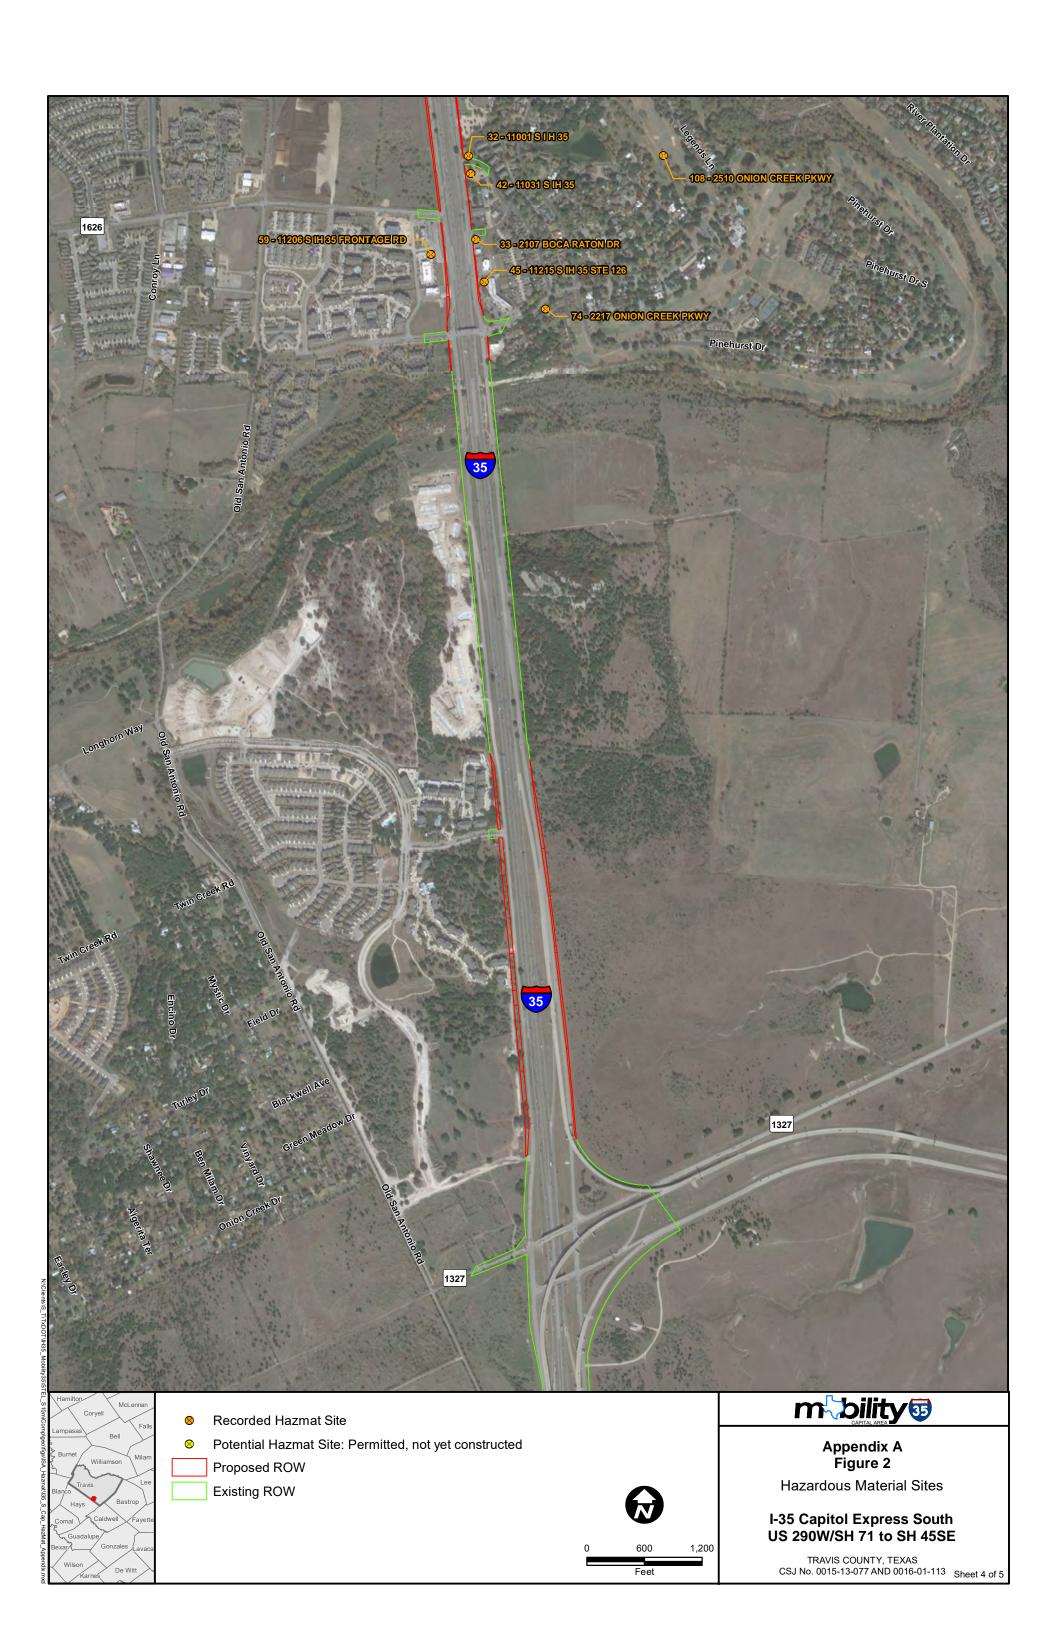

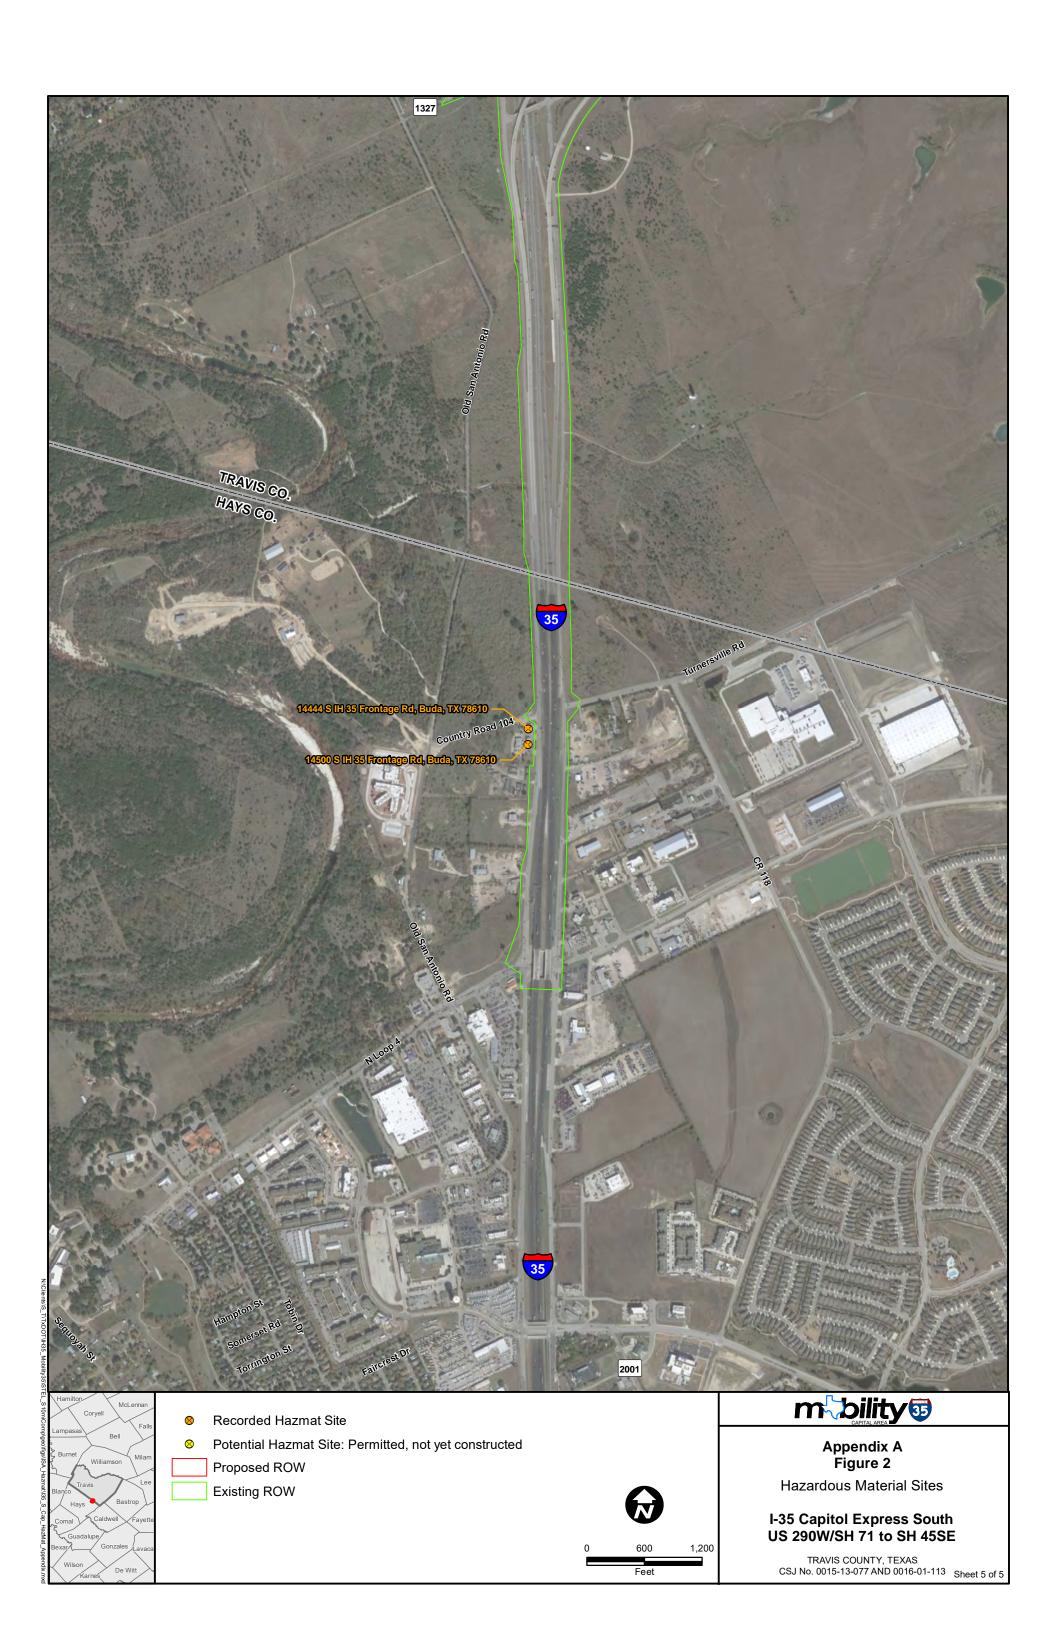

# Appendix B Site Visit Photographs



1. Facing south GeoSearch # 9, Century South Shopping Center, 801 East William Cannon Drive, Austin, TX 78745



2. Facing south GeoSearch # 10, Sams Club formerly Galvon Industries and Janssen Tract, 9808 South IH 35, Austin, TX 78748

#### **Representative Site Photographs**





3. Facing north GeoSearch # 32, Jack Brown Cleaners 28, 11001 South IH 35, Austin, TX 78747



4. Facing north GeoSearch # 45, Wisp Lash Lounge formerly Deluxe Cleaners, 11215 South IH 35, Suite 126, Austin, TX 78747





5. Facing east GeoSearch # 47, Hill Country Springs, Inc. formerly Martine Springs-Slaughter GW Plume, 10019 South IH 35, Austin, TX 78747



6. Facing south GeoSearch # 79, Ron's Cleaners formerly ESE-T Operating LP and SE-P Operating, 919 East Saint Elmo, Austin, TX 78745

#### **Representative Site Photographs**





7. Facing east GeoSearch # 83, Aloft Hotel under construction, formerly John Roberts
BMW/Lexus of Austin,
4110 Santiago Street in Austin, TX 78745



8. Facing west GeoSearch # 92, Strip Shopping Center, 9500 South H 35 Suite 650, Austin, TX 78748





9. Facing north GeoSearch # 101, COA, St. Elmo Service Center formerly McGuire, East of IH 35 and West of Freidrich Lane, South of East Saint Elmo (4500 Block of Friedrich), Austin, TX



10. Facing northwest GeoSearch # 107, Retreat at North Bluff formerly Onion Creek Club, 6210 Crow Lane, Austin, TX 78745





11. Facing west GeoSearch # 111; Chickfila, Starbucks, and Wells Fargo formerly Ben White Lots
1-5 and KMS Retail Payload Pass, and empty field;
500 East Ben White Boulevard, Austin, TX 78704




12. Facing east GeoSearch # 117, Kwik Ice formerly Capitol Metal Finishing, Inc., 3909 A Warehouse Row, Austin, TX 78767





13. Facing north GeoSearch # 118, AFCU, 2000 Woodward Street, Austin, TX 78741

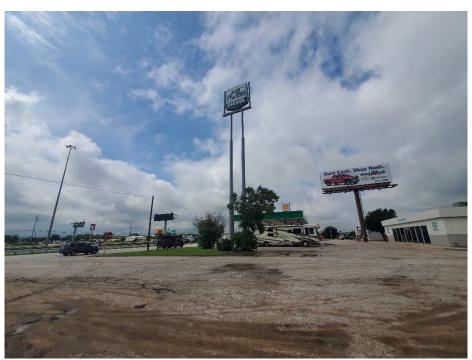

14. Facing south with no GeoSearch reference, Fast Break 4 and 6, 14500 and 14444 South IH 35 in Buda, TX.





15. Facing west with no GeoSearch reference, Under Construction Fuel Station adjacent to HEB at 8700 South IH 35 in Austin, TX, 78753.



16. Facing southeast with no GeoSearch reference, Under Construction Porsche Showroom and Service Shop at 6001 South IH 35 in Austin, TX, 78753.

